



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

July 16, 2019

Client: South Eastern Creations, LLC
146 West Lynne Drive
Augusta, GA 30907
Attn: Mr. James Floyd

Project: Project Management and Environmental Services
Asbestos Abatement, Air Monitoring and Final Clearance
721 Richland Avenue West
Aiken, SC
Report Number: 2145-101-024

Representatives of Alternative Construction & Environmental Solutions, Inc. provided environmental services, managed the abatement of asbestos-containing materials, provided SCDHEC-required air monitoring and performed final visual clearance for the property listed above in Aiken, South Carolina.

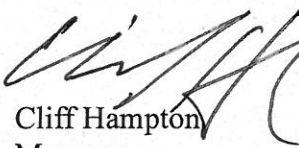
Abatement of asbestos-containing materials was conducted May 24-June 22, 2019. The services of a South Carolina-licensed asbestos abatement contractor, Chaplin & Sons Clearing and Demolition of Augusta, GA, were retained to perform the work. This work was managed by ACES along with verifying proper notification to SCDHEC, worker training and waste disposal documentation.

Air sampling was continually performed at SCDHEC-specified locations at the project area to insure that airborne asbestos fibers in the area were at acceptable levels. Final clearance after abatement was conducted by a representative of ACES along with the abatement supervisor.

Documents required for your records are listed at the end of this report. Copies of these documents are either included with this report or will be forwarded to you by ACES as soon as they are available.

Thank you for allowing ACES to provide these services for South Eastern Creations, LLC. If you have any questions or need additional information, please feel free to give us a call.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.



Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Dept.



Brendan Mitchell Hampton
Project Manager

1. Copy of an approved SCDHEC Project License for abatement - *Attached*
2. Copy of the State of South Carolina Asbestos Contractor's license – *Attached*
3. Proof of State of South Carolina asbestos license of the general Supervisor(s) involved in the project - *Attached*
4. Proof of asbestos worker training for each employee involved in the project - *Attached*
5. "Worker Release Form" for each employee of the Contractor involved in the project - *Attached*
6. Certificate of Visual Inspection for each regulated area signed by the Contractor and a representative of the Owner - *Attached*
7. Waste Shipment Records and Chains of Custody Forms for asbestos waste - *Attached*
8. Copies of all air monitoring reports - *Attached*



ASBESTOS ABATEMENT PROJECT LICENSE

Revised

License Number: R1905135

NESHAP

Issued by: James E Hinkle

Issued: May 06, 2019

ROBERT CHAPLIN
CHAPLIN AND SONS CLEARING AND DEMOLITION INC
1218 NEW SAVANNAH RD
AUGUSTA, GA 30901

SITE: Commerical Bldg
LOCATION: 721 RICHLAND AVE, Aiken
AMOUNT: 600 SF F Surfacing, 810 CF F Debris

This license is issued based on information provided in your asbestos abatement notification received May 06, 2019. Please refer to the license number above whenever you communicate with DHEC about this project. Use of this license indicates your agreement that the information herein is accurate. This license is non-transferable and is issued subject to the following conditions:

I. Removal or other abatement activities which have the potential to disturb regulated asbestos shall begin May 20, 2019, and shall complete May 24, 2019. If there is any change in these dates, you must notify DHEC in accordance with applicable State and Federal regulations.

II. Based on the information you have provided, the license fee is \$141.00 for this project. You will be billed for any amount due. If the amount of asbestos material abated increases after the project has begun, you must amend your notification and pay any additional fees.

III. You are hereby authorized to dispose of asbestos waste from this project at the Augusta-Richmond County Landfill located in Blythe, GA. Authorization is valid only for the amount of asbestos indicated above, and for a reasonable amount of other asbestos-contaminated materials generated during this project. You must obtain prior approval for disposal from the landfill operator. There shall be no leakage or spillage during transport. Authorization for disposal shall expire forty-five (45) days after May 24, 2019.

IV. At the conclusion of this project, you must submit a completed copy of your Waste Shipment Record to the Department.

The SCDHEC Division of Solid Waste Planning & Recycling also has rules governing the disposal of materials that have come in contact with lead-based paint. Materials which have been painted with lead-based paint must be disposed of in a Class Two or Three Landfill. Please contact the Bureau of Land and Waste Management for additional information.

Asbestos Section
Bureau of Air Quality

revised start date



South Carolina
Department of Health and Environmental
Control
Asbestos Abatement License

This Certifies That

Chaplin And Sons Clearing And Demolition Inc

has met the requirements of South Carolina Regulation No. 61-86.1 for licensing in the
category of:

Contractor

The holder of this license shall comply with all applicable requirements of said
regulation. This license is not transferable and shall expire one year from the date
shown below.

A handwritten signature in black ink, appearing to read 'Marc McKenna', is written over a horizontal line.

Marc McKenna, Section Manager
Asbestos
Bureau of Air Quality
South Carolina Department of Health & Environmental

DATE: August 13, 2018

LICENSE NO: CO-00221

This license is the property of the Department and must be surrendered on demand. Contractors must post a copy
of this license in a conspicuous place at each worksite.

DHEC
Issued by: <issuedby>



ASBESTOS ABATEMENT PROJECT LICENSE

Revised

License Number: R1905135

NESHAP

Issued by: James E Hinkle

Issued: May 06, 2019

ROBERT CHAPLIN
CHAPLIN AND SONS CLEARING AND DEMOLITION INC
1218 NEW SAVANNAH RD
AUGUSTA, GA 30901

SITE: Commerical Bldg
LOCATION: 721 RICHLAND AVE, Aiken
AMOUNT: 600 SF F Surfacing, 810 CF F Debris

This license is issued based on information provided in your asbestos abatement notification received May 06, 2019. Please refer to the license number above whenever you communicate with DHEC about this project. Use of this license indicates your agreement that the information herein is accurate. This license is non-transferable and is issued subject to the following conditions:

I. Removal or other abatement activities which have the potential to disturb regulated asbestos shall begin May 20, 2019, and shall complete May 30, 2019. If there is any change in these dates, you must notify DHEC in accordance with applicable State and Federal regulations.

II. Based on the information you have provided, the license fee is \$141.00 for this project. You will be billed for any amount due. If the amount of asbestos material abated increases after the project has begun, you must amend your notification and pay any additional fees.

III. You are hereby authorized to dispose of asbestos waste from this project at the Augusta-Richmond County Landfill located in Blythe, GA. Authorization is valid only for the amount of asbestos indicated above, and for a reasonable amount of other asbestos-contaminated materials generated during this project. You must obtain prior approval for disposal from the landfill operator. There shall be no leakage or spillage during transport. Authorization for disposal shall expire forty-five (45) days after May 30, 2019.

IV. At the conclusion of this project, you must submit a completed copy of your Waste Shipment Record to the Department.

The SCDHEC Division of Solid Waste Planning & Recycling also has rules governing the disposal of materials that have come in contact with lead-based paint. Materials which have been painted with lead-based paint must be disposed of in a Class Two or Three Landfill. Please contact the Bureau of Land and Waste Management for additional information.

Asbestos Section
Bureau of Air Quality

revised start date

CITY OF AIKEN
BUSINESS LICENSES
P.O. Box 2458
AIKEN, SC 29802-2458

Business name . : CHAPLIN & SONS CLEARING & DEMOLITION INC
Location addr . : OUTSIDE CITY

Lic Nbr/Class . : 20 00035486RATE CLASS 8 OUTSIDE CITY
Issue date . . : 7/03/19 Expiration date . : 6/30/20

Ctl nbr . : 23277

DEMOLITION

POST IN CONSPICUOUS PLACE THIS LICENSE IS NONTRANSFERABLE

CHAPLIN & SONS CLEARING & DEMOLITION INC
514 NATIONAL AVE
AUGUSTA GA 30901

The Environmental Institute

Robert Chaplin

Social Security Number - XXX-XX-6358
Chaplin & Sons Clearing & Demolition, Inc. - 514 National Avenue - Augusta, Georgia 30901

*Has completed coursework and satisfactorily passed
an examination that meets all criteria required for
EPA/AHERA/ASHARA (TSCA Title II) Approved Reaccreditation
and NESHAP Regulations Training*

*Asbestos in Buildings: Abatement Project Supervisor
Refresher*

March 11, 2019

Course Date

13981


Certificate Number


March 11, 2019

Examination Date


March 10, 2020

Expiration Date


Thomas G. Laubenthal - Principal Instructor


Rachel B. McCain - Exam Administrator




David W. Hogue - Training Manager

(Approved by the ABIH Certification Maintenance Committee for 1 CM point - Approval #11-583)
(Florida Provider Registration Number FL49-0001342 - Course #FL49-0004693)
TEI - 1395 S. Marietta Parkway SE - Building 900, Suite 910 - Marietta, GA 30067
Phone: 770-427-3600 - www.tei-atl.com

The Environmental Institute

Anthony Martin

Social Security Number - XXX-XX-8042

Chaplin & Sons Clearing & Demolition, Inc. - 514 National Avenue - Augusta, Georgia 30901

*Has completed coursework and satisfactorily passed
an examination that meets all criteria required for
EPA/AHERA/ASHARA (TSCA Title II) Approved Reaccreditation
and NESHAP Regulations Training*

*Asbestos in Buildings: Abatement Project Supervisor
Refresher*

March 11, 2019

Course Date

14000


Certificate Number

March 11, 2019

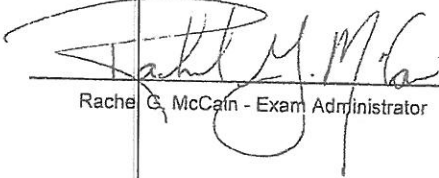
Examination Date

March 10, 2020

Expiration Date




Thomas G. Laubenthal - Principal Instructor



Rachel G. McCain - Exam Administrator





David W. Hogue - Training Manager

(Approved by the ABIH Certification Maintenance Committee for 1 CM point - Approval #11-583)
(Florida Provider Registration Number FL49-0001342 - Course #FL49-0004693)
TEI - 1395 S. Marietta Parkway SE - Building 900, Suite 910 - Marietta, GA 30067
Phone: 770-427-3600 - www.tei-atl.com

The Environmental Institute

Johnny Lyons

Social Security Number - XXX-XX-2483

Chaplin & Sons Clearing & Demolition, Inc. - 514 National Avenue - Augusta, Georgia 30901

*Has completed coursework and satisfactorily passed
an examination that meets all criteria required for
EPA/AHERA/ASHARA (TSCA Title II) Approved Reccreditation
and NESHAP Regulations Training*

*Asbestos in Buildings: Abatement Project Supervisor
Refresher*

March 11, 2019

Course Date

13998


Certificate Number


March 11, 2019

Examination Date


March 10, 2020

Expiration Date


Thomas G. Laubenthal - Principal Instructor


Rachel G. McCain - Exam Administrator




David W. Hogue - Training Manager

(Approved by the ABIH Certification Maintenance Committee for 1 CM point - Approval #11-583)
(Florida Provider Registration Number FL49-0001342 - Course #FL49-0004693)
TEI - 1395 S. Marietta Parkway SE - Building 900, Suite 910 - Marietta, GA 30067
Phone: 770-427-3600 - www.tei-atl.com

The Environmental Institute

Alexander Jackson

Social Security Number - XXX-XX-7581
Chaplin & Sons - 1218 New Savannah Road - Augusta, Georgia 30901

*Has completed coursework and satisfactorily passed
an examination that meets all criteria required for
EPA/AHERA/ASHARA (TSCA Title II) Approved Reaccreditation
and NESHAP Regulations Training*

Asbestos in Buildings: Abatement Worker Refresher

September 28, 2018

Course Date

3055

Certificate Number

September 28, 2018


Examination Date


September 27, 2019

Expiration Date



Mark E. Hartz - Principal Instructor


Rachel G. McCain - Exam Administrator


David W. Hogue - Training Manager

Training Location: 2247 Wrightsboro Road - Augusta, Georgia 30904
(Florida Provider Registration Number FL49-0001342 - Course #FL49-0004702)
TEI - 1841 West Oak Parkway, Suite F - Marietta, Georgia 30062 - (770) 427-3600 - www.tei-atl.com

The Environmental Institute

James W. Bing

Social Security Number - XXX-XX-2411
Chaplin & Sons - 1218 New Savannah Road - Augusta, Georgia 30901

*Has completed coursework and satisfactorily passed
an examination that meets all criteria required for
EPA/AHERA/ASHARA (TSCA Title II) Approved Reaccreditation
and NESHAP Regulations Training*

Asbestos in Buildings: Abatement Worker Refresher

September 28, 2018

Course Date

3054

Certificate Number

September 28, 2018


Examination Date


September 27, 2019

Expiration Date



Mark E. Hartz - Principal Instructor


Rachel G. McCain - Exam Administrator


David W. Hogue - Training Manager

Training Location: 2247 Wrightsboro Road - Augusta, Georgia 30904

(Florida Provider Registration Number FL49-0001342 - Course #FL49-0004702)

TEI - 1841 West Oak Parkway, Suite F - Marietta, Georgia 30062 - (770) 427-3600 - www.tei-atl.com

The Environmental Institute

Larry M. Dunbar

Social Security Number - XXX-XX-4659
Chaplin & Sons - 1218 New Savannah Road - Augusta, Georgia 30901

*Has completed coursework and satisfactorily passed
an examination that meets all criteria required for
EPA/AHERA/ASHARA (TSCA Title II) Approved Reaccreditation
and NESHAP Regulations Training*

Asbestos in Buildings: Abatement Worker Refresher

September 28, 2018

Course Date

3056

Certificate Number

September 28, 2018


Examination Date


September 27, 2019

Expiration Date



Mark E. Hartz - Principal Instructor


Rachel G. McCain - Exam Administrator


David W. Hogue - Training Manager

Training Location: 2247 Wrightsboro Road - Augusta, Georgia 30904
(Florida Provider Registration Number FL49-0001342 - Course #FL49-0004702)
TEI - 1841 West Oak Parkway, Suite F - Marietta, Georgia 30062 - (770) 427-3600 - www.tei-atl.com

The Environmental Institute

Jeffrey R. Johnson

Social Security Number - XXX-XX-3717
Chaplin & Sons - 1218 New Savannah Road - Augusta, Georgia 30901

*Has completed coursework and satisfactorily passed
an examination that meets all criteria required for
EPA/ASHERA/ASHARA (TSCA Title II) Approved Reaccreditation
and NESHAP Regulations Training*

Asbestos in Buildings: Abatement Worker Refresher

September 28, 2018

Course Date

3051

Certificate Number

September 28, 2018


Examination Date


September 27, 2019

Expiration Date



Mark E. Hartz - Principal Instructor


Rachel G. McCain - Exam Administrator


David W. Hogue - Training Manager

Training Location: 2247 Wrightsboro Road - Augusta, Georgia 30904
(Florida Provider Registration Number FL49-0001342 - Course #FL49-0004702)
TEI - 1841 West Oak Parkway, Suite F - Marietta, Georgia 30062 - (770) 427-3600 - www.tei-atl.com

The Environmental Institute

Larry Kemp, Jr.

Social Security Number - XXX-XX-0118
Chaplin & Sons - 1218 New Savannah Road - Augusta, Georgia 30901

*Has completed coursework and satisfactorily passed
an examination that meets all criteria required for
EPA/AHERA/ASHARA (TSCA Title II) Approved Reaccreditation
and NESHAP Regulations Training*

Asbestos in Buildings: Abatement Worker Refresher

September 28, 2018

Course Date

3050

Certificate Number

September 28, 2018


Examination Date


September 27, 2019

Expiration Date



Mark E. Hartz - Principal Instructor


Rachel G. McCain - Exam Administrator


David W. Hogue - Training Manager

Training Location: 2247 Wrightsboro Road - Augusta, Georgia 30904
(Florida Provider Registration Number FL49-0001342 - Course #FL49-0004702)
TEI - 1841 West Oak Parkway, Suite F - Marietta, Georgia 30062 - (770) 427-3600 - www.tei-atl.com

CERTIFICATE OF WORKERS ACKNOWLEDGMENT-ASBESTOS

PROJECT NAME: SOUTH EASTER

PROJECT ADDRESS: 721 RICHLAND AVE. W. AIKEN, SC

CONTRACTOR'S NAME: CHAPLIN & SONS

WORKING WITH ASBESTOS CAN BE DANGEROUS. INHALING ASBESTOS FIBERS HAS BEEN LINKED WITH VARIOUS TYPES OF CANCER. IF YOU SMOKE AND INHALE ASBESTOS FIBERS THE CHANCE THAT YOU WILL DEVELOP LUNG CANCER IS GREATER THAN THAT OF THE NON-SMOKING PUBLIC.

Your employer's contract with the Owner for the above project requires that: You be supplied with the proper respirator and be trained in its use. You will be trained in safe work practices and in the use of the equipment found on the job. You will receive a medical examination. These things are to have been done at no cost to you.

RESPIRATORY PROTECTION: You must have been trained in the proper use of respirators, and informed of the type or respirator to be used on the above referenced project. You must be given a copy of the written respiratory protection manual issued by your employer. You must be equipped at no cost with the respirator to be used on the above project.

TRAINING COURSE: You must have been trained in the dangers inherent in handling asbestos and breathing asbestos dust and in proper work procedures and personal and area protective measures. The topics covered in the course must have included the following:

8. Physical characteristics of asbestos
9. Health hazards associated with asbestos
10. Respiratory protection
11. Use of protective equipment
12. Pressure Differential Systems
13. Work practices including hands-on or on-job training
14. Personal decontamination procedures
15. Air monitoring, personal and area

MEDICAL EXAMINATION: You must have had a medical examination within 12 months at no cost to you. The examination must have included: Health history, pulmonary function tests, and may have included an evaluation of a chest x-ray.

By signing this document you are acknowledging only that the Owner of the building you are about to work in has advised you of your rights to training and protection relative to your employer, the Contractor.

SIGNATURE Larry Kemp Jr

SOCIAL SECURITY No. XXX-XX-0118

PRINT NAME: Larry Kemp Jr

WITNESS: [Signature]

CERTIFICATE OF WORKERS ACKNOWLEDGMENT-ASBESTOS

PROJECT NAME: SOUTH EASTERN

PROJECT ADDRESS: 721 RICHLAND AVE. W Aiken, SC

CONTRACTOR'S NAME: CHAPLIN & SONS

WORKING WITH ASBESTOS CAN BE DANGEROUS. INHALING ASBESTOS FIBERS HAS BEEN LINKED WITH VARIOUS TYPES OF CANCER. IF YOU SMOKE AND INHALE ASBESTOS FIBERS THE CHANCE THAT YOU WILL DEVELOP LUNG CANCER IS GREATER THAN THAT OF THE NON-SMOKING PUBLIC.

Your employer's contract with the Owner for the above project requires that: You be supplied with the proper respirator and be trained in its use. You will be trained in safe work practices and in the use of the equipment found on the job. You will receive a medical examination. These things are to have been done at no cost to you.

RESPIRATORY PROTECTION: You must have been trained in the proper use of respirators, and informed of the type or respirator to be used on the above referenced project. You must be given a copy of the written respiratory protection manual issued by your employer. You must be equipped at no cost with the respirator to be used on the above project.

TRAINING COURSE: You must have been trained in the dangers inherent in handling asbestos and breathing asbestos dust and in proper work procedures and personal and area protective measures. The topics covered in the course must have included the following:

8. Physical characteristics of asbestos
9. Health hazards associated with asbestos
10. Respiratory protection
11. Use of protective equipment
12. Pressure Differential Systems
13. Work practices including hands-on or on-job training
14. Personal decontamination procedures
15. Air monitoring, personal and area

MEDICAL EXAMINATION: You must have had a medical examination within 12 months at no cost to you. The examination must have included: Health history, pulmonary function tests, and may have included an evaluation of a chest x-ray.

By signing this document you are acknowledging only that the Owner of the building you are about to work in has advised you of your rights to training and protection relative to your employer, the Contractor.

SIGNATURE [Signature]
SOCIAL SECURITY No. XXX-XX- 4934

PRINT NAME: Marcell Cooper

WITNESS: [Signature]

CERTIFICATE OF WORKERS ACKNOWLEDGMENT-ASBESTOS

PROJECT NAME: SOUTH EASTERN

PROJECT ADDRESS: 721 RICHLAND AVE W Aiken SC

CONTRACTOR'S NAME: CHAPLIN & SONS

WORKING WITH ASBESTOS CAN BE DANGEROUS. INHALING ASBESTOS FIBERS HAS BEEN LINKED WITH VARIOUS TYPES OF CANCER. IF YOU SMOKE AND INHALE ASBESTOS FIBERS THE CHANCE THAT YOU WILL DEVELOP LUNG CANCER IS GREATER THAN THAT OF THE NON-SMOKING PUBLIC.

Your employer's contract with the Owner for the above project requires that: You be supplied with the proper respirator and be trained in its use. You will be trained in safe work practices and in the use of the equipment found on the job. You will receive a medical examination. These things are to have been done at no cost to you.


RESPIRATORY PROTECTION: You must have been trained in the proper use of respirators, and informed of the type or respirator to be used on the above referenced project. You must be given a copy of the written respiratory protection manual issued by your employer. You must be equipped at no cost with the respirator to be used on the above project.

TRAINING COURSE: You must have been trained in the dangers inherent in handling asbestos and breathing asbestos dust and in proper work procedures and personal and area protective measures. The topics covered in the course must have included the following:

8. Physical characteristics of asbestos
9. Health hazards associated with asbestos
10. Respiratory protection
11. Use of protective equipment
12. Pressure Differential Systems
13. Work practices including hands-on or on-job training
14. Personal decontamination procedures
15. Air monitoring, personal and area

MEDICAL EXAMINATION: You must have had a medical examination within 12 months at no cost to you. The examination must have included: Health history, pulmonary function tests, and may have included an evaluation of a chest x-ray.

By signing this document you are acknowledging only that the Owner of the building you are about to work in has advised you of your rights to training and protection relative to your employer, the Contractor.

SIGNATURE 
SOCIAL SECURITY No. XXX-XX-2483
PRINT NAME: Johnny Lyon

WITNESS: 



CERTIFICATION OF VISUAL INSPECTION FOR ASBESTOS ABATEMENT

In accordance with SECTION 3.16 - **CERTIFICATE OF VISUAL INSPECTION**, the Contractor hereby certifies that he has visually inspected all interior surfaces of the regulated area identified below and has found no dust, debris, or residue.

Area inspected: 721 Richland Ave

By: (Signature): *Johnny Lyons* Date: 6/22/19

(Print Name) Johnny Lyons

(Print Title) Supervisor

OWNER'S REPRESENTATIVE'S CERTIFICATION

An authorized representative of the Owner hereby certifies that he has accompanied the Contractor on his visual inspection and verifies that this inspection has been thorough and to the best of his knowledge and belief, the Contractor's certification above is a true and honest one.

By: (Signature): *Conner Carson* Date: 6/22/19

(Print Name) Conner Carson

(Print Title) Consultant



**AUGUSTA-RICHMOND COUNTY SOLID WASTE FACILITY
ASBESTOS DISPOSAL MANIFEST FORM**

Please Complete and return original and one (1) copy.

I. PROJECT INFORMATION

ASBESTOS PROJECT: 721 Richland Ave
PROJECT ADDRESS: 721 Richland Ave
CITY: Aiken COUNTY: Aiken STATE: SC ZIP: —
REMOVAL CONTRACTOR: Chapin and Sons
ADDRESS: 514 National Ave
CITY: Augusta COUNTY: Richmond STATE: GA ZIP: 30901
LICENSE NO: — TELEPHONE NO: 706-945-0838

II. WASTE GENERATOR INFORMATION:

WASTE GENERATOR/COMPANY: owner
ADDRESS: 721 Richland Ave
CITY: Aiken STATE: SC ZIP: —
LICENSE NO: — TELEPHONE NO: 706-262-7000

Signature of Driver [Signature]

Date 7/8/19

III. WASTE HAULER INFORMATION:

WASTE HAULER COMPANY: Chapin and Sons
ADDRESS: 514 National Ave
CITY: Augusta STATE: GA ZIP: 30901
LICENSE NO: — TELEPHONE NO: 706-945-0835

Signature of Driver [Signature]

Date 7/8/19

III. LANDFILL INFORMATION:

Landfill Name: Augusta-Richmond County Solid Waste Facility
Permit Number: 121-016 D (SL) / 121-018 D (MSWL)
Volume Asbestos Received: — SQ/FT. — LN/FT. 18 CU/YD.
Type of Containers: 6 green Condition of Containers: 6 green
Were Containers Labeled (asbestos waste): EPA/OSHA/DOT: Yes: X No: —

I CERTIFY THAT Augusta-Richmond County Solid Waste Facility HAS BEEN APPROVED FOR THE DISPOSAL OF ASBESTOS-CONTAINING MATERIAL AND THAT THE DELIVERED MATERIAL WILL BE DISPOSED IN ACCORDANCE WITH LOCAL, STATE, AND FEDERAL REGULATIONS.

Signature of Landfill Operator [Signature]

Date —

Cell Grid Location —



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

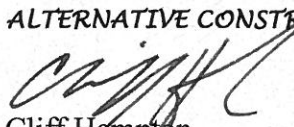
June 28, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-023

On June 22, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-122	Clean Room	Outside	<0.005	0.005
SE-123	Outside of Decon	Outside	<0.005	0.005
SE-124	NPD Exhaust South	Outside	<0.005	0.005
SE-125	Downwind of NPD Exhaust South	Outside	<0.005	0.005
SE-126	Field Blank	Blank	0 f/100 fields	
SE-127	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com


June 28, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-022

On June 20, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-110	Clean Room	Outside	<0.003	0.003
SE-111	Outside of Decon	Outside	<0.003	0.003
SE-112	NPD Exhaust South	Outside	<0.003	0.003
SE-113	Downwind of NPD Exhaust South	Outside	<0.003	0.003
SE-114	Field Blank	Blank	0 f/100 fields	
SE-115	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

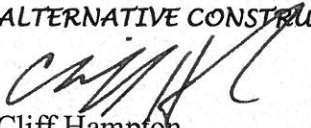
June 28, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-021

On June 19, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-104	Clean Room	Outside	<0.003	0.003
SE-105	Outside of Clean Room	Outside	<0.003	0.003
SE-106	NPD Exhaust South	Outside	<0.003	0.003
SE-107	Downwind of NPD Exhaust South	Outside	<0.003	0.003
SE-108	Field Blank	Blank	0 f/100 fields	
SE-109	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com


June 28, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-020

On June 18, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrm

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-98	Clean Room	Outside	<0.003	0.003
SE-99	Outside of Clean Room	Outside	<0.003	0.003
SE-100	NPD Exhaust South	Outside	<0.003	0.003
SE-101	Downwind of NPD Exhaust South	Outside	<0.003	0.003
SE-102	Field Blank	Blank	0 f/100 fields	
SE-103	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

June 28, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-019

On June 17, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton

Manager

Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-92	Upwind East	Outside	<0.003	0.003
SE-93	Upwind East	Outside	<0.003	0.003
SE-94	Downwind West	Outside	<0.003	0.003
SE-95	Downwind West	Outside	<0.003	0.003
SE-96	Field Blank	Blank	0 f/100 fields	
SE-97	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

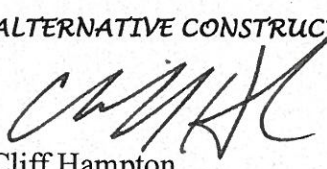
June 20, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: PCM Final Clearance Air Monitoring
721 Richland Ave. – 2nd Containment
Augusta, GA
Report Number: 2145-101-018

On June 22, 2018, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected seven samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-128	Beside Rear Exit	Final	<0.002	0.002
SE-129	East Hallway	Final	0.002	0.002
SE-130	North Hallway	Final	0.002	0.002
SE-131	West Hallway	Final	<0.002	0.002
SE-132	Beside the Decon	Final	0.002	0.002
SE-133	Field Blank	Blank	0 f/100 fields	
SE-134	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: PCM final clearance air monitoring following asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com


June 25, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-017

On June 21, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-116	Outside Decon Entrance	Outside	<0.003	0.003
SE-117	Inside Decon Clean Room	Outside	<0.003	0.003
SE-118	Inside Decon Equipment Room	Inside	<0.003	0.003
SE-119	At NAM Exhaust	Outside	<0.003	0.003
SE-120	Field Blank	Blank	0 f/100 fields	
SE-121	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

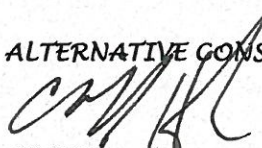
June 27, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-016

On June 15, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-79	Clean Room	Outside	<0.007	0.007
SE-80	Outside of Decon	Outside	<0.007	0.007
SE-81	NPD Exhaust South	Outside	<0.007	0.007
SE-82	Downwind of NPD Exhaust	Outside	<0.007	0.007
SE-83	Field Blank	Blank	0 f/100 fields	
SE-84	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

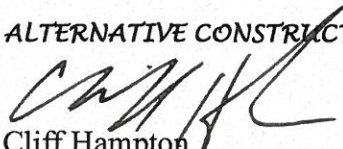
June 25, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-015

On June 13, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-67	Clean Room	Outside	<0.002	0.002
SE-68	Outside of Decon	Outside	<0.002	0.002
SE-69	NPD Exhaust South	Outside	<0.002	0.002
SE-70	Downwind to NPD Exhaust	Outside	<0.002	0.002
SE-71	Field Blank	Blank	0 f/100 fields	
SE-72	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

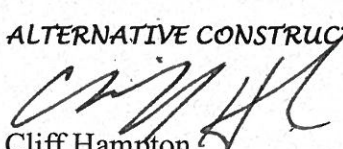
June 25, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-014

On June 12, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-61	Clean Room	Outside	0.002	0.002
SE-62	Outside of Decon	Outside	<0.002	0.002
SE-63	NPD Exhaust South	Outside	<0.003	0.003
SE-64	Downwind to NPD Exhaust	Outside	<0.003	0.003
SE-65	Field Blank	Blank	0 f/100 fields	
SE-66	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

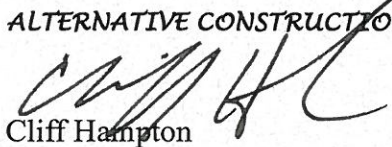
June 25, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-013

On June 11, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-55	Clean Room	Outside	<0.003	0.003
SE-56	Outside of Decon	Outside	<0.003	0.003
SE-57	NPD Exhaust South	Outside	<0.003	0.003
SE-58	Downwind to NPD Exhaust South	Outside	<0.003	0.003
SE-59	Field Blank	Blank	0 f/100 fields	
SE-60	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

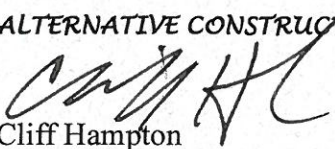
June 25, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-012

On June 10, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-49	Clean Room	Outside	<0.003	0.003
SE-50	Outside of Decon	Outside	<0.004	0.004
SE-51	NPD Exhaust South	Outside	<0.003	0.003
SE-52	Downwind to NPD Exhaust South	Outside	<0.003	0.003
SE-53	Field Blank	Blank	0 f/100 fields	
SE-54	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

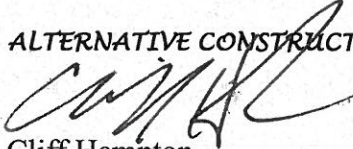
June 25, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-011

On June 14, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-73	Clean Room	Outside	<0.003	0.003
SE-74	Outside of Decon	Outside	<0.002	0.002
SE-75	NPD Exhaust South	Outside	<0.003	0.003
SE-76	Downwind of NPD Exhaust	Outside	<0.003	0.003
SE-77	Field Blank	Blank	0 f/100 fields	
SE-78	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

June 20, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: PCM Final Clearance Air Monitoring
721 Richland Ave. – 1st Containment
Augusta, GA
Report Number: 2145-101-010

On June 15, 2018, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected seven samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-85	West Wall Lobby	Final	0.004	0.002
SE-86	North Wall Lobby	Final	0.003	0.002
SE-87	North Wall Main Hallway	Final	0.004	0.002
SE-88	North Wall Office Hallway	Final	0.004	0.002
SE-89	South Wall Office Hallway	Final	0.004	0.002
SE-90	Field Blank	Blank	0 f/100 fields	
SE-91	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: PCM final clearance air monitoring following asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

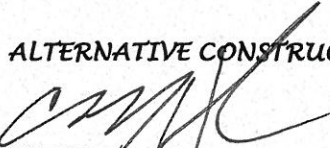
June 20, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-009

On June 7, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-43	Clean Room	Outside	<0.003	0.003
SE-44	Outside of Decon	Outside	<0.003	0.003
SE-45	NPD Exhaust South	Outside	<0.003	0.003
SE-46	Downwind to NPD Exhaust	Outside	<0.003	0.003
SE-47	Field Blank	Blank	0 f/100 fields	
SE-48	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

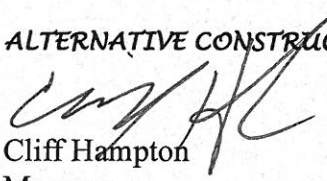
June 7, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-008

On June 5, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrm

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-37	Clean Room	Outside	<0.003	0.003
SE-38	Outside of Decon	Outside	<0.003	0.003
SE-39	NPD Exhaust South	Outside	<0.003	0.003
SE-40	NPD Exhaust West	Outside	<0.003	0.003
SE-41	Field Blank	Blank	0 f/100 fields	
SE-42	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

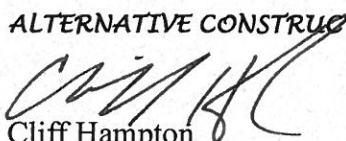
June 7, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-007

On June 4, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-31	Clean Room	Outside	<0.003	0.003
SE-32	Outside of Decon	Outside	<0.003	0.003
SE-33	NPD Exhaust South	Outside	<0.003	0.003
SE-34	NPD Exhaust West	Outside	<0.003	0.003
SE-35	Field Blank	Blank	0 f/100 fields	
SE-36	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

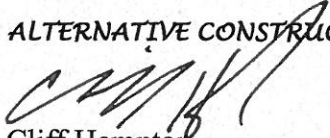
June 7, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-006

On June 3, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-25	Clean Room	Outside	<0.003	0.003
SE-26	Outside of Decon	Outside	<0.003	0.003
SE-27	NPD Exhaust NW	Outside	<0.003	0.003
SE-28	NPD Exhaust SW	Outside	<0.003	0.003
SE-29	Field Blank	Blank	0 f/100 fields	
SE-30	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com


May 30, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-005

On May 31, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-19	East Side of Building	Outside	<0.003	0.003
SE-20	North Side of Building	Outside	<0.003	0.003
SE-21	South Side of Building	Outside	<0.003	0.003
SE-22	West Side of Building	Outside	<0.003	0.003
SE-23	Field Blank	Blank	0 f/100 fields	
SE-24	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

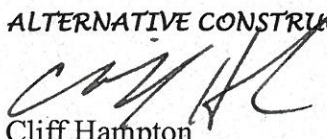
May 30, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-004

On May 29, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-13	West Side of Building	Outside	<0.003	0.003
SE-14	East Side of Building	Outside	<0.003	0.003
SE-15	South Side of Building	Outside	0.003	0.003
SE-16	North Side of Building	Outside	<0.003	0.003
SE-17	Field Blank	Blank	0 f/100 fields	
SE-18	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com


May 30, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-003

On May 28, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-07	North Side of Building	Outside	<0.003	0.003
SE-08	East Side of Building	Outside	<0.003	0.003
SE-09	South Side of Building	Outside	<0.003	0.003
SE-10	West Side of Building	Outside	<0.003	0.003
SE-11	Field Blank	Blank	0 f/100 fields	
SE-12	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.



ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.

2247 Wrightsboro Road
Augusta, GA 30904

Mailing Address: PO Box 3229, Augusta, GA 30914-3229
Telephone: 706-262-2000 • Facsimile: 706-262-3299 • www.aces-usa.com

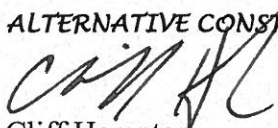
May 28, 2019

Client: South Eastern Creations
146 West Lynne Drive
Augusta, GA 30907

Project: Daily Air Monitoring
721 Richland Ave. W.
Aiken, South Carolina
Report Number: 2145-101-002

On May 24, 2019, a representative of Alternative Construction & Environmental Solutions, Inc. (ACES) was present at the above referenced project and collected six samples. The results of this analysis are documented in the table below. This report relates only to the samples obtained and tested and shall not be reproduced, except in whole and only with the written consent of ACES.

ALTERNATIVE CONSTRUCTION & ENVIRONMENTAL SOLUTIONS, INC.


Cliff Hampton
Manager
Industrial Hygiene, Safety & Health Division

CEH/jrn

TABLE OF RESULTS

Sample ID	Sample Description/Location	Sample Type	Result f/cc	LOD f/cc
SE-01	West Side of Building	Outside	<0.004	0.004
SE-02	North Side of Building	Outside	<0.004	0.004
SE-03	South Side of Building	Outside	<0.004	0.004
SE-04	East Side of Building	Outside	<0.004	0.004
SE-05	Field Blank	Blank	0 f/100 fields	
SE-06	Field Blank	Blank	0 f/100 fields	

ACTIVITIES PERFORMED: Daily air monitoring prior to asbestos removal activities.