

PHASE I ENVIRONMENTAL SITE ASSESSMENT REPORT

Madera Industrial Warehouse Buildings

401-425 and 610 North E Street Madera, California 93638

Report Date: May 3, 2019 Partner Project No. 19-244554.1



Prepared for:

Anthony De Groot

622 San Marino Drive Santa Barbara, California 93111



May 3, 2019

Mr. Anthony De Groot 622 San Marino Drive Santa Barbara, California 93111

Subject: Phase I Environmental Site Assessment

Madera Industrial Warehouse Buildings

401-425 and 610 North E Street

Madera, California 93638

Partner Project No. 19-244554.1

Dear Mr. De Groot:

Partner Engineering and Science, Inc. (Partner) is pleased to provide the results of the *Phase I Environmental Site Assessment* (Phase I ESA) report of the abovementioned address (the "subject property"). This assessment was performed in conformance with the scope and limitations as detailed in the ASTM Practice E1527-13 Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process.

This assessment included a site reconnaissance as well as research and interviews with representatives of the public, property ownership, site manager, and regulatory agencies. An assessment was made, conclusions stated, and recommendations outlined.

We appreciate the opportunity to provide environmental services to you. If you have any questions concerning this report, or if we can assist you in any other matter, please me at (559) 917-9700 or CTaylor@partneresi.com.

Sincerely,

Cody Taylor

National Client Manager

EXECUTIVE SUMMARY

Partner Engineering and Science, Inc. (Partner) has performed a Phase I Environmental Site Assessment (ESA) in accordance with the scope of work and limitations of ASTM Standard Practice E1527-13, the Environmental Protection Agency Standards and Practices for All Appropriate Inquiries (AAI) (40 CFR Part 312) and set forth by Anthony De Groot for the property located at 401-425 and 610 North E Street in Madera, Madera County, California (the "subject property"). The Phase I Environmental Site Assessment is designed to provide Anthony De Groot with an assessment concerning environmental conditions (limited to those issues identified in the report) as they exist at the subject property.

Property Description

The subject property consists of two non-contiguous properties, referred to herein as Parcels 1 and 2, East 3rd Street, and the southern side of East Central Avenue. The subject property is located within a mixed commercial and residential area of Madera, California. Please refer to the table below for further description of the subject property:

Sub	ject Pro	perty	Data

Addresses: 401-425 North E Street (Parcel 1) and 610 North E Street (Parcel 2),

Madera, California

Historical Address(es): 409, 4091/2, 411, and 413 North E Street (Parcel 1); 600, 609, and

615 North E Street (Parcel 2)

Property Use: Commercial Land Acreage (Ac): 1.83 Ac **Number of Buildings:** Four **Number of Floors:** One

Gross Building Area (SF): 36,333 SF (Total)

Date of Construction: 1956, 1977, and 1987 (Parcel 1); Circa 1946 (Parcel 2)

007-054-008, -009, and -010 (Parcel 1); 007-042-001 (Parcel 2) Assessor's Parcel Number (APN): Type of Construction: Concrete masonry unit (CMU), steel and wood framing; Concrete

slab-on-grade foundations

Current Tenants: Smog Check, Martin's Electrical & Auto Repair, Adrian Auto Shop,

> Sinai Auto Repair, Rich Restorations Body Shop, Andy's Transmissions (Parcel 1); Madera Rocks and Madera Auto Tires and

Repairing (Parcel 2)

Site Assessment Performed By: Sheryl A. Amezcua of Partner

Site Assessment Conducted On: April 19, 2019

The subject property is currently occupied by various tenants for commercial use. On-site operations consist of smog testing, general automotive service and repair, auto body repair, auto painting, transmission repair, auto storage, retail sales of granite and decorative tile, pool and spa services, and routine facility maintenance. On-site tenants and uses are further summarized in the table below:

Subject Property Tenants 401 to 425 North E Street (Parcel 1)

Unit	Tenant	Nature of Operation
401 #118	Paulino & Paula	Operations not noted
401 #A	Herrera Smog Shop	Smog testing and repairs
401 #B	Ronald Vega	Automotive window tinting



Subject Property Tenants 401 to 425 North E Street (Parcel 1)				
Unit	Tenant	Nature of Operation		
401 #B2	Vacant	No operations conducted on-site		
401 #C-S	Galvan's Electrical/Auto Repair	Auto and electrical repairing		
401 #G	Galvan's	Storage of cars and equipment		
401 #D	Vacant	Operations not noted		
401 #E	Adrian's Auto Body	Automobile body repair shop		
401 #F	Vacant Unit	Operations not noted		
401 #N	Sinai Auto Repair	General automotive repairing		
401 #P	Ricardo Velazquez	Automotive painting and body repair		
401 #P2	Vacant Unit	Operations not noted		
401/425/116	Andy's Transmission Shop	Specializing in vehicle transmission and repairs		

Subject Property Tenants 610 North E Street (Parcel 2)				
Address	Tenant	Nature of Operation and Square Feet		
#100	Vacant Unit	Operations not noted		
#102	Madera Rocks	Granite and decorative tile showroom		
#104	Madera Pool and Spa	Operations not noted		
#106	Vacant unit	Operations not noted		
#108	Vacant unit	Operations not noted		
#110	Marvin Barrios	Operations not noted		
#112	Madera Auto Tires & Repair	General Auto repair and tire shop		

In addition to the current structures, the subject property is also improved with asphalt-paved parking areas and driveways, concrete-paved walkways and flatwork, and associated landscaping.

According to available historical sources, Parcel 1 was formerly undeveloped as early as 1891 until circa 1898; developed with a stable in at least 1912; developed with a hay storage warehouse and auto garage from at least 1929 until circa 1950; and developed with the existing structures in 1956, 1977, and 1987. Parcel 2 was formerly undeveloped as early as 1922 until circa 1940; and developed with the existing structure as a grain and feed warehouse in circa 1946. Tenants on the subject property have included grain and feed storage businesses (1929-1965), and various commercial tenants including automotive repair-related businesses (1958-Present). Refer to Section 3.3 for a summary of city directory listings for the subject property.

Properties immediately surrounding Parcel 1 consist of single-family residences to the northeast across an alley; Gill Trucking, Ag Pro Solutions, LF Distributing, and a vacant lot to the northwest across East 2nd Street; a vacant lot and Heartland Opportunity Center to the southeast across East 3rd Street; and Comacho's Tires and commercial buildings to the southwest across North E Street. Properties immediately surrounding Parcel 2 consist of commercial buildings and a vacant lot to the northeast across North E Street; Glass & Body Shop to the north across East Central Avenue; a commercial buildings to the southeast; and Enterprise Rent-A-Car, Los Girasoles Restaurant, and commercial buildings to the southwest across a railroad easement.



According to information obtained from the California Department of Water Resources (DWR), *Groundwater Information Center Interactive Map Application*, groundwater in the vicinity of the subject property is inferred to be approximately 235 feet below ground surface (bgs) and flow toward the northnortheast.

Findings

A recognized environmental condition (REC) refers to the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: due to release to the environment; under conditions indicative of a release to the environment; or under conditions that pose a material threat of a future release to the environment. The following was identified during the course of this assessment:

- During Partner's April 19, 2019 site reconnaissance, an oil/water clarifier was observed in a former car wash tenant space on Parcel 1. The clarifier was reportedly used for the car wash operations, and is connected to the municipal sanitary sewer system. An interior visual assessment of the clarifier could not be conducted, and the structural integrity of the clarifier is unknown. Furthermore, the age of the clarifier is unknown, and it is unknown if it was used in association with the automotive repair operations prior to being used for the on-site car wash. The clarifier had been recently pumped and the contents were released in the alley adjacent to the northeast of Parcel 1. Oily residue and a slight sheen were noted in the clarifier discharge sludge that was released to the alley. However, the alley is paved, and the discharge was confined over the paved surfaces. Partner recommends that the practice of discharging the clarifier sludge to the alley cease. However, the sludge noted in the alley is considered a *de minimis* condition. Partner notes that the clarifier has the potential to impact the subsurface of the subject property should the system become compromised. Based on the unknown structural integrity of the clarifier and the potential use of the clarifier in connection with automotive repair-related operations for 50-plus years, the clarifier is considered a REC.
- During Partner's April 19, 2019 site reconnaissance, a pipe of unknown use was observed protruding from the ground surface within the northeastern portion of Parcel 1. Because the purpose of the pipe could not be ascertained, Partner cannot rule out the possibility that the pipe is associated with potential vent or fill pipes for an underground storage tank (UST). Based on this information, the potential presence of an UST in the area of the pipe is considered a REC.

A controlled recognized environmental condition (CREC) refers to a REC resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority, with hazardous substances or petroleum products allowed to remain in place subject to the implementation of required controls. The following was identified during the course of this assessment:

• Partner did not identify evidence of CRECs during the course of this assessment.



A historical recognized environmental condition (HREC) refers to a past release of any hazardous substances or petroleum products that has occurred in connection with the property and has been addressed to the satisfaction of the applicable regulatory authority or meeting unrestricted use criteria established by a regulatory authority, without subjecting the property to any required controls. The following was identified during the course of this assessment:

Partner did not identify evidence of HRECs during the course of this assessment.

An *environmental issue* refers to environmental concerns identified by Partner, which do not qualify as RECs; however, warrant further discussion. The following was identified during the course of this assessment:

- The subject property has been occupied by various automotive repair-related businesses since the late-1950s. During Partner's April 19, 2019 site reconnaissance, hazardous substances and petroleum products including motor oil, transmission oil, antifreeze, waste oil, waste oil filters, waste antifreeze, and various automotive fluids and cleaners were observed to be stored and utilized at the subject property. The materials are stored in drums and containers primarily within the service bays and storage rooms. Secondary containment is provided for some of the drums; however, not all of the materials were stored within secondary containment. Some staining was observed on the concrete shop floors. However, aside from the clarifier discussed as a REC above, no conduits to the subsurface were observed in the automotive repair tenant spaces. Based on the nature of the staining (heavy hydrocarbons) over paved surfaces, the observed staining is considered a de minimis condition. Hazardous wastes generated at the subject property are hauled off-site for proper disposal by a licensed hazardous waste contractor. Furthermore, review of Madera County Environmental Health Division (MCEHD) records for the storage and handling of the referenced materials indicated that previous violations were minor and were brought into compliance. Based on the absence of significant leaks, spills, or staining, the absence of significant violations on file with the MCEHD, and the absence of additoinal subsurface conduits in the automotive repair tenant spaces, the storage, use, and generation of hazardous substances associated with the automotive repair operations are not considered a REC at this time.
- Due to the age of the subject property buildings, there is a potential that asbestos-containing materials (ACMs) and/or lead-based paint (LBP) are present. Overall, suspect ACMs and painted surfaces were observed in good condition and do not appear to pose a health and safety concern to the occupants of the subject property at this time. Suspect ACMs and LBP would need to be sampled to confirm the presence or absence of asbestos and/or LBP prior to any renovation or demolition activities to prevent potential exposure to workers and/or building occupants.

Conclusions, Opinions, and Recommendations

Partner has performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E1527-13 of the property located at 401-425 and 610 North E Street in Madera, Madera County, California (the "subject property"). Any exceptions to, or deletions from, this practice are described in Section 1.5 of this report.



This assessment has revealed evidence of RECs and environmental issues in connection with the subject property; Based on the conclusions of this assessment, Partner recommends the following:

- A Phase II investigation should be conducted in order to assess the presence or absence of subsurface contamination in the location of the on-site oil/water clarifier.
- A ground-penetrating radar (GPR) or similar geophysical survey should be conducted to determine whether an UST is present in the area of the pipe on the northeastern side of Parcel 1.
 In the event that the survey does identify evidence of a tank in the area, a Phase II investigation should be conducted in order to assess the presence or absence of subsurface contamination in the location of the tank.
- As a best management practice, due care should be employed while pumping the on-site oil/water clarifier in order to prevent discharges of sludge to the subject property or adjacent alley. Additionally, secondary containment should be provided for drums of hazardous substances and petroleum products in order to prevent accidental releases to the subsurface.
- Prior to the disturbance of any suspect ACMs or LBP at the subject property, a comprehensive survey, designed to determine if the suspect materials are regulated, is recommended. If such materials are identified and need to be disturbed, repaired, or removed, a licensed abatement contractor should be consulted.



TABLE OF CONTENTS

1.0	INTE	RODUCTION	1
1.1	Pu	rpose	1
1.2		ope of Work	
1.3		nitations	
1.4	Us	er Reliance	3
1.5	Lin	niting Conditions	3
2.0	SITE	DESCRIPTION	4
2.1	Site	e Location and Legal Description	4
2.2	Cu	rrent Property Use	4
2.3		rrent Use of Adjacent Properties	
2.4		ysical Setting Sources	
	.4.1	Topography	
	.4.2	Hydrology	
	.4.3	Geology/Soils	
	.4.4	Flood Zone Information	
3.0	HIST	TORICAL INFORMATION	7
3.1		rial Photograph Review	
3.2		e Insurance Maps	
3.3		y Directories	
3.4		storical Topographic Maps	
4.0	REG	ULATORY RECORDS REVIEW	15
4.1	Re	gulatory Agencies	
-	.1.1	State Department	
	.1.2	Health Department	
	.1.3	Fire Department	
	.1.4	Air Pollution Control Agency	
	.1.5	Regional Water Quality Agency	
	.1.6	Department of Toxic Substances Control	
	.1.7	Building Department	
	.1.8	Planning Department	
	.1.9 .1.10	Oil & Gas ExplorationAssessor's Office	
4.2		apped Database Records Search	
	.2.1	Regulatory Database Summary	
	.2.2	Subject Property Listings	
	.2.3	Adjacent Property Listings	
	.2.4	Sites of Concern Listings	
	.2.5	Orphan Listings	
5.0		R PROVIDED INFORMATION AND INTERVIEWS	
5.1		erviews	
	.1.1	Interview with Owner	
	.1.2	Interview with Report User	
5	.1.3	Interview with Key Site Manager	
5	.1.4	Interviews with Past Owners, Operators, and Occupants	



5.1.5	Interview with Others	25
5.2 Use	r Provided Information	25
5.2.1	Title Records, Environmental Liens, and AULs	25
5.2.2	Specialized Knowledge	25
5.2.3	Actual Knowledge of the User	26
5.2.4	Valuation Reduction for Environmental Issues	26
5.2.5	Commonly Known or Reasonably Ascertainable Information	26
5.2.6	Previous Reports and Other Provided Documentation	26
6.0 SITE	RECONNAISSANCE	27
6.1 Gen	eral Site Characteristics	27
	ential Environmental Hazards	
6.3 Nor	n-ASTM Services	31
6.3.1	Asbestos-Containing Materials (ACMs)	31
6.3.2	Lead-Based Paint (LBP)	32
6.3.3	Radon	32
6.3.4	Lead in Drinking Water	33
6.3.5	Mold	
6.4 Adja	acent Property Reconnaissance	33
7.0 FIND	INGS AND CONCLUSIONS	34
8.0 SIGN	ATURES OF ENVIRONMENTAL PROFESSIONALS	37
	RENCES	38

<u>Figures</u>

Figure 1 Site Location Map

Figure 2 Site Plan

Figure 3 Topographic Map

Appendices

Appendix A Site Photographs

Appendix B Historical/Regulatory Documentation

Appendix C Regulatory Database Report

Appendix D Qualifications



1.0 INTRODUCTION

Partner Engineering and Science, Inc. (Partner) has performed a Phase I Environmental Site Assessment (ESA) in conformance with the scope and limitations of ASTM Standard Practice E1527-13 and the Environmental Protection Agency Standards and Practices for All Appropriate Inquiries (AAI) (40 CFR Part 312) for the property located at 401-425 and 610 North E Street in Madera, Madera County, California (the "subject property"). Any exceptions to, or deletions from, this scope of work are described in the report.

1.1 Purpose

The purpose of this ESA is to identify existing or potential Recognized Environmental Conditions (as defined by ASTM Standard E1527-13) affecting the subject property that: 1) constitute or result in a material violation or a potential material violation of any applicable environmental law; 2) impose any material constraints on the operation of the subject property or require a material change in the use thereof; 3) require clean-up, remedial action or other response with respect to Hazardous Substances or Petroleum Products on or affecting the subject property under any applicable environmental law; 4) may affect the value of the subject property; and 5) may require specific actions to be performed with regard to such conditions and circumstances. The information contained in the ESA Report will be used by Client to: 1) evaluate its legal and financial liabilities for transactions related to foreclosure, purchase, sale, loan origination, loan workout or seller financing; 2) evaluate the subject property's overall development potential, the associated market value and the impact of applicable laws that restrict financial and other types of assistance for the future development of the subject property; and/or 3) determine whether specific actions are required to be performed prior to the foreclosure, purchase, sale, loan origination, loan workout or seller financing of the subject property.

This ESA was performed to permit the *User* to satisfy one of the requirements to qualify for the innocent landowner, contiguous property owner, or bona fide prospective purchaser limitations on scope of Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) (42 U.S.C. §9601) liability (hereinafter, the "landowner liability protections," or "LLPs"). ASTM Standard E1527-13 constitutes "all appropriate inquiry into the previous ownership and uses of the property consistent with good commercial or customary practice" as defined at 42 U.S.C. §9601(35)(B).

1.2 Scope of Work

The scope of work for this ESA is in accordance with the requirements of ASTM Standard E1527-13. This assessment included: 1) a property and adjacent site reconnaissance; 2) interviews with key personnel; 3) a review of historical sources; 4) a review of regulatory agency records; and 5) a review of a regulatory database report provided by a third-party vendor. Partner contacted local agencies, such as environmental health departments, fire departments and building departments in order to determine any current and/or former hazardous substances usage, storage and/or releases of hazardous substances on the subject property.



Additionally, Partner researched information on the presence of activity and use limitations (AULs) at these agencies. As defined by ASTM E1527-13, AULs are the legal or physical restrictions or limitations on the use of, or access to, a site or facility: 1) to reduce or eliminate potential exposure to hazardous substances or petroleum products in the soil or groundwater on the subject property; or 2) to prevent activities that could interfere with the effectiveness of a response action, in order to ensure maintenance of a condition of no significant risk to public health or the environment. These legal or physical restrictions, which may include institutional and/or engineering controls (IC/ECs), are intended to prevent adverse impacts to individuals or populations that may be exposed to hazardous substances and petroleum products in the soil or groundwater on the property.

If requested by Client, this report may also include the identification, discussion of, and/or limited sampling of asbestos-containing materials (ACMs), lead-based paint (LBP), mold, and/or radon.

1.3 Limitations

Partner warrants that the findings and conclusions contained herein were accomplished in accordance with the methodologies set forth in the Scope of Work. These methodologies are described as representing good commercial and customary practice for conducting an ESA of a property for the purpose of identifying recognized environmental conditions. There is a possibility that even with the proper application of these methodologies there may exist on the subject property conditions that could not be identified within the scope of the assessment or which were not reasonably identifiable from the available information. Partner believes that the information obtained from the record review and the interviews concerning the subject property is reliable. However, Partner cannot and does not warrant or guarantee that the information provided by these other sources is accurate or complete. The conclusions and findings set forth in this report are strictly limited in time and scope to the date of the evaluations. The conclusions presented in the report are based solely on the services described therein, and not on scientific tasks or procedures beyond the scope of agreed-upon services or the time and budgeting restraints imposed by the Client. No other warranties are implied or expressed.

Some of the information provided in this report is based upon personal interviews, and research of available documents, records, and maps held by the appropriate government and private agencies. This report is subject to the limitations of historical documentation, availability, and accuracy of pertinent records, and the personal recollections of those persons contacted.

This practice does not address requirements of any state or local laws or of any federal laws other than the all appropriate inquiry provisions of the LLPs. Further, this report does not intend to address all of the safety concerns, if any, associated with the subject property.

Environmental concerns, which are beyond the scope of a Phase I ESA as defined by ASTM include the following: ACMs, LBP, radon, and lead in drinking water. These issues may affect environmental risk at the subject property and may warrant discussion and/or assessment; however, are considered non-scope issues. If specifically requested by the Client, these non-scope issues are discussed in Section 6.3.



1.4 User Reliance

Anthony De Groot engaged Partner to perform this assessment in accordance with an agreement governing the nature, scope and purpose of the work as well as other matters critical to the engagement. All reports, both verbal and written, are for the sole use and benefit of Anthony De Groot. Either verbally or in writing, third parties may come into possession of this report or all or part of the information generated as a result of this work. In the absence of a written agreement with Partner granting such rights, no third parties shall have rights of recourse or recovery whatsoever under any course of action against Partner, its officers, employees, vendors, successors or assigns. Any such unauthorized user shall be responsible to protect, indemnify and hold Partner, Client and their respective officers, employees, vendors, successors and assigns harmless from any and all claims, damages, losses, liabilities, expenses (including reasonable attorneys' fees) and costs attributable to such Use. Unauthorized use of this report shall constitute acceptance of and commitment to these responsibilities, which shall be irrevocable and shall apply regardless of the cause of action or legal theory pled or asserted. Additional legal penalties may apply.

1.5 Limiting Conditions

The findings and conclusions contain all of the limitations inherent in these methodologies that are referred to in ASTM E1527-13. Specific limitations and exceptions to this ESA are more specifically set forth below:

- Partner was unable to determine the property use at five-year intervals, which constitutes a data gap. Except for property tax files and recorded land title records, which were not considered to be sufficiently useful, Partner reviewed all standard historical sources and conducted appropriate interviews.
- Partner submitted a Freedom of Information Act (FOIA) request to the City of Madera Fire
 Department (CMFD) for information pertaining to hazardous substances, underground storage
 tanks, releases, inspection records, etc. for the subject property. As of this writing, this agency has
 not responded to Partner's request. If issues of an environmental concern are identified upon
 review of these documents, Partner will issue an addendum to this report.
- Interviews with past owners, operators, and occupants were not reasonably ascertainable and thus constitute a data gap. Based on information obtained from other historical sources (as discussed in Section 3.0), this data gap is not expected to alter the findings of this assessment.
- Partner requested information relative to deed restrictions and environmental liens, a title search, and completion of a pre-survey questionnaire from the Report User. This information was not provided at the time of the assessment.



2.0 SITE DESCRIPTION

2.1 Site Location and Legal Description

The subject property at 401-425 and 610 North E Street in Madera, California, consists of two non-contiguous properties, referred to herein as Parcels 1 and 2. Parcel 1 is located on the northeastern side of North East Street, the northwestern side of East 3rd Street, and the southeastern side of East 2nd Street. Parcel 2 is located on the southwestern side of North E Street, and the southern side of East Central Avenue. According to information obtained from the Madera County Assessor and Chicago Title Insurance Company, the subject property is identified as Assessor's Parcel Numbers (APNs) 007-054-008, -009, and -010 (Parcel 1); and APN 007-042-001 (Parcel 2). The parcels are legally described as *Lots 4 to 7 Incl BLK 16*, *Lot 3 Blk 16 and Lots 1 and 2 BLK 16* (Parcel 1) and *Strip 50' Wide ADJ E St and NE RR RW* (Parcel 2). Ownership of APNs 007-054-008, 007-054-009, and 007-054-010 (Parcel 1) is currently vested in La Casa De Maria First Mortgage Investors, LP, and ownership of APN 007-042-001 (Parcel 2) is currently vested in 610 North E Street Madera Investors, LP.

Please refer to Figure 1: Site Location Map, Figures 2 and 3: Site Plans, Figure 4: Topographic Map, and Appendix A: Site Photographs for the location and site characteristics of the subject property.

2.2 Current Property Use

The subject property is currently occupied by various tenants for commercial use. On-site operations consist of smog testing, general automotive service and repair, auto body repair, auto painting, transmission repair, auto storage, retail sales of granite and decorative tile, pool and spa services, and routine facility maintenance. In addition to the current structures, the subject property is also improved with asphalt-paved parking areas and driveways, concrete-paved walkways and flatwork, and associated landscaping.

The subject property is designated for commercial development by the City of Madera.

The subject property is identified as a California Environmental Reporting System (CERS), a CERS Hazardous Waste Generator (CERS HAZ WASTE), Certified Unified Program Agency (CUPA) Listings, a Facility Index System/Facility Registry System (FINDS), an Enforcement and Compliance History Information (ECHO), and a Recovered Government Archive Solid Waste Facilities List (RGA LF), site discussed in the regulatory database report in Section 4.2.

2.3 Current Use of Adjacent Properties

The subject property is located within a mixed commercial and residential area of Madera County. During the vicinity reconnaissance, Partner observed the following land use on properties in the immediate vicinity of the subject property:



Immediately Surrounding Properties (Parcel 1)

Northeast: Single-family residences (400-424 North D Street)

Northwest: East 2nd Street, beyond which are Gill Trucking, Ag Pro Solutions, and LF Distributing (501

North E Street), and a vacant lot (500 North D Street)

Southeast: East 3rd Street, beyond which are a vacant lot (324 North D Street) and Heartland

Opportunity Center (323 North E Street)

Southwest: North E Street, beyond which is a commercial building (416 North E Street), Comacho's

Tires (412 North E Street) and commercial buildings (400-414 North E Street)

According to the regulatory database report, the adjacent property to the southeast (323 North E Street) is identified as an Resource Conservation and Recovery Act, Small Quantity Hazardous Waste Generator (RCRA-SQG), a FINDS, an ECHO, and a Facility and Manifest Data (HAZNET) site; the adjacent property to the southwest (416 North E Street) is identified as a Hazardous Substance Storage Container (HIST UST) site; and the adjacent property to the south (314 North E Street) is identified as a CERS and a CERS HAZ WASTE site. These regulatory database listings are further discussed in Section 4.2.

Immediately Surrounding Properties (Parcel 2)

Northeast: North E Street, beyond which are commercial buildings (521, 525, and 601 North E Street)

and a vacant lot (611 North E Street)

North: East Central Avenue beyond which is Glass & Body Shop (111 East Central Avenue)

Southeast: Commercial building (500 North E Street)

Southwest: Railroad easement, beyond which are Enterprise Rent-A-Car (709 North Gateway Avenue),

Los Girasoles Restaurant (703 North Gateway Avenue) and commercial buildings (605, 609

and 625 North Gateway Avenue)

According to the regulatory database report, the adjacent property to the north is identified as a CERS HAZ WASTE and a CUPA Listings site; the adjacent property to the southeast (508 and 520 North E Street) is identified as CERS and CERS HAZ WASTE sites; the adjacent property to the northeast (525 North E Street) is identified as a HIST UST site; and the adjacent property to the southwest (625 North Gateway Avenue) is identified as a Solid Waste Recycling Facilities List (SWRCY) and Environmental Data Resources (EDR) Historical Auto site. These regulatory database listings are further discussed in Section 4.2.

2.4 Physical Setting Sources

2.4.1 Topography

The United States Geological Survey (USGS) *Madera, California* Quadrangle 7.5-minute series topographic map was reviewed for this ESA. According to the contour lines on the topographic map, the subject property is located at approximately 275 feet above mean sea level (MSL). Site-specific improvements are not depicted on the 2012 topographic map.

A copy of the topographic map is included as Figure 3 of this report.

2.4.2 Hydrology

The nearest surface water in the vicinity of the subject property is an irrigation canal located approximately 0.58-mile to the southeast of the subject property. No settling ponds, lagoons, surface impoundments, wetlands or natural catch basins were observed at the subject property during this assessment.



According to available information, a public water system operated by the City of Madera Department of Public Works, Water Division (CMWD) serves the subject property vicinity. According to a representative of the CMWD, the sources of public water for the CMWD are groundwater from public wells located approximately 0.25-mile to the west of the subject property.

According to information obtained from the DWR, *Groundwater Information Center Interactive Map Application*, groundwater in the vicinity of the subject property is inferred to be approximately 235 feet bgs and flow toward the north-northeast.

2.4.3 Geology/Soils

The subject property is situated within the eastern portion of the San Joaquin Valley. The San Joaquin Valley comprises the southern portion of the Great Valley Geomorphic Province of the State of California. The Great Valley is a long structural trough situated between the Sierra Nevada and Cascade Range to the east, the Coast Range to the west, and the Tehachapi Mountains to the south. The San Joaquin Valley has been filled with several thousand feet of sedimentary deposits derived from the erosion of the Sierra Nevada and Coastal Ranges and deposited by major to minor drainages and their tributaries. Near-surface sediments are dominated by sands and silty sands with lesser silts, minor clays, and gravel. The sedimentary deposits in the region form large coalescing alluvial fans with gentle slopes deposited primarily during Plio-Pleistocene time by the streams that drain the adjacent uplands. Sediments consist of recent and older alluvium derived primarily from the Sierra Nevada. The valley basement, consisting of pre-Tertiary granitic and metamorphic rocks, underlies the clastic section at a depth in excess of 2,000 feet below ground surface.

Based on information obtained from the United States Department of Agriculture (USDA) Natural Resources Conservation Service (NRCS) Web Soil Survey online database, the subject property is mapped as towns un-surveyed land. No soil description was available for review

2.4.4 Flood Zone Information

Partner performed a review of the Flood Insurance Rate Map, published by the Federal Emergency Management Agency. According to Community Panel Number 06038C1155E dated September 26, 2008, the majority of the subject property appears to be located in Zone X (unshaded), an area of minimal flood hazard. The southern portion of Parcel 1 is depicted as located in Zone X (shaded); an area of 0.2% annual chance flood; areas of 1% annual chance flood with average depths of less than 1 foot or with drainage areas less than 1 square mile; and areas protected by levees from 1% annual chance flood

A copy of the reviewed flood map is included in Appendix B of this report.



3.0 HISTORICAL INFORMATION

Partner obtained historical use information about the subject property from a variety of sources. A chronological listing of the historical data found is summarized in the table below:

Historical Use Inf	Historical Use Information				
Period/Date	Source	Description/Use			
Parcel 1					
1891-1898	Sanborn Maps	Undeveloped Lots			
1912	Sanborn Map	Stable and Undeveloped Lots			
1929-1950	Sanborn Maps, Aerial Photographs	Valley Feed & Fuel Hay Warehouse and Auto Garage			
1956-Present	Aerial Photographs, Sanborn Maps, City Directories, Regulatory Agency Records, Interviews, On-Site Observations	Commercial			
Parcel 2					
1929-1940	Aerial Photograph, Sanborn Maps	Undeveloped Land			
1946-1950	Aerial Photographs, Sanborn Maps	Valley Feed & Fuel Grain Warehouse			
1959	Sanborn Map	James Grain Company Grain Warehouse			
1962-Present	Aerial Photographs, Sanborn Maps, City Directories, Regulatory Agency Records, Interviews, On-Site Observations	Commercial			

Tenants on the subject property have included grain and feed storage businesses (1929-1965), and various commercial tenants including automotive repair-related businesses (1958-Present). Refer to Section 3.3 for a summary of city directory listings for the subject property.

3.1 Aerial Photograph Review

Partner obtained available aerial photographs of the subject property and surrounding area from EDR. The following features or uses were noted on the subject property and adjacent properties during the aerial photograph review:

Parcel 1

Date: 1937, 19	46	Scale:	1"=500'
Subject Property:	Appears to be undeveloped land within the southern port commercial building within the northern portion	ions and de	veloped with a
Northeast:	Appears to be developed with single-family residences		
North:	Appears to be developed with a single-family residence		
Northwest:	Appears to be undeveloped land		
Southeast:	Appears to be undeveloped land		
Southwest:	Appears to be undeveloped land		

Date: 1950 Scale: 1"=500'

Subject Property:No significant changes visibleNortheast:No significant changes visibleNorth:No significant changes visible



Date: 1950 Scale: 1"=500'

Northwest: Appears to be developed with small outbuildings

Southeast: No significant changes visible **Southwest:** No significant changes visible

Date: 1957 Scale: 1"=500'

Subject Property: Appears to be additionally developed with two of the current commercial buildings

Northeast: No significant changes visible
North: No significant changes visible
Northwest: No significant changes visible

Southeast: Appears to be developed with a commercial building across a road (East 3rd Street) **Southwest:** Appears to be developed with a commercial building across a road (North E Street)

Date: 1962 Scale: 1"=500'

Subject Property: No significant changes visible **Northeast:** No significant changes visible

North: No significant changes visible across a road (East 2nd Street) **Northwest:** No significant changes visible across a road (East 2nd Street)

Southeast: No significant changes visible

Southwest: Appears to be additionally developed with commercial buildings

Date: 1972, 1978 Scale: 1"=500'

Subject Property: No significant changes visible except for the development of a small building within

the southwestern corner

Northeast: No significant changes visible
North: No significant changes visible
Northwest: No significant changes visible
Southeast: No significant changes visible
No significant changes visible

Date: 1981, 1984, 1998, 2006, 2009, 2012 and 2016 Scale: 1"=500'

Subject Property: No significant changes visible except for the development of an expansion to the

existing commercial buildings

Northeast: No significant changes visible North: No significant changes visible

Northwest: Appears to be developed with a commercial building

Southeast: No significant changes visible **Southwest:** No significant changes visible

Date: 2006, 2009, 2012, 2016 Scale: 1"=500'

Subject Property:No significant changes visibleNortheast:No significant changes visibleNorth:No significant changes visible

Northwest: Appears to be developed with a commercial building

Southeast: No significant changes visible except for the absence of previously noted single

family residence

Southwest: No significant changes visible



Parcel 2

Date: 1937 Scale: 1"=500'

Subject Property: Appears to be undeveloped land

Northeast: Appears to be undeveloped land and developed with single family residences across

a road (North E Street)

North: Appears to be undeveloped land across a road (East Central Avenue) **Northwest:** Appears to be undeveloped land across a road (East Central Avenue)

Southeast: Appears to be undeveloped land

Southwest: Appears to be developed with commercial buildings across railroad tracks

Date: 1946 Scale: 1"=500'

Subject Property: Appears to be developed with a building

Northeast: No significant changes visible

North: Appears to be developed with the current commercial building

Northwest: No significant changes visible **Southeast:** No significant changes visible

Southwest: No significant changes visible except for additional commercial buildings

Subject Property: Appears to be developed a narrow commercial building

Northeast: No significant changes visible
North: No significant changes visible
Northwest: No significant changes visible
Southeast: No significant changes visible
No significant changes visible

Date: 1998, 2006, 2009, 2012 and 2016 Scale: 1"=500'

Subject Property:No significant changes visibleNortheast:No significant changes visibleNorth:No significant changes visibleNorthwest:No significant changes visible

Southeast: Appears to be developed with commercial buildings

Southwest: Appears to be undeveloped and re-developed with commercial buildings

Copies of reviewed aerial photographs are included in Appendix B of this report.

3.2 Fire Insurance Maps

Partner reviewed the collection of Sanborn Fire insurance maps from EDR). The following features or uses was depicted on the subject property and adjacent properties during the fire insurance map review:

Parcel 1

Date: 1888

Subject Property:Not depicted on the mapNortheast:Not depicted on the mapNorth:Not depicted on the mapNorthwest:Not depicted on the mapSoutheast:Depicted as undeveloped lots



Date: 1888

Southwest: Not depicted on the map

Date: 1891, 1898

Subject Property: Depicted as an undeveloped lot

Northeast: Depicted as developed with dwellings, outbuildings and stables across an alley

North: Depicted as vacant land across East 2nd Street

Northwest: No significant changes depicted

Southeast: Depicted as developed with a dwelling and an undeveloped lot across a road

Southwest: Not depicted on the map

Date: 1912

Subject Property: Depicted as developed with a large stable with no significant changes depicted in

the remaining area

Northeast: No significant changes depicted

North: Depicted as developed with a dwelling, stable and outbuilding

Northwest: Depicted as undeveloped land Southeast: No significant changes depicted

Southwest: Not depicted on the map

Date: 1929, 1940, 1950

Subject Property: Depicted as developed with commercial building labelled Valley Feed & Fuel hay

warehouse and auto garage (425 North E Street)

Northeast: No significant changes depicted

North: Depicted as developed ;with an outbuilding

Northwest: Depicted as undeveloped land across North E Street

Southeast: No significant changes depicted No significant changes depicted

Date: 1959

Subject Property: Depicted as developed with a commercial building labelled auto repairing (409 ½

North E Street); an auto sales building with a car wash (409 North E Street); developed with two stores and a spray-painting area (411 and 413 North E Street);

and miscellaneous storage (425 North E Street)

Northeast:
No significant changes depicted
North:
No significant changes depicted
Northwest:
Depicted as developed with a dwelling

Southeast: Depicted as developed with a store, for plumbing supplies (325 North E Street) **Southwest:** Depicted as developed with a commercial building labelled Auto Upholstering (400

North E Street); Brake Servicing (404 North E Street); a narrow commercial building

occupied by Howe Plumbing, Paint, Lumber and Cabinets (500 North E Street)



Parcel 2

Date: 1888, 1891, 1898, 1912

Subject Property:Not depicted on the mapNortheast:Not depicted on the mapNorth:Not depicted on the mapNorthwest:Not depicted on the mapSoutheast:Not depicted on the mapSouthwest:Not depicted on the map

Date: 1929, 1940

Subject Property: Depicted as undeveloped land

Northeast: Depicted as developed with dwellings and outbuildings across North E Street

North:
Not depicted on the map
Northwest:
Not depicted on the map
Depicted as undeveloped land

Southwest: Depicted as developed with Southern Pacific Main railroad tracks beyond which is

Sequoia Lumber Company complex

Date: 1950

Subject Property: Depicted as developed with Valley Feed & Fuel Company grain and feed warehouse

and a grain cleaning operation (609 and 615 North E Street)

Northeast: Depicted as developed with dwellings and outbuildings

North:
Not depicted on the map
Northwest:
Not depicted on the map
No significant changes depicted

Southwest: No significant changes depicted

Date: 1959

Subject Property: Depicted as occupied by James Grain Company grain and feed warehouse

constructed of wood joists and concrete floor with a molasses warehouse (609

North E Street) and

Northeast: No significant changes depicted
North: Not depicted on the map

Northwest: Not depicted on the map

Southeast: No significant changes depicted

Southwest: No significant changes depicted

Copies of reviewed Sanborn maps are included in Appendix B of this report.

3.3 City Directories

Partner reviewed historical city directories obtained from EDR for past names and businesses that were listed for the subject property and adjacent properties. The findings are presented in the following table:



City Directory Search for 401-425 North E Street and 610 North E Street (Subject Property) Year(s) **Occupant Listed** Parcel 1 401, 409 409 ½, 411, 413, 421 and 425 North E Street 1958 Frank April acct, Hartwig Mtrs, Kirkman-Taylor grain dealers 1964 Bob's Motorcycle Service, Hughes Honda Sales, Frank April acct, State Farm Insurance Co. 1971 Schoettler General Tire Specialists Inc. Sales & Service, State Board of Equalization, Carousel Beauty Shop 1977 Giersch Gilbert Civil Engineers, Lous Radiator 1982 Schoettler General Tire Specialists Inc. 1987 Elite Glass & Mirror 1992 Bandag Shop 1995 Schoettler Tire Inc. 2000 Schoettler Tire Inc. 2005 Gutierrez Smog Test Only, Maria Auto Repair of Madera, Twilight Hammers Andy's Transmissions 2010 2014 Madera Fine Hand Wash, Andy's Transmissions Parcel 2 600, 609, 610 and 615 North E Street 1952 T. A. Peabody 1958-1964 James Grain Company 1971 Valley Wholesale Building Materials Co. warehouse 1977-2014 Address not listed

According to the city directory review, the subject property has been occupied by various commercial and automotive businesses.

City	Directory	Sparch for	Adiacent P	roportios (Darcol 11
71111		P14' 49 4'	7 = \ ' ' \ 0 -		

Location	Address/Occupant Listed/Years Listed
Location	Addiess, Occupant Listed, i cars Listed

Northeast: 400-424 North D Street residential addresses not searched **North:** 500 North D Street-residential address not searched

Northwest: 501 North E Street was listed as occupied by Roy Ben Lyon building contractor in 1964;

William E. Holt accountant, Huettl Bookkeeping, Roy Ben Lyon building contractor and Regional Center for Mentally Retarded in 1971; Roy Ben Lyon building and Mid-Cal Engineering & Survey in 1977; Roy Ben Lyon building in 1982; Joyce's Bookkeeping and Roy Ben Lyon building in 1987; Carriage House, Allan P. Cohan Deming E P Associates and Joyce's Bookkeeping in 1992; Allan P. Cohan, Deming E P Associates and Joyce's Bookkeeping in 1995; Carpenter Claim Service, Allan P. Cohan, Deming E P Associates, Williams and Caine in 2000; Carpenter Claim Service, Deduction Center, Ovesons Upholstery and Robert L. Jensen & Associates in 2005; Central Valley Enterprises GG Trucking and

Robert L. Jensen & Associates in 2010; and Luis Fimbrez and G. G. Trucking

Southeast: 324 North D Street residential address not searched

Southeast: 323 North E Street was occupied by Madera Community Hospital development office in

1971; Association Development Handicapped in 1977 to 2005; Heartland Opportunity

Center in 2010 and 2014

Southwest: 400 North E Street was occupied by Madera auto Top & Upholstery in 1958, to 1987;

Johnathan Ghosoph, Madera Auto and Furniture Upholstery and Madera Upholstery Company in 2005; Madera Auto and Furniture Upholstery and Madera Upholstery Company in 2010; and IV Lawn Equipment Repair & Sales and Madera Auto and Furniture

Upholstery in 2014.



City Directory Search for Adjacent Properties (Parcel 1)

Location Address/Occupant Listed/Years Listed

Southwest: 412 North E Street was occupied by Mid-State Appliance Center dealers in 1964; Al Ruby's

Air Conditioning and Larry's Garage auto repair in 1971; Antique Upholstery Specialist and Madera Upholstery in 1991; Madera Upholstery in 1995; Madera Upholstery and Nash Oleta in 2000; Shunamite Place and Sunshine Agriculture Service in 2005; Car Connection

Unlimited in 2010 to 2014

Southwest: 414 North E Street was occupied by Greg Valenzuela in 2005

Southwest: 416 North E Street was occupied by Atlas Glass in 1964 and 1971; Cargill Pest Control in

1977; Morgan Brothers Incorporated in 1982; and Phillip's Brothers Auto in 1995

City Directory Search for Adjacent Properties (Parcel 2)

Location Address/Occupant Listed/Years Listed

Northeast: 521 525 and 601 North E Street was occupied by P. A. Terry in 1958; Larry L. Upton in 1964;

Kenley Dilbeck in 1964; Salvador G. Martinez and Muller Irrigation Inc. in 1971; Muller

Irrigation in 1977 and 1982; Valley Irrigation in 1987; and G & L Irrigation in 2000;

Northeast 611 North E Street was occupied by Chas Fleming in 1952 and 1958; Mrs. Viola Fleming in

1964; and vacant in 1971

North: 111 East Central Avenue was not searched
Northwest: 801 North Gateway Avenue was not searched

Southeast: 500 North E Street was occupied by Roy Ben Lyon Building Contractor in 1958; Dick

Anderson Ford Sales in 1964; Madera Automotive & Supply and PMS West Inc. liquid feed supplement sales in 1971; Madera Marine and Quality Motors in 1977 and 1982; Madera Marine in 1987 to 1992; Ray's Small Engine & Garden Equipment in 1995 to 2000; Raymond J. Bellas in 2005; Ray's Small Engine & Garden Equipment and Madera Small Engine &

Garden Equipment in 2010 to 2014

Southwest: 605-709 North Gateway Avenue were not searched

The adjacent properties have been occupied by various residential and commercial businesses since at least 1952. Environmentally sensitive listings are discussed in Section 4.2.3.

3.4 Historical Topographic Maps

Partner reviewed historical topographic maps obtained from EDR. The following features or uses were depicted on the subject property and adjacent properties during the topographic map review:

Parcel 1

Date: 1922

Subject Property: Depicted as undeveloped land

Northeast: Depicted as developed residential-type buildings **North:** Depicted as developed a residential-type building

Northwest: Depicted as undeveloped land **Southeast:** Depicted as undeveloped land

Southwest: Depicted as undeveloped land across a road



Date: 1946, 1947, 1963, and 1981

Subject Property:Depicted as developed landNortheast:Depicted as developed landNorth:Depicted as developed landNorthwest:Depicted as developed landSoutheast:Depicted as developed landSouthwest:Depicted as developed land

Parcel 2

Date: 1922

Subject Property: Depicted as undeveloped land

Northeast: Depicted as developed with a residential-type building across a road **North:** Depicted as developed with a residential-type building across a road

Northwest: Depicted as developed with railroad tracks beyond which was undeveloped land

Southeast: Depicted as undeveloped land

Southwest: Depicted as developed with railroad tracks beyond which was undeveloped land

Date: 1946, 1947, 1963 and 1981

Subject Property: Depicted as undeveloped land **Northeast:** Depicted as undeveloped land

North: Depicted as developed with a residential-type building

Northwest: Depicted as undeveloped land
Southeast: Depicted as undeveloped land
Southwest: Depicted as undeveloped land

Copies of reviewed topographic maps are included in Appendix B of this report.



4.0 REGULATORY RECORDS REVIEW

4.1 Regulatory Agencies

4.1.1 State Department

Regulatory Agency Data

Name of Agency: California Environmental Protection Agency (Cal/EPA)

Point of Contact: CalEPA Regulated Sites Portal

Agency Address: https://siteportal.calepa.ca.gov/nsite/

Agency Phone Number: (916) 323-2514

Date of Contact: April 15, 2019

Method of Communication: Online Research

Summary of Communication: According to records reviewed, the subject property has multiple

automotive occupants as follows:

According to the Cal/EPA database, Sinai Auto Repair is regulated as a Hazardous Waste Generator with a compliance evaluations conducted and violation noted in 2015. Martin's Electrical & Auto Repair is registered as a Hazardous Waste Generator with a compliance evaluation noting violations in 2017. Madera Auto Tires & Repairs as a Hazardous Waste Generator with compliance evaluation conducted in 2016 with violations noted. D & F Body & Paint is tracked as a Hazardous Waste Generator with a compliance evaluation conducted in 2015. Andy's Transmission Shop is a Hazardous Waste Generator with a compliance evaluation and violations noted in 2017. According to the Cal/EPA database, the MCEHD is the lead agency responsible for Certified Unified Program Agency oversight, as discussed in Section 4.1.2.

4.1.2 Health Department

Regulatory Agency Data

Name of Agency: Madera County Environmental Health Department (MCEHD)

Point of Contact: Mr. Richard Jitsumyo

Agency Address: 200 West 4th Street, Suite 3100, Madera, California 93637

Agency Phone Number: (559) 675-7823

Date of Contact: April 15, 2019

Method of Communication: Faxed/In Person

Summary of Communication: According to records reviewed, the subject property is regulated by

the MCEHD for automotive uses as follows:

Review of a Hazardous Waste Generator Inspection Form (HWGIF) for D & F Body Shop at 401 North E Street conducted on April 2, 2015 indication that containers should be closed except for when adding hazardous waste substances. An inspection conducted on July 17, 2009 did not identify violations.

On February 24, ,2011 the MCEHD conducted a HWGIF for Martin's Electrical & Auto Repair (401 North E Street) that did not identify violations. Review of the July 27, 2017 HWGIF stated a number of violations such as the Cal EPA ID needed to be reactivated; a contingency plan needed to be posted; 55-gallon drums were not closed; holes were observed on the drum lids even though they are placed in proper secondary containment structure; regular inspections need to be conducted; waste was accumulated for more than applicable days; and the containers needed proper labelling. A Notice of Violations was issued



with regards to the noted violations. A HWGIF dated November 30, 2017 Re-Inspection identified no violations and that previous violations from the former HWGIF had been corrected.

According to the MCEHD, a Permit to Operate through December 31, 2019 is on file for Sinai Auto Repair. The MCHED HWGIF dated February 20, 2015 indicated violations with regards to no contingency plan; provide proper training to employees; manifest records for three years were not on-site; clean the waste container and surrounding area; weekly inspections were not conducted; failure to keep containers closed unless adding waste; all 3 55-gallon drum lids had holes in them; provide missing spill equipment; and label all containers with labels. Review of the follow-up MCEHD HWGIF dated March 24, 2015 indicated the failure of the operator to activate an EPA ID but noted that all other violations from February 20, 2015 were corrected.

Andy's Transmission at 425 North E Street was issued a PTO through December 31, 2019. A HWGIR conducted on April 8, 2011 did not identify any violations. A HWGIF conducted on June 27, 2017 stated a number of violations such as the absence of a Cal EPA ID number; a contingency plan was required to be posted; manifest records were not observed; containers were not closed; containers needed to be inspected weekly; and containers were not properly labelled. A November 30, 2017 HWGIF reported that manifest records were not complete and training records were not provided. A Re-Inspection HWGIF reported that all previously noted violations had been corrected.

Madera Auto & Repair at 610 North E Street Madera Auto & Repair at 610 North E Street was issued a PTO through December 31, 2019 According to MCHED records of a HWGIF conducted on February 29, 2016 noted violations such as the absence of a contingency plan; that manifests for 2013, ,2014 2015 and 2016 were not observed; 55—gallon drums of oil filters were open; weekly inspections need to be conducted; hazardous waste labels need to have the correct EPA ID; accumulation dates were not accurate; and spent batteries were not labelled. A Hazardous Materials Business Plan Inspection (HMBP) conducted February 29, 2016 indicate the failure to updated hazardous materials inventory and the failure to include provision in the business plan to ensure that initial and annual training is conducted. A Return to Compliance (RTC) Statement was submitted to the MCEHD. The follow-up inspections for the HWGIF and HMBP March 30, 201 report all corrections previously noted have been made.

4.1.3 Fire Department

Regulatory Agency Data

Name of Agency: City of Madera Fire Department (CMFD)

Point of Contact: James Forga: james.forga@fire.ca.gov

Agency Address: 317 North Lake Street, Madera, California 93638

Agency Phone Number: (559) 661-5499 **Date of Contact:** April 15, 2019

Method of Communication: Email

Summary of Communication: As of the date of this report, Partner has not received a response

from the CMFD for inclusion in this report.



4.1.4 Air Pollution Control Agency

Regulatory Agency Data

Name of Agency: San Joaquin Valley Air Pollution Control District (SJVAPCD)

Point of Contact: Ms. Desiree Alvarez, Senior Office Assistant Agency Address: 1990 East Gettysburg Avenue, Fresno, California

Agency Phone Number: (559) 230-6000

Date of Contact: April 15, 2019

Method of Communication: Online Records Request/Email

Summary of Communication: No Permits to Operate (PTO), Notices of Violation (NOV), or Notices

to Comply (NTC); or the presence of AULs, dry cleaning machines, or

USTs were on file for the subject property with the SJVAPCD.

4.1.5 Regional Water Quality Agency

Regulatory Agency Data

Name of Agency: State Water Resources Control Board (SWRCB)

Point of Contact: GeoTracker Database

Agency Address: http://geotracker.waterboards.ca.gov/

Date of Contact: April 15, 2019 **Method of Communication:** Online Research

Summary of Communication: No records regarding hazardous substance use, storage, or releases;

or the presence of USTs and AULs on the subject property were on

file with the SWRCB.

4.1.6 Department of Toxic Substances Control

Regulatory Agency Data

Name of Agency: California Department of Toxic Substances Control (DTSC)

Point of Contact: EnviroStor and Hazardous Waste Tracking System (HWTS) Databases

Agency Address: http://www.envirostor.dtsc.ca.gov/public/

http://hwts.dtsc.ca.gov/report_search.cfm?id=5

Date of Contact: April 15, 2019 **Method of Communication:** Online Review

Summary of Communication: No records regarding hazardous substance use, storage, or releases;

or the presence of USTs and AULs on the subject property were on

file with the DTSC.

4.1.7 Building Department

Regulatory Agency Data

Name of Agency: City of Madera Building Department (CMBD)

Point of Contact: mbravo@cityofmadera.com

Agency Address: 205 West 4th Street, Madera, California 93637

Agency Phone Number: (559) 675-7703 **Date of Contact:** April 15, 2019

Method of Communication: Email

Summary of Communication: Records were available for review, as further discussed in the

following table:



Year(s) Owner/Applicant

04/25/1956 Roy B. Lyon Multi-permit for 401-413 North E Street

4.1.8 Planning Department

Regulatory Agency Data

Name of Agency: City of Madera Planning Department (CMPD)

Point of Contact: https://www.cityofmadera.ca.gov/wp-

content/uploads/2016/04/Zoning_Map_042016.pdf

Agency Address: 204 West 4th Street, Madera, California 93637

Agency Phone Number: (559) 661-5405

Date of Contact: April 15, 2019

Method of Communication: Online Research

Summary of Communication: According to records reviewed, the subject property is zoned C2 for

Heavy Commercial development by the City of Madera.

4.1.9 Oil & Gas Exploration

Regulatory Agency Data

Name of Agency: California Division of Oil, Gas and Geothermal Resources (DOGGR)

Point of Contact: Well Finder Database

Agency Address: https://maps.conservation.ca.gov/doggr/wellfinder/#close

Date of Contact: April 15, 2019 **Method of Communication:** Online Research

Summary of Communication: According to DOGGR, no oil or gas wells are located on or adjacent

to the subject property.

4.1.10 Assessor's Office

Regulatory Agency Data

Name of Agency: Madera County Assessor (MCA)

Point of Contact: Parcel Information Database

Agency Address: 200 West 4th Street, Madera, California 93637

Agency Phone Number: (559) 675-7710

Date of Contact: April 15, 2019

Method of Communication: Online Review

Summary of Communication: According to records reviewed, the subject property is identified by

APNs 007-054-008, 007-054-009, and 007-054-010 (Parcel 1) and APN 007-042-001 (Parcel 2). The current buildings were constructed from 1956 to 1987 and total approximately 36,333 square feet on a

combined 1.83-acre lot.

Copies of pertinent documents obtained from the above-referenced regulatory agencies, if available, are included in Appendix B of this report.



4.2 Mapped Database Records Search

Information from standard federal, state, county, and city environmental record sources was provided by EDR. Data from governmental agency lists are updated and integrated into one database, which is updated as these data are released. The information contained in this report was compiled from publicly available sources and the locations of the sites are plotted utilizing a geographic information system, which geocodes the site addresses. The accuracy of the geocoded locations is approximately +/-300 feet.

Using the ASTM definition of migration, Partner considers the migration of hazardous substances or petroleum products in any form onto the subject property during the evaluation of each site listed on the radius report, which includes solid, liquid, and vapor.

4.2.1 Regulatory Database Summary

Radius Report Data				
Database	Search Radius (mile)	Subject Property	Adjacent Properties	Sites of Concern
Federal NPL or Delisted NPL Site	1.00	No	No	No
Federal SEMS Site	0.50	No	No	No
Federal SEMS-Archive Site	0.50	No	No	No
Federal RCRA CORRACTS Facility	1.00	No	No	No
Federal RCRA TSDF Facility	0.50	No	No	No
Federal RCRA Generators Site	0.25	No	Yes	N/A
Federal IC/EC Registries	0.50	No	No	No
Federal ERNS Site	Subject Property	No	N/A	N/A
State/Tribal Equivalent NPL	1.00	No	No	No
State/Tribal Equivalent CERCLIS	1.00	No	No	No
State/Tribal Landfill/Solid Waste Disposal Site	0.50	No	No	No
State/Tribal Leaking Storage Tank Site	0.50	No	No	No
State/Tribal Registered Storage Tank Sites	0.25	No	Yes	N/A
State/Tribal Voluntary Cleanup Sites (VCP)	0.50	No	No	No
State/Tribal Spills	0.50	No	No	No
Federal Brownfield Sites	0.50	No	No	No
State Brownfield Sites	0.50	No	No	No
Miscellaneous Databases	Varies	Yes	Yes	No
EDR MGP	1.00	No	No	No
EDR Hist Auto	0.125	No	Yes	N/A
EDR Hist Cleaner	0.125	No	No	N/A

4.2.2 Subject Property Listings

The subject property is identified as a CERS, a CERS HAZ WASTE, a CUPA Listings, a FINDs, an ECHO, and a RGA LF, site in the regulatory database report, as discussed below:



- Madera Auto Tires & Repair at 610 North E Street is reported in the Cal EPA database as regulated by the MCEHD. This facility is tracked by the CERS database as a Hazardous Waste Generator with various compliance issues noted. The issues are also noted as returned to compliance. The FINDS database points to the RCRA program and the ECHO database reports the no violation status. A discussion of the facility is included in Section 4.1.2. This facility is not listed on databases indicative of a release of hazardous substances. Based on the MCEHD oversight and the absence of documented releases, these listings are not expected to represent a significant environmental concern.
- Schoettler Tire Inc. at 401 North E Street is listed in the RGA Solid Waste Facility repository from 1997 to 2004. The facility is listed presumably for the storage and disposal of waste tires accumulated as a part of the operations conducted on-site. No additional information is reported in the database report. This facility is not listed on databases indicative of a release of hazardous substances. Based on the presumed nature of this listing related to waste tire generation and the absence of documented releases, this listing is not expected to represent a significant environmental concern.
- Andy's Transmission at 425 North E Street is listed in the FINDS database that points to the
 Hazardous Waste/Enforcement and Compliance History and is listed in the ECHO database with a
 no violation status. This facility is tracked by the CERS database as a Hazardous Waste Generator
 with various compliance issues noted. The issues are also noted as returned to compliance.
 MCEHD tracks this facility under program element Haz Mat Inventory-Exempt. A discussion of the
 facility is included in Section 4.1.2. No additional information is reported in the database report.
 This facility is not listed on databases indicative of a release of hazardous substances. Based on
 the MCEHD oversight and the absence of documented releases, these listings are not expected to
 represent a significant environmental concern.
- Sinai Auto Repair at 401 North E Street, Suite N is reported in the Cal EPA database as regulated by the MCEHD. This facility is tracked by the CERS database as a Hazardous Waste Generator with various compliance issues noted. The issues are also noted as returned to compliance. No additional information is reported in the database report. This facility is not listed on databases indicative of a release of hazardous substances. Based on the MCEHD oversight and the absence of documented releases, these listings are not expected to represent a significant environmental concern.
- D & F Body & Paint 401 North E Street is reported in the Cal EPA database as regulated by the MCEHD. This facility is tracked by the CERS database as a Hazardous Waste Generator with various compliance issues noted. The issues are also noted as returned to compliance. No additional information is reported in the database report. This facility is not listed on databases indicative of a release of hazardous substances. Based on the MCEHD oversight and the absence of documented releases, these listings are not expected to represent a significant environmental concern.



• Martin's Electrical & Auto Repair is reported in the Cal EPA database as regulated by the MCEHD. This facility is tracked by the CERS database as a Hazardous Waste Generator with various compliance issues noted. The issues are also noted as returned to compliance. No additional information is reported in the database report. This facility is not listed on databases indicative of a release of hazardous substances. Based on the MCEHD oversight and the absence of documented releases, these listings are not expected to represent a significant environmental concern.

4.2.3 Adjacent Property Listings

The adjacent property to the southeast is identified as a RCRA-SQG, a FINDS, an ECHO, and a HAZNET site in the regulatory database report, as discussed below:

• Heartland Opportunity Center at 323 North E Street registered in 1990 as a small quantity generator of hazardous substances with the EPA with no violations found. The FINDS database point so the California Hazardous Waste Tracking System-Datamart, the RCRA program and the ECHO database. The ECHO report reports the no violations status. This facility reported the off-site transfer and disposal of pesticide rinsewater; unspecified oil-containing waste; unspecified organic liquid mixture; unspecified solvent mixture; and other organic solids in 2006. This facility is not listed on databases indicative of a release of hazardous substances. Based on the absence of documented violations or releases, these listings are not expected to represent a significant environmental concern and it is unlikely that a regulatory file review for this site would alter the findings of this assessment.

The adjacent property to the southwest is identified as a HIST UST site in the regulatory database report, as discussed below:

• San Joaquin Pest Control at 416 North E Street is reported in the HIST UST database as formerly operating a 550-gallon unleaded gasoline tank. Review of MCEHD records indicates the UST was removed with the agency oversight in 1986. A handwritten note on the removal inspection report indicated no significant soil contamination was identified. This facility is not listed on databases indicative of a release of hazardous substances including the LUST database. Based on the reported removal of the UST and the absence of documented releases, this listing is not expected to represent a significant environmental concern.

The adjacent property to the northeast is identified as a HIST UST site in the regulatory database report, as discussed below:

• Mueller Irrigation Inc. at 525 North E Street is reported in the HIST UST database as formerly operating a 1,000-gallon gasoline tank installed in 1970. No additional information pertaining to the UST is reported in the database report. However, this facility is not listed on databases indicative of a release of hazardous substances including the LUST database. Based on the absence of documented releases, this listing is not expected to represent a significant environmental concern and it is unlikely that a regulatory file review for this site would alter the findings of this assessment.



The adjacent property to the southwest is identified as a SWRCY and EDR Historical Auto site in the regulatory database report, as discussed below:

• GL Perez at 625 North Gateway Avenue is registered as a recycling facility and WA McGee is listed in EDR's proprietary database as a historical gasoline service station operating from 1969 to 1973. This facility is located down-gradient of the subject property. No additional information is listed in the database report. This facility is not listed on databases indicative of a release of hazardous substances including the LUST database. Based on the absence of documented releases and inferred direction of groundwater flow, these listings are not expected to represent a significant environmental concern and it is unlikely that a regulatory file review for this site would alter the findings of this assessment.

The adjacent property to the southeast is identified as a CERS and CERS HAZ WASTE site in the regulatory database report, as discussed below:

• Casey's Discount Auto at 508 North E Street, and Auto Service Labs at 520 North E Street, are both listed on the CERS databases related to permitted hazardous waste generation through the MCEHD. Neither facility is listed on databases indicative of a release. Based on the MCEHD oversight and the absence of documented releases, these listings are not expected to represent a significant environmental concern and it is unlikely that a regulatory file review for this site would alter the findings of this assessment.

The adjacent property to the north is identified as a CUPA Listings and a CERS HAZ WASTE site in the regulatory database report, as discussed below:

Madera Glass & Body Works at 105 East Central Avenue, is regulated by the MCEHD as a
hazardous substance storage and hazardous waste generator facility. This facility is not listed on
databases indicative of a release of hazardous substances to the subsurface. Based on the MCEHD
oversight and the absence of documented releases, these listings are not expected to represent a
significant environmental concern and it is unlikely that a regulatory file review for this site would
alter the findings of this assessment.

The adjacent property to the south is identified as a CERS and CERS HAZ WASTE site in the regulatory database report, as discussed below:

• Barajas Body Shop at 314 North E Street is listed on the CERS databases related to permitted hazardous waste generation through the MCEHD. This facility is listed on databases indicative of a release. Based on the MCEHD oversight and the absence of documented releases, these listings are not expected to represent a significant environmental concern and it is unlikely that a regulatory file review for this site would alter the findings of this assessment.

Based on the findings, vapor migration from the adjacent properties is not expected to represent a significant environmental concern at this time.



4.2.4 Sites of Concern Listings

No sites with the potential to adversely impact the subject property are identified in the regulatory database report. Based on various mitigating factors including relative distance from the subject property, inferred direction of groundwater flow, media affected, and/or regulatory status, the listed sites within the specified search radius of the subject property which appeared on local, State, or Federally published lists of sites that have had releases of hazardous substances are not expected to represent a significant environmental concern.

Based on the findings, vapor migration from the surrounding properties is not expected to represent a significant environmental concern at this time.

4.2.5 Orphan Listings

No orphan listings of potential environmental concern to the subject property are identified in the regulatory database report.

A copy of the regulatory database report is included in Appendix C of this report.



5.0 USER PROVIDED INFORMATION AND INTERVIEWS

In order to qualify for one of the *Landowner Liability Protections (LLPs)* offered by the Small Business Liability Relief and Brownfields Revitalization Act of 2001 (the *Brownfields Amendments*), the *User* must conduct the following inquiries required by 40 CFR 312.25, 312.28, 312.29, 312.30, and 312.31. The *User* should provide the following information to the *environmental professional*. Failure to provide this information could result in a determination that *all appropriate inquiries* is not complete. The *User* is asked to provide information or knowledge of the following:

- Review Title and Judicial Records for Environmental Liens and AULs
- Specialized Knowledge or Experience of the User
- Actual Knowledge of the User
- Reason for Significantly Lower Purchase Price
- Commonly Known or Reasonably Ascertainable information
- Degree of Obviousness
- Reason for Preparation of this Phase I ESA

Fulfillment of these user responsibilities is key to qualification for the identified defenses to CERCLA liability. Partner requested our Client to provide information to satisfy User Responsibilities as identified in Section 6 of the ASTM guidance.

Pursuant to ASTM E1527-13, Partner requested the following site information from Anthony De Groot (User of this report).

User Responsibilities				
Item	Provided By User	Not Provided By User	Discussed Below	Does Not Apply
Environmental Pre-Survey Questionnaire		-	X	
Title Records, Environmental Liens, and AULs			X	
Specialized Knowledge			X	
Actual Knowledge			X	
Valuation Reduction for Environmental Issues			X	
Identification of Key Site Manager	Section 5.1.3			
Reason for Performing Phase I ESA	Section 1.1			
Prior Environmental Reports		X		
Other		X		



5.1 Interviews

5.1.1 Interview with Owner

Mr. Carl Lindros subject property owner, was not aware of any pending, threatened, or past litigation relevant to hazardous substances or petroleum products in, on, or from the subject property; any pending, threatened, or past administrative proceedings relevant to hazardous substances or petroleum products in, on, or from the subject property; or any notices from a governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances or petroleum products.

According to Mr. Lindros, the subject property was formerly a general warehouse and light auto repair. Mr. Lindros further stated that there are no USTs, ASTs, clarifiers, oil/water separators, groundwater monitoring wells, or hazardous substance use, storage or generation on the subject property to the best of his knowledge except for quantities of antifreeze and oil in above ground drums.

5.1.2 Interview with Report User

Please refer to Section 5.2 below for information requested from the Report User. The information requested was not received prior to the issuance of this report.

5.1.3 Interview with Key Site Manager

Mr. Jared Ennis, key site manager, indicated that that there are no USTs, ASTs, groundwater monitoring wells, or hazardous substance use, storage or generation on the subject property to the best of his knowledge except for what was observed during the site reconnaissance. An area of oily staining was observed in the alley within the eastern portion of the subject property. The staining was apparently the contents of the clarifier located within the interior of central portion of the 401-425 North E Street portion of the subject property. The clarifier had been recently pumped and the contents were released in the alley.

5.1.4 Interviews with Past Owners, Operators, and Occupants

Interviews with past owners, operators, and occupants were not reasonably ascertainable and thus constitute a data gap.

5.1.5 Interview with Others

As the subject property is not an abandoned property as defined in ASTM 1527-13, interview with others were not performed.

5.2 User Provided Information

5.2.1 Title Records, Environmental Liens, and AULs

Partner was not provided with title records or environmental lien and AUL information for review as part of this assessment.

5.2.2 Specialized Knowledge

No specialized knowledge of environmental conditions associated with the subject property was provided by the User at the time of the assessment.



5.2.3 Actual Knowledge of the User

No actual knowledge of any environmental lien or AULs encumbering the subject property or in connection with the subject property was provided by the User at the time of the assessment.

5.2.4 Valuation Reduction for Environmental Issues

No knowledge of valuation reductions associated with the subject property was provided by the User at the time of the assessment.

5.2.5 Commonly Known or Reasonably Ascertainable Information

The User did not provide information that is commonly known or *reasonably ascertainable* within the local community about the subject property at the time of the assessment.

5.2.6 Previous Reports and Other Provided Documentation

No previous reports or other pertinent documentation was provided to Partner for review during the course of this assessment.



6.0 SITE RECONNAISSANCE

The weather at the time of the site visit was sunny and clear. Refer to Section 1.5 for a discussion of limitations encountered during the site reconnaissance and Sections 2.1 and 2.2 for a discussion of subject property operations. The table below provides the site assessment details:

Site Assessment Data

Site Assessment Performed By: Sheryl A. Amezcua
Site Assessment Conducted On: April 19, 2019

The table below provides the subject property personnel interviewed during the site reconnaissance:

Site Visit Personnel for 401-425 and 610 North E Street (Subject Property) Name Title/Role Contact Number Site Walk* Yes/No

Mr. Jared Ennis Key Site Manager (559) 302-8698 Yes

Potential environmental concerns were identified during the site reconnaissance related to the storage, use, and generation of hazardous substances, signs of a release, the presence of an oil/water clarifier, and the presence of a suspected UST pipe, as further discussed in Sections 6.1 and 6.2.

6.1 General Site Characteristics

6.1.1 Solid Waste Disposal

Solid waste generated at the subject property is disposed of in commercial dumpsters located throughout the subject property. An independent solid waste disposal contractor removes solid waste from the subject property. According to property personnel, only non-hazardous trash is permitted to be placed in the dumpsters. No evidence of prohibited disposal to the dumpsters was observed. No evidence of illegal dumping of solid waste was observed during the site reconnaissance.

6.1.2 Sewage Discharge and Disposal

Sanitary discharges on the subject property are directed into the municipal sanitary sewer system. The City of Madera services the subject property vicinity. No wastewater treatment facilities or septic systems were observed or reported on the subject property.

6.1.3 Surface Water Drainage

Stormwater is removed from the subject property primarily by sheet flow action across the paved surfaces towards stormwater drains located throughout the subject property and in the public right-of-way. Site stormwater from roofs, landscaped areas, and paved areas is directed to on-site concrete swales, which drain to the public right-of-way, and to on-site stormwater drains. The subject property is connected to a municipally owned and maintained sewer system.



^{*} Accompanied Partner during the site reconnaissance activities and provided information pertaining to the current operations and maintenance of the subject property.

The subject property does not appear to be a designated wetland area, based on information obtained from the United States Fish & Wildlife Service Wetlands Mapper; however, a comprehensive wetlands survey would be required in order to formally determine actual wetlands on the subject property. No surface impoundments, wetlands, natural catch basins, settling ponds, or lagoons are located on the subject property. No drywells were identified on the subject property.

6.1.4 Source of Heating and Cooling

Heating and cooling systems as well as domestic hot water equipment are fueled by electricity and natural gas provided by the Pacific Gas & Electric (PG&E) Company. The mechanical systems are comprised of a split system with a central unit and interior air-handler unit located above the office areas. The shop areas are not heated or cooled. Hot water is provided by individual natural gas water heaters.

6.1.5 Wells and Cisterns

No aboveground evidence of wells or cisterns was observed during the site reconnaissance.

6.1.6 Wastewater

Domestic wastewater generated at the subject property is disposed by means of the sanitary sewer system. No industrial wastewater streams were identified at the subject property.

6.1.7 Septic Systems

No septic systems were observed or reported on the subject property.

6.1.8 Additional Site Observations

A pipe of unknown use was observed protruding from the ground surface within the northeastern portion of Parcel 1. Because the purpose of the pipe could not be ascertained, Partner cannot rule out the possibility that the pipe is associated with potential vent or fill pipes for an UST. Based on this information, the potential presence of an UST in the area of the pipe is considered a REC.

A pothole was observed in the asphalt-paved surface of the covered space in Parcel 1. The pothole was reportedly caused by excessive water runoff from the former car wash operations in this area. No hazardous substance storage, leakage, or staining was observed on or adjacent to the pothole.

A slop sink was observed within an automotive tenant space. The sink is reportedly connected to the sanitary sewer system. According to property personnel, no hazardous substances are disposed of in the sink. Based on the absence of hazardous substance disposal and sanitary sewer connection, the sink is not expected to represent a significant environmental concern.

No additional general site characteristics were observed during the site reconnaissance.



6.2 Potential Environmental Hazards

6.2.1 Hazardous Substances and Petroleum Products Used or Stored at the Site

Partner identified hazardous substances used, stored, and/or generated on the subject property as noted in the following table:

Hazardous Substances and/or Petroleum Products Noted On-site					
Substance	Container Size	Location	Nature of Use	Disposal Method	
Antifreeze	55-gallon drums	Automotive Tenants	Auto Repair A	Transported off-site	
New Oil	55-gallon drums	Automotive Tenants	Auto Repair	N/A	
Paint	Pint/Quarts	Parcel 1	Auto Painting	N/A	
Solvents	Various 1 quart	Cabinet	Spray gun	Transported off-site	
Used Antifreeze	55-gallon drums	Automotive Tenants	Auto Repair	Transported off-site	
Waste oil	55-gallon drums	Automotive Tenants	Auto Repair	Transported off-site	
Transmission Fld	Various quarts	Automotive Tenants	Auto Repair	N/A	
Fluids/Cleaners	Pint/Quarts	Automotive Tenants	Auto Repair	N/A	

The materials appeared to be properly labeled and stored at the time of the assessment with minimal signs of leaks, stains, or spills. Secondary containment is not provided for the drums with the exception of the automotive repair shop on Parcel 2. No conduits or drains are present in the concrete paved automotive tenant shop floors. Based on the absence of drains or conduits within the buildings (aside from the clarifier discussed in Section 6.2.7), and the reported proper off-site disposal of the hazardous substances, the storage of these materials on the subject property is not expected to represent significant environmental concern at this time. As a best management practice, appropriate secondary containment should be provided for the remaining drums.

Additionally, small quantities of general maintenance supplies appeared to be properly labeled and stored at the time of the assessment with no signs of leaks, stains, or spills. The storage and use of maintenance supplies does not appear to pose a significant threat to the environmental integrity of the subject property at this time.

6.2.2 Aboveground & Underground Hazardous Substance or Petroleum Product Storage Tanks (ASTs/USTs)

As previously noted, a pipe of unknown use was observed protruding from the ground surface within the northeastern portion of Parcel 1. Because the purpose of the pipe could not be ascertained, Partner cannot rule out the possibility that the pipe is associated with potential vent or fill pipes for an UST. Based on this information, the potential presence of an UST in the area of the pipe is considered a REC.

No other evidence of current or former ASTs or USTs was observed during the site reconnaissance.

6.2.3 Evidence of Releases

An area of oily staining was observed in the alley within the eastern portion of the subject property Parcel. The staining was reportedly associated with the oil/water clarifier sludge that was released to the alley during recent pumping of the clarifier. Refer to Section 6.2.7 for further discussion.



Dried oily surface staining was observed on the concrete foundation within the automotive repair tenant spaces and on the asphalt paved parking areas in various locations. Based on the nature of the staining (heavy hydrocarbons) over paved surfaces, the observed staining is considered a *de minimis* condition

No additional spills, stains, or other indications that a surficial release has occurred at the subject property were observed.

6.2.4 Polychlorinated Biphenyls (PCBs)

Older transformers and other electrical equipment could contain PCBs at a level that subjects them to regulation by the U.S. EPA. PCBs in electrical equipment are controlled by United States Environmental Protection Agency regulations 40 CFR, Part 761. Under the regulations, there are three categories into which electrical equipment can be classified: 1) Less than 50 parts per million (ppm) of PCBs – "Non-PCB;" 2) 50 ppm-500 ppm – "PCB-Contaminated;" and, 3) Greater than 500 ppm – "PCB-Containing." The manufacture, process, or distribution in commerce or use of any PCB in any manner other than in a totally enclosed manner was prohibited after January 1, 1977.

The site reconnaissance addressed indoor and outdoor transformers that may contain PCBs. Polemounted transformers were observed on the subject property. The transformers are not labeled indicating PCB content. No staining or leakage was observed in the vicinity of the transformers. PG&E maintains ownership and operational responsibility for the transformers. Based on the good condition of the equipment, the transformers are not expected to represent a significant environmental concern.

Several aboveground hydraulic lifts were observed throughout the subject property. No leakage or staining was observed around the hydraulic equipment. Based on the age and good condition of the equipment, the hydraulic lifts are not expected to represent a significant environmental concern.

No other potential PCB-containing equipment (interior transformers, oil-filled switches, hoists, lifts, dock levelers, hydraulic elevators, balers, etc.) was observed on the subject property during the site reconnaissance.

6.2.5 Strong, Pungent, or Noxious Odors

No strong, pungent, or noxious odors were evident during the site reconnaissance.

6.2.6 Pools of Liquid

No pools of liquid were observed on the subject property during the site reconnaissance.

6.2.7 Drains, Sumps and Clarifiers

An oil/water clarifier was observed in a former car wash tenant space on Parcel 1. The clarifier was reportedly used for the car wash operations, and is connected to the municipal sanitary sewer system. An interior visual assessment of the clarifier could not be conducted, and the structural integrity of the clarifier is unknown. Furthermore, the age of the clarifier is unknown, and it is unknown if it was used in association with the automotive repair operations prior to being used for the on-site car wash. The clarifier had been recently pumped and the contents were released in the alley adjacent to the northeast of Parcel 1. Oily residue and a slight sheen were noted in the clarifier discharge sludge that was released to the alley. However, the alley is paved, and the discharge was confined over the paved surfaces. Partner



recommends that the practice of discharging the clarifier sludge to the alley cease. However, the sludge noted in the alley is considered a *de minimis* condition. Partner notes that the clarifier has the potential to impact the subsurface of the subject property should the system become compromised. Based on the unknown structural integrity of the clarifier and the potential use of the clarifier in connection with automotive repair-related operations for 50-plus years, the clarifier is considered a REC.

6.2.8 Pits, Ponds, and Lagoons

No pits, ponds, or lagoons were observed on the subject property.

6.2.9 Stressed Vegetation

No stressed vegetation was observed on the subject property.

6.2.10 Additional Potential Environmental Hazards

No additional environmental hazards, including landfill activities or radiological hazards, were observed.

6.3 Non-ASTM Services

6.3.1 Asbestos-Containing Materials (ACMs)

Asbestos is the name given to a number of naturally occurring, fibrous silicate minerals mined for their useful properties such as thermal insulation, chemical and thermal stability, and high tensile strength. The Occupational Safety and Health Administration (OSHA) regulation 29 CFR 1926.1101 requires certain construction materials to be *presumed* to contain asbestos, for purposes of this regulation. All thermal system insulation (TSI), surfacing material, and asphalt/vinyl flooring that are present in a building constructed prior to 1981 and have not been appropriately tested are "presumed asbestos-containing material" (PACM).

The subject property buildings were constructed in 1956, 1977 and 1987 (Parcel 1) and circa 1946 (Parcel 2) and may have asbestos containing materials (ACMs: materials containing >1% asbestiform components determined by the EPA 600/R-93/116 Method using Polarized Light Microscopy) present. The table below outlines suspect ACM that is generally found in buildings of this age:

Suspect ACMs
Drywall Systems
Floor Tiles
Floor Tile Mastic
Spray-Applied Acoustical Material-If Any
Roofing Materials

The limited visual survey consisted of noting observable materials (materials which were readily accessible and visible during the course of the site reconnaissance) that are commonly known to potentially contain asbestos. This activity was not designed to discover all sources of suspect ACM, PACM, or asbestos at the site; or to comply with any regulations and/or laws relative to planned disturbance of building materials such as renovation or demolition, or any other regulatory purpose. Rather, it is intended to give the User an indication if significant (significant due to quantity, accessibility, or condition) potential sources of ACM or PACM are present at the subject property. Additional sampling, assessment, and evaluation will be warranted for any other use.



According to the US EPA, ACM and PACM that is intact and in good condition can, in general, be managed safely in-place under an Operations and Maintenance (O&M) Program until removal is dictated by renovation, demolition, or deteriorating material condition. Prior to any disturbance of the construction materials within this facility, a comprehensive ACM survey is recommended.

6.3.2 Lead-Based Paint (LBP)

Lead is a highly toxic metal that affects virtually every system of the body. LBP is defined as any paint, varnish, stain, or other applied coating that has 1 mg/cm² (or 5,000 ug/g or 0.5% by weight) or more of lead. Congress passed the Residential Lead-Based Paint Hazard Reduction Act of 1992, also known as "Title X", to protect families from exposure to lead from paint, dust, and soil. Under Section 1017 of Title X, intact LBP on most walls and ceilings is not considered a "hazard," although the condition of the paint should be monitored and maintained to ensure that it does not become deteriorated. Further, Section 1018 of this law directed the Housing and Urban Development (HUD) and the US EPA to require the disclosure of known information on LBP and LBP hazards before the sale or lease of most housing built before 1978.

Based on the age of the subject property buildings (pre-1978), there is a potential that LBP is present. Interior and exterior painted surfaces were observed in good condition and therefore not expected to represent a "hazard," although the condition of the paint should be monitored and maintained to ensure that it does not become deteriorated. Actual material samples would need to be collected or an XRF Survey would need to be completed in order to determine if LBP is present.

6.3.3 Radon

Radon is a colorless, odorless, naturally occurring, radioactive, inert, gaseous element formed by radioactive decay of radium (Ra) atoms. The US EPA has prepared a map to assist National, State, and local organizations to target their resources and to implement radon-resistant building codes. The map divides the country into three Radon Zones, according to the table below:

EPA Radon Zones				
EPA Zones	Average Predicted Radon Levels	Potential		
Zone 1	Exceed 4.0 pCi/L	Highest		
Zone 2	Between 2.0 and 4.0 pCi/L	Moderate		
Zone 3	Less than 2.0 pCi/L	Low		

It is important to note that the EPA has found homes with elevated levels of radon in all three zones, and the US EPA recommends site-specific testing in order to determine radon levels at a specific location. However, the map does give a valuable indication of the propensity of radon gas accumulation in structures.

Radon sampling was not conducted as part of this assessment. Review of the US EPA Map of Radon Zones places the subject property in Zone 2. Based upon the radon zone classification, radon is not considered to be a significant environmental concern.



6.3.4 Lead in Drinking Water

According to available information, a public water system operated by the CMWD serves the subject property vicinity. According to a representative of the CMWD, the sources of public water for the CMWD are groundwater from public wells. According to the 2017 Annual Water Quality Report, water supplied by the CMWD is in compliance with applicable State and Federal regulations pertaining to drinking water standards, including lead and copper. Water sampling was not conducted to verify water quality.

6.3.5 Mold

Molds are microscopic organisms found virtually everywhere, indoors and outdoors. Mold will grow and multiply under the right conditions, needing only sufficient moisture (e.g.in the form of very high humidity, condensation, or water from a leaking pipe, etc.) and organic material (e.g., ceiling tile, drywall, paper, or natural fiber carpet padding).

Partner observed accessible, interior areas for the subject property buildings for evidence of mold growth with the exceptions detailed in Section 1.5 of this report; however, this ESA should not be used as a mold survey or inspection. Additionally, this limited assessment was not designed to assess all areas of potential mold growth that may be affected by mold growth on the subject property. Rather, it is intended to give the client an indication as to whether or not conspicuous (based on observed areas) mold growth is present at the subject property. This evaluation did not include a review of pipe chases, mechanical systems, or areas behind enclosed walls and ceilings.

No obvious indications of water damage or mold growth were observed during Partner's visual assessment.

6.4 Adjacent Property Reconnaissance

The adjacent property reconnaissance consisted of observing the adjacent properties from the subject property premises. No items of environmental concern were identified on the adjacent properties during the site assessment, including hazardous substances, petroleum products, ASTs, USTs, evidence of releases, PCBs, strong or noxious odors, pools of liquids, sumps or clarifiers, pits or lagoons, stressed vegetation, or any other potential environmental hazards.



7.0 FINDINGS AND CONCLUSIONS

Findings

A *REC* refers to the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: due to release to the environment; under conditions indicative of a release to the environment; or under conditions that pose a material threat of a future release to the environment. The following was identified during the course of this assessment:

- During Partner's April 19, 2019 site reconnaissance, an oil/water clarifier was observed in a former car wash tenant space on Parcel 1. The clarifier was reportedly used for the car wash operations, and is connected to the municipal sanitary sewer system. An interior visual assessment of the clarifier could not be conducted, and the structural integrity of the clarifier is unknown. Furthermore, the age of the clarifier is unknown, and it is unknown if it was used in association with the automotive repair operations prior to being used for the on-site car wash. The clarifier had been recently pumped and the contents were released in the alley adjacent to the northeast of Parcel 1. Oily residue and a slight sheen were noted in the clarifier discharge sludge that was released to the alley. However, the alley is paved, and the discharge was confined over the paved surfaces. Partner recommends that the practice of discharging the clarifier sludge to the alley cease. However, the sludge noted in the alley is considered a de minimis condition. Partner notes that the clarifier has the potential to impact the subsurface of the subject property should the system become compromised. Based on the unknown structural integrity of the clarifier and the potential use of the clarifier in connection with automotive repair-related operations for 50-plus years, the clarifier is considered a REC.
- During Partner's April 19, 2019 site reconnaissance, a pipe of unknown use was observed protruding from the ground surface within the northeastern portion of Parcel 1. Because the purpose of the pipe could not be ascertained, Partner cannot rule out the possibility that the pipe is associated with potential vent or fill pipes for an UST. Based on this information, the potential presence of an UST in the area of the pipe is considered a REC.

A *CREC* refers to a REC resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority, with hazardous substances or petroleum products allowed to remain in place subject to the implementation of required controls. The following was identified during the course of this assessment:

• Partner did not identify evidence of CRECs during the course of this assessment.

A HREC refers to a past release of any hazardous substances or petroleum products that has occurred in connection with the property and has been addressed to the satisfaction of the applicable regulatory authority or meeting unrestricted use criteria established by a regulatory authority, without subjecting the property to any required controls. The following was identified during the course of this assessment:

• Partner did not identify evidence of HRECs during the course of this assessment.



An environmental issue refers to environmental concerns identified by Partner, which do not qualify as RECs; however, warrant further discussion. The following was identified during the course of this assessment:

- The subject property has been occupied by various automotive repair-related businesses since the late-1950s. During Partner's April 19, 2019 site reconnaissance, hazardous substances and petroleum products including motor oil, transmission oil, antifreeze, waste oil, waste oil filters, waste antifreeze, and various automotive fluids and cleaners were observed to be stored and utilized at the subject property. The materials are stored in drums and containers primarily within the service bays and storage rooms. Secondary containment is provided for some of the drums; however, not all of the materials were stored within secondary containment. Some staining was observed on the concrete shop floors. However, aside from the clarifier discussed as a REC above, no conduits to the subsurface were observed in the automotive repair tenant spaces. Based on the nature of the staining (heavy hydrocarbons) over paved surfaces, the observed staining is considered a de minimis condition. Hazardous wastes generated at the subject property are hauled off-site for proper disposal by a licensed hazardous waste contractor. Furthermore, review of MCEHD records for the storage and handling of the referenced materials indicated that previous violations were minor and were brought into compliance. Based on the absence of significant leaks, spills, or staining, the absence of significant violations on file with the MCEHD, and the absence of additional subsurface conduits in the automotive repair tenant spaces, the storage, use, and generation of hazardous substances associated with the automotive repair operations are not considered a REC at this time.
- Due to the age of the subject property buildings, there is a potential that ACMs and/or LBP are present. Overall, suspect ACMs and painted surfaces were observed in good condition and do not appear to pose a health and safety concern to the occupants of the subject property at this time. Suspect ACMs and LBP would need to be sampled to confirm the presence or absence of asbestos and/or LBP prior to any renovation or demolition activities to prevent potential exposure to workers and/or building occupants.

Conclusions, Opinions, and Recommendations

Partner has performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E1527-13 of the property located at 401-425 and 610 North E Street in Madera, Madera County, California (the "subject property"). Any exceptions to, or deletions from, this practice are described in Section 1.5 of this report.

This assessment has revealed evidence of RECs and environmental issues in connection with the subject property; Based on the conclusions of this assessment, Partner recommends the following:

• A Phase II investigation should be conducted in order to assess the presence or absence of subsurface contamination in the location of the on-site oil/water clarifier.



- A ground-penetrating radar (GPR) or similar geophysical survey should be conducted to
 determine whether an UST is present in the area of the pipe on the northeastern side of Parcel 1.
 In the event that the survey does identify evidence of a tank in the area, a Phase II investigation
 should be conducted in order to assess the presence or absence of subsurface contamination in
 the location of the tank.
- As a best management practice, due care should be employed while pumping the on-site oil/water clarifier in order to prevent discharges of sludge to the subject property or adjacent alley. Additionally, secondary containment should be provided for drums of hazardous substances and petroleum products in order to prevent accidental releases to the subsurface.
- Prior to the disturbance of any suspect ACMs or LBP at the subject property, a comprehensive survey, designed to determine if the suspect materials are regulated, is recommended. If such materials are identified and need to be disturbed, repaired, or removed, a licensed abatement contractor should be consulted.



8.0 SIGNATURES OF ENVIRONMENTAL PROFESSIONALS

Partner has performed a Phase I Environmental Site Assessment of the property located at 401-425 and 610 North E Street in Madera, Madera County, California in conformance with the scope and limitations of the protocol and the limitations stated earlier in this report. Exceptions to or deletions from this protocol are discussed earlier in this report.

By signing below, Partner declares that, to the best of our professional knowledge and belief, we meet the definition of *Environmental Professional* as defined in §312.10 of 40 CFR §312. Partner has the specific qualifications based on education, training, and experience to assess a *property* of the nature, history, and setting of the subject *property*. Partner has developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

Prepared By:

Sheryl A. Amezcua Project Scientist

Shugh America

Reviewed By:

Joel Redding

Environmental Professional Senior Project Manager



9.0 REFERENCES

Reference Documents

American Society for Testing and Materials, Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process, ASTM Designation: E1527-13.

Environmental Data Resources, Inc. (EDR), 6 Armstrong Road, 4th floor, Shelton, Connecticut 06484

EDR, Aerial Photo Decade Package, April 2019.

EDR, Certified Sanborn Map Report, April 2019.

EDR, City Directory Abstract, April 2019.

EDR, Historical Topo Map Report, April 2019.

EDR, Radius Map Report, April 2019.

Federal Emergency Management Agency, Federal Insurance Administration, National Flood Insurance Program, Flood Insurance Map, accessed via the internet, April 2019.

United States Department of Agriculture, Natural Resources Conservation Service, Web Soil Survey, accessed via the internet, April 2019.

United States Department of Fish & Wildlife Service Wetlands Mapper, accessed via the internet, April 2019.


United States Environmental Protection Agency, EPA Map of Radon Zones (Document EPA-402-R-93-071), accessed via the internet, April 2019.



FIGURES

- 1 SITE LOCATION MAP
- 2 SITE PLAN
- 3 TOPOGRAPHIC MAP



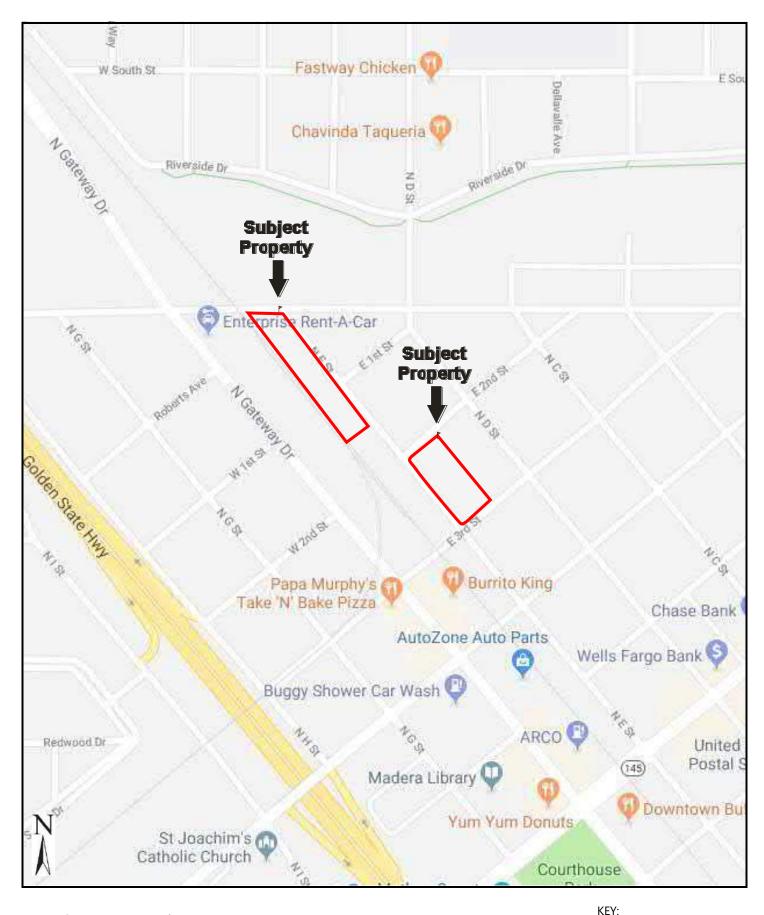

Drawing Not To Scale

Subject Property

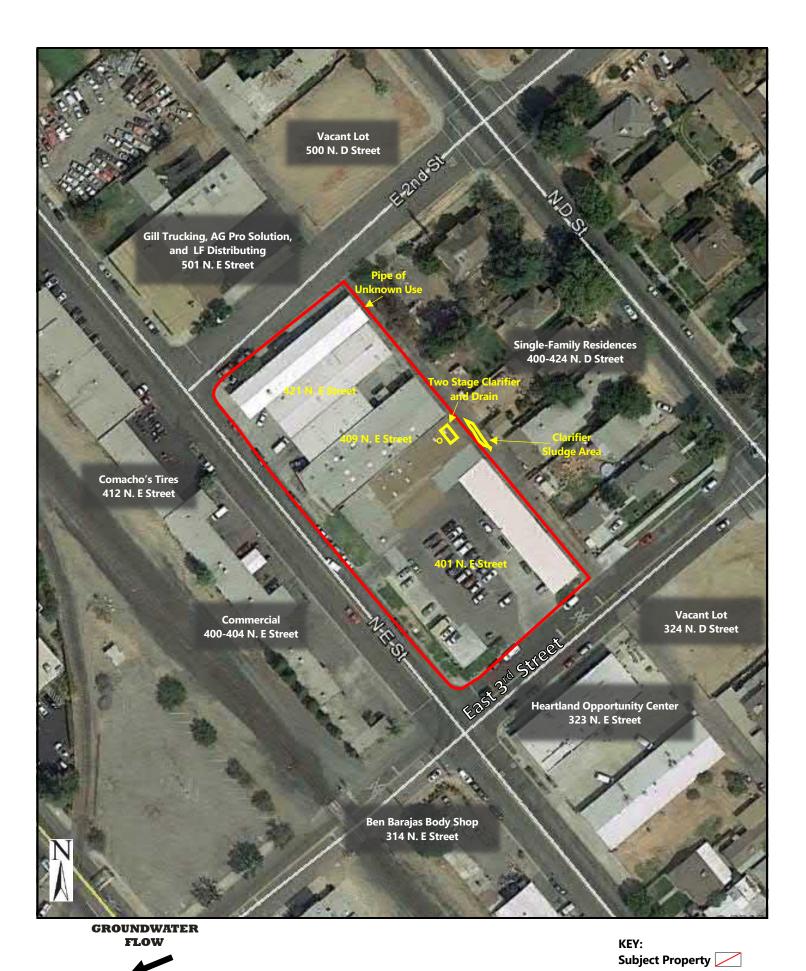


FIGURE 2: SITE PLAN — PARCEL 1 Project No. 19-244554.1




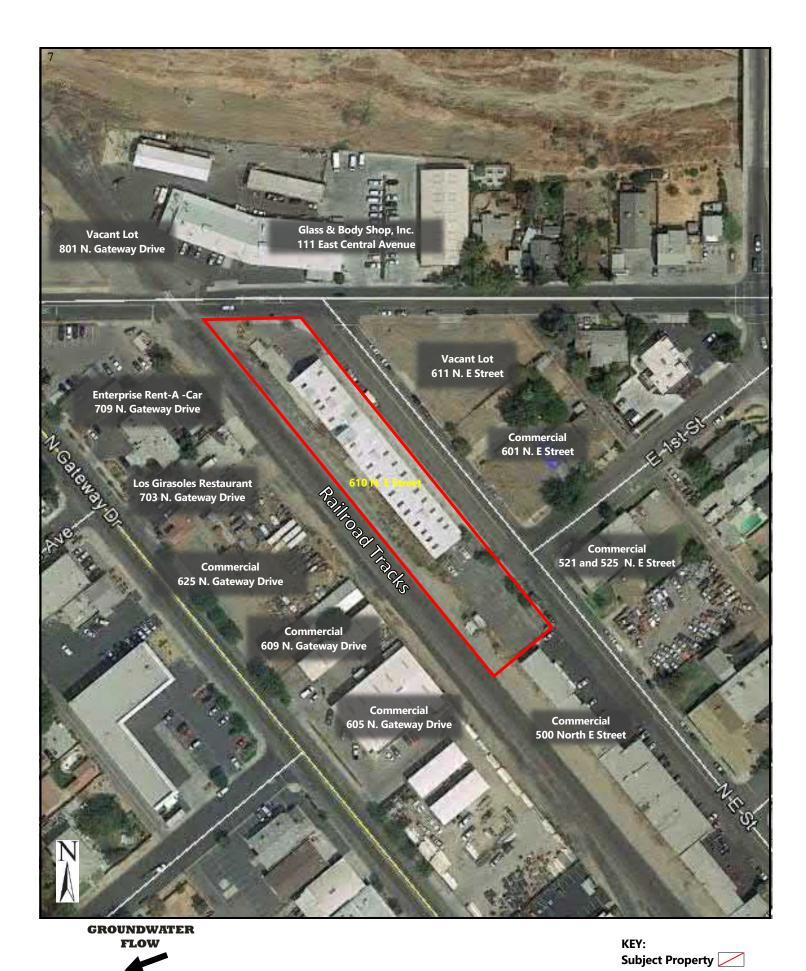


FIGURE 3: SITE PLAN — PARCEL 2 Project No. 19-244554.1





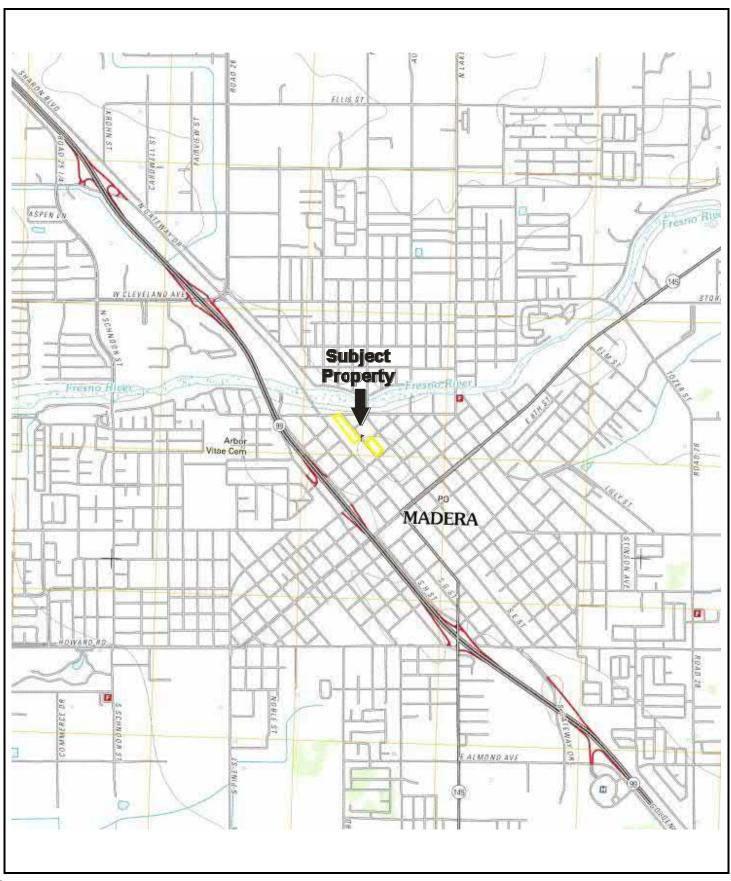

USGS 7.5-Minute Madera, California Quadrangle Created: 2012

KEY: Subject Property



APPENDIX A: SITE PHOTOGRAPHS





1. View of the parking lot and buildings on subject property Parcel 1.



2. View of the southern portion of Parcel 1.



3. View of the southern building on Parcel 1.



4. View of the northeastern corner of Parcel 1.



5. View along the alley located adjacent to the northeast of Parcel 1.



6. View along the alley located adjacent to the northeast of Parcel 1.





7. View along the northern portion of Parcel 1.



8. View along the northern portion of Parcel 1



9. View along the western portion of Parcel 1.



10. View of the exterior of a subject property tenant space on Parcel 1.



11. View of the sludge from the oil/water clarifier that had been pumped in the alley adjacent to Parcel 1.




12. View of the sludge from the oil/water clarifier that had been pumped in the alley adjacent to Parcel 1.





13. View of the pipe protruding from the ground surface within the northeastern portion of Parcel 1.

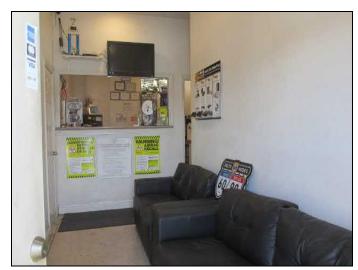

14. View of a reception and customer waiting area for an automotive repair tenant.



15. View of an aboveground hydraulic lift and *de minimis* oily staining on the concrete foundation



16. View of an aboveground hydraulic lift and new battery storage in the tenant space.



17. View of repair bay and an aboveground hydraulic lift within a subject property tenant space.



18. View of various stored equipment and tools within a subject property tenant space.





19. View of the slop sink located in the tenant space.



21. Close-up view of the pothole.



23. View of an empty tenant restroom area.



20. View of the pothole located within the open covered space on Parcel 1.



22. View of a floor drain and the two-stage oil/water clarifier located within the enclosed area.



24. View of the concrete floor with water from wet sanding in the auto body shop tenant space.





25. View of the various hazardous substances and solvents located in the auto body shop tenant



26. View of hazardous substance containers stored in the body shop tenant space.



27. View of a vacant tenant space.



28. View of an aboveground hydraulic lift in the transmission repair tenant space.



29. View of stored equipment and vehicles in the transmission repair tenant space.



30. View of a storage area in the transmission repair tenant space.





31. View of the automotive painting tenant space.



32. View of the automotive painting tenant space and the paint booth.



33. View of the automotive repair shop within the northern portion of Parcel 1.



34. View of a 55-gallon oil drum.



35. View of waste oil drums within the northern automotive repair tenant space.



36. View of a self-contained parts washing station within the northern automotive repair tenant space.





37. View of a waste oil drum.



39. View of the flammable materials cabinet in the northern tenant space.



41. View of the northeastern portion of Parcel 2.



38. View of additional storage and shelving in the northern portion of Parcel 1.



40. View of the northeastern portion of Parcel 2.



42. View of the southwestern portion of Parcel 2.






43. View of the northwestern portion of the building on Parcel 2.



45. View of waste oil drums in secondary containment in the automotive tenant repair space on Parcel 2.

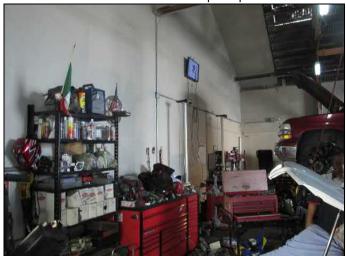

47. View of various equipment and tool storage in the automotive repair tenant space.



44. View of new batteries located on shelving in the automotive tenant repair space on Parcel 2.



46. View of an aboveground hydraulic lift in the automotive repair tenant space.



48. View of new tire storage and miscellaneous equipment in the automotive repair tenant space.





49. View of a vacant tenant space in the Parcel 2



51. View of the adjacent property to the north of Parcel 2.



53. View of the adjacent property to the northeast of Parcel 1.



50. View of the building material tenant space on



52. View of the adjacent property to the south of Parcel 1.




54. View of the adjacent property to the southwest of Parcel 2.



APPENDIX B: HISTORICAL/REGULATORY DOCUMENTATION





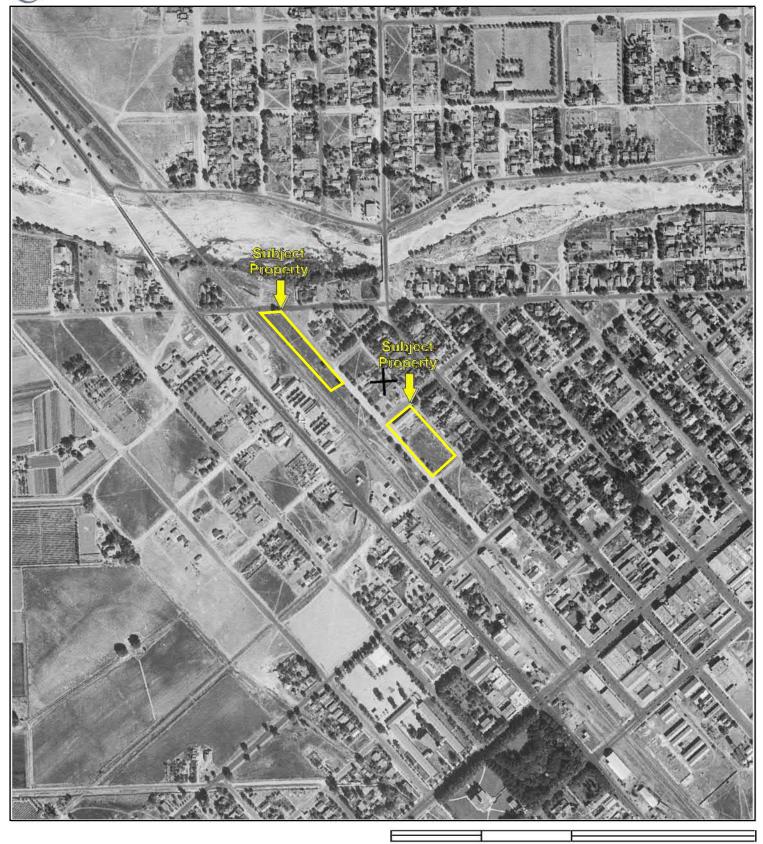

1000

2000


Key: Subject Property



APPENDIX B: AERIAL PHOTOGRAPHS





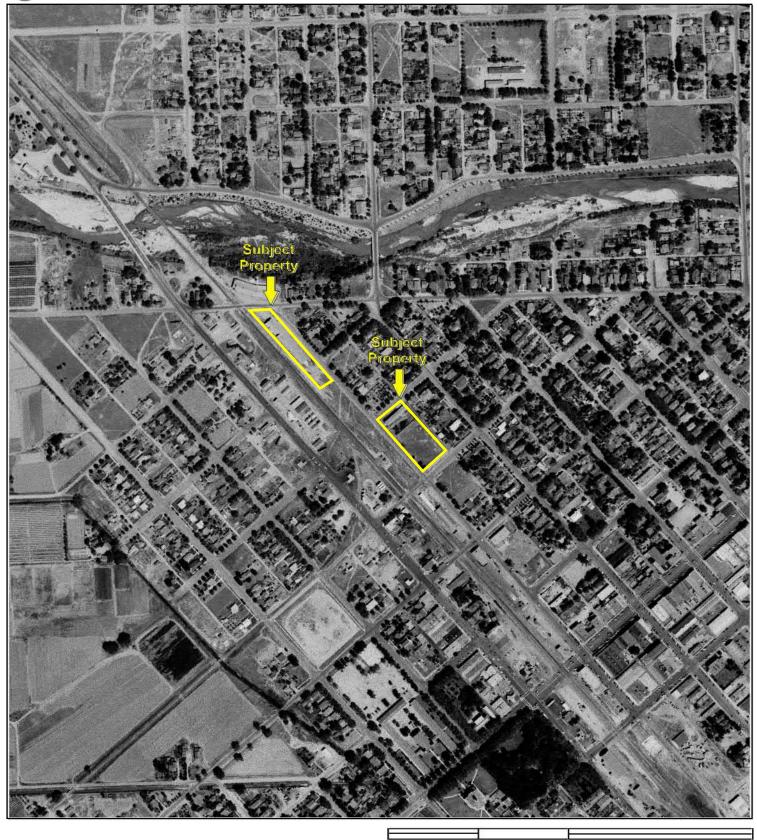

1000

2000


Key: Subject Property



APPENDIX B: AERIAL PHOTOGRAPHS





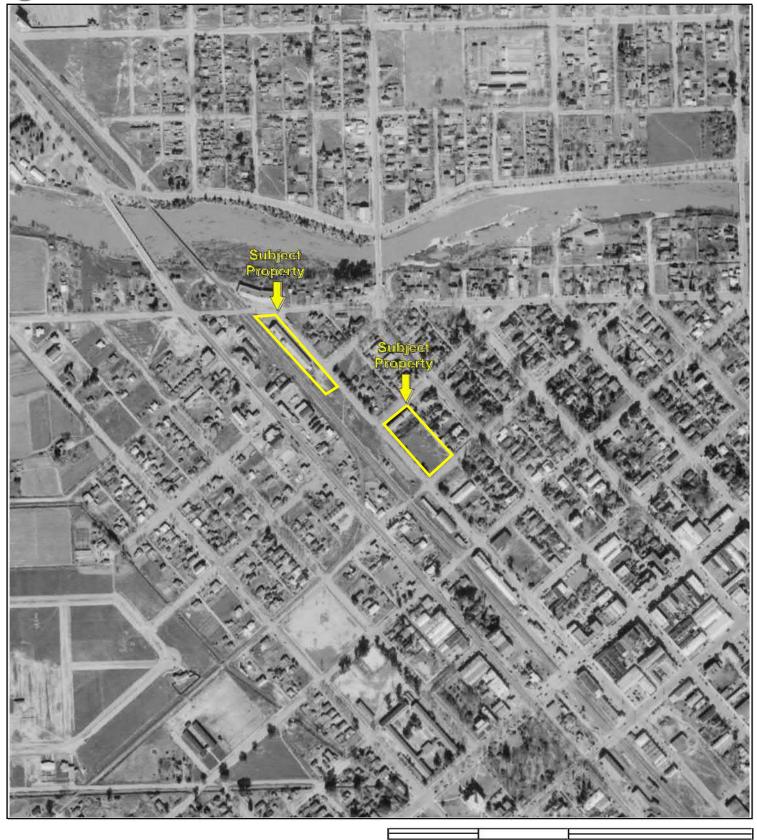

1000

2000


Key: Subject Property



APPENDIX B: AERIAL PHOTOGRAPHS





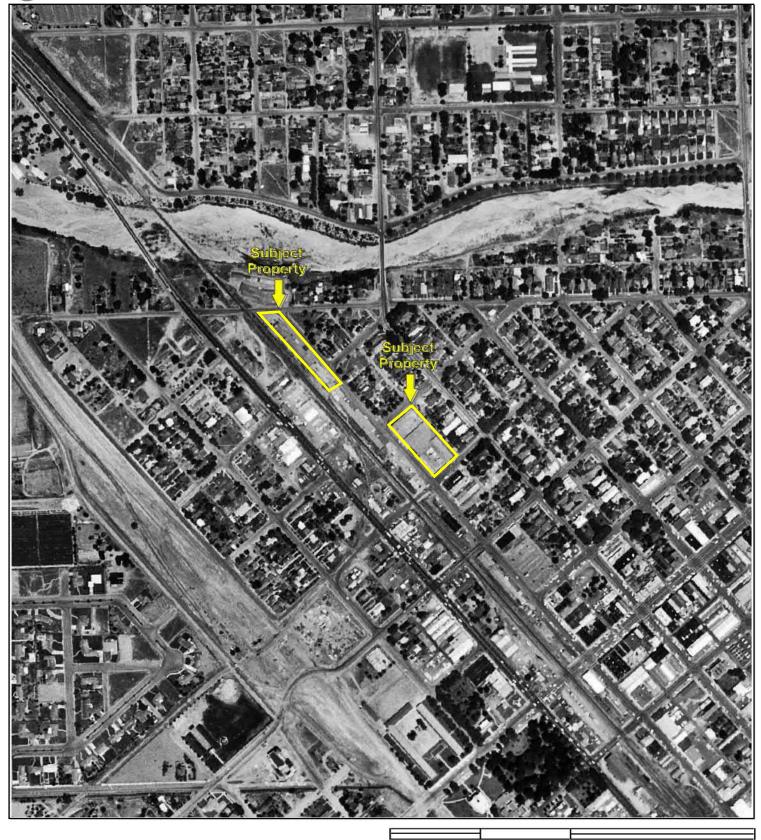

1000

2000

Key: Subject Property



APPENDIX B: AERIAL PHOTOGRAPHS







1000

2000

Key: Subject Property



APPENDIX B: AERIAL PHOTOGRAPHS







1000

2000

Key: Subject Property



APPENDIX B: AERIAL PHOTOGRAPHS









2000

APPENDIX B: AERIAL PHOTOGRAPHS

Project No. 19-244554.1



Key: Subject Property





Key: Subject Property



APPENDIX B: AERIAL PHOTOGRAPHS







1000

2000


Key: Subject Property



APPENDIX B: AERIAL PHOTOGRAPHS





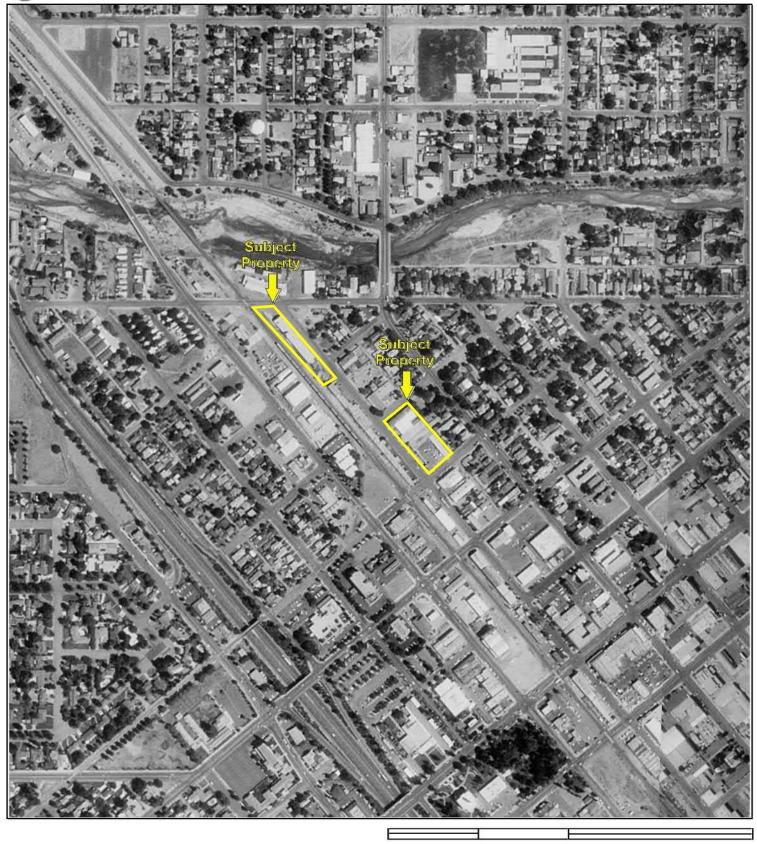

1000

2000


Key: Subject Property



APPENDIX B: AERIAL PHOTOGRAPHS





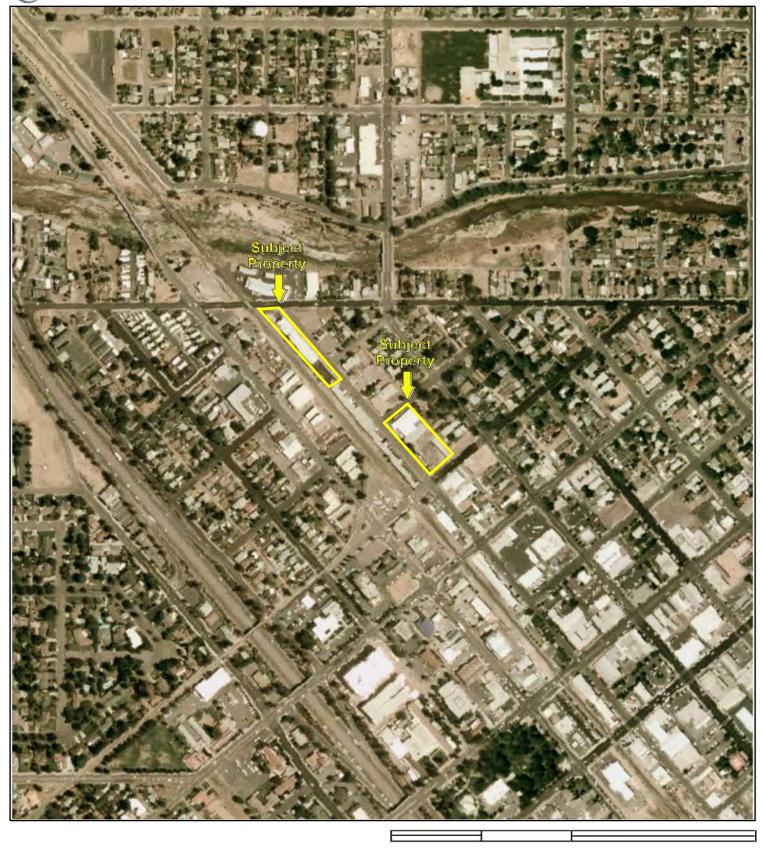

1000

Key: Subject Property



2000

APPENDIX B: AERIAL PHOTOGRAPHS







1000

2000

Key: Subject Property



APPENDIX B: AERIAL PHOTOGRAPHS







1000

2000


Key: Subject Property



APPENDIX B: AERIAL PHOTOGRAPHS





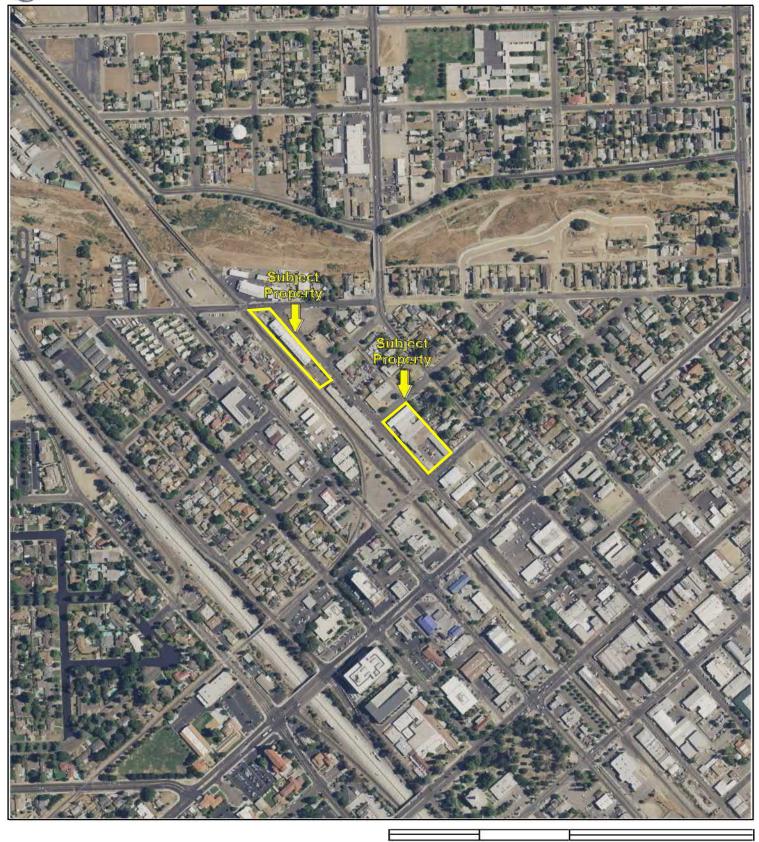

1000

2000


Key: Subject Property










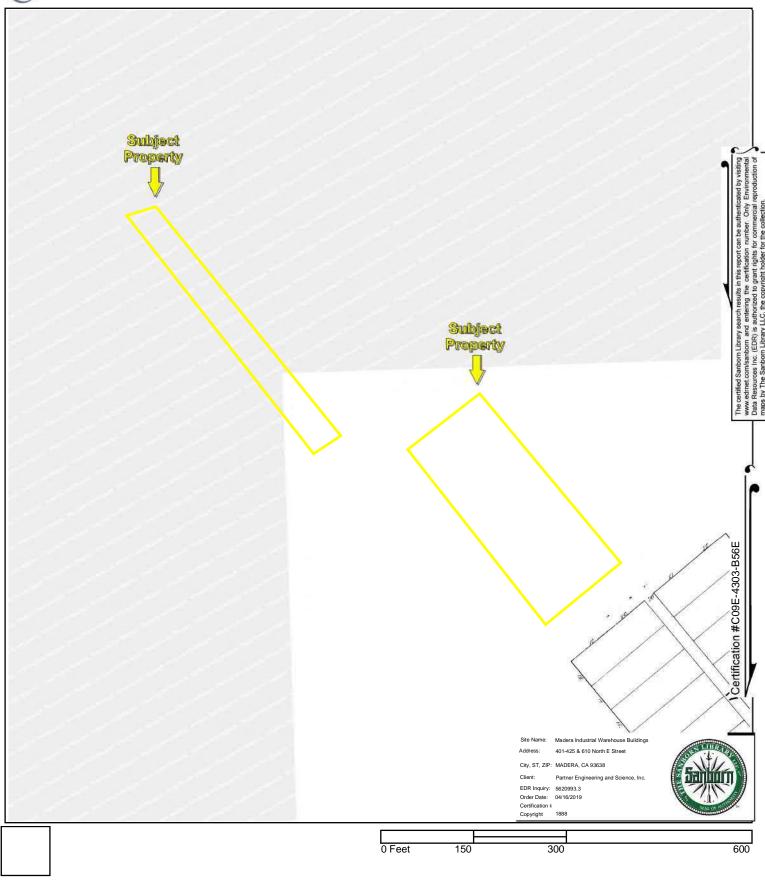




Key: Subject Property



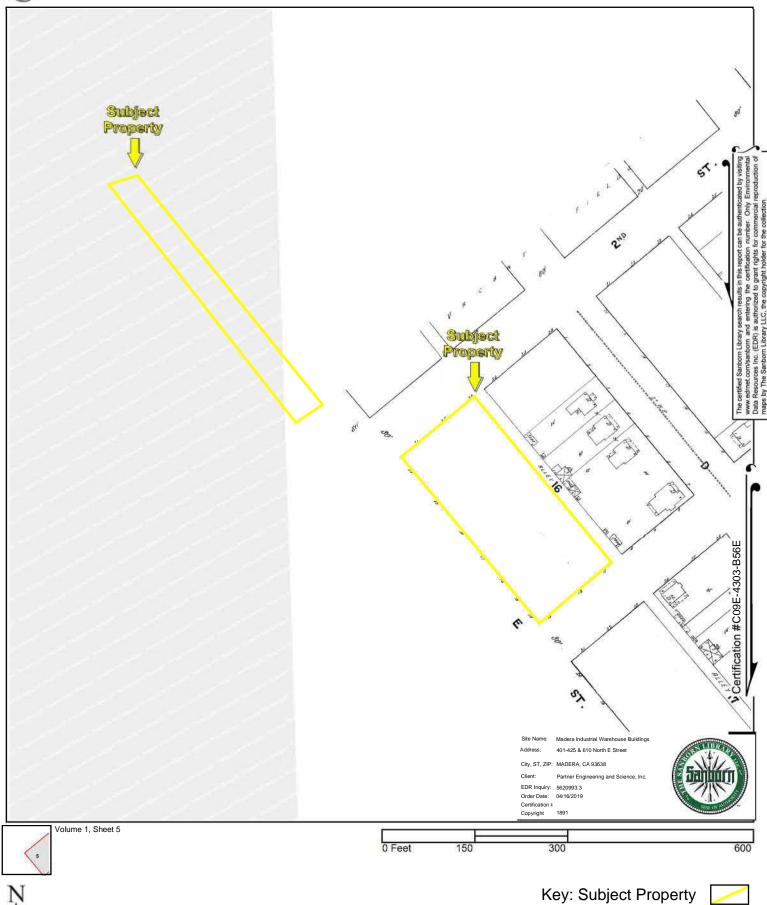






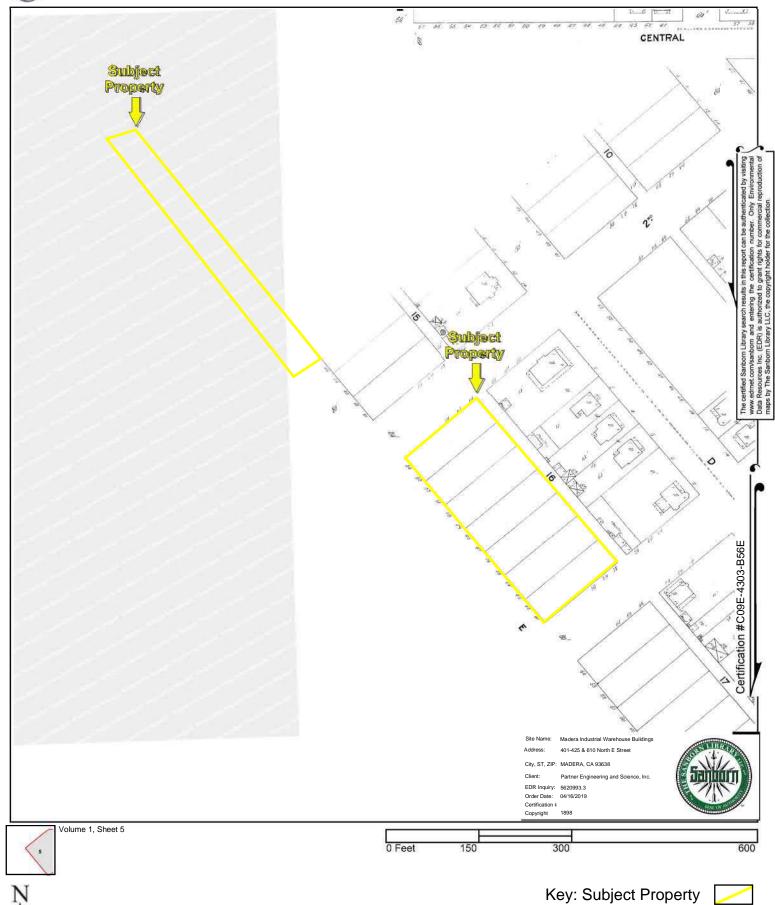






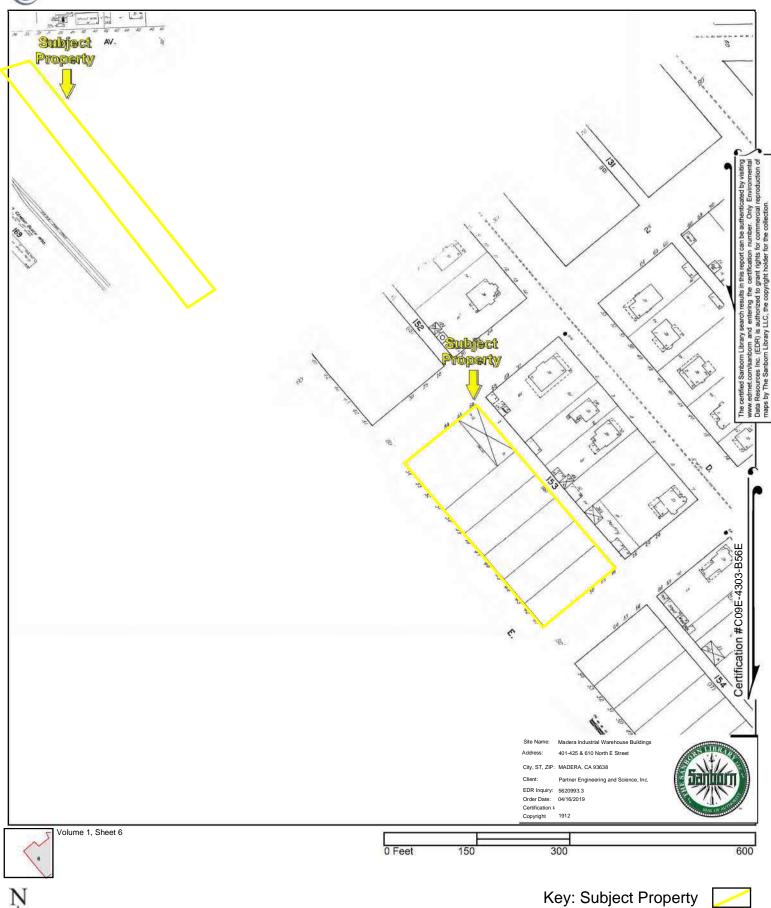






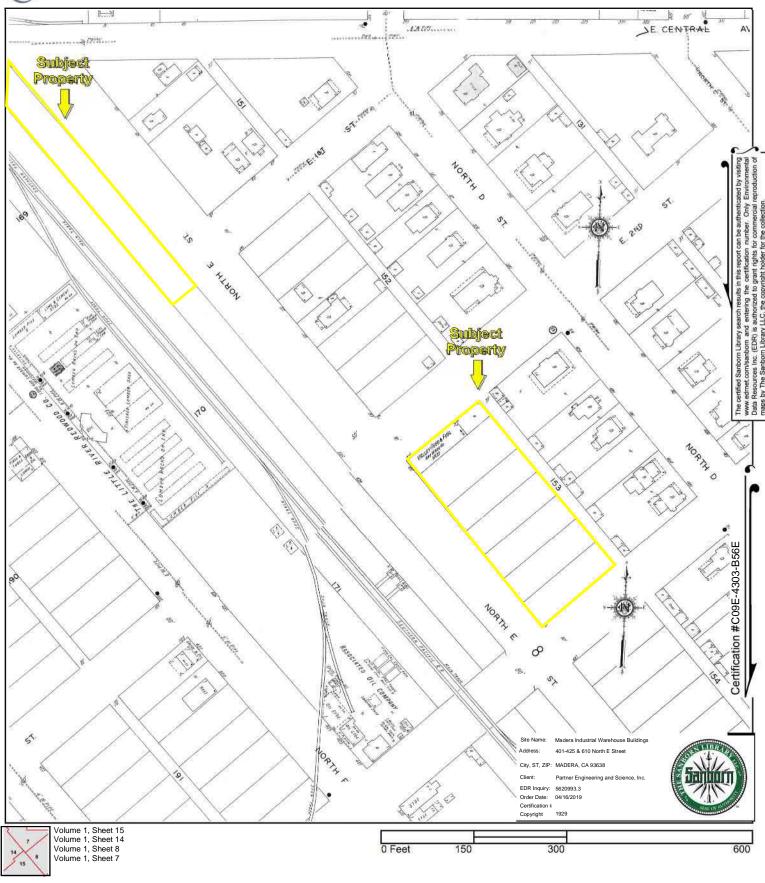




Key: Subject Property



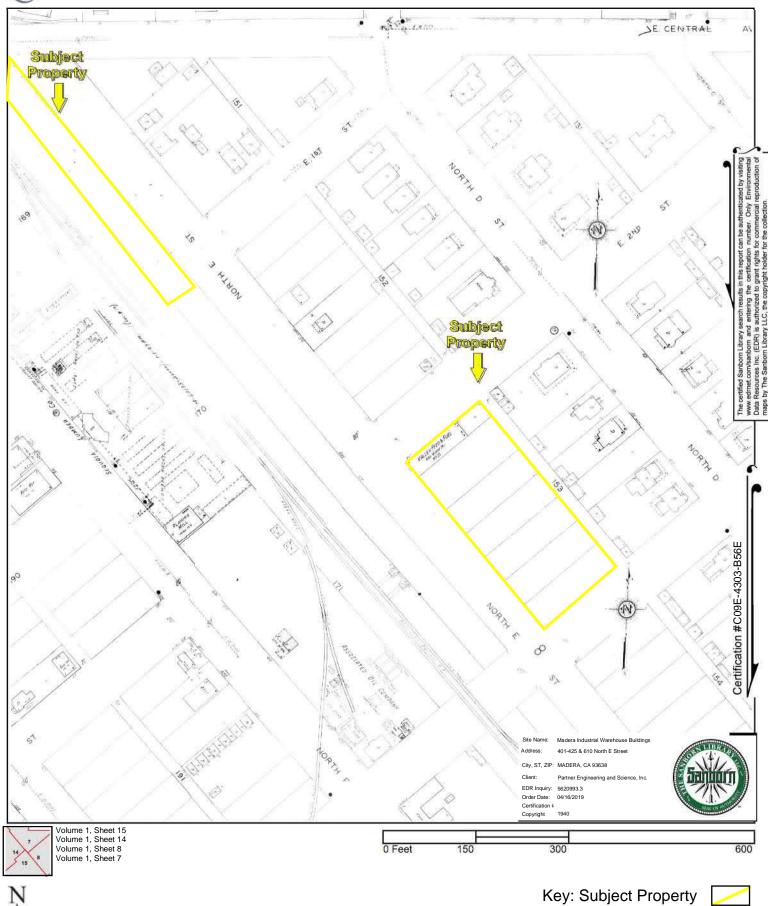






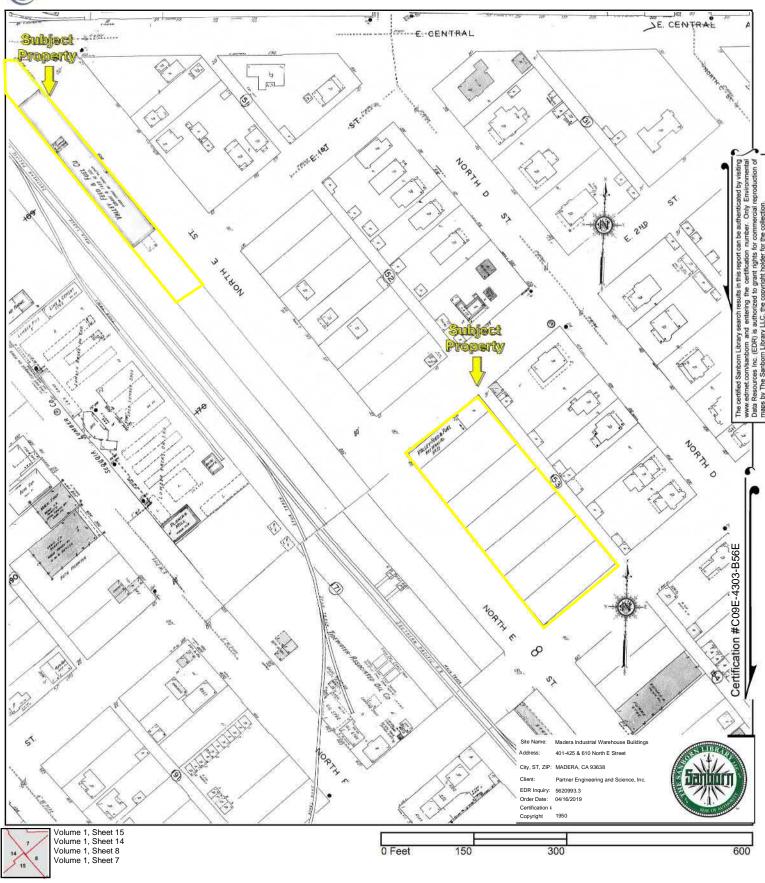



Key: Subject Property



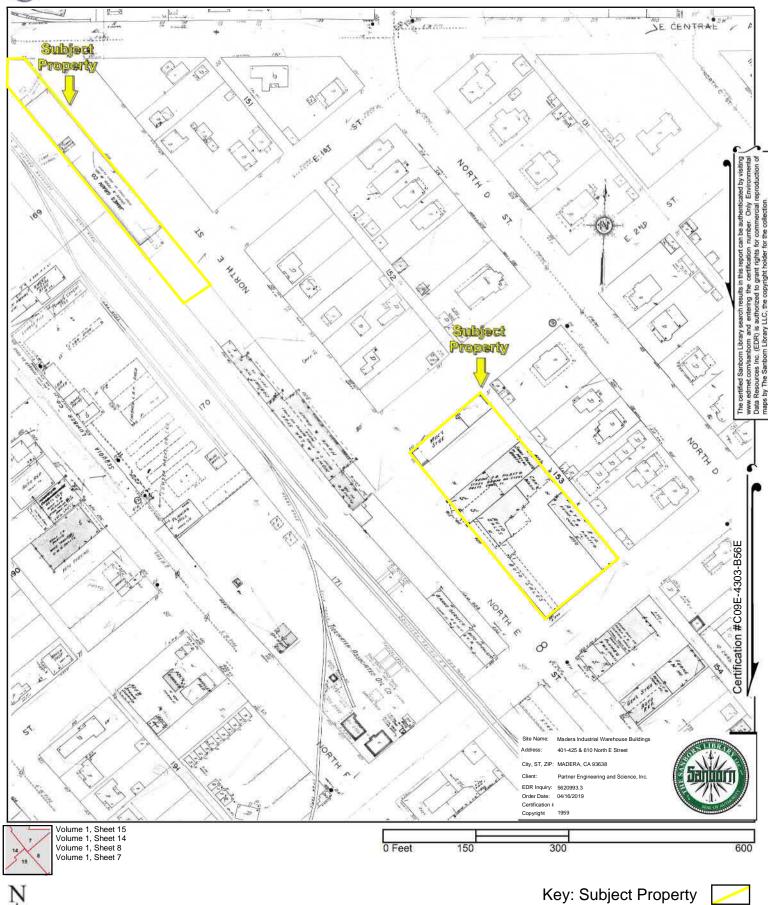



Madera Industrial Warehouse Buildings

401-425 & 610 N E St MADERA, CA 93638

Inquiry Number: 5620993.5

April 15, 2019

The EDR-City Directory Image Report



TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING. WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction orforecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2017 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Report is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Report includes a search of available city directory data at 5 year intervals.

RECORD SOURCES

EDR's Digital Archive combines historical directory listings from sources such as Cole Information and Dun & Bradstreet. These standard sources of property information complement and enhance each other to provide a more comprehensive report.

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer. Reproduction of City Directories without permission of the publisher or licensed vendor may be a violation of copyright.



RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. A check mark indicates where information was identified in the source and provided in this report.

<u>Year</u>	Target Street	Cross Street	<u>Source</u>
2014	$\overline{\checkmark}$		EDR Digital Archive
2010	$\overline{\checkmark}$		EDR Digital Archive
2005			EDR Digital Archive
2000			EDR Digital Archive
1995			EDR Digital Archive
1992			EDR Digital Archive
1987			EDR Digital Archive
1982			EDR Digital Archive
1977	$\overline{\checkmark}$		EDR Digital Archive
1971			POLK DIRECTORY CO
1964			POLK DIRECTORY CO
1958			POLK DIRECTORY CO
1952	$\overline{\checkmark}$		POLK DIRECTORY CO

FINDINGS

TARGET PROPERTY STREET

401-425 & 610 N E St MADERA, CA 93638

<u>Year</u>	CD Image	<u>Source</u>
<u>N E ST</u>		
2014	pg A1	EDR Digital Archive
2010	pg A2	EDR Digital Archive
2005	pg A3	EDR Digital Archive
2000	pg A4	EDR Digital Archive
1995	pg A5	EDR Digital Archive
1992	pg A6	EDR Digital Archive
1987	pg A7	EDR Digital Archive
1982	pg A8	EDR Digital Archive
1977	pg A9	EDR Digital Archive
1971	pg A10	POLK DIRECTORY CO
1971	pg A11	POLK DIRECTORY CO
1964	pg A12	POLK DIRECTORY CO
1964	pg A13	POLK DIRECTORY CO
1958	pg A14	POLK DIRECTORY CO
1952	pg A15	POLK DIRECTORY CO

5620993-5 Page 3

FINDINGS

CROSS STREETS

No Cross Streets Identified

5620993-5 Page 4



	305	CRUZ, FRANCISCA
		GONZALEZ FARM LABOR
	309	OCCUPANT UNKNOWN,
	314	BARAJAS BODY SHOP
	323	HEARTLAND OPPORTUNITY CTR INC
	400	IV LAWN EQUIPMENT REPAIR & SLS
		MADERA AUTO AND FURNITURE UPHL
1.	401	MADERA S FINEST HAND WASH
	412	CAR CONNECTION UNLIMITED
	425	ANDYS TRANSMISSIONS
	500	MADERA SMALL ENGS & MAR REPR
		RAYS SMALL ENGINE & GRDN EQP
	501	FIMBREZ, LUIS
		G G TRUCKING
	504	SCHOETTLER TIRE INC
	508	CASEYS DISCOUNT AUTOMOTIVE
	520	AUTO SERVICE LAB
	609	OCCUPANT UNKNOWN,

	305	CRUZ, FRANCISCA
		GONZALEZ FARM LABOR
	314	BARAJAS BODY SHOP
	323	HEARTLAND OPPORTUNITY CTR INC
	400	MADERA AUTO AND FURNITURE UPHL
		MADERA UPHOLSTERY CO
	412	CAR CONNECTION UNLIMITED
	425	ANDYS TRANSMISSIONS
•	500	MADERA SMALL ENGS & MAR REPR
		RAYS SMALL ENGINE & GRDN EQP
501 CENTRAL VALLEY ENTERPRISES		CENTRAL VALLEY ENTERPRISES
		G G TRUCKING
		ROBERT L JENSEN & ASSOC
	504	SCHOETTLER TIRE INC
	508	CASEYS DISCOUNT AUTOMOTIVE
	520	AUTO SERVICE LAB
	521	CHATWIN, DANA
	601	WEST, GARY K
	609	WEST & WEST ENTERPRISES

305	GONZALEZ FARM LABOR
309	MARCHETTI, ROSE K
314	BARAJAS BODY SHOP
323	ASSOCIATION FOR DEVELOPMENT
	ASSOCIATION/DEVPMLY HNDCPD
400	JOHNATHAN GHOSOPH
	MADERA AUTO AND FURNITURE UPHL
	MADERA UPHOLSTERY CO
401	GUTIERREZ SMOG TEST ONLY STATI
	MARIAS AUTO REPAIR OF MADERA
	TWILIGHT HAMMERS
404	D JS AUDIO & SECURITY
	OLETA M NASH
412	SHUNAMMITE PLACE
	SUNSHINE AGRICULTURE SERV
414	VALENZUELA, GREG
460	BREEDLOVE MARION FIREPLACE SPC
500	RAYMOND J BELLAS
501	CARPENTER CLAIM SERVICE
	DEDUCTION CENTER
	OVESONS UPHOLSTERY
	ROBERT L JENSEN & ASSOC
504	SCHOETTLER TIRE INC
508	WASEM KASEY
511	TOLBERT, ELWAYNE
516	LEES AUTO GLASS
520	AUTO SERVICE LAB
521	CHATWIN, DANA
524	MADERA QUALITY DETAIL
601	WEST, GARY K
609	WEST & WEST ENTERPRISES

300	AICHNER, BEVERLY A	
309	MARCHETTI, ROSE	
314	BARAJAS BODY SHOP	
323	ASSOCIATION/DEVPMLY HNDCPD	
401	SCHOETTLER TIRE INC	
404	CENTRAL VALLEY TOWING	
412	MADERA UPHOLSTERY CO	
	NASH OLETA	
500	RAYS SMALL ENGINE & GRDN EQP	
501	CARPENTER CLAIM SERVICE	
	COHAN ALLAN P	
	DEMING E P ASSOCIATES	
	WILLIAMS AND CAINE	
504	SCHOETTLER TIRE INC	
508	LEES AUTO GLASS	
516	TRANSMISSION SHOP	
520	AUTO SERVICE LAB	
524	MADERA QUALITY DETAIL	
525	G AND L IRRIGATION	

300	JACK, HELENE
305	BECKWITH, SUSAN
	MILLIES CHARTER SERVICE
	NEW VALLEY CORPORATION
	SMITH MILDRED
	SMITH, MILDRED
309	BORREGO, CHRIS
	MARCHETTI, ROSE
323	ASSOCIATION/DEVPMLY HNDCPD
401	SCHOETTLER TIRE INC
404	JIMS AUTOMOTIVE REPAIR
409	SCHOETTLER TIRE INC
412	MADERA UPHOLSTERY
416	PHILLIPS BROTHERS AUTO
500	RAYS SMALL ENGINE & GRDN EQP
501	COHAN ALLAN P
	DEMING E P ASSOCIATES
	JOYCES BOOKKEEPING
504	SCHOETTLER TIRE INC
508	MADERA PARTY RENTAL
520	AUTO SERVICE LAB

305	NEW VALLEY CORPORATION
	SMITH MILDRED
	SMITH, MILDRED
309	MARCHETTI, ROSE
323	ASSOCIATION/DEVPMLY HNDCPD
404	JIMS AUTOMOTIVE REPAIR
409	BANDAG SHOP
412	ANTIQUE UPHOLSTERY SPECIALIST
	MADERA UPHOLSTERY
500	MADERA MARINE
501	CARRIAGE HOUSE
	COHAN ALLAN P
	DEMING E P ASSOCIATES
	JOYCES BOOKKEEPING
504	SCHOETTLER TIRE INC
511	PETERSON, MIKE
515	VICTORS USED CARS

305	MADERA ANSWERING SERVICE
	MADERA ANSWERING SVC
	MILLIE S CHORES & CHARTERS
	WESTERN UNION TELG CO THE*
314	MELVINS GARAGE
	TOLLES AUTO REPAIR
323	ASSOC DVLPMTLY HNDCPD MADRA
400	MADERA AUTO & FURNITURE UPHL
425	ELITE GLASS & MIRROR
500	MADERA MARINE
501	JOYCES BOOKKEEPING
	LYON ROY BEN GENERAL BLD CONTR
504	CENTRAL CAL TIRE & WHL CO
515	VICTORS USED CARS
525	VALLEYWIDE IRRIGATION

	305	MADERA CAB COMPANY INC
	314	J & J MOBILE CATERING
		TOLLES AUTO REPAIR
	323	ASSOCIATION DEVLPMT HDCPD
	400	MADERA AUTO TOP & UPHL SP
Γ	401	SCHOETTLER GEN TR SPCLSTS INC
	404	A-1 BODY SHOP
	416	MORGAN BROTHERS INCORPORATED
	500	MADERA MARINE
		QUALITY MOTORS
	501	LYON ROY BEN GENERAL BLD CONTR
	525	MULLER IRRIGATION INC

	N E ST	1977
305	MADERA CAB COMPANY INC	
314	J & J MOBILE CATERING	
323	ASSOCIATION DEVLPMT HDCPD	
400	MADERA AUTO TOP & UPHL SP	
409	GIERSCH GILBERT CIVIL ENGINERS	
416	CARGILL PEST CONTROL	
425	LOUS RADIATOR	
500	MADERA MARINE	
	QUALITY MOTORS	
501	LYONS ROY BEN	
	MID-CAL ENGINEERING & SURVEYG*	
525	MULLER IRRIGATION INC	

E 4TH ST INTERSECTS 300 Fresno Bee newspaper 674-5812 305 Continental Trailways bus line 674-2411 Madera & Chowchilla Answering Service tel answering 674-2413 Madera Cab Co 674-2411 Western Union teleg 674-4825 3051/2 Smith Mildred R Mrs © 674-7954 309 Minton Lyman L 314 Vacant 317 Vacant 323 Madera Community Hospital (Development Ofc) 674-8874 325 Warburton's plmb & htg 674-4760 E 3D ST INTERSECTS 400 Madera Auto Top & Upholstering 674-7901

Source
POLK DIRECTORY CO

NEST 1971

401 Schoettler General Tire Specialists Inc sls & serv 674-4678 404 A-1 Body Shop auto repr 673-3179 409 State Bd Of Equalization 674-2007 411 Carousel Beauty Shop 412 Ruby's Al Air Conditioning Service 674-2716 Larry's Garage auto reprs 673-1431 416 Atlas Glass 673-3583 E 2D ST INTERSECTS 500 Madera Automotive & Supply automotive parts 674-8597 P M S West Inc liquid feed supplement sls 673-3571 501 Holt Wm E acct 674-7745 Huettl Bookkeeping 674-8042 Lyon Roy Ben Bldg Contractor 674-8556 Regional Center For Mentally Retarded 511 Mc Ginnis James W @ 674-7696 Rear Mc Ginnis John W @ 674-7696 521 Martinez Salvador G 525 Muller Irrigation Inc agrl irrigation 673-9269

Valley Mountain Appliance Center serv 673-1872

E 1ST ST INTERSECTS

600 Valley Wholesale Building Materials Co (whse)

609 No Return

611 Vacant

<u>Source</u> POLK DIRECTORY CO


E NORTH — From E Yosemite
av northwest to Central av
102 Sou Pac Depot OR 4-6701
117 Madera Bowl OR 3-3367
Maple Rm tavern OR 3-3367
123 Vacant
E 5th intersects
200 James Grain Co (stge)
222 Madera Ice Del OR 4-2053
E 4th intersects
300 Fresno Bee newspaper
OR 4-5812
305 Madera Answering Serv
674-2413
Madera Cab Co OR 4-2411
305½Smith Mildred R Mrs ©
OR 4-7954
309 DeBenedetto Jack 673-9528
314 Vacant

E North—Contd
317 Lee's Automotive Serv OR
4-2796
325 Warburton's plmb OR 4-4760
E 2d intersects
400 Madera Auto Top & Uphol-
stering 4-7901
401 Bob's Motorcycle Serv 674-
12/0/9/6
Hughes Honda Sls 674-2096
404 Vacant
409 April Frank acct OR 4-5616
411 State Farm Ins Co 674-5671
412 Mid State Appl Center dlrs
674-8661
416 Atlas Glass 673-3583 & 673-
500 Andergen Diels Ford Claret
500 Anderson Dick Ford Sls 674-
501 Lyon Roy Ben Bldg Contr OR 4-8556
511 McGinnis James W © 674-
7696
George Frank jr
rear McGinnis John W (9)
513 Vacant
515 Mines Robt
521 Dilbeck Kenley 674-8660
E 1st intersects
600 James Grain Co OR 4-2120
601 Talley Steve
611 Fleming Viola Mrs © OR
4-5853
615 Fleming Hermena Mrs OR
4-4357
Central av intersects

200 James Grain Co (stge)	
222 Madera Ice Del 4 OR42053	
E 4th intersects	
300 Fresno Bee (br) A OR45812	
305 Madera Answering Serv	
Δ OR42413	
Yellow Cab Co Madera Cab Co A OR42411	
305½ Smith Mildred Mrs ①	
Φ OR47954	
309 Gravelle Richd △ OR33006	
314 James Tractor & Implt Co	
Ф OR33665	
317 Lee's Automotive Serv	
4 OR42796	
325 Warburton's A OR44760	
E 2d intersects	
400 Madera Auto Top & Uphol A OR47901	
409 April Frank acct 4 OR45616	
Hartwig Mtrs & OR46746	
411 Kirkman-Taylor grain dlrs	
△ OR45629	87 11
420 S P Co (stge yd)	
500 Lyon Roy Ben Bldg Contr	
Φ OR48556 507 Homan Chas @ pntr	
4 OR33449	
511 Dedman Leonard L	
rear McGinnis John W @	
Δ OR47696	
rear Mulka John C	
513 Valencia Elfredo D	
515 Sotelo Barney P @ \$\triangle OR42750 521 Upton Larry L \$\triangle OR33053)
E 1st intersect	9
600 James Grain Co A OR42120	
609 Nabors Clyde A @ 4 OR4479	7
611 Fleming Chas © 4 OR45853	
615 Fleming Hermena Mrs	
△ OR44357	
Central av intersect	S

E, NORTH - Northwest from E Yosemite av to Central av 120 Sou Pac Co 1 5th intersects 200 James Grain Co 320 222 Madera Ice Delivery 59 309 Landucci Fred 1887-J 314 James Tractor & Implement Co 764 321 Vacant 325 Warburton's plmb 352 3d intersects 507 Homan Chas @ 493-W 511 McGinnis J W @ 1145 513 Lewis Eadamae Mrs 515 Sotelo F B Mrs @ 927-R 521 Terry P A 927-J E 1st intersects 609 Peabody T A 1299-M 611 Fleming Chas @ 615 Fleming Hermina Mrs 1118-M




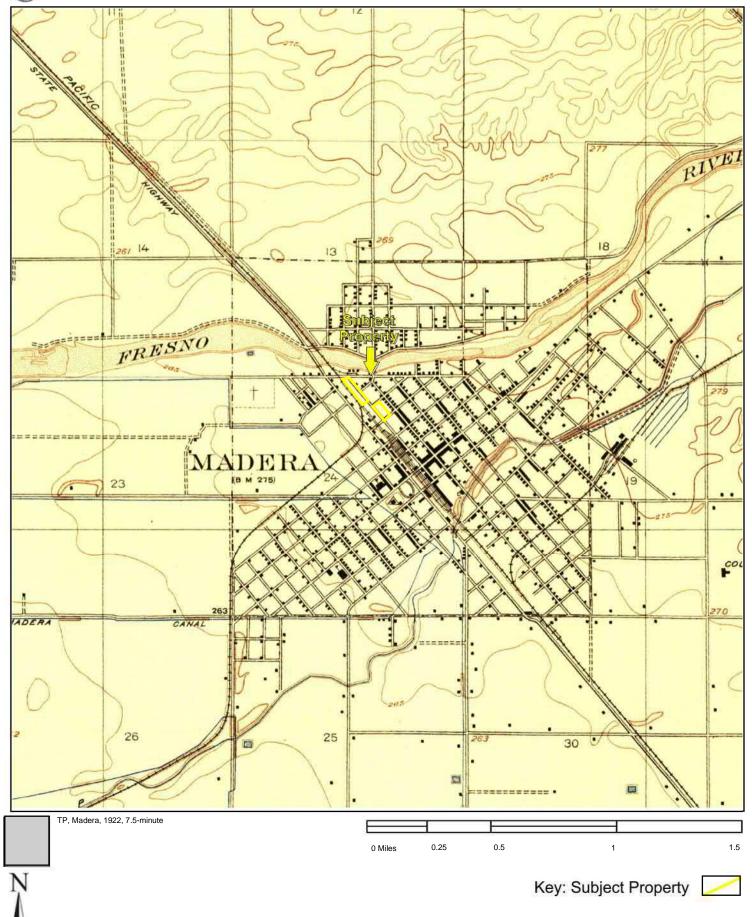

APPENDIX B: Topographic Maps Project No. 19-244554.1






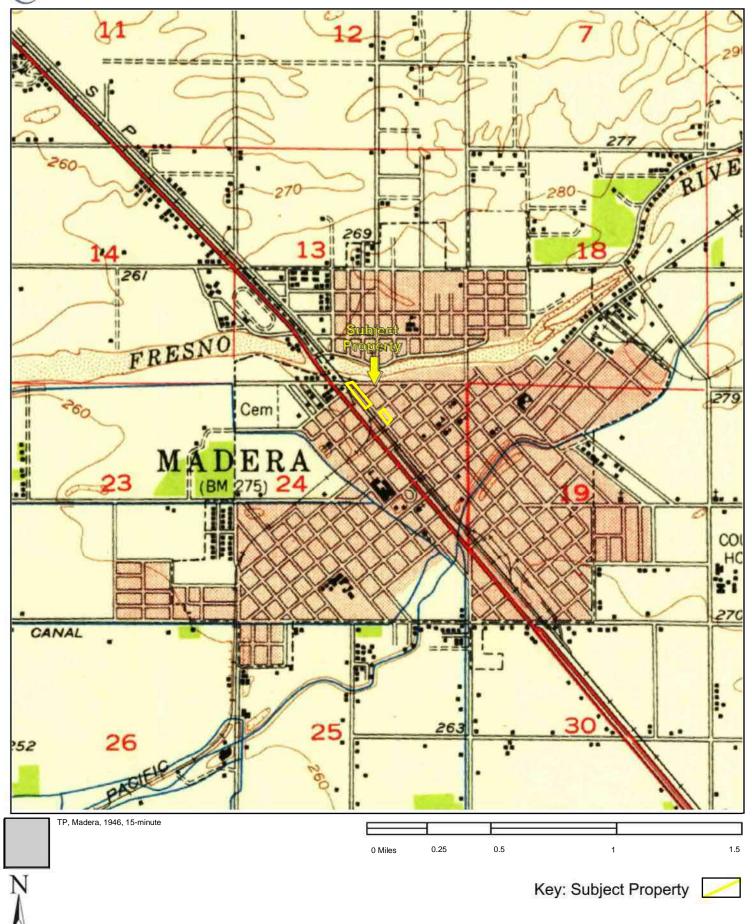






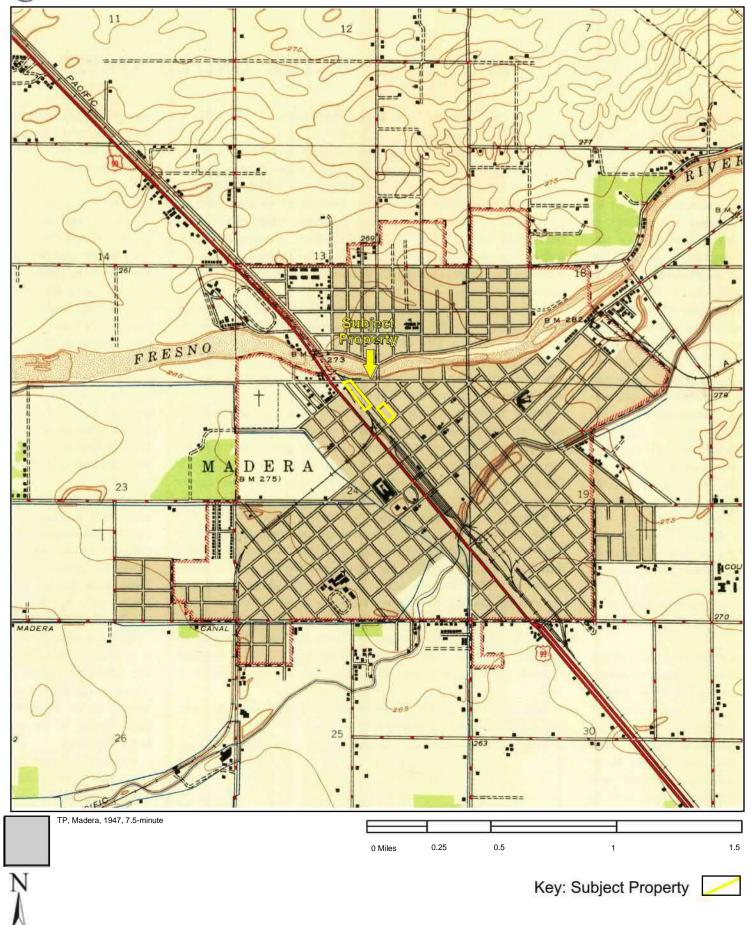






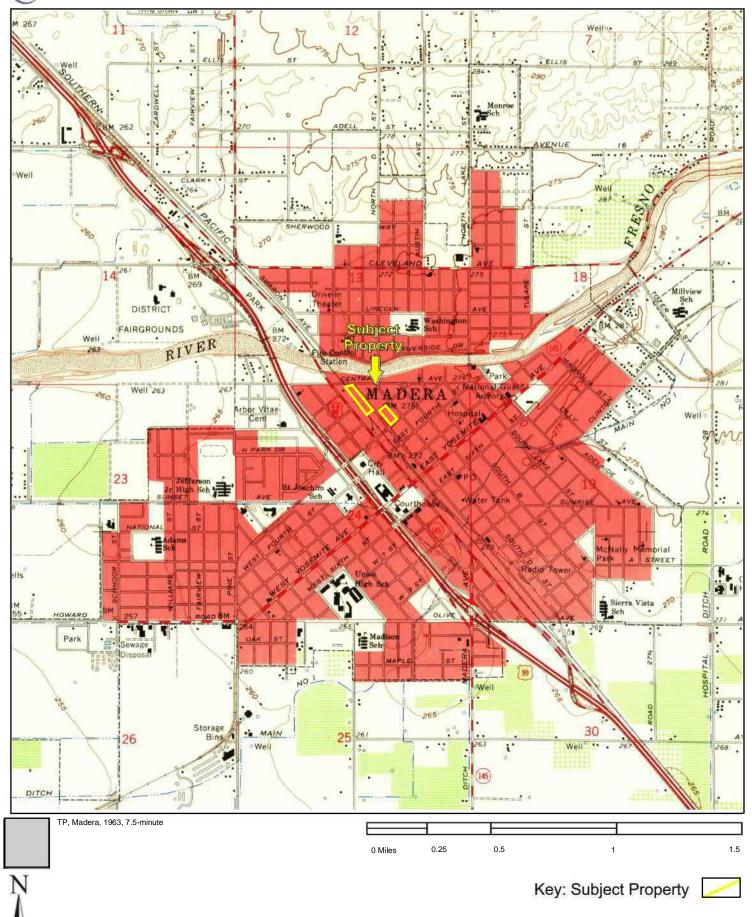





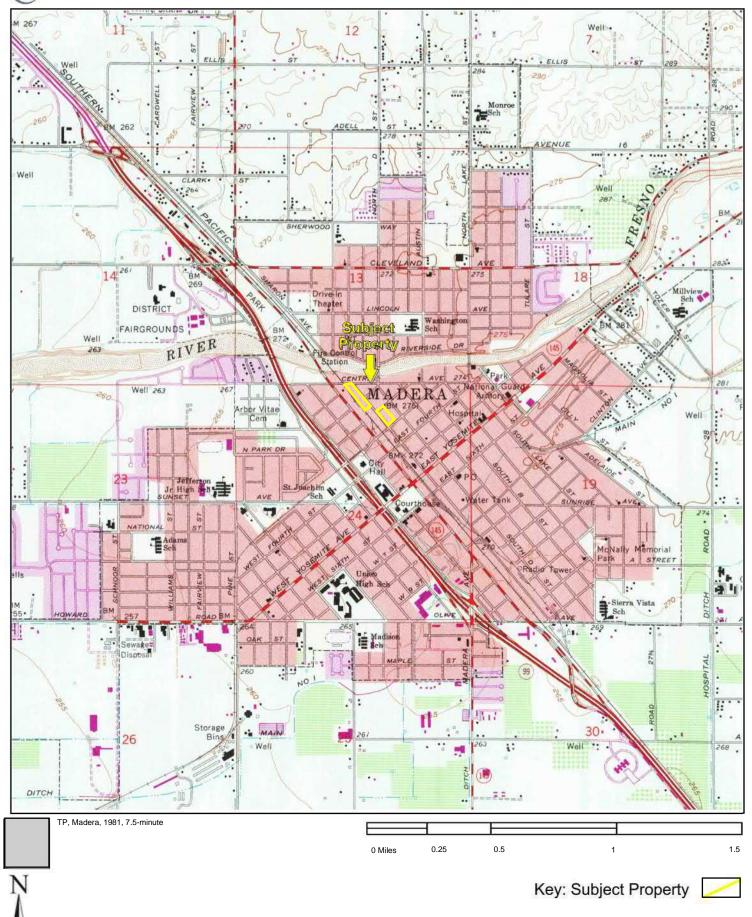









SINAI AUTO REPAIR

401 N E ST STE N MADERA CA 93638



PROFILE

MAP

COMPLIANCE



GEOPOLITICAL

COUNTY

Madera County

CALENVIROSCREEN 3.0 PERCENTILE RANGE

86-90%

SITE CODES

SIC

7538 General automotive repair shops

NAICS

811111 General Automotive Repair

ALTERNATE IDS

FACILITIES EXPLORER ID EPA IDENTIFIER

516417 CAL000000000

REGULATORY PROGRAMS

HAZARDOUS WASTE GENERATOR 1

ENVIRONMENTAL INTEREST START DATE 07/10/2013

LAST INSPECTED

03/24/2015

SOURCE SYSTEM

California Environmental Reporting System

SOURCE SYSTEM ID

10425367

SITE CONTACTS

CUPA DISTRICT

NAME

Madera County Env Health

PHONE

(559) 675-7823

ADDRESS

200 W. 4th StreetSuite 3100 Madera, CA 93637

FACILITY MAILING ADDRESS

NAME

Mailing Address

ADDRESS

401 N "E" ST, Suite N MADERA, CA 93638

DOCUMENT
PREPARER,
ENVIRONMENTAL
CONTACT,
IDENTIFICATION
SIGNER, LEGAL
OWNER,
OPERATOR

NAME

Natanael Beltran

TITLE

OWNER

PHONE

(559) 474-5610

ADDRESS

401 N E ST, Suite N MADERA, CA 93638

PARENT CORPORATION

NAMESINAI AUTO REPAIR

SINAI AUTO REPAIR

401 N E ST STE N MADERA CA 93638



PROFILE MAP COMPLIANCE

EVALUATIONS

Evaluations With Violations 1
Evaluations Without 1
Violations

VIOLATIONS

Total

COMPLIANCE ACTIONS

Total

1

EVALUATIONS WITH VIOLATIONS (1)

	Date	Program		
_	02/20/2015	HW - Hazardous Waste Generator	Rou	

DESCRIPTION

Routine done by local CUPA or Participating Agency

NOTES

_

EVALUATIONS WITHOUT VIOLATIONS (1)

	Date	Program	
_	03/24/2015	HW - Hazardous Waste Generator	Oth

DESCRIPTION

Other, not routine, done by local CUPA or Participating Agency

NOTES

MARTINS ELECTRICAL&AUTO REPAIR

401 N E ST STE C MADERA CA 93638



PROFILE

MAP

COMPLIANCE



GEOPOLITICAL

COUNTY

Madera County

CALENVIROSCREEN 3.0 PERCENTILE RANGE

86-90%

SITE CODES

SIC

7538 General automotive repair shops

ALTERNATE IDS

FACILITIES EXPLORER ID EPA IDENTIFIER

46933 CAL000359068

REGULATORY PROGRAMS

HAZARDOUS WASTE GENERATOR 1

ENVIRONMENTAL INTEREST START DATE

11/23/2013

LAST INSPECTED

11/30/2017

SOURCE SYSTEM

California Environmental Reporting System

SOURCE SYSTEM ID

10471105

SITE CONTACTS

CUPA DISTRICT

NAME

Madera County Env Health

PHONE

(559) 675-7823

ADDRESS

200 W. 4th StreetSuite 3100 Madera, CA 93637

FACILITY MAILING ADDRESS

NAME

Mailing Address

ADDRESS

401 N E St Ste C Madera, CA 93638

DOCUMENT
PREPARER,
ENVIRONMENTAL
CONTACT,
IDENTIFICATION
SIGNER, LEGAL
OWNER,
OPERATOR

NAME

MARTIN GALVAN

TITLE

Owner

PHONE

(559) 474-5679

ADDRESS

401 N E St Ste C Madera, CA 93638

PARENT

CORPORATION

NAME MARTINS ELECTRICAL&AUTO

REPAIR

MARTINS ELECTRICAL&AUTO REPAIR

401 N E ST STE C MADERA CA 93638



PROFILE MAP COMPLIANCE

EVALUATIONS

Evaluations With Violations 1
Evaluations Without 1
Violations

VIOLATIONS

Total

9

COMPLIANCE ACTIONS

Total

2

EVALUATIONS WITH VIOLATIONS (1)

	Date	Program	
_	07/27/2017	HW - Hazardous Waste Generator	Rou

DESCRIPTION

Routine done by local CUPA or Participating Agency

NOTES

_

EVALUATIONS WITHOUT VIOLATIONS (1)

	Date	Program	Тур
_	11/30/2017	HW - Hazardous Waste Generator	Oth

DESCRIPTION

Other, not routine, done by local CUPA or Participating Agency

NOTES

MADERA AUTO TIRES & REPAIRS

610 N E ST STE 112 MADERA CA 93638



PROFILE

MAP

COMPLIANCE



GEOPOLITICAL

COUNTY

Madera County

CALENVIROSCREEN 3.0 PERCENTILE RANGE

86-90%

SITE CODES

NAICS

811111 General Automotive Repair

ALTERNATE IDS

FACILITIES EXPLORER ID EPA IDENTIFIER

360924 CAL000411412

REGULATORY PROGRAMS

HAZARDOUS WASTE GENERATOR 1

ENVIRONMENTAL INTEREST START DATE 11/18/2015

LAST INSPECTED

03/31/2016

SOURCE SYSTEM

California Environmental Reporting System

SOURCE SYSTEM ID

10650358

SITE CONTACTS

DOCUMENT
PREPARER,
ENVIRONMENTAL
CONTACT,
IDENTIFICATION
SIGNER, LEGAL
OWNER,
OPERATOR

NAME

Cesar Ortiz

TITLE

Owner

PHONE

(559) 674-1515

ADDRESS

610 N E St Ste 112 Madera, CA 93638

PARENT CORPORATION

NAME

Madera Auto Tires & Repairs

CUPA DISTRICT

NAME

Madera County Env Health

PHONE

(559) 675-7823

ADDRESS

200 W. 4th StreetSuite 3100 Madera, CA 93637

FACILITY MAILING ADDRESS

NAME

Mailing Address

ADDRESS

610 N E St Ste 112 Madera, CA 93638

MADERA AUTO TIRES & REPAIRS

610 N E ST STE 112 MADERA CA 93638



PROFILE

MAP

COMPLIANCE

EVALUATIONS

Evaluations With Violations 2

Evaluations Without 1

Violations

VIOLATIONS

Total 8

COMPLIANCE ACTIONS

Total

2

EVALUATIONS WITH VIOLATIONS (2)

		Date	Program	Тур
	+	02/29/2016	HMRRP - Hazardous Materials Release Response Plans (HMRRP)	Rou
+		02/29/2016	HW - Hazardous Waste Generator	Rou

EVALUATIONS WITHOUT VIOLATIONS (1)

	Date	Program	
+	03/31/2016	HMRRP - Hazardous Materials Release Response Plans (HMRRP)	Oth

D & F BODY & PAINT

401 N E ST MADERA CA 93638



PROFILE

MAP

COMPLIANCE



GEOPOLITICAL

COUNTY

Madera County

CALENVIROSCREEN 3.0 PERCENTILE RANGE

86-90%

SITE CODES

None.

ALTERNATE IDS

FACILITIES EXPLORER ID EPA IDENTIFIER

109881 CAL000341053

REGULATORY PROGRAMS

HAZARDOUS WASTE GENERATOR 1

ENVIRONMENTAL INTEREST START DATE 07/10/2013

LAST INSPECTED

04/02/2015

SOURCE SYSTEM

California Environmental Reporting System

SOURCE SYSTEM ID

10425385

SITE CONTACTS

PARENT CORPORATION

NAME

D & F BODY & PAINT

DOCUMENT
PREPARER,
ENVIRONMENTAL
CONTACT,
IDENTIFICATION
SIGNER,
OPERATOR

NAME

DIANA ORTIZ

TITLE

OWNER

PHONE

(559) 363-2823

ADDRESS

27349 PERKINS ROAD MADERA, CA 93636-6

CUPA DISTRICT

NAME

Madera County Env Health

PHONE

(559) 675-7823

ADDRESS

200 W. 4th StreetSuite 3100 Madera, CA 93637

FACILITY MAILING ADDRESS

NAME

Mailing Address

ADDRESS

27349 PERKINS ROAD MADERA, CA 93637

LEGAL OWNER

NAME

ORTIZ, DIANA

PHONE

(559) 363-2823

ADDRESS

27349 PERKINS ROAD MADERA, CA 93637

D & F BODY & PAINT

401 N E ST MADERA CA 93638



PROFILE

MAP

COMPLIANCE

1

EVALUATIONS

Total

Total

VIOLATIONS

COMPLIANCE ACTIONS

Total

1

TOTAL

	Date	Program	Тур	
_	04/02/2015	HW - Hazardous Waste Generator	Rou	

DESCRIPTION

Routine done by local CUPA or Participating Agency

1

NOTES

_

ANDY'S TRANSMISSION SHOP

425 N E ST MADERA CA 93638



PROFILE

MAP

COMPLIANCE



GEOPOLITICAL

COUNTY

Madera County

CALENVIROSCREEN 3.0 PERCENTILE RANGE

86-90%

SITE CODES

SIC

7549 Automotive services, n.e.c.

ALTERNATE IDS

FRS
FACILITIES EXPLORER ID
EPA IDENTIFIER

110065265581 5874 CAL000361669

REGULATORY PROGRAMS

HAZARDOUS WASTE GENERATOR (1)

ENVIRONMENTAL INTEREST START DATE 07/10/2013

LAST INSPECTED 11/30/2017

SOURCE SYSTEM

California Environmental Reporting System

SOURCE SYSTEM ID 10426282

SITE CONTACTS

DOCUMENT
PREPARER,
ENVIRONMENTAL
CONTACT,
IDENTIFICATION
SIGNER,
OPERATOR

NAME

ANDY LOPEZ

TITLE

OWNER

PHONE

(559) 408-0960

ADDRESS

425 N "E" STREET MADERA, CA 93638

PARENT CORPORATION

NAME

ANDY'S TRANSMISSION SHOP

LEGAL OWNER

NAME

LOPEZ, ANDY

PHONE

(559) 673-1778

ADDRESS

425 N "E" STREET MADERA, CA 93638

CUPA DISTRICT

NAME

Madera County Env Health

PHONE

(559) 675-7823

ADDRESS

200 W. 4th StreetSuite 3100 Madera, CA 93637

FACILITY MAILING ADDRESS

NAME

Mailing Address

ADDRESS

425 N E ST MADERA, CA 93638

ANDY'S TRANSMISSION SHOP

425 N E ST MADERA CA 93638



PROFILE MAP COMPLIANCE

EVALUATIONS

Evaluations With Violations 1
Evaluations Without 1
Violations

VIOLATIONS

Total

7

COMPLIANCE ACTIONS

Total

EVALUATIONS WITH VIOLATIONS (1)

	Date	Program		
_	06/27/2017	HW - Hazardous Waste Generator	Rou	

DESCRIPTION

Routine done by local CUPA or Participating Agency

NOTES

_

EVALUATIONS WITHOUT VIOLATIONS (1)

	Date	Program	Тур
_	11/30/2017	HW - Hazardous Waste Generator	Rou

DESCRIPTION

Routine done by local CUPA or Participating Agency

NOTES



er/Operato	or t	rancisus Ortiz Phone	559) 363-282
e of Inspec	tion	Inspection Consolidation	Inspector S. Chau
Routine		Re-Inspection Solo Joint Multimed	ia Facility ID FA
ollow-up	L	Other Combined Integrated	Program Element
ISENT TO	INSPECT	GRANTED BY Name / Title: Francis co Ontiz	FPA ID
ection may	involve o	btaining photographs, review and copying of records, and determination of compliance	e. Page of
T 400 T 400	77-27 (3.0)	II – Class II Violation M - Minor Violation	rage 01
III M	Code	HAZARDOUS WASTE REQUIREMENTS	COMMENTS / OBSERVATIONS
		Record keeping/Documentation	140-17
	HW01	Generator shall have EPA ID number.	1+(x 12
	HW02	Hazardous waste determination made for all wastes. □Analysis □Generator knowledge	
	HW03	Contingency plan information shall be posted near phone.	tentainers shall
	HW04	Facility personnel shall demonstrate training/awareness.	be closed exect
	HW05	Manifests/Consolidated Manifest receipts shall be complete.	solo 11
	HW06	Shall mail manifest copy(s) to DTSC.	- men adding
	HW07	TSDF signed copy of manifest available within 35 days of waste shipment.	Vennetry wester
	HW08	Bills of Lading/receipts shall be available.	
	HW09	LDRs shall be available and complete.	(OS (SX
	HW10	Onsite recycling shall be reported using UPCF.	
	111110	Container/Tank Management	
6	HW11	Containers shall be in good condition.	
1	HW12	Containers shall be closed except when adding/removing waste.	
	HW13	Contaminated empty containers shall be empty.	
	HW14	Containers shall be inspected weekly.	V. P. Commission of the Commis
	HW15	Tanks shall be inspected daily.	
	HW16	Satellite containers shall be at or near point of generation.	
	HW17	Satellite containers shall be under control of the operator.	
	HW18	There shall be one container per waste stream at satellite area.	
	HW19	Exclude recyclable materials stored in accordance with local ordinance/haz materials codes.	
	ALCOHOLD	Accumulation Time Limits	
NAME OF TAXABLE PARTY.	HW20	Waste shall not be accumulated more than applicable 90/180/270 days.	
	HW21	Satellite wastes shall accumulate for less than 1 year.	
	HW22	Empty containers shall be managed within 1 year.	
	HW23	Universal wastes shall accumulate for less than 1 year.	
	HW24	Used oil filters shall accumulate for less than 1 year (180 days if more than 1 ton).	
	HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 days if more than 1 ton).	
	XI MARKET		
2946-1 C000811108	HW26	Containers shall be properly labeled.	
	HW27	Satellite containers shall be marked once added and full.	
1	HW28	Excluded recyclable materials shall be marked properly.	
	HW29	Universal waste container shall be properly labeled.	
	HW30	Drained used oil filters shall be marked "Drained Used Oil Filters".	
	HW31	Shall have beginning date written on spent lead-acid batteries.	
	HW32	Shall mark "Used Oil" on all used oil tanks/containers.	
	HW33	Shall mark tank with "Hazardous Waste", contents, and start date.	
	HW34	Shall mark empty containers with date emptied.	
	ottymitiken	Treatment, Transport and Disposal/Other	
	HW35	Shall have permit/authorization to do treatment.	
	HW36	Waste shall be sent with authorized transport (gen. eligible).	
	HW37	Waste shall be disposed of to authorized point/party.	#
	HW38	Failed to properly handle appliance wastes.	
25-35-5			
er to Violati Corrective	on and Co	RUCTIONS: NOTICE TO COMPLY Trective Action page for Regulation, Description and Guidance. Sign in this box for not imply agreement agreement.	r receipt of this report. Signature doo nt with findings, only receipt of repo



pe	erator	1	Diana Octiz Phone	(559) 237-0292
ns	pecti	<u>on</u>	Inspection Consolidation	Inspector Leitel
ne /-u		-	Routine Solo Joint Multimed Other Combined Integrated	ia Facility ID 1- A010 307 Program Element
			GRANTED BY Name / Title: Cotaining photographs, review and copying of records, and determination of compliance	_ EPAID Calooo3410s
s	l Vio	lation	II - Class II Violation M - Minor Violation	Page of
1	М	Code	HAZARDOUS WASTE REQUIREMENTS	COMMENTS / OBSERVATIONS
-1		Name :	Record keeping/Documentation	
		HW01	Generator shall have EPA ID number.	Records maintaine
		HW02	Hazardous waste determination made for all wastes. □Analysis □Generator knowledge	Leger of the state
		HW03	Contingency plan information shall be posted near phone.	for waster
I		HW04	Facility personnel shall demonstrate training/awareness.	pant
1		HW05	Manifests/Consolidated Manifest receipts shall be complete.	
ŀ		HW06	Shall mail manifest copy(s) to DTSC.	
ŀ		HW07 HW08	TSDF signed copy of manifest available within 35 days of waste shipment.	The second secon
ŀ	1000000	HW09	Bills of Lading/receipts shall be available. LDRs shall be available and complete.	
ł		HW10	Onsite recycling shall be reported using UPCF.	
11.			Container/Tank Management	
		HW11	Containers shall be in good condition.	Portamen /
		HW12	Containers shall be closed except when adding/removing waste.	Fa. I. Hat -
ļ	- 8	HW13	Contaminated empty containers shall be empty.	
ŀ		HW14	Containers shall be inspected weekly.	my good
ŀ		HW15 HW16	Tanks shall be inspected daily. Satellite containers shall be at or near point of generation.	nepair
ŀ		HW17	Satellite containers shall be under control of the operator.	20 <u>1000 0000 0000 0000</u>
t		HW18	There shall be one container per waste stream at satellite area.	A Secretary Section (Control of Control of C
		HW19	Exclude recyclable materials stored in accordance with local ordinance/haz materials codes. Accumulation Time Limits	
1		HW20	Waste shall not be accumulated more than applicable 90/180/270 days.	
Ì		HW21	Satellite wastes shall accumulate for less than 1 year.	Time Times
-		HW22	Empty containers shall be managed within 1 year.	Mourenter
		HW23	Universal wastes shall accumulate for less than 1 year.	- 1 - 2
		HW24	Used oil filters shall accumulate for less than 1 year (180 days if more than 1 ton).	TROUGHS CONTROL CONTRO
		HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 days if more than 1 ton). Labeling/Marking	
		HW26	Containers shall be properly labeled.	-a
		HW27	Satellite containers shall be marked once added and full.	Contreves Tabeled
-		HW28	Excluded recyclable materials shall be marked properly.	labeled
-		HW29 HW30	Universal waste container shall be properly labeled. Drained used oil filters shall be marked "Drained Used Oil Filters".	
STREET, SQUARE,	Web 311	HW31	Shall have beginning date written on spent lead-acid batteries.	THE TAXABLE CONTROL OF TAXAB
The Personal Property lies		HW32	Shall mark "Used Oil" on all used oil tanks/containers.	
Ì		HW33	Shall mark tank with "Hazardous Waste", contents, and start date.	
		HW34	Shall mark empty containers with date emptied.	
Ī		LIMING	Treatment, Transport and Disposal/Other	No treatured.
1		HW35 HW36	Shall have permit/authorization to do treatment. Waste shall be sent with authorized transport (gen. eligible).	140 Vicasor
1		HW37	Waste shall be disposed of to authorized point/party.	Ge MEANING AND TOWN AND STREET
1		HW38	Failed to properly handle appliance wastes.	
	DECT			or receipt of this report. Signature does
				ent with findings, only receipt of report
			nust be demonstrated with proof of compliance within 30	





Facili	ity Na	ame _	Ma	Hin's Electrical of Auto Repo	Date .	2-24-11
Site /	Addre	ess	H	101 N E Street	Time In	Time Out
Owne	er/Op	perator	11	Maturahan	Phone 6	62-1705
Туре	of In	specti	ion	Inspection Consolidation		Inspector Leitel
	SEN	up T TO 1	NSPECT	Re-Inspection Solo Joint Combined Integrated GRANTED BY Name / Title:	Multimedia	Program Element 1509 EPA ID (2100035906)
				btaining photographs, review and copying of records, and determination II – Class II Violation M - Minor Violation	of compliance.	Page of
	II	M	Code	HAZARDOUS WASTE REQUIREMENTS		COMMENTS / OBSERVATIONS
			Joan	Record keeping/Documentation		COMMENTO / CECENTATIONS
2000		Likhtfi to	HW01	Generator shall have EPA ID number.	_	P - , - P
	-		HW02	Hazardous waste determination made for all wastes. □Analysis □Generator k	noulodgo	Jacelity has
\vdash	-	-	1000000		nowleage —	FDA VIX #
\vdash	-	-	HW03	Contingency plan information shall be posted near phone.		181 1
-	-	-	HW04	Facility personnel shall demonstrate training/awareness.		appropriate
-	_	_	HW05	Manifests/Consolidated Manifest receipts shall be complete.		records mantained
		_	HW06	Shall mail manifest copy(s) to DTSC.		
			HW07	TSDF signed copy of manifest available within 35 days of waste shipment.		T
			HW08	Bills of Lading/receipts shall be available.		
2			HW09	LDRs shall be available and complete.	-	
2.00			HW10	Onsite recycling shall be reported using UPCF.		
again.				Container/Tank Management		a 1 - 11 1
			HW11	Containers shall be in good condition.		Container / fand
_			HW12	Containers shall be closed except when adding/removing waste.		west in land
			HW13	Contaminated empty containers shall be empty.		1 - 10000
			HW14	Containers shall be inspected weekly.		Contestiones.
\vdash			HW15	Tanks shall be inspected daily.		Mas litter to
_			HW16	Satellite containers shall be at or near point of generation.		Pontain Shilli
			HW17	Satellite containers shall be under control of the operator.		The state of the s
\vdash	_		HW18	There shall be one container per waste stream at satellite area.		
	000000000	F 54005 U.S.	HW19	Exclude recyclable materials stored in accordance with local ordinance/haz materials	erials codes.	
3483	0.00美。	100	1500115011	Accumulation Time Limits		1
			HW20	Waste shall not be accumulated more than applicable 90/180/270 days.		Accumula From
			HW21	Satellite wastes shall accumulate for less than 1 year.		
			HW22	Empty containers shall be managed within 1 year.		time limits
			HW23	Universal wastes shall accumulate for less than 1 year.		documented
			HW24	Used oil filters shall accumulate for less than 1 year (180 days if more than 1 tor		
EXECUTE:	VED 2000	W 200 V 200	HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 days if more	e than 1 ton).	
20000	20120		101100	Labeling/Marking		
			HW26	Containers shall be properly labeled.		0 1
		\vdash	HW27	Satellite containers shall be marked once added and full.		Contained
\vdash	\vdash		HW28	Excluded recyclable materials shall be marked properly.		appropriately
\vdash			HW29	Universal waste container shall be properly labeled.		laseled +11 alsod
	\vdash	-	HW30	Drained used oil filters shall be marked "Drained Used Oil Filters".		y cure
	-	-	HW31	Shall have beginning date written on spent lead-acid batteries.		
	-		HW32	Shall mark "Used Oil" on all used oil tanks/containers.		
	\vdash	-	HW33	Shall mark tank with "Hazardous Waste", contents, and start date.		
	WAR BEEF	STATE OF THE PARTY.	HW34	Shall mark empty containers with date emptied.		
337777			LIMA	Treatment, Transport and Disposal/Other	4-11-12-11	No troates &
		\vdash	HW35	Shall have permit/authorization to do treatment.		No treatment
\vdash	-		HW36 HW37	Waste shall be sent with authorized transport (gen. eligible). Waste shall be disposed of to authorized point/party.		
-	-		HW38	Failed to properly handle appliance wastes.		
	inganese.		and the same of the same of	Mathematical Publication Country area of states and consequent states	in this have farmer	asint of this sevent Claust
				indeficite. Notice to domine.		ceipt of this report. Signature does
				orrective richert page for riegalation, Decomption and Galdanice.	mpry agreement	with findings, only receipt of report.
				ust be demonstrated with proof of compliance within 30	11.15 -4	lla.
				ubmission of the Return to Compliance Statement. HALL BE CORRECTED WITHIN DAYS.	pur war	
			.5,250	, / DATE:		
Signa	ature	(certi	fying the	correction of all violations)		Date



e of	Inspec	ction	Inspection Consolidation	(559)474-5679
61	M		SCALLS VICTORIAN OF THE CONTROL OF T	Inspector MENDEZ,G., R
Routine Follow-up		<u> </u>	Re-Inspection ⊠ Solo □ Joint □ Mu Other □ Combined □ Integrated	Itimedia Facility ID FA 616287
	000000			P/F 2010
NSE	NT TO	INSPEC	GRANTED BY Name / Title: MARTIN GAIVAN OW	O ON C FOR ID
pectio	on may	involve o	obtaining photographs, review and copying of records, and determination of comp	Oliance. EPA ID CAL 000359
			II - Class II Violation M - Minor Violation	Page _/_ o
	M	Code	HAZARDOUS WASTE REQUIREMENTS	COMMENTO / OPOEDVATIONS
	3000		Record keeping/Documentation	COMMENTS / OBSERVATIONS
		HW01	Generator shall have EPA ID number.	- NO MOLATION
		HW02	Hazardous waste determination made for all wastes. □Analysis □Generator knowledge	
		HW03	Contingency plan information shall be posted near phone.	ALL VIOLATION
		HW04	Facility personnel shall demonstrate training/awareness.	COCRECTED FROM
		HW05	Manifests/Consolidated Manifest receipts shall be complete.	LAST POUR
1		HW06	Shall mail manifest copy(s) to DTSC.	LAST ROUTINE
-		HW07	TSDF signed copy of manifest available within 35 days of waste shipment.	INSPECTION!
1		HW08	Bills of Lading/receipts shall be available.	
	-	HW09	LDRs shall be available and complete.	SITE VERY WE
_	_	HW10	Onsite recycling shall be reported using UPCF.	MAINTAINED!
T	1	HW11	Containers shall be in good and the	
		HW12	Containers shall be in good condition. Containers shall be closed except when adding/removing waste.	
		HW13	Contaminated empty containers shall be empty.	
		HW14	Containers shall be inspected weekly.	_
Ď		HW15	Tanks shall be inspected daily.	-
		HW16	Satellite containers shall be at or near point of generation.	
		HW17	Satellite containers shall be under control of the operator.	
		HW18	There shall be one container per waste stream at satellite area.	
		HW19	Exclude recyclable materials stored in accordance with local ordinance/haz materials code	s.
		101100	Accumulation Time Limits	
-		HW20	Waste shall not be accumulated more than applicable 90/180/270 days.	
-		HW21 HW22	Satellite wastes shall accumulate for less than 1 year.	
		HW23	Empty containers shall be managed within 1 year. Universal wastes shall accumulate for less than 1 year.	
		HW24	Used oil filters shall accumulate for less than 1 year (180 days if more than 1 ton).	
		HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 days if more than 1 tor).	x
			Labeling/Marking	IJ.
		HW26	Containers shall be properly labeled.	
		HW27	Satellite containers shall be marked once added and full.	
		HW28	Excluded recyclable materials shall be marked properly.	
-		HW29	Universal waste container shall be properly labeled.	***************************************
-		HW30	Drained used oil filters shall be marked "Drained Used Oil Filters".	
		HW31 HW32	Shall have beginning date written on spent lead-acid batteries. Shall mark "Used Oil" on all used oil tanks/containers.	
		HW33	Shall mark tank with "Hazardous Waste", contents, and start date.	
		HW34	Shall mark empty containers with date emptied.	
	× 7/3		Treatment, Transport and Disposal/Other	
		HW35	Shall have permit/authorization to do treatment.	
		HW36	Waste shall be sent with authorized transport (gen. eligible).	
		HW37	Waste shall be disposed of to authorized point/party.	
		HW38	Failed to properly handle appliance wastes.	
INS	PECT	ION INST	RUCTIONS: NOTICE TO COMPLY Sign in this bo	ox for receipt of this report. Signature do
	12-1-0	on and Co	rrective Action page for Regulation, Description and Guidance.	eement with findings, only receipt of repo

DERA

4 - 600	A A AK	27110 = 5-811- 1 0201-0	tour of TI who
Facility Name _	NP	MINUS ELECTRICE AUTO REPARK O	Pate II Wischard Survey 20
Site Address	401	N. E St. Ste. C. Madera KA936381	ime In 3 OOMTime Out 4.45
Owner/Operator	MA	RANAN Phone (59)474-5679
Type of Inspection	<u>on</u>	Inspection Consolidation	Inspector MENDEZG; REAS
☐ Routine ☐Follow-up		Re-Inspection Solo Joint Multime	edia Facility ID TAGO 874
Prollow-ub	-	Other Combined Integrated	Program Element
		GRANTED BY Name / Title: MARTIN GAWAW OWN btaining photographs, review and copying of records, and determination of complian	
I – Class I Viol		II – Class II Violation M - Minor Violation	Page 1 of
I II M	Code	HAZARDOUS WASTE REQUIREMENTS	COMMENTS / OBSERVATIONS
6		Record keeping/Documentation	A low Read loss FOO In to 2
1045	HW01	Generator shall have EPA ID number.	THOUSE THE THE
1	HW02	Hazardous waste determination made for all wastes. □Analysis □Generator knowledge	PRIVICE PROFICES
00	HW03	Contingency plan information shall be posted near phone.	NOO3 Bedfezom Create
	HW04	Facility personnel shall demonstrate training/awareness.	E Food continuences Dan
	HW05	Manifests/Consolidated Manifest receipts shall be complete.	1 0 0
	HW06	Shall mail manifest copy(s) to DTSC.	where all personnel can
	HW07	TSDF signed copy of manifest available within 35 days of waste shipment.	E inchide emogenus
-	HW08		- Contact names phose number
\square		Bills of Lading/receipts shall be available.	Redects Phone Munder
	HW09 HW10	LDRs shall be available and complete.	bration of the extinatustic
	HVVIO	Onsite recycling shall be reported using UPCF.	CONTON SHE CAMPULANT
	HW11	Container/Tank Management Containers shall be in good condition.	gorin Equationient. cos.
	HW12	Containers shall be closed except when adding/removing waste.	this antifeeze wase
	HW13	Contaminated empty containers shall be empty.	- EUSED motor would SEG
	HW14	Containers shall be inspected weekly.	down containers need
	HW15	Tanks shall be inspected daily.	La las stantes res
	HW16	Satellite containers shall be at or near point of generation.	TO DE CLOSED ENCEPTUIC)
	HW17	Satellite containers shall be under control of the operator.	adding or comprise west
	HW18	There shall be one container per waste stream at satellite area.	Personaled haves were
	HW19	Exclude recyclable materials stored in accordance with local ordinance/haz materials codes.	mental M alocared
		Accumulation Time Limits	on secondale la se
- X	HW20	Waste shall not be accumulated more than applicable 90/180/270 days.	on removasiences for
	HW21	Satellite wastes shall accumulate for less than 1 year.	these containers. Even
	HW22	Empty containers shall be managed within 1 year.	- Showin containers are then
	HW23	Universal wastes shall accumulate for less than 1 year.	Socrational Contrincol
	HW24	Used oil filters shall accumulate for less than 1 year (180 days if more than 1 ton).	must provide leak-book
	HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 days if more than 1 ton).	C 1 FO
		Labeling/Marking	Centames
\sim	HW26	Containers shall be properly labeled.	this 14. Containers and
	HW27	Satellite containers shall be marked once added and full.	area around containers
	HW28	Excluded recyclable materials shall be marked properly.	Should be to marted for
	HW29	Universal waste container shall be properly labeled.	Spile Oil spill address
	HW30	Drained used oil filters shall be marked "Drained Used Oil Filters".	Shire Dil Shir Mason Sul
	HW31	Shall have beginning date written on spent lead-acid batteries.	in saturcein containing
	HW32	Shall mark "Used Oil" on all used oil tanks/containers.	area whomis a potential
	HW33	Shall mark tank with "Hazardous Waste", contents, and start date.	compsion morard. Person
	HW34	Shall mark empty containers with date emptied. Treatment, Transport and Disposal/Other	Trust be trained on inspection
	HW35	Shall have permit/authorization to do treatment.	fix on some solone
	HW36	Waste shall be sent with authorized transport (gen. eligible).	in a dip de trans
	HW37	Waste shall be disposed of to authorized point/party.	ANIS OU SITE SI SOUCH
	HW38	Failed to properly handle appliance wastes.	to immediately s
DOOT INCORPOR	551345 Vin545	CONSISTANT PROPERTY CONTROL OF THE PROPERTY OF	for receipt of this report. Signature does
			ment with findings, only receipt of report.
		brechive Action page for Regulation, Description and Odidance.	// receipt of report.
		ust be demonstrated with proof of compliance within 30 ubmission of the Return to Compliance Statement.	4.11 7 17.17
VIOLATIONS N	OTEDS	HALL BE CORRECTED WITHIN DAYS.	Jan 1-21-11
		MAN MA	
Signature (certif	ying the	correction of all violations)	Date



ENVIRONME. AL HEALTH DIVISION • CERTIFIED UNIFIED PROGRAM AGENCY (CUPA) 200 W. 4TH STREET, SUITE 3100 • MADERA, CA 93637 • PHONE: (559) 675-7823 • FAX: (559) 675-7919

OFFICIAL INSPECTION FORM

ELECTRIC & AUTO PEPATR Date Thursday July 77 2017

(Continuation Page)

Type of Inspection	<u>n</u>			07	U
□НМВР	- DHW	□ust	☐ APSA	☐ Other	
				Р	age <mark>2</mark> of 2
			Comments /	Observations	
11:06WH	o manif	sts for	OILBHO	pick-up were observed L	abel
lio us	filters	indicate	ed last	time it was picked u	ip was
in	2015	obsen	jed 555	drum continer ful of	1001
filters	, mese	filter	must be	picked up. Provide moni	FRST
				tid not get picked up :	
for ove	raye	ac in a	2015, T	no consecutive prik-	1P
dates	obsone	ed were	the Soli	land	~
08-	31-15	è 11-	the 80/1	0.	
HUDG:	Proper	y labe	1 antip	reeze yest container @	850
e oil	Sitter	Eusea)	Contains	er @SSG COST	7
* * C	Joseve	7 30	ent Cour 1	patteres,	
944	DOSENE	d 1410	FOR A	outleries	
		5 90		O	
				8	
	W			18	
			0.000		
RECEIVED BY:	alea >	-27-17		MENDEZG, P.E.H.S.	
	D. 668		Å	7	



Com unity and Economic Devel ment Environmental Health Division

Dexter Marr Deputy Director

- 200 W. 4th Street, Suite 3100
- Madera, CA 93637
- (559) 675-7823
- FAX (559) 675-7919
- envhealth@madera-county.com

NOTICE OF VIOLATION

November 22nd 2017

Martins Electrical & Auto Repair 401 North E Street Suite C Madera, CA 93638

Re: Hazardous Waste Generator Program

Dear Owner/Operator,

Our records indicate that the Madera County Environmental Health Division (MCEHD) has not received the information requested at the last inspection for Martins Electrical & Auto Repair located at 401 North C Street Suite C, Madera, CA 93638. An inspection was completed at your facility on July 27th 2017 at which time you were directed to obtain the information listed below and submit this documentation to MCEHD. As of this date our Division has not received this information.

Hazardous Waste Generator Program:

- Containers and areas around containers should be inspected for spills. Oil spill was observed in secondary
 containment area, which is a potential corrosion hazard. Personnel must be trained on inspecting for oil
 spills and potential oil spills on site & respond to immediately.
- Antifreeze waste and used motor waste 55 gallon drum containers need to be closed except when adding
 or removing waste. Perforated holes were observed on removable lids for these containers. Even though
 containers are secondary contained, must provide leak proof containers.
- No manifests for oil-filters pick-up were observed. Label on oil filters indicated last time it was picked up was in 2015. Observed 55 gallon drum container full of oil filters, these filters must be picked up. Provide manifest for over a year in 2015. Two consecutive pick-up dates observed were the following. 08/31/15 & 11/23/16.

CLASS II Violation

This notice is to advice you that there is a Class II violation at your facility for failing to submit the required information. Failure to correct this violation in a timely manner will result in the violation being escalated to a Class I violation. Class I violations require formal enforcement by this Division. Should the violation be escalated to a Class I violation, an Administrative Enforcement Order (AEO) will be issued to your facility and a penalty assessed.

Violation of the California Health and Safety Code and the California Code of Regulations can carry civil and criminal penalties of five hundred (\$500) to five thousand dollars (\$5000) per day of violations. You are hereby notified to submit the above information to MCEHD in 30 business days from the receipt of this letter.

Please contact me at this office if you have any questions at (559) 675-7823 Ext 3408.

Sincerely,

Gabriela Mendez, R.E.H.S.

Registered Environmental Health Specialist





	,	arrie	Sinai	Auto Repair	Date _ 2/30/34
Site A	ddr	ess	401	North E Street	Time In Time Out
Owne	r/Op	perato	or Pa	aulino Silva Phone 4	74-5610
уре с	of In	spec	tion	Inspection Consolidation	Inspector Ken Vang
Ro				Re-Inspection Solo Joint Multin	nedia Facility ID FA0103021
_Foll	ow-	up	L	Other Combined Integrated	Program Element 2219
ONS	EN	т то	INSPEC	T GRANTED BY Name / Title: Paulino STlug	₩
nspec	tion	may	involve o	obtaining photographs, review and copying of records, and determination of complia	EPA ID <u>CAL000317028</u>
				II - Class II Violation M - Minor Violation	Page of
1	II	IM	Code	HAZARDOUS WASTE REQUIREMENTS	001111111111111111111111111111111111111
19900				Record keeping/Documentation	COMMENTS / OBSERVATIONS
T		X	HW01	Generator shall have EPA ID number.	HWOL: Activate EPA ID
			HW02	Hazardous waste determination made for all wastes. □Analysis □Generator knowledge	number, Insactor provi
	4	X	HW03	Contingency plan information shall be posted near phone.	form to operator.
		X	HW04	Facility personnel shall demonstrate training/awareness.	HW03: Provide conting
		1x	HW05	Manifests/Consolidated Manifest receipts shall be complete.	
		100	HW06	Shall mail manifest copy(s) to DTSC.	plan. corrected on site
			HW07	TSDF signed copy of manifest available within 35 days of waste shipment.	HWO4: Provide training
			HW08	Bills of Lading/receipts shall be available.	to start that hand bs
			HW09	LDRs shall be available and complete.	hazandons waste.
			HW10	Onsite recycling shall be reported using UPCF.	HWOS: Assure to Keep
				Container/Tank Management	
		X	HW11	Containers shall be in good condition.	mentest receipts for
		X	HW12	Containers shall be closed except when adding/removing waste.	atteast 3 years.
_	_		HW13	Contaminated empty containers shall be empty.	HWIL: cleun weste.
_	_	X	HW14	Containers shall be inspected weekly.	Container & surrounding
-	_	•	HW15	Tanks shall be inspected daily.	1400 10 1000
-	\dashv		HW16	Satellite containers shall be at or near point of generation.	14.11111 1200 100
-	\dashv	-	HW17	Satellite containers shall be under control of the operator.	HWIS. Inspected
-	\dashv		HW18 HW19	There shall be one container per waste stream at satellite area.	contagues weekly to
ender.	100,000	Materia	110013	Exclude recyclable materials stored in accordance with local ordinance/haz materials codes. Accumulation Time Limits	menter, leak, lent,
T	T	10229-111	HW20	Waste shall not be accumulated more than applicable 90/180/270 days.	cleanliness.
			HW21	Satellite wastes shall accumulate for less than 1 year.	HW12: continues chall
	1		HW22	Empty containers shall be managed within 1 year.	ha through assist at actili
			HW23	Universal wastes shall accumulate for less than 1 year.	the correct extent week
			HW24	Used oil filters shall accumulate for less than 1 year (180 days if more than 1 ton).	vernoving waste, jusper
			HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 days if more than 1 ton).	Officered holes on all
	din.			Labeling/Marking Labeling/Marking	the 42 of the 3-Bfal
1	1	X	HW26	Containers shall be properly labeled.	dues Repla dume
-	-		HW27	Satellite containers shall be marked once added and full.	HWRE: Assum nOO
+	+		HW28	Excluded recyclable materials shall be marked properly.	contagners has their
-	+		HW29	Universal waste container shall be properly labeled.	The state of the s
	+	-	HW30 HW31	Drained used oil filters shall be marked "Drained Used Oil Filters".	own caper.
	+		HW32	Shall have beginning date written on spent lead-acid batteries. Shall mark "Used Oil" on all used oil tanks/containers.	4.5
	+		HW33	Shall mark tank with "Hazardous Waste", contents, and start date.	* Frovide missing
	1		HW34	Shall mark empty containers with date emptied.	Spill egusoment.
		Signal .		Treatment, Transport and Disposal/Other	
	T		HW35	Shall have permit/authorization to do treatment.	Tout of
			HW36	Waste shall be sent with authorized transport (gen. eligible).	(1)
			HW37	Waste shall be disposed of to authorized point/party.	W. Com Annivel
		_1	HW38	Failed to properly handle appliance wastes.	* CERS Submittel 15 due
STIN	ISP	ECTI	ON INST	RUCTIONS: NOTICE TO COMPLY Sign in this box	for receipt of this report. Signature does
Refer	to V	liolatic	on and Co	rrective Action page for Regulation, Description and Guidance not imply agreer	nent with findings, only receipt of report.
OJ Co	rrec	ctive a	action mu	ust be demonstrated with proof of compliance within 30	01
lays	by c	comple	etion & su	bmission of the Return to Compliance Statement.	5/10
	TIO	NS N	OTED SH	HALL BE CORRECTED WITHIN DAYS.	CMS
IOLA				The state of the s	



n may i	Pai	North E Street	Inspector Ken Vang
nspecti ne <i>i-</i> up NT TO I	ion □	Inspection Consolidation Re-Inspection Solo Joint Multime	Inspector Ken Vang
ne v-up NT TO I on may i	NSPECT	Re-Inspection Solo Joint Multime	
/-up NT TO I on may i	□ INSPECT	Re-Inspection Other Solo	dia Facility ID FA0103021
/-up NT TO I on may i	□ INSPECT	Other Combined Integrated	Tacility ID TACTOSOZT
NT TO I			
n may i			Program Element 2219
n may i		GRANTED BY Name / Title: * XIIII Fauto	EPA ID CAL000317028
		btaining photographs, review and copying of records, and determination of compliance	26
			Page <u>/</u> of <u>3</u>
s I Vio	T .	II – Class II Violation M - Minor Violation	COMMENTS / ODSEDVATIONS
M	Code	HAZARDOUS WASTE REQUIREMENTS	COMMENTS / OBSERVATIONS
	HW01	Record keeping/Documentation Generator shall have EPA ID number.	HWO1; Operator for lead
-			to activate GDA IA#
1	District Annual Annual		Inspector gave form to
+			The top of the
1-			altivate the 18#:
-			
-			All the other violetions to
+			- the last isspection 2/20/2
			has been completed.
-	T-MACHERINE.	Experience in the second of th	
	HWV10		
B SPECIFICAÇÃO	HW11		1
	-		1 1
	HW15		
	HW16	Satellite containers shall be at or near point of generation.	1-1
	HW17	Satellite containers shall be under control of the operator.	
	HW18	There shall be one container per waste stream at satellite area.	
	HW19	Exclude recyclable materials stored in accordance with local ordinance/haz materials codes.	
		Accumulation Time Limits	
	HW20	Waste shall not be accumulated more than applicable 90/180/270 days.	
\perp		•	_
-			
-			
	The State of the S		\
ULTRU LINE	HVVZ5		V
11001100000	HW26		
	HW27	Satellite containers shall be marked once added and full.	
	HW28	Excluded recyclable materials shall be marked properly.	1
	HW29	Universal waste container shall be properly labeled.	1
	HW30	Drained used oil filters shall be marked "Drained Used Oil Filters".	
	HW31	Shall have beginning date written on spent lead-acid batteries.	
	HW32	Shall mark "Used Oil" on all used oil tanks/containers.	
	HW33	Shall mark tank with "Hazardous Waste", contents, and start date.	
	HW34	Shall mark empty containers with date emptied.	
			· · · · · · · · · · · · · · · · · · ·
\vdash			
			1
eleveni		Cign in this hav	for receipt of this report. Cispature days
		INDUTIONS. NOTICE TO COMPLY	for receipt of this report. Signature does ment with findings, only receipt of report.
		briedive Action page for Regulation, Description and Guidance.	ment with initings, only receipt of report.
			110 11
			109
0	violat rective y comp	HW16 HW17 HW18 HW19 HW20 HW21 HW22 HW23 HW24 HW25 HW26 HW27 HW28 HW29 HW30 HW31 HW30 HW31 HW32 HW33 HW34 HW35 HW35 HW35 HW36 HW37 HW38 SPECTION INS	HW03 Contingency plan information shall be posted near phone. HW04 Facility personnel shall demonstrate training/awareness. HW05 Manifests/Consolidated Manifest receipts shall be complete. HW06 Shall mail manifest copy(s) to DTSC. HW07 TSDF signed copy of manifest available within 35 days of waste shipment. HW08 Bills of Lading/receipts shall be available. HW09 LDRs shall be available and complete. HW10 Onsite recycling shall be reported using UPCF. Containers Tank Management HW11 Containers shall be in good condition. HW12 Containers shall be logod condition. HW13 Containers shall be logod condition. HW14 Containers shall be inspected weekly. HW15 Tanks shall be inspected weekly. HW16 Satellite containers shall be under control of the operator. HW17 Satellite containers shall be under control of the operator. HW18 There shall be one container per waste stream at satellite area. HW19 Exclude recyclable materials stored in accordance with local ordinance/haz materials codes. Accumulation Time Limits HW20 Waste shall not be accumulated more than applicable 90/180/270 days. HW21 Satellite wastes shall accumulate for less than 1 year. HW22 Empty containers shall accumulate for less than 1 year. HW22 Used oil filters shall accumulate for less than 1 year (180 days if more than 1 ton). Labeling/Marking HW28 Excluder recyclable materials shall be marked properly. HW28 Spent lead-acid batteries shall accumulate for less than 1 year (180 days if more than 1 ton). Labeling/Marking HW28 Excluded recyclable materials shall be marked properly. HW29 Shall mark stall be properly labeled. HW20 Shall mark stank with "Hazardous Waste", contents, and start date. HW31 Shall mark stank with "Hazardous Waste", contents, and start date. HW33 Shall mark stank with "Hazardous Waste", contents, and start date. HW34 Shall mark stank with "Hazardous Waste", contents, and start date. HW35 Shall mark stank with "Hazardous Waste", contents, and start date. HW36 Shall have permit/authorization to do treatment



Sinai Anto Repari 401 North E St.

- Holes top of containers

- cleanliness problem - Not closed







wner	r/Op	erator P	aulino Silva Phone 474	4-5610
/pe c	of Ins	spection	Inspection Consolidation	Inspector Ken Vang
Rou	utine	. г	Re-Inspection ⊠ Solo □ Joint □ Multime	2
Follo		3.75 A	☐ Re-Inspection ☐ Solo ☐ Joint ☐ Multime ☐ Other ☐ Integrated	edia Facility ID FA0103021
		10.5	Integrated	Program Element 2219
SIAC	ENT	TO INSPEC	T GRANTED BY Name / Title: * July 2 / Fauto	
spec	tion	may involve	obtaining photographs, review and copying of records, and determination of compliance	EPA IDCAL000317028
			II – Class II Violation M - Minor Violation	Page _/_ of _
\neg	11	M Code	HAZARDOUS WASTE REQUIREMENTS	COMMENTS / OBSERVATIONS
			Record keeping/Documentation	11 /04 Descriptions
	X	HW01	Generator shall have EPA ID number.	MNOZ; Opera to too lead
		HW02	Hazardous waste determination made for all wastes. □Analysis □Generator knowledge	to activate GDA IA
		HW03	Contingency plan information shall be posted near phone.	inspector save form
		HW04	Facility personnel shall demonstrate training/awareness.	action to Beautiful
		HW05	Manifests/Consolidated Manifest receipts shall be complete.	active the 14 #:
		HW06	Shall mail manifest copy(s) to DTSC.	1011 10
		HW07	TSDF signed copy of manifest available within 35 days of waste shipment.	All the other villations
1		HW08	Bills of Lading/receipts shall be available.	the last is petion 2/2
1		HW09	LDRs shall be available and complete.	has born completed.
1	1	HW10	Onsite recycling shall be reported using UPCF.	is the completes.
	Station.	in spieles dieds	Container/Tank Management	
T	T	HW11	Containers shall be in good condition.	1
		HW12	Containers shall be closed except when adding/removing waste.	
		HW13	Contaminated empty containers shall be empty.	
T		HW14	Containers shall be inspected weekly.	
		HW15	Tanks shall be inspected daily.	1
T	1	HW16	Satellite containers shall be at or near point of generation.	
		HW17	Satellite containers shall be under control of the operator.	
		HW18	There shall be one container per waste stream at satellite area.	\
		HW19	Exclude recyclable materials stored in accordance with local ordinance/haz materials codes.	
			Accumulation Time Limits	
		HW20	Waste shall not be accumulated more than applicable 90/180/270 days.	
		HW21	Satellite wastes shall accumulate for less than 1 year.	
		HW22	Empty containers shall be managed within 1 year.	
		HW23	Universal wastes shall accumulate for less than 1 year.	
L		HW24	Used oil filters shall accumulate for less than 1 year (180 days if more than 1 ton).	
		HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 days if more than 1 ton).	-
100000			Labeling/Marking	
┡	_	HW26	Containers shall be properly labeled.	
-	-	HW27	Satellite containers shall be marked once added and full.	
-	+	HW28	Excluded recyclable materials shall be marked properly.	
_	+	HW29	Universal waste container shall be properly labeled.	
	+	HW30	Drained used oil filters shall be marked "Drained Used Oil Filters".	
-	+	HW31	Shall have beginning date written on spent lead-acid batteries.	
-	+	HW32	Shall mark "Used Oil" on all used oil tanks/containers.	
	+	HW33	Shall mark tank with "Hazardous Waste", contents, and start date.	
110000	2404.00 E	HW34	Shall mark empty containers with date emptied.	
		LIMAGE	Treatment, Transport and Disposal/Other	
-	-	HW35 HW36	Shall have permit/authorization to do treatment.	
_	+	HW37	Waste shall be sent with authorized transport (gen. eligible).	
	+	HW38	Waste shall be disposed of to authorized point/party. Failed to properly handle appliance wastes.	1
				()
IN:	SPE	CTION INST	RUCTIONS: NOTICE TO COMPLY Sign in this box for	or receipt of this report. Signature does
er to	o Vic	plation and Co	rective Action page for Regulation Description and Guidance not imply agreement	ent with findings, only receipt of report.
Cor	rect	ive action m	ust be demonstrated with proof of compliance within	1 - ()

Madera County Environmental Health Division

200 W. 4th Street, Suite 3100, Madera, CA 93637 (559) 675-7823

PERMIT TO OPERATE

SINAI AUTO REPAIR

Mail to:

SINAI AUTO REPAIR 401 N "E" ST, Suite N MADERA, CA 93638 Facility Name:

SINAI AUTO REPAIR 401N E St Ste N Madera, CA 93638

Permit Expires: 12/31/2019

SILVA, PAULINO

Permit Number - Authorized Description

PT0006313 Haz Waste Recycled 100-999 Kg/Mo. Valid From 1/1/2019 To 12/31/2019



By Authority of: Dexter Marr, Deputy Director Environmental Health Division

Permit is NOT TRANSFERABLE

Permit may be revoked or suspended for:

-non payments of fees


-violations of the California Health and Safety Codes

-imminent health hazards

THIS FORM MUST BE DISPLAYED CONSPICUOUSLY AT THE PERMITTED FACILITY

Obtain a copy of inspection results by calling MCEHD (559)675-7823

PO04.rpt

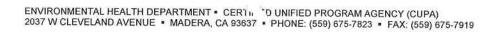



ine w-u			Inspection Consolidation	
				Inspector Lei Fel.
NT			Re-Inspection Solo Joint Multime Other Dombined Integrated	dia Facility ID FA01038
		1	Gotholied Integrated	Program Element 3 3 9
	TO 1	Medect	GRANTED BY Name / Title: Chulky Jean	
1579.00			btaining photographs, review and copying of records, and determination of compliance	EPAID CaloudSE16
				Page of _
	-	1	II - Class II Violation M - Minor Violation	
Ш	M	Code	HAZARDOUS WASTE REQUIREMENTS	COMMENTS / OBSERVATIONS
1		Luxios	Record keeping/Documentation	
\dashv		HW01 HW02	Generator shall have EPA ID number.	Albert Amala
-	-	HW03	Hazardous waste determination made for all wastes. □Analysis □Generator knowledge Contingency plan information shall be posted near phone.	various menta
-		HW04	Facility personnel shall demonstrate training/awareness.	1 2 1
1	-	HW05	Manifests/Consolidated Manifest receipts shall be complete.	for material
1		HW06	Shall mail manifest copy(s) to DTSC.	- asporen
7		HW07	TSDF signed copy of manifest available within 35 days of waste shipment.	
		HW08	Bills of Lading/receipts shall be available.	
		HW09	LDRs shall be available and complete.	
		HW10	Onsite recycling shall be reported using UPCF.	
		are entre	Container/Tank Management	Container fant
+	-	HW11	Containers shall be in good condition.	mienageressot -
+		HW12 HW13	Containers shall be closed except when adding/removing waste.	T. C.
+		HW14	Contaminated empty containers shall be empty. Containers shall be inspected weekly.	
1		HW15	Tanks shall be inspected daily.	
		HW16	Satellite containers shall be at or near point of generation.	
		HW17	Satellite containers shall be under control of the operator.	-
		HW18	There shall be one container per waste stream at satellite area.	
		HW19	Exclude recyclable materials stored in accordance with local ordinance/haz materials codes.	
	D. S. S. Y	HW20	Accumulation Time Limits	Hocurenter from
+	-	HW21	Waste shall not be accumulated more than applicable 90/180/270 days. Satellite wastes shall accumulate for less than 1 year.	tories
T		HW22	Empty containers shall be managed within 1 year.	around Led.
		HW23	Universal wastes shall accumulate for less than 1 year.	
		HW24	Used oil filters shall accumulate for less than 1 year (180 days if more than 1 ton).	<u> </u>
1		HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 days if more than 1 ton).	-
200	Alexand.		Labeling/Marking	1.10 .00
+	-	HW26 HW27	Containers shall be properly labeled.	Lasel all
+	_	HW28	Satellite containers shall be marked once added and full. Excluded recyclable materials shall be marked properly.	containers
1	_	HW29	Universal waste container shall be properly labeled.	Kirchel E
1		HW30	Drained used oil filters shall be marked "Drained Used Oil Filters".	Tublete morning
	_	HW31	Shall have beginning date written on spent lead-acid batteries.	to rinclude
1	_	HW32	Shall mark "Used Oil" on all used oil tanks/containers.	nerste telkers
-		HW33	Shall mark tank with "Hazardous Waste", contents, and start date.	7
1	September	HW34	Shall mark empty containers with date emptied.	
T	ETAL STEE	HW35	Treatment, Transport and Disposal/Other Shall have permit/authorization to do treatment.	- x de book
+		HW36	Waste shall be sent with authorized transport (gen. eligible).	- New sternings
T		HW37	Waste shall be disposed of to authorized point/party.	
T		HW38	Failed to properly handle appliance wastes.	10 10 10 10 10 10 10 10 10 10 10 10 10 1
SPI	1			or receipt of this report. Signature does
o Vi	olatio	n and Co	rrective Action page for Regulation, Description and Guidance.	ept with findings, only receipt of report
rec	tive a	ection mu	ist be demonstrated with proof of compliance within 30	. ()
y co	mple	tion & sul	bmission of the Return to Compliance Statement.	1 Lopen
y co	mple	tion & sul	bmission of the Return to Compliance Statement. ALL BE CORRECTED WITHIN DAYS.	Jopey



Signature (certifying the correction of all violations)

Add	ress	425 N E	Street Madera, CA 93638				Time In	9:30AM	Time Out	11:15AN	
ner/O	perator	And	y Lopez			Phone	(559) 63		5 0.		
e of I	nspecti	on.		Inspection Consol	idation		()		3.5		
		211		inspection Consol	idadon			Inspector	Mendez, C	i., R.E.H.	
Routi			Re-Inspection Other	Solo	Joint	☐ Mul	timedia	nedia Facility ID FA0102874			
Ollow	-up	_	J Other	Combined	☐ Integrated			Prog. Ele.	2219 HWR -	- SQG	
NSE	NT TO	INSPECT	GRANTED BY Name / Title: btaining photographs, review and	ANDY L	OPEZ	BO	SS	EPA ID	CAL00036	61669	
				or Violation	and determination	of comp	liance.			Page 1 c	
II	- V	Code		OUS WASTE REQUIR	EMENTS			COMMEN.	TS / OBSERVA	TIONS	
			OADMAND COM	rd keeping/Documenta	DOMESTIC STREET, STATE OF THE S	Y I I I I I I	HW		EPA ID#. Opera		
	х	HW01	Generator shall have EPA ID numb				DT	SC form 1358,	inspector emaile		
		HW02	Hazardous waste determination ma	de for all wastes. □Ana	lysis Generator k	nowledge	DT	SC. Corrected	on Site.		
	x	HW03	Contingency plan information shall	be posted near phone.			HW	/03: Create & n	ost contingency	nlan where	
		HW04	Facility personnel shall demonstrate	training/awareness.			per	sonnel can see	 Operator ment 	ioned that	
	х	HW05	Manifests/Consolidated Manifest re	ceipts shall be complete.			faci	lity has expand	ed in last 3 mon	ths (Since	
		HW06	Shall mail manifest copy(s) to DTS0	2.				il 2017). Provid tingency plan.	e pictures of ne	w updated	
		HW07	TSDF signed copy of manifest avail	able within 35 days of wa	aste shipment.						
		HW08	Bills of Lading/receipts shall be ava	lable.					its were observe		
		HW09	LDRs shall be available and comple	te.			mai	nifests for the p	ast 3 years (201	4-2017).	
		HW10	Onsite recycling shall be reported u	sing UPCF.			HW	12: Used oil 55	G drum contain	ners on site	
			Con	tainer/Tank Manageme	ent		(X2) were not activ	ely being used a	and had	
\perp		HW11	Containers shall be in good condition						ening. Containe ve removable li		
+	X	HW12	Containers shall be closed except w		aste.				ept when addin		
-	+	HW13	Contaminated empty containers sha					te. Corrected o			
-	×	HW14	Containers shall be inspected week	y.			LIVA/	44. 0		core	
+	1	HW15	Tanks shall be inspected daily.				con	14: Areas arou tainers are surr	nd hazardous w	aste n scran me	
		HW16	Satellite containers shall be at or ne				met wee	containers are surrounded by sharp scrap metal parts, personnel must inspect areas weekly for any hazards involving leaks & spill that can potentially occur. Inspect containers			
		HW17	Satellite containers shall be under co	ontrol of the operator.					immediately to		
_		HW18	There shall be one container per wa				min	imizing hazards	. Provide picture	es of clean	
1		HW19	Exclude recyclable materials stored			erials code	es. and area		secondary con	tainment	
-				cumulation Time Limits			alea				
+	-	HW20	Waste shall not be accumulated mo	re than applicable 90/180	0/270 days.				d one hazardou		
-	-	HW21	Satellite wastes shall accumulate for	The state of the s	•			for both used oil containers. Oil filters @ 55- drum tank had no HW label. Properly label			
-		HW22 HW23	Empty containers shall be managed					individual container.		ny label ea	
1		HW24	Universal wastes shall accumulate for		if						
		HW25	Used oil filters shall accumulate for I Spent lead-acid batteries shall accur				***F		neet the conditi		
200	VSCOV.	20	oponitiona dolla batteries sirail accui	Labeling/Marking	ai (100 days ii more	man 1 to			on regulations. I ite accumulatior		
x		HW26	Containers shall be properly labeled				cont	aining used oil	throughout facili	ity. It is	
		HW27	Satellite containers shall be marked	The state of the s			reco	mmended to la	bel them as: "Sa	atellite	
		HW28	Excluded recyclable materials shall I				Acci	imulation Area,	Hazardous Wa y." 22 CCR 12 6	ste, Used	
		HW29	Universal waste container shall be p					or Violation)	y. 22 OUR 12 C	0202.34(6	
		HW30	Drained used oil filters shall be mark		ters".		- 1	National services	1. Edward Company Company	MARKYSTIAS THEA	
		HW31	Shall have beginning date written on	spent lead-acid batterie			****0	Operator man	G containers in	back alley	
		HW32	Shall mark "Used Oil" on all used oil					not on his prop	tioned does not erty.	belong to	
		HW33	Shall mark tank with "Hazardous Wa	ste", contents, and start	date.				6		
		HW34	Shall mark empty containers with da								
1		1040- 1		Transport and Disposa	al/Other						
		HW35	Shall have permit/authorization to do								
		HW36	Waste shall be sent with authorized t								
		HW37	Waste shall be disposed of to author	ized point/party.							
		HW38	Failed to properly handle appliance v					16 71 - 11			
TINS	PECT	ION INST	RUCTIONS: NOTICE TO COMP	PLY					eport. Signa		
		on and Co	rrective Action page for Regulation,	Description and Cuida	I not it	nply agr	eement w	ith findings.	only receipt	of repor	
efer to	Violati	on and Co	ust be demonstrated with proof o	Description and Guida					and tooght	01.1000.	



Facility Name	Andy's	Transmission Shop		Date Tuesday, June 27th 2017
Site Address	425 N E	Street Madera, CA 93638		Time In 9:30 AM Time Out 11:15 AM
Owner/Opera	tor And	y Lopez	Phone _	559.673.1778
Type of Inspe	ection		Inspection Consolidation	Inspector Mendez, G., R.E.H.S.
		Re-Inspection Other	Solo ☐ Joint ☐ Mult ☐ Combined ☐ Integrated	imedia Facility ID <u>FA0102874</u>
<u> </u>	· -	Total	Combined Integrated	Prog. Ele. <u>2219 HWR > 100 Kg/Mo.</u>
CONSENT T	O INSPECT	GRANTED BY Name / Title:		EPA ID CAL000361669
			ying of records, and determination of compl	iance.
I - Class I \	iolation	II - Class II Violation M - Minor V	/iolation	Pageof
1 II N	71 19821 97		WASTE REQUIREMENTS	COMMENTS / OBSERVATIONS
		# 11804 # 1415 - 450 # 7 C 4 (4 (5 4)	eeping/Documentation	HWO! heactivate EPA ID#Cos.
	HW01	Generator shall have EPA ID number.		HWO3: Create & HATEM
	HW02		or all wastes. □Analysis □Generator knowledge	
	HW03	Contingency plan information shall be po		Post Contingion plan
	HW04	Facility personnel shall demonstrate trai		where an personner can
	HW05	Manifests/Consolidated Manifest receipt	s shall be complete.	see
	HW06	Shall mail manifest copy(s) to DTSC.		- twos Nomanifestswer
\vdash	HW07 HW08	TSDF signed copy of manifest available		observed Drivide all
	HW09	Bills of Lading/receipts shall be available LDRs shall be available and complete.	2.	many rests for the past
	HW10	Onsite recycling shall be reported using	LIPCE	3 Mass (2014-2017)
	111110		er/Tank Management	14 119 1180 01 CC
	HW11	Containers shall be in good condition.		TOURS. WOLL OIL SS
	HW12	Containers shall be closed except when	adding/removing waste.	- arum containers on
	HW13	Contaminated empty containers shall be	empty.	= 3ite (x2) were not actively
$\overline{}$	HW14	Containers shall be inspected weekly.		being used stad funnels
	HW15	Tanks shall be inspected daily.		- through opening Continer
	HW16	Satellite containers shall be at or near po	aint of generation	essa for all Alters and
	111110	Odicinic containers shall be at of flear po	ont of generation.	AN have AR removable
	HW17	Satellite containers shall be under control	of the operator.	Lid. Container shall be
	HW18	There shall be one container per waste s		a social property loop and will an a
	HW19		cordance with local ordinance/haz materials codes	s coad except will actually hallow
	LINAGO		ulation Time Limits	The cost
	HW20 HW21	Waste shall not be accumulated more the Satellite wastes shall accumulate for less	an applicable 90/180/2/0 days.	HW14: them treas ground
	HW22	Empty containers shall be managed with		narandow wase antoines
	HW23	Universal wastes shall accumulate for les		gre surrounded by snarp
	HW24	Used oil filters shall accumulate for less t	han 1 year (180 days if more than 1 ton).	Scar metal metal punts
	HW25	Spent lead-acid batteries shall accumula	te for less than 1 year (180 days if more than 1 ton	tersonnel must inspect
124	10400		peling/Marking	areas welicus for you
	HW26 HW27	Containers shall be properly labeled. Satellite containers shall be marked once	- dd-d d & II	Daras inventiona Paris
	HW28	Excluded recyclable materials shall be m		Wighter an trad 3/1023
	HW29	Universal waste container shall be prope		
	HW30	Drained used oil filters shall be marked "I		Dear inspect containers
	HW31	Shall have beginning date written on spe	nt lead-acid batteries.	weekly respirating monday
-	HW32	Shall mark "Used Oil" on all used oil tank	DATE OF THE PROPERTY OF THE PR	to any soils Emminion
	HW33 HW34	Shall mark tank with "Hazardous Waste",		HW26. AltiGM tagthrused
0.000	HVV34	Shall mark empty containers with date en	nsport and Disposal/Other	100 Nos mars land
	HW35	Shall have permit/authorization to do trea	The state of the s	OFF FOR MASK PARENTE POOL
	HW36	Waste shall be sent with authorized trans	12 (CO.) 12 CO.)	- mara of contained of the
	HW37	Waste shall be disposed of to authorized	point/party.	- SSO chumtank trid to Husland.
	HW38	Failed to properly handle appliance waste	98.	working label each individual
OST INSPEC	TION INST	RUCTIONS: NOTICE TO COMPLY	Sign in this bo	ox for receipt of this report. Signature does
Refer to Viola	ation and Co	prective Action page for Regulation, De-	scription and Guidance. not imply agre	eement with findings, only receipt of report.
Corrective	e action m	ust be demonstrated with proof of co	mpliance within 30	NO SEG CONTAINED ON SHE GM
VIOLATIONS	IPIETION & SU	ibmission of the Return to Compliance S HALL BE CORRECTED WITHIN	- Counce	paced I to toler characteristic in the little in the littl
Observe	eriss C	ME OS MISSIAND AND AS	DAYS. H does not well	CONTRACTOR OF THE CONTRACTOR O
Signature (ce	tifying the	correction of all violations)	runny has expanded in last	3 mo Bate
Fachto.	failed	to meet the conditions a	s satellite accumulation regul	cotions. Label all scitllife acc. areas.





Facility Nam	And	ly's Transmission Snop N. E Street Madera, (A936	Da Tie	te Thursday, Nov. 35th 20
Owner/Oper	ator An	dy lope Z		59)673.1778
Type of Insp		Inspection Consolidation		Inspector MENDEZ,G., REHS
⊠ Routine		Re-Inspection Solo Joi		dia Facility ID <u>FA 0162874</u>
☐Follow-up		Other Combined Inter	egrated	P/E 2219 HWK-SQG
CONSENT	TO INSPECT	GRANTED BY Name / Title:		EPAID CAL 000361669
		btaining photographs, review and copying of records, and deter	rmination of compliance	e. Page I of _
I – Class I	M Code	II – Class II Violation M - Minor Violation HAZARDOUS WASTE REQUIREMENTS		COMMENTS / ODSEDVATIONS
1 1 11	IW Code			COMMENTS / OBSERVATIONS
	HW01	Record keeping/Documentation Generator shall have EPA ID number.		HW05: Provide 2015
	HW02	Hazardous waste determination made for all wastes. □Analysis □G	enerator knowledge	training records.
	HW03	Contingency plan information shall be posted near phone.	onorator timomoago	0
	HW04	Facility personnel shall demonstrate training/awareness.		
×	HW05	Manifests/Consolidated Manifest receipts shall be complete.		
	HW06	Shall mail manifest copy(s) to DTSC.		N=
	HW07	TSDF signed copy of manifest available within 35 days of waste shipr	ment.	
	HW08	Bills of Lading/receipts shall be available.		,
	HW09	LDRs shall be available and complete.		
	HW10	Onsite recycling shall be reported using UPCF.		
	HW11	Container/Tank Management Containers shall be in good condition.		
	HW12	Containers shall be closed except when adding/removing waste.		
	HW13	Contaminated empty containers shall be empty.		
	HW14	Containers shall be inspected weekly.		
	HW15	Tanks shall be inspected daily.		
	HW16	Satellite containers shall be at or near point of generation.		
	HW17	Satellite containers shall be under control of the operator.		
	HW18	There shall be one container per waste stream at satellite area.		
	HW19	Exclude recyclable materials stored in accordance with local ordinanc Accumulation Time Limits	e/haz materials codes.	
	HW20	Waste shall not be accumulated more than applicable 90/180/270 day	rs.	
	HW21	Satellite wastes shall accumulate for less than 1 year.		
	HW22	Empty containers shall be managed within 1 year.		
	HW23	Universal wastes shall accumulate for less than 1 year.		
	HW24	Used oil filters shall accumulate for less than 1 year (180 days if more		
	HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 da Labeling/Marking	ays if more than 1 ton).	
	HW26	Containers shall be properly labeled.		1:
	HW27	Satellite containers shall be marked once added and full.		
	HW28	Excluded recyclable materials shall be marked properly.		
	HW29	Universal waste container shall be properly labeled.		
	HW30	Drained used oil filters shall be marked "Drained Used Oil Filters".		7,
	HW31	Shall have beginning date written on spent lead-acid batteries.		
	HW32	Shall mark "Used Oil" on all used oil tanks/containers.		
-	HW33 HW34	Shall mark tank with "Hazardous Waste", contents, and start date. Shall mark empty containers with date emptied.		
	110034	Treatment, Transport and Disposal/Other		
	HW35	Shall have permit/authorization to do treatment.		
	HW36	Waste shall be sent with authorized transport (gen. eligible).):
	HW37	Waste shall be disposed of to authorized point/party.		
	HW38	Failed to properly handle appliance wastes.		
		TRUCTIONS: NOTICE TO COMPLY		or receipt of this report. Signature does
		prrective Action page for Regulation, Description and Guidance.	not imply agreem	ent with findings, only receipt of report.
		ust be demonstrated with proof of compliance within 30 ubmission of the Return to Compliance Statement.		
		HALL BE CORRECTED WITHIN DAYS.		
ignature (c	ertifying the	correction of all violations)		Date



vner/Op	perator A	ys transmission shop N EST, Madera, CA 936	Phone (5.5 9	1622 1220
	spection		Phone (\$3.7	
	The second secon	Inspection Consolidation		Inspector MENDEZ,G., R
Routing Follow-		Re-Inspection Solo Join		Facility ID FA61628
i Ollow-	up [Other Combined Inte	grated	- CANADA CARANTA CARAN
MSENT	T TO INSPEC	T GRANTED BY Name / Title: ANDY LOPET	0000	TIWIC
pection	may involve	obtaining photographs, review and copying of records, and determ	ingtion of compliance	EPAID GLOGOJOI
		II – Class II Violation M - Minor Violation	illiation of compliance.	Page
II	M Code	HAZARDOUS WASTE REQUIREMENTS		
		Record keeping/Documentation		COMMENTS / OBSERVATIONS
	HW01	Generator shall have EPA ID number.		JO VIGLATIONS
1 0	HW02	Hazardous waste determination made for all wastes. □Analysis □Ger	erator knowledge	
	HW03	Contingency plan information shall be posted near phone.	A	LLVIOLATIONS
	HW04	Facility personnel shall demonstrate training/awareness.		
	HW05	Manifests/Consolidated Manifest receipts shall be complete.	- 00	PRECTED FROM
	HW06	Shall mail manifest copy(s) to DTSC.		ST ROUTINE
	HW07	TSDF signed copy of manifest available within 35 days of waste shipme		WPECTION!
	HW08	Bills of Lading/receipts shall be available.		
	HW09	LDRs shall be available and complete.	51	TO VERY WELL
	HW10	Onsite recycling shall be reported using UPCF.	~	1AINTAINGOI
	100444	Container/Tank Management		
	HW11	Containers shall be in good condition.		
+	HW12 HW13	Containers shall be closed except when adding/removing waste.	-	
+	HW14	Contaminated empty containers shall be empty.		
+	HW15	Containers shall be inspected weekly. Tanks shall be inspected daily.		
	HW16	Satellite containers shall be at or near point of generation.		
	HW17	Satellite containers shall be at or real point of generation. Satellite containers shall be under control of the operator.		
	HW18	There shall be one container per waste stream at satellite area.		
	HW19	Exclude recyclable materials stored in accordance with local ordinance/h	az materiale codes	
5 18 27		Accumulation Time Limits	az materiais codes.	
	HW20	Waste shall not be accumulated more than applicable 90/180/270 days.	_	
	HW21	Satellite wastes shall accumulate for less than 1 year.		
	HW22	Empty containers shall be managed within 1 year.		
	HW23	Universal wastes shall accumulate for less than 1 year.		
	HW24	Used oil filters shall accumulate for less than 1 year (180 days if more than	an 1 ton).	
	HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 days	if more than 1 ton).	
	HW26	Labeling/Marking Containers shall be properly labeled.		
	HW27	Satellite containers shall be marked once added and full.		
	HW28	Excluded recyclable materials shall be marked properly.		
	HW29	Universal waste container shall be properly labeled.		
	HW30	Drained used oil filters shall be marked "Drained Used Oil Filters".		
	HW31	Shall have beginning date written on spent lead-acid batteries.		
	HW32	Shall mark "Used Oil" on all used oil tanks/containers.		
	HW33	Shall mark tank with "Hazardous Waste", contents, and start date.		
	HW34	Shall mark empty containers with date emptied.		
	LIMOS	Treatment, Transport and Disposal/Other		
	HW35 HW36	Shall have permit/authorization to do treatment.		
	HW37	Waste shall be sent with authorized transport (gen. eligible). Waste shall be disposed of to authorized point/party.		
	HW38	Failed to properly handle appliance wastes.		
LINED			01-1-11-1	
for to V	eletion and C	RUCTIONS: NOTICE TO COMPLY	Sign in this box for rece	ipt of this report. Signature do
ici tu VI	oration and Co	rrective Action page for Regulation, Description and Guidance. ust be demonstrated with proof of compliance within 30	not imply agreement wit	th findings, only receipt of repo
Correc	tive action mi			

Madera County Environmental Health Division

200 W. 4th Street, Suite 3100, Madera, CA 93637 (559) 675-7823

PERMIT TO OPERATE

ANDY'S TRANSMISSION SHOP

Mail to:

ANDY'S TRANSMISSION SHOP 425 N E ST MADERA, CA 93638 Facility Name:

ANDY'S TRANSMISSION SHOP 425 N E ST MADERA, CA 93638

Permit Expires: 12/31/2019

LOPEZ, ANDY

Permit Number - Authorized Description

PT0005965 Haz Waste Recycled 100-999 Kg/Mo. Valid From 1/1/2019 To 12/31/2019

By Authority of: Dexter Marr, Deputy Director Environmental Health Division

Permit is **NOT TRANSFERABLE**

Permit may be revoked or suspended for:

-non payments of fees

-violations of the California Health and Safety Codes

-imminent health hazards

THIS FORM MUST BE DISPLAYED CONSPICUOUSLY AT THE PERMITTED FACILITY

Obtain a copy of inspection results by calling MCEHD (559)675-7823

POO4.mt

CERS ID #: 10426282 FA0102839

Date_



Signature (certifying the correction of all violations)

ite /	Addre	ess 6	OIUNE	Street 112 Madera, CA	Time In Time Out		
Owne	er/Op	erator	Cesa	r Ortiz Phone (S	559) 674.15115		
ype	of In	specti	<u>on</u>	Inspection Consolidation	Inspector Mendez, G. REHS		
	outin			Re-Inspection Solo Joint Multin	nedia Facility ID FA0103688		
_IF0	llow-	up		Other Combined Integrated	Program Element 2208		
MO.	CEN	T TO I	NEDECT	GRANTED BY Name / Title: Cosar Work Co Quiner	and worth deviation to the property of the pro		
				btaining photographs, review and copying of records, and determination of complia			
541 - 125					Page of		
1-0	II	I Viol	Code	II – Class II Violation M - Minor Violation CERS Anniversary Date HAZARDOUS WASTE REQUIREMENTS	COMMENTS / OBSERVATIONS		
A Tolerania	1.00 M	IVI	Code	Record keeping/Documentation			
			HW01	Generator shall have EPA ID number.	HWO3: Next to post contingence		
			HW02	Hazardous waste determination made for all wastes. □Analysis □Generator knowledge	Plan near Phone. < 05 300		
		><	HW03	Contingency plan information shall be posted near phone.	HW 05: Need to abserve		
			HW04	Facility personnel shall demonstrate training/awareness.	manifests from 2013, 2614		
		×	HW05	Manifests/Consolidated Manifest receipts shall be complete.	2015,2016		
			HW06	Shall mail manifest copy(s) to DTSC.	HWIZ Make sure oil filter		
		Щ	HW07	TSDF signed copy of manifest available within 35 days of waste shipment.	55 Godum trank is closed		
			HW08	Bills of Lading/receipts shall be available.	et autimos.		
			HW09	LDRs shall be available and complete.	HW14: Make sure containe		
			HW10	Onsite recycling shall be reported using UPCF. Container/Tank Management	are inspected weekly w		
			HW11	Containers shall be in good condition.			
		><	HW12	Containers shall be closed except when adding/removing waste.	no oil residues around b		
			HW13	Contaminated empty containers shall be empty.	oran the surfaces.		
		\times	HW14	Containers shall be inspected weekly.	1		
_			HW15	Tanks shall be inspected daily.	HW26: Make sure all Haz		
		\vdash	HW16 HW17	Satellite containers shall be at or near point of generation. Satellite containers shall be under control of the operator.	waste labors have the		
_	-	\vdash	HW18	There shall be one container per waste stream at satellite area.	CONCET EPA ID#.		
086			HW19	Exclude recyclable materials stored in accordance with local ordinance/haz materials codes.			
				Accumulation Time Limits	Start date begins when		
			HW20	Waste shall not be accumulated more than applicable 90/180/270 days.	276 00 000 local		
			HW21	Satellite wastes shall accumulate for less than 1 year.	For the antifreeze the alumulation standar		
			HW22	Empty containers shall be managed within 1 year.			
		-	HW23 HW24	Universal wastes shall accumulate for less than 1 year. Used oil filters shall accumulate for less than 1 year (180 days if more than 1 ton).			
			HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 days if more than 1 ton).	bagins w/ the first da		
	1000	_		Labeling/Marking	OF 61.		
		\times	HW26	Containers shall be properly labeled.			
_			HW27	Satellite containers shall be marked once added and full.	HW26: Make Sure to		
			HW28	Excluded recyclable materials shall be marked properly.	label all sport lead		
			HW29 HW30	Universal waste container shall be properly labeled. Drained used oil filters shall be marked "Drained Used Oil Filters".	- acid batteries who dat		
			HW31	Shall have beginning date written on spent lead-acid batteries.	since first sport		
			HW32	Shall mark "Used Oil" on all used oil tanks/containers.	She thoropoly,		
			HW33	Shall mark tank with "Hazardous Waste", contents, and start date.			
		,	HW34	Shall mark empty containers with date emptied.			
				Treatment, Transport and Disposal/Other			
			HW35	Shall have permit/authorization to do treatment.			
-			HW36 HW37	Waste shall be sent with authorized transport (gen. eligible). Waste shall be disposed of to authorized point/party.			
			HW38	Failed to properly handle appliance wastes.			
000	F 13.0	DECT		Ciam in this ha	x for receipt of this report. Signature does		
					ement with findings, only receipt of report.		
	TOT TO	viniali	on and C	onecove ACION DADE TO REQUISION DESCRIBTION AND GUIDANCE.			



HAZARDOUS MATERIAL BUSINESS PLAN INSPECTION FORM

Site Ad Owner/		tor Ces	244-15	ne In Time Out 9) 674.15115
Rou Othe	er		Inspection Consolidation	Inspector Mendez, G. REHS lia Facility ID FA0103688
nspect	ion ma	inspection involve	et GRANTED BY Name / Title: Color Vr 17 () Owner obtaining photographs, review and copying of records, and determination of compliance II – Class II Violation M - Minor Violation	
1 11	M	Code	HAZARDOUS MATERIAL REQUIREMENTS	COMMENTS / OBSERVATIONS
			ADMINISTRATION/DOCUMENTATION	HM03: Observed:
		HM01A HM01B	Owner/Operator failed to establish and implement a Hazardous Materials Business Plan (HMBP) when storing hazardous materials at or above the thresholds quantities of 55 gallons/500 lbs/200 cubic feet. Owner/Operator failed to complete and/or submit a Hazardous Materials Business Plan when storing hazardous materials at or above the thresholds quantities of 55	Waste Oil >556 downtrack Transmission Fluid -555 down- Used Oil-filters >556 down-to
		HM02	gallons/500 lbs/200 cubic feet. Failure to complete and/or submit hazardous material inventory forms for all reportable hazardous materials on site.	Need Antifreeze > 556 prum
	X	НМ03	Failure to update hazardous materials on site. Failure to update hazardous material inventory within 30 days when one of the following occurs: A) a 100 percent or more increase in the quantity of a previously disclosed material, B) any handling of a previously undisclosed hazardous materials, C) a change of business address, business ownership, or business name.	tist on ŒRS. HM10B: Cesar Ortiz is tr only employee currently.
	HM06 Failure to		Failure to submit a revised business plan upon a substantial change in handler's operation.	soft all chemicals on sin
		HM07	Failure to include in the HMBP adequate emergency response procedures for A) a release or threatened release, B) the immediate notification to the CUPA and to appropriate local emergency rescue personnel, C) evacuation and immediate notice for the business site.	has to properly clean up of Spill where correct person Protective equipment
		HM11	Failure to submit inventory reports - Activities, Owner/Operator, Hazardous Materials Descriptions and Map pages, if required. Documentation must be resubmitted (for facilities which exceed EPCRA thresholds) or re-certified (for facilities which do not exceed EPCRA thresholds) annually.	the Emergency Respons
		HM13	Failure to review, revise, and recertify the business plan at least once every three years	Make sure to update
_		HM15 HM16	Owner/Operator failed to complete and/or submit the Business Activities Declaration and/or the Business Owner/Operator Identification page. Failure to complete and/or submit an annotated site map as required by the CUPA.	an sections for required
1		HM20	Failure to notify the property owner in writing that the business is subject to the	documents on CERS
1		HM21	business plan program and has complied with its provisions. Failure to provide a copy of the business plan to the owner or the owner's agent	every year regardles
			within five working days after receiving a request for a copy from the owner or the owner's agent.	
		HM10A	Failure to include an adequate training program in the business plan which is reasonable and appropriate for the size of the business and the nature of the hazardous material handled.	
	X	НМ10В	Failure to include provisions in the business plan to ensure that appropriate personnel receive initial and annual training.	
		HIPITE NOTES	RELEASE/LEAKS/SPILLS	
		HM17	Failure of business to report a release or threatened release of a hazardous material to the CUPA and OES.	
		HM18	Failure to maintain storage area in a manner to prevent discharge to the environment.	
Refer Co days	to Viole prrective by con	ation and 0 e action rapletion & s		or receipt of this report. Signature does ent with findings, only receipt of report.



Facili	ty Name	Ma	dura Auto Tires & Repairs Dat	te 03-30-16
Site A	Address	610		ne In 2:00pm Time Out
Owne	er/Operato	r Ce	Sar Ortiz Phone (S	59) 674.1515
Туре	of Inspect	ion	Inspection Consolidation	Inspector MENDEZ, G. REHS
	outine llow-up		Re-Inspection Solo Joint Multimed	lia Facility ID FA0163688
Пьо	ilow-up		Other Combined Integrated	Program Element 211/2268
			GRANTED BY Name / Title: Cosar Ord. 7 Galvon own	EPAID CALOOGYIY12
- M - 00 - 50			btaining photographs, review and copying of records, and determination of compliance	e. Page <u>t</u> of <u>/</u>
1-0	lass I Vic	Code	II – Class II Violation M - Minor Violation HAZARDOUS WASTE REQUIREMENTS	COMMENTS / OBSERVATIONS
	H J W	Code	Level and the rest of the state	AND STREET OF STATE AND STATE OF STATE
		HW01	Record keeping/Documentation Generator shall have EPA ID number.	ALL CORRECTIONS HAVE
\vdash		HW02		BEEN MADE
-		TO COM DESIGNO	Hazardous waste determination made for all wastes. Analysis Generator knowledge	
\vdash		HW03 HW04	Contingency plan information shall be posted near phone.	
-		HW05	Facility personnel shall demonstrate training/awareness.	
		100000000000000000000000000000000000000	Manifests/Consolidated Manifest receipts shall be complete.	
		HW06 HW07	Shall mail manifest copy(s) to DTSC.	
		HW08	TSDF signed copy of manifest available within 35 days of waste shipment. Bills of Lading/receipts shall be available.	
\vdash	_	HW09	LDRs shall be available and complete.	
\vdash		HW10	The state of the s	
	W 1995 1	HVVIO	Onsite recycling shall be reported using UPCF. Container/Tank Management	
		HW11	Containers shall be in good condition.	
		HW12	Containers shall be closed except when adding/removing waste.	
		HW13	Contaminated empty containers shall be empty.	
		HW14	Containers shall be inspected weekly.	
		HW15	Tanks shall be inspected daily.	
		HW16	Satellite containers shall be at or near point of generation.	
		HW17	Satellite containers shall be under control of the operator.	
		HW18	There shall be one container per waste stream at satellite area.	
		HW19	Exclude recyclable materials stored in accordance with local ordinance/haz materials codes.	
		and the second	Accumulation Time Limits	
		HW20	Waste shall not be accumulated more than applicable 90/180/270 days.	
		HW21	Satellite wastes shall accumulate for less than 1 year.	
		HW22	Empty containers shall be managed within 1 year.	
		HW23	Universal wastes shall accumulate for less than 1 year.	
		HW24	Used oil filters shall accumulate for less than 1 year (180 days if more than 1 ton).	
		HW25	Spent lead-acid batteries shall accumulate for less than 1 year (180 days if more than 1 ton).	
		LIMAGO	Labeling/Marking	·
\vdash	-	HW26 HW27	Containers shall be properly labeled. Satellite containers shall be marked once added and full.	
\vdash		HW28	Excluded recyclable materials shall be marked properly.	
		HW29	Universal waste container shall be properly labeled.	
	-	HW30	Drained used oil filters shall be marked "Drained Used Oil Filters".	4
		HW31	Shall have beginning date written on spent lead-acid batteries.	
		HW32	Shall mark "Used Oil" on all used oil tanks/containers.	
		HW33	Shall mark tank with "Hazardous Waste", contents, and start date.	
		HW34	Shall mark empty containers with date emptied.)
			Treatment, Transport and Disposal/Other	
		HW35	Shall have permit/authorization to do treatment.	k <u></u>
		HW36	Waste shall be sent with authorized transport (gen. eligible).	
		HW37	Waste shall be disposed of to authorized point/party.	
		HW38	Failed to properly handle appliance wastes.	
POST	INSPEC	TION INS		or receipt of this report. Signature does
4			orrective Action page for Regulation, Description and Guidance. not imply agreem	ent with findings, only receipt of report.
• 🗆	Corrective	action m		52 (
			ubmission of the Return to Compliance Statement.	1560
VIC	LATIONS	NOTED S	HALL BE CORRECTED WITHIN DAYS.	3
Signa	iture (cert	ifying the	e correction of all violations)	1526 Date 07-30-16



HAZARDOUS MATERIAL BUSINESS PLAN INSPECTION FORM

Fac	cility N	Name	M	adera Auto Tires & Repairs Date	03-30-16
Site	e Add	ress	GIC		e In 3:15 Time Out
Ow	ner/C	perat	or	esar Ortiz Phone (5	59)674.1515
		Inspe		Inspection Consolidation	Inspector MENDEZ, G. REHS
	Routi Othe	ne r)		FACILITY ID FACIO3688
				☐ Combined ☐ Integrated	Program Element 2208/7111
				obtaining photographs, review and copying of records, and determination of compliance	wher
					Page of
Ė	II	M	Code	II – Class II Violation M - Minor Violation HAZARDOUS MATERIAL REQUIREMENTS	COMMENTS / OBSERVATIONS
	Mes			ADMINISTRATION/DOCUMENTATION	
			HM01A	Owner/Operator failed to establish and implement a Hazardous Materials Business Plan (HMBP) when storing hazardous materials at or above the thresholds	ALL CORRECTIONS MANE BEEN MADE
			HM01B	quantities of 55 gallons/500 lbs/200 cubic feet. Owner/Operator failed to complete and/or submit a Hazardous Materials Business	
				Plan when storing hazardous materials at or above the thresholds quantities of 55 gallons/500 lbs/200 cubic feet.	
			HM02	Failure to complete and/or submit hazardous material inventory forms for all	
-			HM03	reportable hazardous materials on site. Failure to update hazardous material inventory within 30 days when one of the	
			CSS GD NOOR	following occurs: A) a 100 percent or more increase in the quantity of a previously	
				disclosed material, B) any handling of a previously undisclosed hazardous materials, C) a change of business address, business ownership, or business name.	
			HM06	Failure to submit a revised business plan upon a substantial change in handler's operation.	
			HM07	Failure to include in the HMBP adequate emergency response procedures for A) a	
				release or threatened release, B) the immediate notification to the CUPA and to appropriate local emergency rescue personnel, C) evacuation and immediate notice for the business site.	
			HM11	Failure to submit inventory reports - Activities, Owner/Operator, Hazardous	
				Materials Descriptions and Map pages, if required. Documentation must be resubmitted (for facilities which exceed EPCRA thresholds) or re-certified (for facilities which do not exceed EPCRA thresholds) annually.	
			HM13	Failure to review, revise, and recertify the business plan at least once every three years	
			HM15	Owner/Operator failed to complete and/or submit the Business Activities	
			HM16	Declaration and/or the Business Owner/Operator Identification page.	·
			HM20	Failure to complete and/or submit an annotated site map as required by the CUPA. Failure to notify the property owner in writing that the business is subject to the	· · · · · · · · · · · · · · · · · · ·
				business plan program and has complied with its provisions.	
			HM21	Failure to provide a copy of the business plan to the owner or the owner's agent within five working days after receiving a request for a copy from the owner or the owner's agent.	
			1,4,713	TRAINING	0
			HM10A	Failure to include an adequate training program in the business plan which is reasonable and appropriate for the size of the business and the nature of the hazardous material handled.	
			HM10B	Failure to include provisions in the business plan to ensure that appropriate personnel receive initial and annual training.	
5 62	T.		HM17	RELEASE/LEAKS/SPILLS Failure of business to report a release or threatened release of a hazardous	
			L	material to the CUPA and OES.	
			HM18	Failure to maintain storage area in a manner to prevent discharge to the environment.	
	1		Acadigman, processors	Sign in this box fo	r receipt of this report. Signature does
					ent with findings, only receipt of report.
• [Co ays	rrectivoy com	ve action appletion &	must be demonstrated with proof of compliance within 30 submission of the Return to Compliance Statement.	Ursiz (
				SHALL BE CORRECTED WITHIN DAYS.	Data 03-30-16



ENVIRONMENTAL HEA TH DIVISION & CERTIFIED UNIFIED PRO RAM AGENCY (CUPA) 200 W 4th STREET, SUI. _ 3100 & MADERA, CA 93637 & PHONE. _ 559) 675-7823

FAX: (559) 675-7919

FA 0103688

PE 2111/2208

Inspector Mendez 6

RETURN TO COMPLIANCE STATEMENT

Facility Name: Maclera Auto Tires	& Repairs	Š	
Facility Address: 610 N. E Street Ste.	112	City:	Madera
This Return To Compliance Statement must be re Health Department CUPA within 30 days of your compliance with each violation noted at your rece by proof of compliance (photos, copies of maniforiginal paperwork) where appropriate. [California	facility inspection ent facility inspection est/disposal rec	on, dem ction, ar ords or r	onstrate nd be accompanied receipts, or other
This office may conduct a re-inspection of your fac-	cility at any time	to deter	mine compliance.
In the matter of the Violation(s) identified in the fol	lowing Inspection	n Repoi	rt(s) dated: <u>02/29/1</u> 0
Hazardous Material Business Plan (HMBP)	Inspection Form	m	
Hazardous Waste Generator (HWG) Inspec	ction Form		
☐ Underground Storage Tank (UST) Inspection	on Form		
Aboveground Petroleum Storage Act (APSA	A) Inspection Fo	orm	
California Accidental Release Program (Ca	IARP) Inspectio	n Form	
☐ Notice of Violation (NOV)			
I certify under penalty of law that:			
 The violations noted on the Inspection Report cited above I have personally examined any attached documents and believe the information to be true, accurate and complete I am aware that there are significant penalties for submit violations noted. I am authorized to file this certification on behalf of the R 	d/or pictures submi e. ting false information	itted as pr	10.
Name (Print or Type)	Owner Position/Title		
Signature Ordz 6	07-70-	16	

Madera County Environmental Health Division

200 W. 4th Street, Suite 3100, Madera, CA 93637 (559) 675-7823

PERMIT TO OPERATE

Madera Auto Tires & Repairs

Mail to:

Madera Auto Tires & Repairs 610 N E St Ste 112 Madera, CA 93638

Facility Name:

Madera Auto Tires & Repairs 610 N E St Ste 112 Madera, CA 93638

Permit Expires: 12/31/2019

Cesar Ortiz

Permit Number - Authorized Description

PT0007932 Haz Waste Recycled <100 Kg/Mo. Valid From 1/1/2019 To 12/31/2019

By Authority of: Dexter Marr, Deputy Director Environmental Health Division

Permit is NOT TRANSFERABLE

Permit may be revoked or suspended for:

-non payments of fees

-violations of the California Health and Safety Codes

-imminent health hazards

THIS FORM MUST BE DISPLAYED CONSPICUOUSLY AT THE PERMITTED FACILITY
Obtain a copy of inspection results by calling MCEHD (559)675-7823

POO4.rpt

Amezcua, Sheryl

From: Public Records Coordinator < Public.RecordsCoordinator@valleyair.org >

Sent: Thursday, April 25, 2019 4:40 PM

To: Amezcua, Sheryl

Subject: Public Records Request C-2019-4-52; Commercial and Automotive Businesses

April 25, 2019

Sheryl Amezcua Partner Engineering & Science, Inc. 5451 North Gates Avenue #120 Fresno, CA 93722

SUBJECT: Public Records Request

LOCATION: 401-425 North E Street and 610 North E Street

Madera, CA 93638

Dear Sheryl Amezcua:

The District has processed your request for information regarding the above mentioned site address/location. A search of the District's databases has returned no records on file for this location.

If you have any questions, or need additional information, please contact me at the number below.

Respectfully,

Diseree Alvarez
Senior Office Assistant and
Public Records Coordinator
San Joaquin Valley Air Pollution Control District
1990 E. Gettysburg Ave
Fresno, CA. 93726
559.230.6003
Diseree.Alvarez@valleyair.org

Amezcua, Sheryl

From: Amezcua, Sheryl

Sent: Monday, April 15, 2019 9:39 AM

To: James Forga Cc: Amezcua, Sheryl

Subject: Public Records Request Fire Department

Good Morning,

To Whom It May Concern:

Partner Engineering and Science, Inc., is conducting an environmental site assessment of a property located in the City of Madera, California. As part of our project research, I would like to request to review any files pertaining to hazardous substance use, storage or releases, Activity Use Limitations (AULs), incidents or the presence of USTs and AULs on the subject property the fire department may have for the following property:

401-425 North E Street and 610 North E Street, Madera, CA 93638

Please contact me at (559) 999-4211 or at samezcua@partneresi.com with any pertinent information you have so that I may schedule a file review if necessary. The favor of your reply whether you have records or not is greatly appreciated at the previously mentioned email address. Please direct me to the appropriate person or station.

Thank you in advance for your assistance with this request. Sincerely,

Sheryl A. Amezcua Project Scientist

PARTNER ENGINEERING AND SCIENCE, INC.

Central Valley, California

Shuyl A America

(559) 999-4211

More Than Just Assessments. Solutions – For a complete list of services, <u>click here</u>

INSPECTOR'S COPY

PERMIT ENGINEERING DEPARTMENT CITY OF MADERA, CALIFORNIA

1630

APPLICANT IS PERMITTED TO DO THE WORK AS INDICATED BELOW BUILDING PLUMBING. ELECTRICAL LEGAL DESCRIPTION OF LOT PHONE 1. BUILDING SIZE BUILDING WIDTH SIZE GARAGE WIDT EST. VALUATION PLUMBING LAUNDRY TRAYS GAS WATER HEATERS LAVATORIES KITCHEN SINKS GAS SPACE HEATERS DISH WASHERS GAS FURNACES BATH TUBS GARBAGE DISPOSAL SHOWERS ELECTRICAL DESCRIPTION OF WORK NE house LELECTRIC RANGES CIRCUIT BREAKERS LIGHTS _TEMP. CIRCUITS RECTIFIERS RECEPTACLES SIGNS FIXTURES WALL SWITCHES ____ ELECTRIC WATER HEATERS TOTAL FEE BUILDING INSPECTOR.

1. BUILDING REMARKS - BUILDING DATE APPROVED TYPE OF SIGNATURE OF INSPECTION INSPECTOR FOUNDATION 5/2/56 FRAME LATHING (EXT.) LATHING (INT.) BOND BEAM FINAL 2. PLUMBING REMARKS -- PLUMBING TOP OUT FIXTURES 3. ELECTRICAL REMARKS - ELECTRICAL ROUGH WIRING METER LOOP 9 FIXTURES EQUIPMEN' FINAL

(1 of 2)

PARCEL: 007-054-008

Parcel 007-054-008

Description LOTS 4 TO 7 INCL BLK 16

Address 401 N E ST
City - Zip MADERA 93638

500 P

417

410

Zoom to

411 N G ST 409 N G ST

400 N GATEWAY DR

//


319 N G

SZO N GATEWAT UN

-120.062 36.965 Degrees

100ft




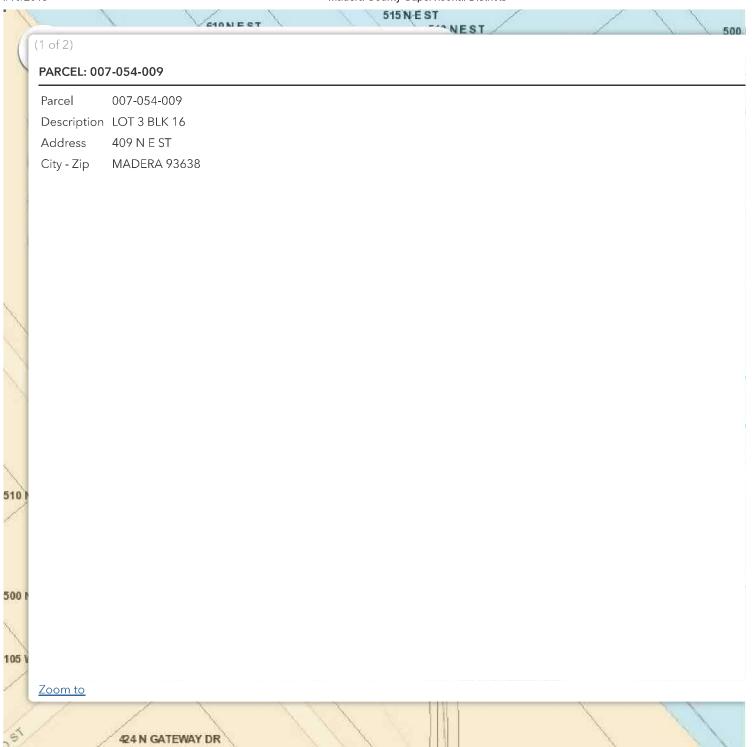

-120.062 36.965 Degrees





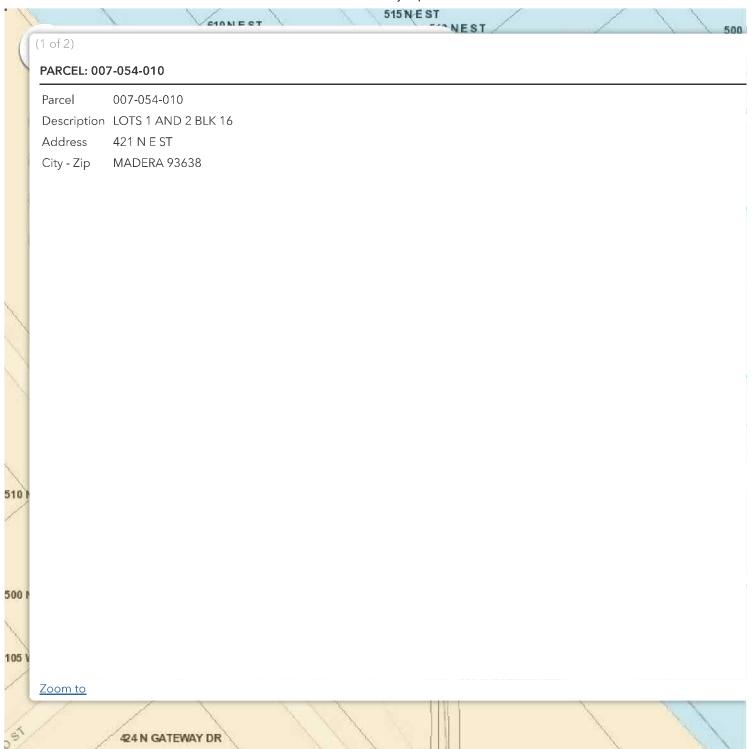

-120.063 36.965 Degrees

100ft



(1 of 2)

PARCEL: 007-042-001

Parcel 007-042-001

Description STRIP 50' WIDE ADJ E ST AND NE RR RW

Address 610 N E ST City - Zip MADERA 93638

Zoom to

625 N G ST 608 N GATEWAY DR

-120.065 36.967 Degrees

100ft



4/29/2019 **Enhanced Report**



Property Overview

401 N E ST, MADERA, CA 93638-

Page / Grid:

Owner and Geographic Information

BIBL

Primary Owner: Secondary Owner:

LA CASA DE MARIA FIRST MORTGAGE INVESTORS L P

Mail Address: 747 GARDEN ST , SANTA BARBARA, CA 93101-1505

Site Address: 401 N E ST , MADERA, CA 93638-3281 APN: 007-054-008-000 Lot Number:

Housing Tract Number:

Legal Description: Block: 16

Legal Brief Description: BLK:16 LOTS 4 TO 7 INCL BLK 16

Property Details



5,370 0 Year Built: Bedrooms: 1977 Square Feet:

Bathrooms: 0 Lot Size: Garage: Attached 13

Total Rooms: Fireplace: Number of Units:

Zoning: Pool: Use Code: Auto repair (& related), Gara

Sale Information



Transfer Date: 06/20/2008 Seller: GODOY, ROSA E Transfer Value: \$1,684,049.00 Document#: 2008021298

Cost/Sq Feet:

Assessment and Taxes



Assessed Value: \$237,208.00 Percent Improvement: 54.09% **Homeowner Exemption:** Land Value: \$108,904.00 Tax Amount: \$2,764.28 2-040 Tax Rate Area:

Improvement Value: \$128,304.00 Tax Status: Current Tax Account ID: Market Land Value: Market Value: Market Improvement Value:

4/29/2019 **Enhanced Report**



Property Overview

409 N E ST, MADERA, CA 93638-

Owner and Geographic Information

BIBL

Primary Owner: Secondary Owner:

LA CASA DE MARIA FIRST MTG INVESTORS LP

Mail Address: 747 GARDEN ST , SANTA BARBARA, CA 93101-1505

Site Address: 409 N E ST , MADERA, CA 93638-3247

APN: 007-054-009-000 Lot Number: Page / Grid:

Housing Tract Number:

Legal Description: Lot Code: 3 Block: 16

Legal Brief Description: LOT:3 BLK:16 LOT 3 BLK 16

Property Details



0 2,400 Bedrooms: Year Built: 1977 Square Feet: 0 Lot Size: Bathrooms: Garage:

Total Rooms: Fireplace: **Number of Units:** 0

Zoning: Pool: Use Code: Retail Stores (Personal Services, Photog Travel)

Sale Information



Transfer Date: 09/29/2008 Seller: GODOY, ROSA A; GODOY, ROSA ELENA

ansfer Value: \$0.00 Document#: 2008034951

Cost/Sq Feet:

Assessment and Taxes



Assessed Value: \$219,625.00 Percent Improvement: 73,50% Homeowner

Exemption:

Land Value: \$58,195.00 Tax Amount: \$2,486.42 Tax Rate Area: 2-040 Improvement Value: \$161,430.00 Tax Status: Tax Account ID:

Market Improvement Value: **Market Land Value:** Market Value:



Property Overview

421 N E ST, MADERA, CA 93638-

Owner and Geographic Information

BIBL

Primary Owner: Secondary Owner:

LA CASA DE MARIA FIRST MTG INVESTORS LP

Mail Address: 747 GARDEN ST , SANTA BARBARA, CA 93101-1505

Site Address: 421 N E ST, MADERA, CA 93638-3247 007-054-010-000 Page / Grid: Lot Number:

Housing Tract Number:

Legal Description: Block: 16

Legal Brief Description: BLK:16 LOTS 1 AND 2 BLK 16

Property Details



0 Bedrooms:

Year Built:

1987 Square Feet: Lot Size:

5,160

Total Rooms:

Garage: Fireplace:

Number of Units:

Zoning:

Pool:

Seller:

Use Code:

Office Bldg (General)

Sale Information



Transfer Date:

09/29/2008

Document#:

GODOY, ROSA A; GODOY, ROSA ELENA

2008034951

Cost/Sq Feet:

Assessment and Taxes

\$295,545.00

\$0.00

0

Percent Improvement:

60.58%

Homeowner Exemption:

Assessed Value: Land Value:

\$116,505.00 \$179,040.00

Tax Amount: Tax Status:

\$3,363.58 Current

Tax Rate Area: Tax Account ID: 2-040

Market Improvement Value:

Improvement Value:

Market Land Value:

Market Value:

LIMITATIONS OF LIABILITY

THIS REPORT IS LIMITED IN SCOPE. IT IS NOT A COMMITMENT, ABSTRACT OF TITLE, TITLE OPINION, CERTIFICATE OF TITLE OR PRELIMINARY TITLE REPORT, NOR IS IT A REPRESENTATION OF THE STATUS OF TITLE, AND ITS ACCURACY IS NOT INSURED, WHILE THIS INFORMATION IS BELIEVED TO BE CORRECT, THE COMPANY MAKES NO REPRESENTATIONS AS TO ITS ACCURACY, DISCLAIMS ANY WARRANTIES AS TO THE REPORT, ASSUMES NO DUTIES TO YOU OR ANY THIRD PARTY, DOES NOT INTEND FOR YOU OR ANY THIRD PARTY TO RELY ON THE REPORT, AND ASSUMES NO LIABILITY FOR ANY LOSS OCCURRING BY REASON OF RELIANCE ON THIS REPORT OR OTHERWISE. IN PROVIDING THIS REPORT, THE COMPANY IS NOT ACTING AS AN ABSTRACTOR OF TITLE. IF IT IS DESIRED THAT LIABILITY BE ASSUMED BY THE COMPANY, YOU MAY REQUEST AND PURCHASE A POLICY OF TITLE. CUSTOMER RECOGNIZES THAT THE FEE CHARGED IS NOMINAL IN RELATION TO THE POTENTIAL LIABILITY WHICH COLLD ARTSE FROM SUCH ERRORS, OMISSIONS OR NEGLIGENCE. THEREFORE, CUSTOMER UNDERSTANDS THAT THE COMPANY IS NOT WILLING TO PROCEED IN THE PREPARATION AND ISSUANCE OF THE REPORT, THAT THE COMPANY AND ITS AGENTS, SUBSIDIARIES, AFFILIATES, EMPLOYEES AND SUBCONTRACTORS OR AGENTS AND SUBSIDIARIES, AFFILIATES, EMPLOYEES AND SUBCONTRACTORS SHALL NOT IN ANY EVENT EXCEED THE COMPANY'S TOTAL FEE FOR THE REPORT. IN NO EVENT WILL THE COMPANY, ITS SUBSIDIARIES, AFFILIATES, EMPLOYEES, SUSCIONTRACTORS OR AGENTS SE LIABILE FOR CONSEQUENTIAL, INCIDENTAL, DIRECT, INDIFFCT, PUNITIVE, EXEMPLARY OR SPECIAL DAMAGES REGARDLESS OF WHETHER SUCH LIABILITY IS REACH OF CONTRACT, TORT, NEGLIGENCE OF THE COMPANY, STRICT LIABILITY, BREACH OF WARRANTIES, FAILURE OF ESSENTIAL PURPOSE, OR OTHERWISE. ESSENTIAL PURPOSE, OR OTHERWISE.

This property profile is being provided as a general service to the community at large without the condition of the referral of title insurance business.

4/29/2019 **Enhanced Report**



Property Overview

610 N E ST, MADERA, CA 93638-

Owner and Geographic Information

BIBL

Primary Owner: Secondary Owner:

610 NORTH E STREET MADERA INVESTORS L P

Mail Address: 747 GARDEN ST , SANTA BARBARA, CA 93101-1505

Site Address: 610~N E ST , MADERA, CA 93638-3100007-042-001-000 Lot Number: Page / Grid:

Housing Tract Number:

Legal Description: Legal Brief Description: STRIP 50' WIDE ADJ E ST AND NE RR RW

Property Details



0 1977 Bedrooms: Year Built: Square Feet: 14,400

0 Lot Size: **Bathrooms:** Garage:

Total Rooms: Fireplace: **Number of Units:** 0

Zoning: Pool: Use Code: Warehouse (Industrial)

Sale Information



Transfer Date: 12/19/2008 Seller: CALIFORNIA NATIONAL BANK, ; JOHN CARTER IRA,

ransfer Value: \$0.00 Document#: 2008042878

Cost/Sq Feet:

Assessment and Taxes



Assessed Value: \$565,878.00 Percent Improvement: 68.00% **Homeowner Exemption:**

\$181,078.00 Land Value: Tax Amount: \$6,432.26 Tax Rate Area: 2-040

Improvement Value: \$384,800.00 Tax Status: Current Tax Account ID: Market Value: Market Improvement Value: Market Land Value:

ENVIRONMENTAL SITE ASSESSMENT QUESTIONNAIRE

Please complete to the best of your knowledge. For those questions that are not applicable, please respond with an "N/A". For those questions that are unknown, please respond with "unknown".

1	PROPERTY	INFORMATION:
1.	INUTERII	INTURIMATION.

Property Name:								
Property Address: 401-425 and	610 North E Stree	et						
City Madera		State CA		Zip9363	8			
	-054-009, 007-054-010,			1				
Property Owner &	Contact Information: C	arl Lindros 805-966-1	1793					
Date Property Ow 6/2008	ner Purchased:							
Key Site Manager	& Contact Information: @mortgage-co.com							
2. COMPLE								
,	uSigned by:		T					
\ <u>-</u>	l lindros		Date 4/18	3/2019				
Designate of Marine	10984699B24C1 Arl Lindros		Relation to Si	ubject Proper	ty Current	Owner/S	eller	
3. Previou	US INVESTIGATIONS							
II Subsurfa	us environmental in ice Investigation	ns, Remedia	ition, A	sbestos	or	Lead-	-Based	Paint
copies)					(If	yes,	please	provide
4. Proper	TY DESCRIPTION							
Property Size:	1.83 Acres	Numb	er of Buildin	ng(s):	4			
Size of Building	(s):36,333 sf							
Date of Constru	ction:1977							
Property Type: (Commercial/Industri	al						
Other:								
Please provide F	Rent Roll if Applicab	le.						
Historical Use o	f Property:l	eased to warehou	se tenants					
7 C	unnia Doonenau II							



5. SURROUNDING PROPERTY USES

PARTNER

DIRECTION	USE			
North	SINGLE FAMILY HOMES			
South	COMMERCIAL WAREHOUSE			
East	COMMERCIAL WAREHOUSE			
West	COMMERCIAL WAREHOUSE			
If yes, please	e of any potential environmental conce YES describe:	XNO		
6. Utili	TIES & SERVICES			
Please provide	e the name of the utility or contractor	providing the following:		
Electric	PGE	Bio-hazardous Waste	N/A	
Gas	PGE	Elevator Maintenance	N/A	
Potable	Water <u>City of Madera</u>	Used Grease	N/A	
Sanitary	Sewer City of Madera	Hazardous Waste	N/A	
7. On Si	7. On Site Operations			
Are you awar	re of any of the following conditions	s, either past or present, on the	e property?	

Are you aware of any of the following conditions, either past or present, on the property?				
Condition	Response	If yes, please describe		
1. Stored Chemicals	□ Yes 🛛 No			
2. Underground Storage Tanks	□ Yes 🔀 No			
3. Aboveground Storage Tanks	X Yes □ No	Only above ground approved metal drums		
4. Spills or Releases	☐ Yes X No			
5. Dump Areas/Landfills	□ Yes ¥ No			
6. Waste Treatment Systems	□ Yes 🛛 No			
7. Clarifiers/Separators	☐ Yes X No			
8. Vents/Odors	☐ Yes 🛛 No			
9. Floor Drains/Sumps	□ Yes ¬No			
10. Stained Soil	□ Yes 🗓 No			
11. Electrical Transformers	☐ Yes X No			
12. Hydraulic Lifts/Elevators	□ Yes ≯No			
13. Dry Cleaning Operations	□ Yes × No			
14. Oil/Gas/Water/Monitoring Wells	□ Yes ^X No			
15. Environmental Permits	□ Yes 🔀 No			





PROPERTY ADDRESS:

PHASE I ENVIRONMENTAL SITE ASSESSMENT QUESTIONNAIRE

The following questionnaire is required by the ASTM Standard E 1527-13, which adheres to the All Appropriate Inquiries (AAI) Rule (United States Environmental Protection Agency) (40 CFR 312).

As defined by ASTM, the User of the report is the "party seeking to use Practice E 1527 to complete an environmental site assessment of the property. A user may include, without limitation, a potential purchaser of property, a potential tenant of property, an owner of property, a lender, or a property manager. The user has specific obligations for completing a successful application of this practice."

401-425 and 610 North E Street

C C 7	
PERTY CITY, STATE ZIP:	Madera, CA 93638
Did a search of recorded land title re	recorded against the property (40 CFR 312.25) cords (or judicial records) identify any environmental erty under federal, tribal, state or local law?
Filed or records against the property Did a search of recorded land title re- engineering controls, land use restrict property and/or have been filed or recorded.	that are in place on the property or that have been (40 CFR 312.26(a)(1)(v) and (vi)) cords (or judicial records) identify any AULs, such as tions or institutional controls that are in place at the orded against the property under federal, tribal, state or
CFR 312.28) Do you have any specialized knowled properties? For example, are you involvement occupants of the property or an	te of the person seeking to qualify for the LLP (40 edge or experience related to the property or nearby volved in the same line of business as the current or adjoining property so that you would have specialized sses used by this type of business?
	Did a search of recorded land title receives filed or recorded against the property NO Activity and use limitations (AULs) filed or records against the property Did a search of recorded land title receives engineering controls, land use restrict property and/or have been filed or recorded law? YES NO Specialized knowledge or experience CFR 312.28) Do you have any specialized knowledge or experience for you have any specialized knowledge of the chemicals and proceives.





4.	Relationship of the purchase price to the fair market value of the property if it were not contaminated (40 CFR 312.29) Does the purchase price being paid for this property reasonably reflect the fair market value of the property? If you conclude that there is a difference, have you considered whether the lower purchase price is because contamination is known or believed to be present at the property? YES NO
5.	Commonly known or reasonably ascertainable information about the Property (40 CFR
	Are you aware of commonly known or reasonably ascertainable information about the property that would help the environmental professional to identify conditions indicative of releases or threatened releases? YES NO
	a. Do you know the past uses of the property? ✓ YES NO
	general warehouse use and light auto repair.
	b. Do you know of specific chemicals that are present or once were present at the property?
	YES NO Antifreeze and moderate Oil in regulated above ground holding drums.
	c. Do you know of spills or other chemical releases that have taken place at the property? YES NO
	d. Do you know of any environmental cleanups that have taken place at the property?
	YES NO
	 e. Do you have any prior knowledge that the property was developed as a gas station, dry cleaner, manufacturing/industrial facility in the past? YES NO
	f. Are you aware of historical use of hazardous materials or petroleum products used or present on the property? YES NO





 g. Do you know if the property is currently or was formerly equipped with undergroun storage tanks (USTs) or septic tanks? YES NO
h. Do you know of any past, threatened or pending lawsuits or administrative proceeding concerning a release or threatened release of any hazardous substance or petroleur products involving the property by any owner or occupant of the property? YES NO
6. The degree of obviousness of the presence or likely presence of contamination at the property, and the ability to detect the contamination by appropriate investigation (4 CFR 312.31) Based on your knowledge and experience related to the property are there any obvious indicators that point to the presence or likely presence of releases at the property? YES NO
Carl Lindres
Signature of User/Person Interviewed:
Name of User/Person Interviewed: Carl Lindros
Title/Relationship to Property: Current owner/Seller
Phone Number/Email: (805) 966-1793 / carl@mortgage-co.com
Date:
Contact for additional information:
Name:
Relationship to Property:
Phone Number/Email:





VALUE ADD INVESTMENT: 36,333 SF OF WAREHOUSE BUILDINGS

401-610 North E St, Madera, CA 93638





SALE PRICE:	\$1,695,000		
PRICE/SF:	\$46.65/SF		
GROSS INCOME:	\$205,637		
CAP RATE:	7.38%		
NOI:	\$125,055		
STABILIZED GROSS INCOME:	\$235,960		
STABILIZED CAP RATE:	9.17%		
LOT SIZE:	1.83 Acres		
BUILDING SIZE:	36,333 SF		
GRADE LEVEL DOORS	31		
CEILING HEIGHT:	20.0 FT		
ZONING:	Commercial Service		
ZUNING.			
MARKET:	Central Madera		
	Central Madera E Central Avenue		

PROPERTY FEATURES

- TEEN Cash-on-Cash Returns After Stabilized
- Investment Opportunity: Leased Industrial Buildings
- Long-Term Tenants | Low Turnover | Low Maintenance
- ±36,333 SF On ±1.83 Acres w/ Ample Yard Area
- Cash Cow To Produce \$236K In Rents (\$6.49/SF/Yr)
- Metal Construction Well Maintained Buildings
- Long Term Tenants w/ Upside Potential Via Leasing
- Easy Access from Surrounding Major Corridors
- Functional Warehouse Spaces | East To Rent
- Requires Little Management or Maintenance (Metal Buildings)
- Easy Access to Highway 99 On/Off Ramps
- Excellent Existing Signage On 3 City Street Corners
- Shop with Roll Up Doors + Fully Improved Yard Area
- Ample Parking, Quality Tenants, & Great Exposure
- Building Equipped w/ Evaporative Coolers & Heaters

KW COMMERCIAL

559.302.8698



JARED ENNIS

Senior Commercial Associate 0: 559.302.8698 C: 559.302.8698 jaredennis@kw.com CA DRE# #01945284

KEVIN LAND

Commercial Director 0: 559.359.4035 C: 559.359.4035 kevin.land@kw.com CA DRE# #01516541



VALUE ADD INVESTMENT: 36,333 SF OF WAREHOUSE BUILDINGS

401-610 North E St, Madera, CA 93638



PROPERTY OVERVIEW

Bank owned opportunity: ±36,333 SF commercial service multi-tenant complex on 1.83 Acres (79,606 SF) between Fresno and Merced in Madera, CA. Cash-cow producing \$205K/year in rents with great upside potential to produce \$236K/year via leasing vacancies and extending leases. Unique leased investment offering easy-to-rent warehouse spaces within an under-built market offering a strong need for these type of spaces. Once stabilized, the deal offers TEEN cash-on-cash returns when leveraged. Great visibility, convenient parking & easy access to CA-99 on/off ramps. Many front parking spaces available and excellent existing corner signage. Breakdown is 21,910 SF at 401-425 N "E" Street offering (9) units with (17) rollup doors, and 14,423 SF offering (7) units with (14) rollup doors at 610 N "E" Street.

Offers (18) economical separate spaces leased to (16) long-term tenants on AIR Industrial Gross leases. (4) tenants are at market rents w/ 6 months to 4 years of term. The value-add opportunity consists of leasing the (7) vacancies totaling 16,683 SF, extending (2) existing MTM tenants on market lease rates, and stabilizing the (3) MTM tenants on longer lease terms up to market rents. Suites offer multiple configurations ranging from 980 SF up to 6,000 SF with an average of 2,270 SF units. Spaces are setup to have a office/showroom, shop, and fenced yard area. Spaces equipped w/ample power, roll up doors, restrooms, sky lights, air vents, evap coolers, heaters, security, separate meters, and have the ability to be combined.



Located just SW of N "E" St between Central & E 3rd. Madera is the county seat with the city and county population at 65,508 and 156,890, respectively. Located in the San Joaquin Valley, Madera is the principal city of the Madera-Chowchilla Metropolitan Area, which encompasses all of Madera County, and Fresno. Within the city, CA-99 carries traffic in a north/south orientation. East of the city, CA-41 can be accessed via county roads, or via CA-145. Near the Madera Amtrak station as well as a planned California High-Speed Rail stop.







KW COMMERCIAL 559.302.8698



JARED ENNIS

Senior Commercial Associate 0: 559.302.8698 C: 559.302.8698 jaredennis@kw.com CA DRE# #01945284

KEVIN LAND

Commercial Director 0: 559.359.4035 C: 559.359.4035 kevin.land@kw.com CA DRE# #01516541



VALUE ADD INVESTMENT: 36,333 SF OF WAREHOUSE BUILDINGS

401-610 North E St, Madera, CA 93638







KW COMMERCIAL 559.302.8698



JARED ENNIS

Senior Commercial Associate 0: 559.302.8698 C: 559.302.8698 jaredennis@kw.com CA DRE# #01945284

KEVIN LAND

Commercial Director 0: 559.359.4035 C: 559.359.4035 kevin.land@kw.com CA DRE# #01516541



VALUE ADD INVESTMENT: 36,333 SF OF WAREHOUSE BUILDINGS

401-610 North E St, Madera, CA 93638















KW COMMERCIAL 559.302.8698



JARED ENNIS

Senior Commercial Associate 0: 559.302.8698 C: 559.302.8698 jaredennis@kw.com CA DRE# #01945284

KEVIN LAND

Commercial Director 0: 559.359.4035 C: 559.359.4035 kevin.land@kw.com CA DRE# #01516541



VALUE ADD INVESTMENT: 36,333 SF OF WAREHOUSE BUILDINGS



401-610 North E St, Madera, CA 93638

TENANT NAME	UNIT NUMBER	UNIT SIZE (SF)	LEASE START	LEASE END	MARKET RENT	ANNUAL RENT	% OF Building
Christian Electronic Recyclers	401 #118	1,530	5/1/2017	4/30/2020	\$11,016	\$10,373	4.21
Herrera Smog Shop	401 #A	1,350	2/1/2011	9/30/2019	\$12,960	\$12,960	3.72
(Available)	401 #B	1,230			\$10,800	\$10,800	3.39
Galvan's Electrical and Auto Repair	401 #C-S	1,919	11/1/2015	9/30/2019	\$19,200	\$19,209	5.28
Adrian's Auto Body	401 #E	2,176	11/1/2012		\$14,361	\$10,200	5.99
(Available)	401 #F	6,000			\$35,280	\$35,280	16.51
Sinai Auto Repair	401 #N	2,350	11/1/2015		\$15,510	\$10,810	6.47
Ricardo Velazquez	401 #P	2,350	10/1/2018	11/30/2023	\$15,510	\$13,207	6.47
Andy's Transmission Shop	401 #425 & 116	3,005	11/1/2015	3/31/2020	\$19,800	\$19,803	8.27
(Available)	610 #100	3,038			\$16,405	\$16,405	8.36
Madera Rocks	610 #102	2,940			\$15,876	\$10,800	8.09
Madera Pool and Spa	610 #104	980			\$6,000	\$6,000	2.7
(Available)	610 #106	1,960			\$11,760	\$5,400	5.39
(Available)	610 #108	1,960			\$11,760	\$5,400	5.39
(Available)	610 #110	965			\$5,790	\$5,790	2.66
Madera Auto Tires & Repair	610 #112	2,580			\$13,932	\$13,200	7.1
TOTALS/AVERAGES		36,333			\$235,960	\$205,637	

Under "Documents", click to view Lease Agreements here: https://www.centralcacommercial.com/available/?propertyId=ValueAddMadera

KW COMMERCIAL 559.302.8698



JARED ENNIS

Senior Commercial Associate 0: 559.302.8698 C: 559.302.8698 jaredennis@kw.com CA DRE# #01945284

KEVIN LAND

Commercial Director O: 559.359.4035 C: 559.359.4035 kevin.land@kw.com CA DRE# #01516541



VALUE ADD INVESTMENT: 36,333 SF OF WAREHOUSE BUILDINGS



401-610 North E St, Madera, CA 93638

INCOME SUMMARY	2019 ACTUAL (EXISTING RENTS + VACANCIES)	PER SF
401-425 North E St - Existing	\$142,620	\$3.93
610 North E St - Existing	\$63,017	\$1.73
GROSS INCOME	\$205,637	\$5.66
EXPENSE SUMMARY	2019 ACTUAL (EXISTING RENTS + VACANCIES)	PER SF
Vacancy & Capital Reserves (7&)	\$14,394	\$0.40
Property Management (5%)	\$7,200	\$0.20
Taxes - 401-425 North E St	\$12,633	\$0.35
Taxes - 610 North E St	\$6,063	\$0.17
Insurance - 401-425 and 610 North E St	\$14,391	\$0.40
Landscaping - 401-425 North E St	\$2,500	\$0.07
Landscaping - 610 North E St	\$0	\$0.00
Water/Trash - 401-425 North E St	\$4,500	\$0.12
Electricity/Gas - 401-425 North E St	\$0	\$0.00
GROSS EXPENSES	\$80,582	\$2.22
NET OPERATING INCOME	\$125,055	\$3.44

KW COMMERCIAL 559.302.8698



JARED ENNIS

Senior Commercial Associate
0: 559.302.8698
C: 559.302.8698
jaredennis@kw.com
CA DRE# #01945284

KEVIN LAND

Commercial Director 0: 559.359.4035 C: 559.359.4035 kevin.land@kw.com CA DRE# #01516541



INDUSTRIAL FOR SALE

VALUE ADD INVESTMENT: 36,333 SF OF WAREHOUSE BUILDINGS



401-610 North E St, Madera, CA 93638

INVESTMENT OVERVIEW	2019 ACTUAL (EXISTING RENTS + VACANCIES)	
Price	\$1,695,000	
Price per SF	\$46.65	
CAP Rate	7.4%	
Proposed Loan Cash-on-Cash Return (yr 1)	7.4 %	
Proposed Loan Total Return (yr 1)	\$55,744	
Proposed Loan Debt Coverage Ratio	1.33	

OPERATING DATA	2019 ACTUAL (EXISTING RENTS + VACANCIES)	
Gross Scheduled Income	\$205,637	
Vacancy Cost (10%)	\$0	
Gross Income	\$205,637	
Operating Expenses	\$80,582	
Net Operating Income	\$125,055	
Proposed Loan Pre-Tax Cash Flow	\$31,376	

FINANCING DATA	2019 ACTUAL (EXISTING RENTS + VACANCIES)	
Proposed Loan Down Payment	\$423,750	
Proposed Loan Amount	\$1,271,250	
Proposed Loan Debt Service	\$93,679	
Proposed Loan Debt Service Monthly	\$7,806	
Proposed Loan Principal Reduction (yr 1)	\$24,368	

KW COMMERCIAL 559.302.8698



JARED ENNIS

Senior Commercial Associate
0: 559.302.8698
C: 559.302.8698
jaredennis@kw.com
CA DRE# #01945284

KEVIN LAND

Commercial Director 0: 559.359.4035 C: 559.359.4035 kevin.land@kw.com CA DRE# #01516541





INDUSTRIAL FOR SALE

VALUE ADD INVESTMENT: 36,333 SF OF WAREHOUSE BUILDINGS

401-610 North E St, Madera, CA 93638



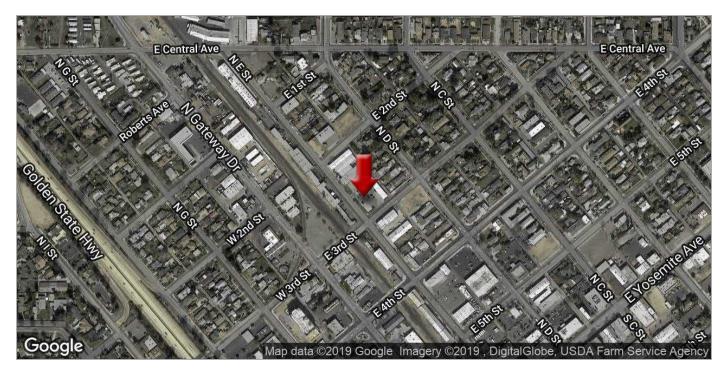

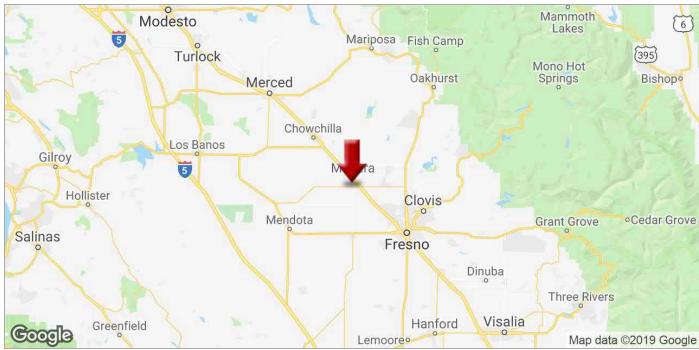

KW COMMERCIAL 559.302.8698



JARED ENNIS

Senior Commercial Associate 0: 559.302.8698 C: 559.302.8698 jaredennis@kw.com CA DRE# #01945284

KEVIN LAND

Commercial Director 0: 559.359.4035 C: 559.359.4035 kevin.land@kw.com CA DRE# #01516541




We obtained the information above from sources we believe to be reliable. However, we have not verified its accuracy and make no guarantee, warranty or representation about it. It is submitted subject to the possibility of errors, omissions, change of price, rental or other conditions, prior sale, lease or financing, or withdrawal without notice. We include projections, opinions, assumptions or estimates for example only, and they may not represent current or future performance of the property. You and your tax and legal advisors should conduct your own investigation of the property and transaction.

INDUSTRIAL FOR SALE

VALUE ADD INVESTMENT: 36,333 SF OF WAREHOUSE BUILDINGS



401-610 North E St, Madera, CA 93638

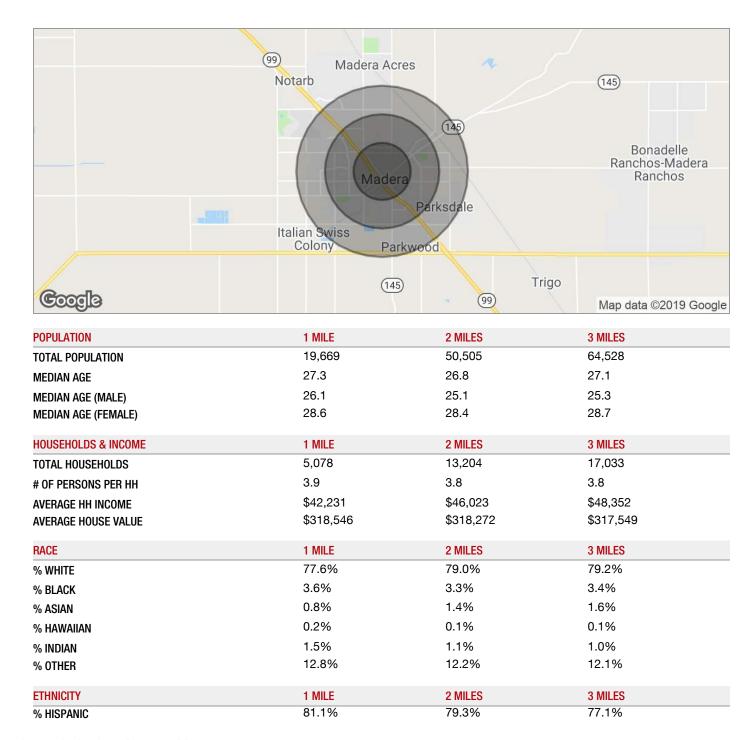

^{*} Demographic data derived from 2010 US Census

KW COMMERCIAL 559.302.8698



JARED ENNIS

Senior Commercial Associate 0: 559.302.8698 C: 559.302.8698 jaredennis@kw.com CA DRE# #01945284

KEVIN LAND

Commercial Director 0: 559.359.4035 C: 559.359.4035 kevin.land@kw.com CA DRE# #01516541



We obtained the information above from sources we believe to be reliable. However, we have not verified its accuracy and make no guarantee, warranty or representation about it. It is submitted subject to the possibility of errors, omissions, change of price, rental or other conditions, prior sale, lease or financing, or withdrawal without notice. We include projections, opinions, assumptions or estimates for example only, and they may not represent current or future performance of the property. You and your tax and legal advisors should conduct your own investigation of the property and transaction.


Each Office Independently Owned and Operated CentralCaCommercial.com

National Flood Hazard Layer FIRMette



Legend

SEE FIS REPORT FOR DETAILED LEGEND AND INDEX MAP FOR FIRM PANEL LAYOUT

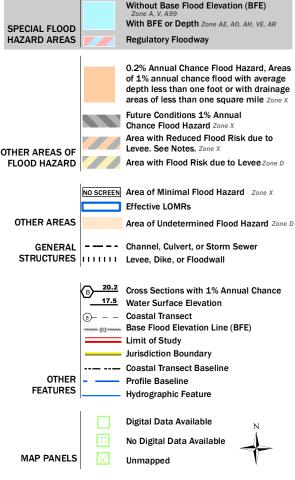

The pin displayed on the map is an approximate point selected by the user and does not represent an authoritative property location.

This map complies with FEMA's standards for the use of digital flood maps if it is not void as described below. The basemap shown complies with FEMA's basemap accuracy standards


The flood hazard information is derived directly from the authoritative NFHL web services provided by FEMA. This map was exported on 4/29/2019 at 5:17:12 PM and does not reflect changes or amendments subsequent to this date and time. The NFHL and effective information may change or become superseded by new data over time.

This map image is void if the one or more of the following map elements do not appear: basemap imagery, flood zone labels, legend, scale bar, map creation date, community identifiers, FIRM panel number, and FIRM effective date. Map images for unmapped and unmodernized areas cannot be used for regulatory purposes.



U.S. Fish and Wildlife Service National Wetlands Inventory

Wetlands

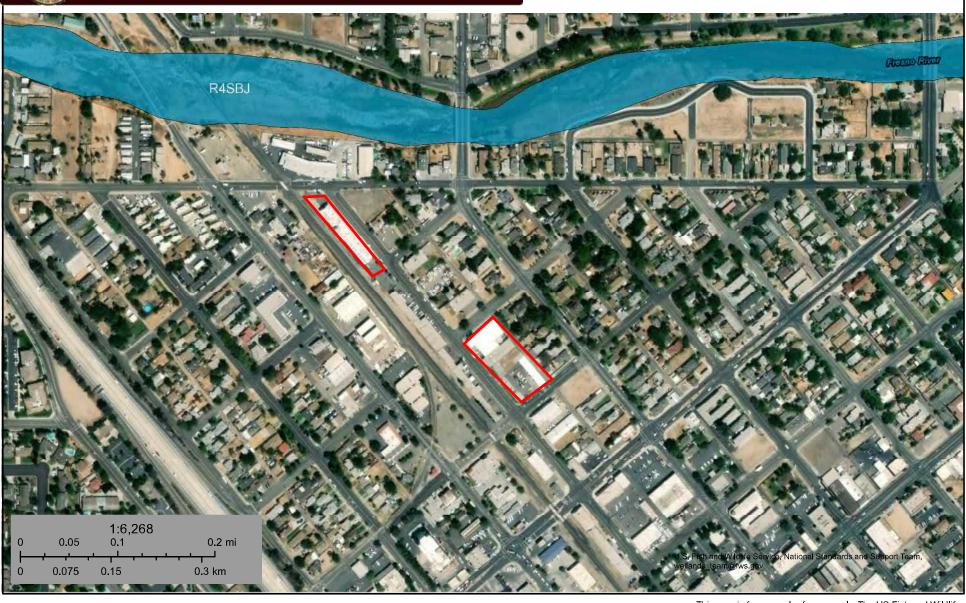

May 2, 2019

Wetlands

Estuarine and Marine Deepwater

Estuarine and Marine Wetland

Freshwater Emergent Wetland

Freshwater Forested/Shrub Wetland

Freshwater Pond

Lake

Lake

Other

Riverine

This map is for general reference only. The US Fish and Wildlife Service is not responsible for the accuracy or currentness of the base data shown on this map. All wetlands related data should be used in accordance with the layer metadata found on the Wetlands Mapper web site.

APPENDIX C: REGULATORY DATABASE REPORT



Madera Industrial Warehouse Buildings 401-425 & 610 North E Street MADERA, CA 93638

Inquiry Number: 5620993.2s

April 15, 2019

The EDR Radius Map™ Report with GeoCheck®



TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map.	2
Detail Map.	
Map Findings Summary	 4
Map Findings.	8
Orphan Summary.	376
Government Records Searched/Data Currency Tracking.	GR-1
GEOCHECK ADDENDUM	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map.	A-9
Physical Setting Source Map Findings	A-11
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2019 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-13), the ASTM Standard Practice for Environmental Site Assessments for Forestland or Rural Property (E 2247-16), the ASTM Standard Practice for Limited Environmental Due Diligence: Transaction Screen Process (E 1528-14) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

401-425 & 610 NORTH E STREET MADERA, CA 93638

COORDINATES

Latitude (North): 36.9653170 - 36° 57' 55.14" Longitude (West): 120.0627530 - 120° 3' 45.91"

Universal Tranverse Mercator: Zone 10 UTM X (Meters): 761501.7 UTM Y (Meters): 4094854.5

Elevation: 273 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map: 5602514 MADERA, CA

Version Date: 2012

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from: 20140627 Source: USDA

MAPPED SITES SUMMARY

Target Property Address: 401-425 & 610 NORTH E STREET MADERA, CA 93638

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
A1	MADERA AUTO TIRES &	610 N E ST STE 112	CERS HAZ WASTE, CUPA Listings, CERS		TP
A2	MADERA AUTO TIRES &	610 N E ST STE 112	FINDS, ECHO		TP
A3	SCHOETTLER TIRE INC.	401 NORTH E	RGA LF		TP
A4	ANDY'S TRANSMISSION	425 N E ST	FINDS, ECHO		TP
A5	ANDY'S TRANSMISSION	425 N E ST	CERS HAZ WASTE, CERS		TP
A6	ANDY'S TRANSMISSION	425 E	CUPA Listings		TP
A7	SINAI AUTO REPAIR	401 N E ST STE N	CERS HAZ WASTE, CERS	Lower	1 ft.
A8	MARTINS ELECTRICAL&A	401 N E ST STE C	CERS HAZ WASTE, CERS	Lower	1 ft.
A9	D & F BODY & PAINT	401 N E ST	CERS HAZ WASTE, CERS	Lower	1 ft.
A10	CASEY'S DISCOUNT AUT	508 N "E" ST	CERS HAZ WASTE, CERS	Higher	20, 0.004, WNW
B11	AUTO SERVICE LABS	520 N E ST	CERS HAZ WASTE, CERS	Higher	34, 0.006, WNW
A12	SAN JOAQUIN PEST CON	416 NORTH E STREET	HIST UST	Lower	72, 0.014, SW
A13	SAN JOAQUIN PEST CON	416 N E ST	HIST UST	Lower	72, 0.014, SW
B14	MULLER IRRIGATION, I	525 N E ST	HIST UST	Higher	77, 0.015, NW
B15	MULLER IRRIGATION IN	525 NO E ST	HIST UST	Higher	77, 0.015, NW
C16	HEARTLAND OPPORTUNIT	323 N E ST	RCRA-SQG, FINDS, ECHO, HAZNET	Lower	121, 0.023, SE
17	MADERA GLASS & BODY	105 E CENTRAL	CERS HAZ WASTE, CUPA Listings	Higher	129, 0.024, NW
D18	MC GEE W A	625 N GATEWAY DR	EDR Hist Auto	Higher	209, 0.040, WNW
D19	GL PEREZ INC	625 N GATEWAY DR	SWRCY	Higher	209, 0.040, WNW
C20	BARAJAS BODY SHOP	314 N E	CERS HAZ WASTE, CERS	Lower	219, 0.041, SSE
21	VANS STUDIO	600 N D ST	RCRA-SQG, FINDS, ECHO, HAZNET	Higher	327, 0.062, NNW
D22	FEARLESS AUTO AND OF	624 N GATEWAY DR	CERS HAZ WASTE, CERS	Higher	339, 0.064, WNW
C23	MADERA TRANSPORTATIO	305 NORTH E STREET	Cortese, CUPA Listings	Lower	348, 0.066, SE
C24	MADERA COB INC	305 NORTH E	HIST UST	Lower	348, 0.066, SE
C25	MADERA TRANSPORTATIO	305 N E ST	SWEEPS UST, HIST UST	Lower	348, 0.066, SE
E26	YOUNG ROBERT E	421 NO GATEWAY DR	EDR Hist Auto	Higher	380, 0.072, SW
E27	HARMIN'S LIQUOR & GA	500 GATEWAY DR N	LUST, HIST CORTESE	Higher	391, 0.074, WSW
28	MADERA TRANSPORTATIO	305 E ST N	LUST, HIST CORTESE, CERS	Lower	419, 0.079, SSE
E29	RODRIQUEZ & SONS SUN	500 N GATEWAY DR	EDR Hist Auto	Higher	428, 0.081, WSW
E30	AMIRK GILL	500 N GATEWAY DR	CUPA Listings, HAZNET	Higher	428, 0.081, WSW
E31	HARRY'S LIQUOR & GAS	500 N GATEWAY DR	UST	Higher	428, 0.081, WSW
E32	RODRIQUEZ AND SONS	500 N GATEWAY DR	HIST UST	Higher	428, 0.081, WSW
E33	GIL AMERIC	500 N GATEWAY	HIST UST, HAZNET	Higher	428, 0.081, WSW
E34	HARRY'S LIQUOR & GAS	500 N GATEWAY DR	CERS TANKS, CERS	Higher	428, 0.081, WSW
E35	J. J. JETTY/SALOK S.	500 N GATEWAY DR	SWEEPS UST, CA FID UST	Higher	428, 0.081, WSW
F36	VALLEY WHOLESALE BUI	105 W CENTRAL AVE	HIST UST	Higher	572, 0.108, WNW
G37	RAMIREZ SERVICE & GA	300 GATEWAY	LUST, CUPA Listings, HIST CORTESE, CERS	Lower	597, 0.113, South
G38	UNOCAL S/S #5936	300 GATEWAY N	LUST, CERS	Lower	597, 0.113, South
G39	UNION OIL SS# 5936	300 N GATEWAY DR	HIST UST	Lower	604, 0.114, South

MAPPED SITES SUMMARY

Target Property Address: 401-425 & 610 NORTH E STREET MADERA, CA 93638

Click on Map ID to see full detail.

	i map 12 to ooo ran actam				
MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
G40	UNION OIL SS#5936	300 N GATEWAY DR	HIST UST	Lower	604, 0.114, South
G41	EARLS UNION 76 SERV	300 N GATEWAY	EDR Hist Auto	Lower	604, 0.114, South
G42	RED CARPET UNION #59	300 N GATEWAY DR	SWEEPS UST, HIST UST, CA FID UST	Lower	604, 0.114, South
G43	GATEWAY RENTALS	225 N GATEWAY DR	HIST UST	Lower	638, 0.121, SSE
G44	BJ'S GAS AND LIQUOR	225 N GATEWAY DR	CUPA Listings, EMI	Lower	638, 0.121, SSE
G45	B-J LIQUOR	225 GATEWAY N	LUST, SWEEPS UST, HIST UST, CA FID UST, HIST	Lower	638, 0.121, SSE
G46	BJ'S GAS & LIQUOR	225 N GATEWAY DR	CERS TANKS, CERS	Lower	638, 0.121, SSE
G47	BJ'S MART & DELI	225 N GATEWAY DR	UST	Lower	638, 0.121, SSE
G48	LEES CONCRETE MATERI	225 N GATEWAY	EDR Hist Auto	Lower	638, 0.121, SSE
G49	VALLEE FOODSTORE / B	225 GATEWAY N	LUST, CERS	Lower	639, 0.121, SSE
F50	VALEY WHOLESALE LUMB	101 CENTRAL E	LUST, CERS	Higher	657, 0.124, WNW
F51	VALLEY WHOLESALE BLD	101 CENTRAL	HIST CORTESE	Higher	657, 0.124, WNW
F52	VALLEY WHOLESALE BLD	105 W CENTRAL	SWEEPS UST, CA FID UST	Higher	666, 0.126, WNW
F53	VALEY WHOLESALE LUMB	105 CENTRAL	HIST CORTESE	Higher	666, 0.126, WNW
G54	BUGGY SHOWER CAR WAS	230 GATEWAY DR	UST	Lower	672, 0.127, South
G55	POLICE DEPARTMENT	203 W 4TH	HIST UST	Lower	691, 0.131, South
G56	MADERA CITY-POLICE D	203 W 4TH ST	SWEEPS UST, CA FID UST	Lower	691, 0.131, South
G57	MADERA AUTO RADIATOR	226 NORTH GATEWAY DR	ENVIROSTOR	Lower	751, 0.142, South
G58	BUGGY SHOWER CAR WAS	230 N GATEWAY DR	HIST UST	Lower	774, 0.147, South
G59	BUGGY SHOWERS	230 N GATEWAY DR	SWEEPS UST, HIST UST, CA FID UST, CERS TANKS, O	CUPALower	774, 0.147, South
G60	BUGGY SHOWER CAR WAS	230 N GATEWAY DR	UST	Lower	774, 0.147, South
H61	AUTOZONE #2874	211 N GATEWAY DR	CERS HAZ WASTE, HAZNET, CERS	Lower	786, 0.149, SSE
l62	COMMUNITY INTEGRATED	201 N E ST	RCRA-SQG, FINDS, ECHO	Lower	806, 0.153, SE
G63	JIM BARSETTI	220 NORTH GATEWAY	CUPA Listings, HAZNET	Lower	829, 0.157, SSE
H64	BUGGY SHOWER	230 GATEWAY DR N	LUST, CUPA Listings, HIST CORTESE, CERS	Lower	836, 0.158, SSE
165	SERVICE STATION	200 D ST N	LUST, HIST CORTESE, CERS	Higher	837, 0.159, SE
H66	OIL STOP-DRIVE THRU	212 N GATEWAY DR	CERS HAZ WASTE, CERS TANKS, CERS	Lower	883, 0.167, SSE
H67	OIL STOP-DRIVE THRU	212 N GATEWAY DR	AST	Lower	883, 0.167, SSE
68	JOYEE'S RECYCLING	705 NORTH D ST	SWRCY	Higher	921, 0.174, North
69	CIRCLE K STORE #3603	500 B ST	HIST UST, RCRA NonGen / NLR, FINDS, ECHO	Higher	1036, 0.196, NE
170	MADERA INTERMODAL TR	123 E ST N	LUST, CERS	Higher	1058, 0.200, SE
71	GOODYEAR TIRE	115 N D ST	CERS HAZ WASTE, CERS	Higher	1121, 0.212, SE
72	HI TECH AUTOMOTIVE	128 N GATEWAY DR	CERS HAZ WASTE, CUPA Listings, CERS	Lower	1124, 0.213, SSE
J73	DOWNTOWN SHELL	101 GATEWAY DR N	LUST, CERS	Lower	1224, 0.232, SSE
J74	ARCO AM/PM	101 GATEWAY DR	UST	Lower	1224, 0.232, SSE
J75	ARCO AM/PM	101 GATEWAY DR N	LUST, CERS	Lower	1224, 0.232, SSE
J76	MADERA ARCO AM PM	101 N GATEWAY DR	CERS TANKS, CUPA Listings, HAZNET, CERS	Lower	1249, 0.237, SSE
J77	DOWNTOWN SHELL	101 N GATEWAY DR	SWEEPS UST, HIST UST, CA FID UST, EMI, HIST	Lower	1249, 0.237, SSE
J78	ARCO AM/PM #82032	101 N GATEWAY DR	UST	Lower	1249, 0.237, SSE

MAPPED SITES SUMMARY

Target Property Address: 401-425 & 610 NORTH E STREET MADERA, CA 93638

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS		ELATIVE EVATION	DIST (ft. & mi.) DIRECTION
K79	FASTWAY MARKET	800 D ST	UST, HIST UST	Higher	1269, 0.240, North
K80	FASTWAY MARKET	800 N D ST	UST	Higher	1269, 0.240, North
K81	FASTWAY MARKET	800 N D ST	SWEEPS UST, CA FID UST, CERS TANKS, CUPA Listings,	. Higher	1269, 0.240, North
K82	FASTWAY MARKET	800 NORTH D ST	HIST UST, EMI	Higher	1269, 0.240, North
J83	CHEVRON #90318	2 YOSEMITE W	LUST, HIST CORTESE, CERS	Lower	1412, 0.267, SSE
L84	MADERA REDEVELOPMENT	C STREET @ YOSEMITE	LUST, CERS	Higher	1461, 0.277, ESE
L85	MADERA REDEVELOPMENT	C STREET @ YOSEMITE	LUST	Higher	1461, 0.277, ESE
86	MR GAS - MADERA	401 YOSEMITE AVE E	LUST, CERS	Higher	1681, 0.318, ESE
M87	FORMER SIX STAR SHEL	125 GATEWAY DRIVE SO	LUST, HAZNET, CERS	Higher	1685, 0.319, SSE
M88	HATFIELDS SERVICE	125 GATEWAY S	LUST, CERS	Higher	1711, 0.324, SSE
M89	HATFIELDS MOBIL SERV	125 SOUTH GATEWAY DR	SWEEPS UST, HIST UST, CUPA Listings, HIST CORTESE	Higher	1712, 0.324, SSE
90	DON ROBERTS JEWELERS	317 YOSEMITE E	LUST, HIST CORTESE, CERS	Lower	1877, 0.355, South
N91	PEARTS AUTO SUPPLY	212 E 6TH ST	RCRA-SQG, LUST, SWEEPS UST, HIST UST, CA FID UST,.	Higher	1951, 0.370, SE
N92	SILVA'S AUTO BODY	201 S C ST	ENVIROSTOR, SWEEPS UST, CA FID UST	Higher	1990, 0.377, ESE
N93	FORDS WELDING WORKS	237 SOUTH D	ENVIROSTOR	Higher	2078, 0.394, SE
94	PACIFIC BELL	221 SOUTH E STREET	RCRA-SQG, LUST, SWEEPS UST, HIST UST, CA FID UST,.	Higher	2219, 0.420, SE
O95	MADERA REDEVELOPMENT	201 GATEWAY DR S	LUST, CERS	Lower	2243, 0.425, SSE
O96	PG&E FORMER MADERA S	309 S GATEWAY DR	CPS-SLIC, SWEEPS UST, HIST UST, DEED, CERS	Lower	2311, 0.438, SSE
P97	MADERA PCE GROUNDWAT	SOUTH C STREET AND 7	RESPONSE, ENVIROSTOR, Cortese	Higher	2405, 0.455, SE
P98	MADERA CLEANERS AND	321 SOUTH C STREET	CPS-SLIC, CERS	Higher	2469, 0.468, ESE
Q99	PG AND E MANUFACTURE	BLOCK OF 9TH,CLINTON	EDR MGP	Higher	2965, 0.562, SE
Q100	PG&E MANUFACTURED GA	BLOCK OF: 9TH, CLINT	HIST Cal-Sites	Higher	3023, 0.573, SE
Q101	VICINITY OF PG&E POL	CORNER OF "D" ST & 9	Notify 65	Higher	3039, 0.576, SE
Q102	PG&E MANUFACTURED GA	CORNER OF 9TH AND SO	ENVIROSTOR, VCP	Higher	3057, 0.579, SE
103	COUNTY OF MADERA, BR	2037 W. CLEVELAND AV	ENVIROSTOR, VCP	Lower	5224, 0.989, WNW
104	MADERA AUTOMATIC TRA	905 SOUTH GATEWAY DR	ENVIROSTOR, CERS HAZ WASTE, CUPA Listings, CERS	Lower	5255, 0.995, SE

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following records. For more information on this property see page 8 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
MADERA AUTO TIRES & 610 N E ST STE 112 MADERA, CA 93638	CERS HAZ WASTE CUPA Listings Database: CUPA MADERA, Date of Government V Facility Id: FA0103688	N/A ersion: 02/20/2019
	CERS	
MADERA AUTO TIRES & 610 N E ST STE 112 MADERA, CA 93638	FINDS Registry ID:: 110070418910	N/A
MADERA, OA 33030	ECHO Registry ID: 110070418910	
SCHOETTLER TIRE INC. 401 NORTH E MADERA, CA	RGA LF Facility ID: 20-TI-0194	N/A
ANDY'S TRANSMISSION 425 N E ST	FINDS Registry ID:: 110065265581	N/A
MADERA, CA 93638	ECHO Registry ID: 110065265581	
ANDY'S TRANSMISSION 425 N E ST MADERA, CA 93638	CERS HAZ WASTE CERS	N/A
ANDY'S TRANSMISSION 425 E MADERA, CA	CUPA Listings Database: CUPA MADERA, Date of Government V Facility Id: FA0102839	N/A ersion: 02/20/2019

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list	
NPL	₋ National Priority List

Proposed NPL..... Proposed National Priority List Sites NPL LIENS..... Federal Superfund Liens Federal Delisted NPL site list Delisted NPL..... National Priority List Deletions Federal CERCLIS list FEDERAL FACILITY..... Federal Facility Site Information listing SEMS...... Superfund Enterprise Management System Federal CERCLIS NFRAP site list SEMS-ARCHIVE...... Superfund Enterprise Management System Archive Federal RCRA CORRACTS facilities list CORRACTS..... Corrective Action Report Federal RCRA non-CORRACTS TSD facilities list RCRA-TSDF...... RCRA - Treatment, Storage and Disposal Federal RCRA generators list RCRA-LQG...... RCRA - Large Quantity Generators RCRA-CESQG...... RCRA - Conditionally Exempt Small Quantity Generator Federal institutional controls / engineering controls registries LUCIS...... Land Use Control Information System US ENG CONTROLS...... Engineering Controls Sites List US INST CONTROL..... Sites with Institutional Controls Federal ERNS list ERNS..... Emergency Response Notification System State and tribal landfill and/or solid waste disposal site lists SWF/LF..... Solid Waste Information System State and tribal leaking storage tank lists INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land State and tribal registered storage tank lists FEMA UST..... Underground Storage Tank Listing INDIAN UST...... Underground Storage Tanks on Indian Land State and tribal voluntary cleanup sites VCP......Voluntary Cleanup Program Properties

INDIAN VCP..... Voluntary Cleanup Priority Listing

State and tribal Brownfields sites

BROWNFIELDS..... Considered Brownfieds Sites Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS..... A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

WMUDS/SWAT..... Waste Management Unit Database HAULERS..... Registered Waste Tire Haulers Listing

INDIAN ODI_____ Report on the Status of Open Dumps on Indian Lands DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations

ODI...... Open Dump Inventory IHS OPEN DUMPS...... Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL..... Delisted National Clandestine Laboratory Register

SCH..... School Property Evaluation Program

CDL..... Clandestine Drug Labs Toxic Pits...... Toxic Pits Cleanup Act Sites

US CDL...... National Clandestine Laboratory Register

Local Land Records

LIENS..... Environmental Liens Listing LIENS 2..... CERCLA Lien Information

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System CHMIRS..... California Hazardous Material Incident Report System

LDS..... Land Disposal Sites Listing MCS..... Military Cleanup Sites Listing SPILLS 90 SPILLS 90 data from FirstSearch

Other Ascertainable Records

FUDS..... Formerly Used Defense Sites

US FIN ASSUR..... Financial Assurance Information

EPA WATCH LIST..... EPA WATCH LIST

2020 COR ACTION........... 2020 Corrective Action Program List TSCA..... Toxic Substances Control Act

TRIS...... Toxic Chemical Release Inventory System

SSTS..... Section 7 Tracking Systems

ROD...... Records Of Decision

RMP...... Risk Management Plans

RAATS......RCRA Administrative Action Tracking System

PRP...... Potentially Responsible Parties PADS..... PCB Activity Database System

ICIS...... Integrated Compliance Information System

FTTS......FIFŘA/ TSCA Tracking System - FIFŘA (Federal Insecticide, Fungicide, & Rodenticide

Act)/TSCA (Toxic Substances Control Act)

..... Material Licensing Tracking System COAL ASH DOE..... Steam-Electric Plant Operation Data

COAL ASH EPA..... Coal Combustion Residues Surface Impoundments List

PCB TRANSFORMER...... PCB Transformer Registration Database

RADINFO...... Radiation Information Database

HIST FTTS..... FIFRA/TSCA Tracking System Administrative Case Listing

DOT OPS..... Incident and Accident Data

CONSENT...... Superfund (CERCLA) Consent Decrees

INDIAN RESERV..... Indian Reservations

FUSRAP..... Formerly Utilized Sites Remedial Action Program

UMTRA..... Uranium Mill Tailings Sites

LEAD SMELTERS..... Lead Smelter Sites

US AIRS..... Aerometric Information Retrieval System Facility Subsystem

US MINES..... Mines Master Index File ABANDONED MINES..... Abandoned Mines

UXO...... Unexploded Ordnance Sites

DOCKET HWC..... Hazardous Waste Compliance Docket Listing

FUELS PROGRAM..... EPA Fuels Program Registered Listing CA BOND EXP. PLAN...... Bond Expenditure Plan

DRYCLEANERS..... Cleaner Facilities EMI..... Emissions Inventory Data ENF..... Enforcement Action Listing

Financial Assurance Information Listing

HAZNET..... Facility and Manifest Data

ICE.....ICE

HWP..... EnviroStor Permitted Facilities Listing

HWT...... Registered Hazardous Waste Transporter Database

MINES..... Mines Site Location Listing

MWMP..... Medical Waste Management Program Listing

NPDES Permits Listing PEST LIC...... Pesticide Regulation Licenses Listing

PROC...... Certified Processors Database UIC......UIC Listing

UIC GEO...... UIC GEO (GEOTRACKER)

WASTEWATER PITS..... Oil Wastewater Pits Listing WDS...... Waste Discharge System

MILITARY PRIV SITES..... MILITARY PRIV SITES (GEOTRACKER)

PROJECT......PROJECT (GEOTRACKER)

WDR..... Waste Discharge Requirements Listing CIWQS...... California Integrated Water Quality System WIP..... Well Investigation Program Case List NON-CASE INFO...... NON-CASE INFO (GEOTRACKER) OTHER OIL GAS..... OTHER OIL & GAS (GEOTRACKER) PROD WATER PONDS...... PROD WATER PONDS (GEOTRACKER) SAMPLING POINT..... SAMPLING POINT (GEOTRACKER) WELL STIM PROJ...... Well Stimulation Project (GEOTRACKER)

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR Hist Cleaner EDR Exclusive Historical Cleaners

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA LUST...... Recovered Government Archive Leaking Underground Storage Tank

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in **bold italics** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal RCRA generators list

RCRA-SQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

A review of the RCRA-SQG list, as provided by EDR, and dated 03/01/2018 has revealed that there are 3 RCRA-SQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
<i>VANS STUDIO</i> EPA ID:: CA0000010892	600 N D ST	NNW 0 - 1/8 (0.062 mi.)	21	58
Lower Elevation	Address	Direction / Distance	Map ID	Page
HEARTLAND OPPORTUNIT EPA ID:: CAD982435554	323 N E ST	SE 0 - 1/8 (0.023 mi.)	C16	46
COMMUNITY INTEGRATED EPA ID:: CAR000096636	201 N E ST	SE 1/8 - 1/4 (0.153 mi.)	<i>1</i> 62	183

State- and tribal - equivalent NPL

RESPONSE: Identifies confirmed release sites where DTSC is involved in remediation, either in a lead or oversight capacity. These confirmed release sites are generally high-priority and high potential risk.

A review of the RESPONSE list, as provided by EDR, has revealed that there is 1 RESPONSE site within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MADERA PCE GROUNDWAT	SOUTH C STREET AND 7	SE 1/4 - 1/2 (0.455 mi.)	P97	344
Database: RESPONSE Date of Govern	ment Version: 01/28/2019			

Status: Active Facility Id: 60001450

State- and tribal - equivalent CERCLIS

ENVIROSTOR: The Department of Toxic Substances Control's (DTSC's) Site Mitigation and Brownfields Reuse Program's (SMBRP's) EnviroStor database identifies sites that have known contamination or sites for which there may be reasons to investigate further. The database includes the following site types: Federal Superfund sites (National Priorities List (NPL)); State Response, including Military Facilities and State Superfund; Voluntary Cleanup; and School sites. EnviroStor provides similar information to the information that was available in CalSites, and provides additional site information, including, but not limited to, identification of formerly-contaminated properties that have been released for reuse, properties where environmental deed restrictions have been recorded to prevent inappropriate land uses, and risk characterization information that is used to assess potential impacts to public health and the environment at contaminated sites.

A review of the ENVIROSTOR list, as provided by EDR, and dated 01/28/2019 has revealed that there are 7 ENVIROSTOR sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SILVA'S AUTO BODY Facility Id: 20750005 Status: Refer: Other Agency	201 S C ST	ESE 1/4 - 1/2 (0.377 mi.)	N92	332
FORDS WELDING WORKS Facility Id: 20760004 Status: Refer: Other Agency	237 SOUTH D	SE 1/4 - 1/2 (0.394 mi.)	N93	333
MADERA PCE GROUNDWAT Facility Id: 60001450 Status: Active	SOUTH C STREET AND 7	SE 1/4 - 1/2 (0.455 mi.)	P97	344
PG&E MANUFACTURED GA Facility Id: 60000297 Status: Certified	CORNER OF 9TH AND SO	SE 1/2 - 1 (0.579 mi.)	Q102	355
Lower Elevation	Address	Direction / Distance	Map ID	Page
MADERA AUTO RADIATOR Facility Id: 20750002 Status: Refer: Other Agency	226 NORTH GATEWAY DR	S 1/8 - 1/4 (0.142 mi.)	G57	140
COUNTY OF MADERA, BR	2037 W. CLEVELAND AV	WNW 1/2 - 1 (0.989 mi.)	103	362

Facility Id: 20000002 Status: No Further Action

MADERA AUTOMATIC TRA 905 SOUTH GATEWAY DR SE 1/2 - 1 (0.995 mi.) 104 365

Facility Id: 20750006 Status: Refer: RCRA

State and tribal leaking storage tank lists

LUST: Leaking Underground Storage Tank (LUST) Sites included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

A review of the LUST list, as provided by EDR, has revealed that there are 22 LUST sites within approximately 0.5 miles of the target property.

311	-1 - 3			
Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HARMIN'S LIQUOR & GA Database: LUST REG 5, Date of Government Ve Status: Completed - Case Closed Status: Remedial action (cleanup) Underweiglobal Id: T0603900177	rsion: 12/10/2018	WSW 0 - 1/8 (0.074 mi.)	E27	68
VALEY WHOLESALE LUMB Database: LUST REG 5, Date of Government Ve Database: LUST, Date of Government Ve Status: Completed - Case Closed Status: Case Closed Global Id: T0603991983		WNW 0 - 1/8 (0.124 mi.)	F50	135
SERVICE STATION Database: LUST REG 5, Date of Government Ve Status: Completed - Case Closed Status: Case Closed Global Id: T0603900033		SE 1/8 - 1/4 (0.159 mi.)	<i>1</i> 65	188
MADERA INTERMODAL TR Database: LUST REG 5, Date of Government Ventabase: LUST, Date of Government Ventabase: Completed - Case Closed Status: Case Closed Global Id: T0603900148		SE 1/8 - 1/4 (0.200 mi.)	<i>170</i>	239
MADERA REDEVELOPMENT Database: LUST REG 5, Date of Government Status: Case Closed	C STREET @ YOSEMITE nent Version: 07/01/2008	ESE 1/4 - 1/2 (0.277 mi.)	L84	313
MADERA REDEVELOPMENT Database: LUST, Date of Government Ve Status: Completed - Case Closed Global Id: T0603991985	C STREET @ YOSEMITE rsion: 12/10/2018	ESE 1/4 - 1/2 (0.277 mi.)	L85	314
MR GAS - MADERA Database: LUST REG 5, Date of Government Ve		ESE 1/4 - 1/2 (0.318 mi.)	86	315

Status: Completed - Case Closed

Status: No Action Global Id: T0603991892

FORMER SIX STAR SHEL 125 GATEWAY DRIVE SO SSE 1/4 - 1/2 (0.319 mi.) M87 318

Database: LUST, Date of Government Version: 12/10/2018

Status: Open - Site Assessment Global Id: T10000011236

HATFIELDS SERVICE 125 GATEWAY S SSE 1/4 - 1/2 (0.324 mi.) M88 320

Database: LUST REG 5, Date of Government Version: 07/01/2008 Database: LUST, Date of Government Version: 12/10/2018

Status: Completed - Case Closed

Status: Case Closed Global Id: T0603900097

PEARTS AUTO SUPPLY 212 E 6TH ST SE 1/4 - 1/2 (0.370 mi.) N91 327

Database: LUST REG 5, Date of Government Version: 07/01/2008 Database: LUST, Date of Government Version: 12/10/2018

Status: Completed - Case Closed

Status: Case Closed Global Id: T0603900132

PACIFIC BELL 221 SOUTH E STREET SE 1/4 - 1/2 (0.420 mi.) 94 335

Database: LUST REG 5, Date of Government Version: 07/01/2008 Database: LUST, Date of Government Version: 12/10/2018

Status: Completed - Case Closed

Status: Case Closed Global Id: T0603900068

 Lower Elevation
 Address
 Direction / Distance
 Map ID
 Page

 MADERA TRANSPORTATIO
 305 E ST N
 SSE 0 - 1/8 (0.079 mi.)
 28
 73

Database: LUST REG 5, Date of Government Version: 07/01/2008 Database: LUST, Date of Government Version: 12/10/2018

Status: Completed - Case Closed

Status: Preliminary site assessment underway

Global Id: T0603900162

RAMIREZ SERVICE & GA 300 GATEWAY \$ 0 - 1/8 (0.113 mi.) G37 98

Database: LUST REG 5, Date of Government Version: 07/01/2008 Database: LUST, Date of Government Version: 12/10/2018

Status: Completed - Case Closed

Status: Case Closed Global Id: T0603900039

UNOCAL S/S #5936 300 GATEWAY N S 0 - 1/8 (0.113 mi.) G38 101

Database: LUST REG 5, Date of Government Version: 07/01/2008 Database: LUST, Date of Government Version: 12/10/2018

Status: Completed - Case Closed

Status: Case Closed Global Id: T0603900122

B-J LIQUOR 225 GATEWAY N SSE 0 - 1/8 (0.121 mi.) G45 113

Database: LUST REG 5, Date of Government Version: 07/01/2008 Database: LUST, Date of Government Version: 12/10/2018

Status: Completed - Case Closed

Status: Case Closed Global Id: T0603900159

Global Id: T0603900018				
VALLEE FOODSTORE / B Database: LUST REG 5, Date of Governing Status: Case Closed	225 GATEWAY N ment Version: 07/01/2008	SSE 0 - 1/8 (0.121 mi.)	G49	135
BUGGY SHOWER Database: LUST REG 5, Date of Government Versitatus: Completed - Case Closed Status: Case Closed Global Id: T0603900160		SSE 1/8 - 1/4 (0.158 mi.)	H64	186
DOWNTOWN SHELL Database: LUST REG 5, Date of Government Versional Status: Completed - Case Closed Status: Case Closed Global Id: T0603900127 Global Id: T0603991640		SSE 1/8 - 1/4 (0.232 mi.)	J73	257
ARCO AM/PM Database: LUST REG 5, Date of Government Status: Case Closed	101 GATEWAY DR N ment Version: 07/01/2008	SSE 1/8 - 1/4 (0.232 mi.)	J75	261
CHEVRON #90318 Database: LUST REG 5, Date of Government Version Database: LUST, Date of Government Version Status: Completed - Case Closed Status: Case Closed Global Id: T0603900145 Global Id: T0603900005		SSE 1/4 - 1/2 (0.267 mi.)	J83	309
DON ROBERTS JEWELERS Database: LUST REG 5, Date of Government Versitatus: Completed - Case Closed Status: Case Closed Global Id: T0603900135		S 1/4 - 1/2 (0.355 mi.)	90	325
MADERA REDEVELOPMENT Database: LUST REG 5, Date of Government Versitatus: Completed - Case Closed Status: Case Closed Global Id: T0603991984		SSE 1/4 - 1/2 (0.425 mi.)	O95	340

CPS-SLIC: Cleanup Program Sites (CPS; also known as Site Cleanups [SC] and formerly known as Spills, Leaks, Investigations, and Cleanups [SLIC] sites) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

A review of the CPS-SLIC list, as provided by EDR, has revealed that there are 2 CPS-SLIC sites within approximately 0.5 miles of the target property.

	Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
	MADERA CLEANERS AND	321 SOUTH C STREET	ESE 1/4 - 1/2 (0.468 mi.)	P98	351
Database: CPS-SLIC, Date of Government Version: 12/10/2018					

Facility Status: Open - Verification Monitoring

Global Id: SL0603921176

Lower Elevation	Address	Direction / Distance	Map ID	Page
PG&E FORMER MADERA S	309 S GATEWAY DR	SSE 1/4 - 1/2 (0.438 mi.)	O96	342

Database: CPS-SLIC, Date of Government Version: 12/10/2018

Facility Status: Completed - Case Closed

Global Id: SL186434606

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the State Water Resources Control Board's Hazardous Substance Storage Container Database.

A review of the UST list, as provided by EDR, has revealed that there are 8 UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HARRY'S LIQUOR & GAS Database: UST, Date of Governmer Facility Id: FA0100264	500 N GATEWAY DR at Version: 12/10/2018	WSW 0 - 1/8 (0.081 mi.)	E31	78
FASTWAY MARKET Database: UST, Date of Governmer Facility Id: FA0100187	800 D ST nt Version: 12/10/2018	N 1/8 - 1/4 (0.240 mi.)	K79	289
FASTWAY MARKET Database: UST, Date of Governmer Facility Id: FA0100187	800 N D ST nt Version: 12/10/2018	N 1/8 - 1/4 (0.240 mi.)	K80	290
Lower Elevation	Address	Direction / Distance	Map ID	Page
BJ'S MART & DELI Database: UST, Date of Governmer Facility Id: FA0100182	225 N GATEWAY DR at Version: 12/10/2018	SSE 0 - 1/8 (0.121 mi.)	G47	134
BUGGY SHOWER CAR WAS Database: UST, Date of Governmer Facility Id: FA0100166	230 GATEWAY DR nt Version: 12/10/2018	S 1/8 - 1/4 (0.127 mi.)	G54	139
BUGGY SHOWER CAR WAS Database: UST, Date of Governmer Facility Id: 100166	230 N GATEWAY DR nt Version: 12/10/2018	S 1/8 - 1/4 (0.147 mi.)	G60	172
ARCO AM/PM Database: UST, Date of Governmer Facility Id: FA0101982	101 GATEWAY DR nt Version: 12/10/2018	SSE 1/8 - 1/4 (0.232 mi.)	J74	260
ARCO AM/PM #82032 Database: UST, Date of Governmer Facility Id: FA0101982	101 N GATEWAY DR nt Version: 12/10/2018	SSE 1/8 - 1/4 (0.237 mi.)	J78	288

AST: A listing of aboveground storage tank petroleum storage tank locations.

A review of the AST list, as provided by EDR, has revealed that there is 1 AST site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
OIL STOP-DRIVE THRU	212 N GATEWAY DR	SSE 1/8 - 1/4 (0.167 mi.)	H67	235
Database: AST, Date of Government Version: 07/06/2016				

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

SWRCY: A listing of recycling facilities in California.

A review of the SWRCY list, as provided by EDR, and dated 12/10/2018 has revealed that there are 2 SWRCY sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
GL PEREZ INC Cert Id: RC14169	625 N GATEWAY DR	WNW 0 - 1/8 (0.040 mi.)	D19	54
JOYEE'S RECYCLING Cert ld: RC193741.001	705 NORTH D ST	N 1/8 - 1/4 (0.174 mi.)	68	236

Local Lists of Hazardous waste / Contaminated Sites

HIST Cal-Sites: Formerly known as ASPIS, this database contains both known and potential hazardous substance sites. The source is the California Department of Toxic Substance Control. No longer updated by the state agency. It has been replaced by ENVIROSTOR.

A review of the HIST Cal-Sites list, as provided by EDR, and dated 08/08/2005 has revealed that there is 1 HIST Cal-Sites site within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
PG&E MANUFACTURED GA	BLOCK OF: 9TH, CLINT	SE 1/2 - 1 (0.573 mi.)	Q100	352

CERS HAZ WASTE: List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the Hazardous Chemical Management, Hazardous Waste Onsite Treatment, Household Hazardous Waste Collection, Hazardous Waste Generator, and RCRA LQ HW Generator programs.

A review of the CERS HAZ WASTE list, as provided by EDR, and dated 10/22/2018 has revealed that there are 12 CERS HAZ WASTE sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CASEY'S DISCOUNT AUT	508 N "E" ST	WNW 0 - 1/8 (0.004 mi.)	A10	35
AUTO SERVICE LABS	520 N E ST	WNW 0 - 1/8 (0.006 mi.)	B11	41
MADERA GLASS & BODY	105 E CENTRAL	NW 0 - 1/8 (0.024 mi.)	17	49
FEARLESS AUTO AND OF	624 N GATEWAY DR	WNW 0 - 1/8 (0.064 mi.)	D22	61

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
GOODYEAR TIRE	115 N D ST	SE 1/8 - 1/4 (0.212 mi.)	71	241
Lower Elevation	Address	Direction / Distance	Map ID	Page
SINAI AUTO REPAIR	401 N E ST STE N	0 - 1/8 (0.000 mi.)	A7	25
MARTINS ELECTRICAL&A	401 N E ST STE C	0 - 1/8 (0.000 mi.)	A8	29
D & F BODY & PAINT	401 N E ST	0 - 1/8 (0.000 mi.)	A9	33
BARAJAS BODY SHOP	314 N E	SSE 0 - 1/8 (0.041 mi.)	C20	55
AUTOZONE #2874	211 N GATEWAY DR	SSE 1/8 - 1/4 (0.149 mi.)	H61	172
OIL STOP-DRIVE THRU	212 N GATEWAY DR	SSE 1/8 - 1/4 (0.167 mi.)	H66	190
HI TECH AUTOMOTIVE	128 N GATEWAY DR	SSE 1/8 - 1/4 (0.213 mi.)	72	245

Local Lists of Registered Storage Tanks

SWEEPS UST: Statewide Environmental Evaluation and Planning System. This underground storage tank listing was updated and maintained by a company contacted by the SWRCB in the early 1990's. The listing is no longer updated or maintained. The local agency is the contact for more information on a site on the SWEEPS list.

A review of the SWEEPS UST list, as provided by EDR, and dated 06/01/1994 has revealed that there are 9 SWEEPS UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
J. J. JETTY/SALOK S. Status: A Tank Status: A Comp Number: 100264	500 N GATEWAY DR	WSW 0 - 1/8 (0.081 mi.)	E35	96
VALLEY WHOLESALE BLD Status: A Tank Status: A Comp Number: 100088	105 W CENTRAL	WNW 1/8 - 1/4 (0.126 mi.)	F52	137
FASTWAY MARKET Status: A Tank Status: A Comp Number: 100187	800 N D ST	N 1/8 - 1/4 (0.240 mi.)	K81	290
Lower Elevation	Address	Direction / Distance	Map ID	Page
MADERA TRANSPORTATIO Status: A Tank Status: A Comp Number: 100225	305 N E ST	SE 0 - 1/8 (0.066 mi.)	C25	67
RED CARPET UNION #59 Status: A Tank Status: A Comp Number: 100207	300 N GATEWAY DR	S 0 - 1/8 (0.114 mi.)	G42	106
B-J LIQUOR Status: A Tank Status: A	225 GATEWAY N	SSE 0 - 1/8 (0.121 mi.)	G45	113

Comp Number: 100182				
MADERA CITY-POLICE D Status: A Tank Status: A Comp Number: 100226	203 W 4TH ST	S 1/8 - 1/4 (0.131 mi.)	G56	140
BUGGY SHOWERS Status: A Tank Status: A Comp Number: 100166	230 N GATEWAY DR	S 1/8 - 1/4 (0.147 mi.)	G59	142
DOWNTOWN SHELL Status: A Tank Status: A Comp Number: 100097	101 N GATEWAY DR	SSE 1/8 - 1/4 (0.237 mi.)	J77	283

HIST UST: Historical UST Registered Database.

A review of the HIST UST list, as provided by EDR, and dated 10/15/1990 has revealed that there are 21 HIST UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MULLER IRRIGATION, I Facility Id: 00000006926	525 N E ST	NW 0 - 1/8 (0.015 mi.)	B14	45
MULLER IRRIGATION IN RODRIQUEZ AND SONS Facility Id: 00000064681	525 NO E ST 500 N GATEWAY DR	NW 0 - 1/8 (0.015 mi.) WSW 0 - 1/8 (0.081 mi.)	B15 E32	45 78
GIL AMERIC VALLEY WHOLESALE BUI Facility Id: 00000014199	500 N GATEWAY 105 W CENTRAL AVE	WSW 0 - 1/8 (0.081 mi.) WNW 0 - 1/8 (0.108 mi.)	E33 F36	79 97
CIRCLE K STORE #3603 Facility Id: 00000058847	500 B ST	NE 1/8 - 1/4 (0.196 mi.)	69	236
FASTWAY MARKET Facility Id: 00000009939	800 D ST	N 1/8 - 1/4 (0.240 mi.)	K79	289
FASTWAY MARKET	800 NORTH D ST	N 1/8 - 1/4 (0.240 mi.)	K82	306
Lower Elevation	Address	Direction / Distance	Map ID	Page
SAN JOAQUIN PEST CON SAN JOAQUIN PEST CON Facility Id: 00000001306	416 NORTH E STREET 416 N E ST	SW 0 - 1/8 (0.014 mi.) SW 0 - 1/8 (0.014 mi.)	A12 A13	44 44
MADERA COB INC MADERA TRANSPORTATIO Facility Id: 00000002384	305 NORTH E 305 N E ST	SE 0 - 1/8 (0.066 mi.) SE 0 - 1/8 (0.066 mi.)	C24 C25	66 67
UNION OIL SS# 5936 Facility Id: 00000060726	300 N GATEWAY DR	S 0 - 1/8 (0.114 mi.)	G39	103
UNION OIL SS#5936 Facility Id: 00000021159	300 N GATEWAY DR	S 0 - 1/8 (0.114 mi.)	G40	104
RED CARPET UNION #59 GATEWAY RENTALS Facility Id: 00000019596	300 N GATEWAY DR 225 N GATEWAY DR	S 0 - 1/8 (0.114 mi.) SSE 0 - 1/8 (0.121 mi.)	G42 G43	106 108
B-J LIQUOR	225 GATEWAY N	SSE 0 - 1/8 (0.121 mi.)	G45	113

Lower Elevation	Address	Direction / Distance	Map ID	Page
POLICE DEPARTMENT Facility Id: 00000042553	203 W 4TH	S 1/8 - 1/4 (0.131 mi.)	G55	139
BUGGY SHOWER CAR WAS Facility Id: 00000013173	230 N GATEWAY DR	S 1/8 - 1/4 (0.147 mi.)	G58	141
BUGGY SHOWERS DOWNTOWN SHELL Facility Id: 00000018125	230 N GATEWAY DR 101 N GATEWAY DR	S 1/8 - 1/4 (0.147 mi.) SSE 1/8 - 1/4 (0.237 mi.)	G59 J77	142 283

CERS TANKS: List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the Aboveground Petroleum Storage and Underground Storage Tank regulatory programs.

A review of the CERS TANKS list, as provided by EDR, and dated 10/22/2018 has revealed that there are 6 CERS TANKS sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HARRY'S LIQUOR & GAS	500 N GATEWAY DR	WSW 0 - 1/8 (0.081 mi.)	E34	80
FASTWAY MARKET	800 N D ST	N 1/8 - 1/4 (0.240 mi.)	K81	290
Lower Elevation	Address	Direction / Distance	Map ID	Page
BJ'S GAS & LIQUOR	225 N GATEWAY DR	SSE 0 - 1/8 (0.121 mi.)	G46	118
BUGGY SHOWERS	230 N GATEWAY DR	S 1/8 - 1/4 (0.147 mi.)	G59	142
OIL STOP-DRIVE THRU	212 N GATEWAY DR	SSE 1/8 - 1/4 (0.167 mi.)	H66	190
MADERA ARCO AM PM	101 N GATEWAY DR	SSE 1/8 - 1/4 (0.237 mi.)	J76	261

CA FID UST: The Facility Inventory Database contains active and inactive underground storage tank locations. The source is the State Water Resource Control Board.

A review of the CA FID UST list, as provided by EDR, and dated 10/31/1994 has revealed that there are 8 CA FID UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
J. J. JETTY/SALOK S. Facility Id: 20000686 Status: A	500 N GATEWAY DR	WSW 0 - 1/8 (0.081 mi.)	E35	96
VALLEY WHOLESALE BLD Facility Id: 20000071 Status: A	105 W CENTRAL	WNW 1/8 - 1/4 (0.126 mi.)	F52	137
FASTWAY MARKET Facility Id: 20000673 Status: A	800 N D ST	N 1/8 - 1/4 (0.240 mi.)	K81	290
Lower Elevation	Address	Direction / Distance	Map ID	Page
RED CARPET UNION #59 Facility Id: 20000315 Status: A	300 N GATEWAY DR	S 0 - 1/8 (0.114 mi.)	G42	106
B-J LIQUOR	225 GATEWAY N	SSE 0 - 1/8 (0.121 mi.)	G45	113

Facility Id: 20000016 Status: A				
MADERA CITY-POLICE D Facility Id: 20000682 Status: A	203 W 4TH ST	S 1/8 - 1/4 (0.131 mi.)	G56	140
BUGGY SHOWERS Facility Id: 20000488 Status: A	230 N GATEWAY DR	S 1/8 - 1/4 (0.147 mi.)	G59	142
DOWNTOWN SHELL Facility Id: 20000074 Status: A	101 N GATEWAY DR	SSE 1/8 - 1/4 (0.237 mi.)	J77	283

Local Land Records

DEED: The use of recorded land use restrictions is one of the methods the DTSC uses to protect the public from unsafe exposures to hazardous substances and wastes .

A review of the DEED list, as provided by EDR, and dated 03/04/2019 has revealed that there is 1 DEED site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
PG&E FORMER MADERA S	309 S GATEWAY DR	SSE 1/4 - 1/2 (0.438 mi.)	O96	342
Status: COMPLETED - CASE CLOSED				
Envirostor ID: SL186434606				

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 03/01/2018 has revealed that there is 1 RCRA NonGen / NLR site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CIRCLE K STORE #3603	500 B ST	NE 1/8 - 1/4 (0.196 mi.)	69	236
EPA ID:: CAD981681596				

Cortese: The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWF/LS), and the Department of Toxic Substances Control (Cal-Sites).

A review of the Cortese list, as provided by EDR, and dated 12/20/2018 has revealed that there are 2 Cortese sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MADERA PCE GROUNDWAT Envirostor Id: 60001450 Cleanup Status: ACTIVE	SOUTH C STREET AND 7	SE 1/4 - 1/2 (0.455 mi.)	P97	344
Lower Elevation	Address	Direction / Distance	Map ID	Page
MADERA TRANSPORTATIO	305 NORTH E STREET	SE 0 - 1/8 (0.066 mi.)	C23	65

CUPA Listings: A listing of sites included in the county's Certified Unified Program Agency database. California's Secretary for Environmental Protection established the unified hazardous materials and hazardous waste regulatory program as required by chapter 6.11 of the California Health and Safety Code. The Unified Program consolidates the administration, permits, inspections, and enforcement activities.

A review of the CUPA Listings list, as provided by EDR, has revealed that there are 11 CUPA Listings sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MADERA GLASS & BODY Database: CUPA MADERA Facility Id: FA0102949	105 E CENTRAL , Date of Government Version: 02/20/2019	NW 0 - 1/8 (0.024 mi.)	17	49
AMIRK GILL Database: CUPA MADERA Facility Id: FA0100264	500 N GATEWAY DR , Date of Government Version: 02/20/2019	WSW 0 - 1/8 (0.081 mi.)	E30	77
FASTWAY MARKET Database: CUPA MADERA Facility Id: FA0100187	800 N D ST, Date of Government Version: 02/20/2019	N 1/8 - 1/4 (0.240 mi.)	K81	290
Lower Elevation	Address	Direction / Distance	Map ID	Page
MADERA TRANSPORTATIO Database: CUPA MADERA Facility Id: FA0100225	305 NORTH E STREET , Date of Government Version: 02/20/2019	SE 0 - 1/8 (0.066 mi.)	C23	65
RAMIREZ SERVICE & GA Database: CUPA MADERA Facility Id: FA0103448 Facility Id: FA0100207 Facility Id: FA0102925	300 GATEWAY , Date of Government Version: 02/20/2019	S 0 - 1/8 (0.113 mi.)	G37	98
BJ'S GAS AND LIQUOR Database: CUPA MADERA Facility Id: FA0100182	225 N GATEWAY DR, Date of Government Version: 02/20/2019	SSE 0 - 1/8 (0.121 mi.)	G44	109
BUGGY SHOWERS Database: CUPA MADERA Facility Id: FA0100166	230 N GATEWAY DR , Date of Government Version: 02/20/2019	S 1/8 - 1/4 (0.147 mi.)	G59	142
JIM BARSETTI Database: CUPA MADERA Facility Id: FA0101112	220 NORTH GATEWAY , Date of Government Version: 02/20/2019	SSE 1/8 - 1/4 (0.157 mi.)	G63	185
BUGGY SHOWER Database: CUPA MADERA Facility Id: FA0102956	230 GATEWAY DR N , Date of Government Version: 02/20/2019	SSE 1/8 - 1/4 (0.158 mi.)	H64	186

Facility Id: FA0100844

HI TECH AUTOMOTIVE Database: CUPA MADERA, Date Facility Id: FA0102974	128 N GATEWAY DR of Government Version: 02/20/2019	SSE 1/8 - 1/4 (0.213 mi.)	72	245
MADERA ARCO AM PM	101 N GATEWAY DR	SSE 1/8 - 1/4 (0.237 mi.)	J76	261

Database: CUPA MADERA, Date of Government Version: 02/20/2019

Facility Id: FA0101982

HIST CORTESE: The sites for the list are designated by the State Water Resource Control Board [LUST], the Integrated Waste Board [SWF/LS], and the Department of Toxic Substances Control [CALSITES]. This listing is no longer updated by the state agency.

A review of the HIST CORTESE list, as provided by EDR, and dated 04/01/2001 has revealed that there are 13 HIST CORTESE sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HARMIN'S LIQUOR & GA Reg ld: 5T20000181	500 GATEWAY DR N	WSW 0 - 1/8 (0.074 mi.)	E27	68
VALLEY WHOLESALE BLD Reg ld: 5T20000188	101 CENTRAL	WNW 0 - 1/8 (0.124 mi.)	F51	137
VALEY WHOLESALE LUMB Reg ld: 5T20000121	105 CENTRAL	WNW 1/8 - 1/4 (0.126 mi.)	F53	139
SERVICE STATION Reg Id: 5T20000033	200 D ST N	SE 1/8 - 1/4 (0.159 mi.)	<i>1</i> 65	188
HATFIELDS MOBIL SERV Reg ld: 5T20000097	125 SOUTH GATEWAY DR	SSE 1/4 - 1/2 (0.324 mi.)	M89	322
PEARTS AUTO SUPPLY Reg ld: 5T20000135	212 E 6TH ST	SE 1/4 - 1/2 (0.370 mi.)	N91	327
Lower Elevation	Address	Direction / Distance	Map ID	Page
MADERA TRANSPORTATIO Reg ld: 5T20000165	305 E ST N	SSE 0 - 1/8 (0.079 mi.)	28	73
RAMIREZ SERVICE & GA Reg ld: 5T20000123 Reg ld: 5T20000039	300 GATEWAY	S 0 - 1/8 (0.113 mi.)	G37	98
B-J LIQUOR Reg ld: 5T20000018 Reg ld: 5T20000162	225 GATEWAY N	SSE 0 - 1/8 (0.121 mi.)	G45	113
BUGGY SHOWER Reg ld: 5T20000163	230 GATEWAY DR N	SSE 1/8 - 1/4 (0.158 mi.)	H64	186
DOWNTOWN SHELL Reg ld: 5T20000128	101 N GATEWAY DR	SSE 1/8 - 1/4 (0.237 mi.)	J77	283
CHEVRON #90318 Reg Id: 5T20000005 Reg Id: 5T20000148	2 YOSEMITE W	SSE 1/4 - 1/2 (0.267 mi.)	J83	309
DON ROBERTS JEWELERS Reg ld: 5T20000138	317 YOSEMITE E	S 1/4 - 1/2 (0.355 mi.)	90	325

Notify 65: Listings of all Proposition 65 incidents reported to counties by the State Water Resources Control Board and the Regional Water Quality Control Board. This database is no longer updated by the reporting agency.

A review of the Notify 65 list, as provided by EDR, and dated 09/19/2018 has revealed that there is 1 Notify 65 site within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
VICINITY OF PG&E POL	CORNER OF "D" ST & 9	SE 1/2 - 1 (0.576 mi.)	Q101	354

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the EDR MGP list, as provided by EDR, has revealed that there is 1 EDR MGP site within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
PG AND E MANUFACTURE	BLOCK OF 9TH, CLINTON	SE 1/2 - 1 (0.562 mi.)	Q99	352

EDR Hist Auto: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.


A review of the EDR Hist Auto list, as provided by EDR, has revealed that there are 5 EDR Hist Auto sites within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page	
MC GEE W A	625 N GATEWAY DR	WNW 0 - 1/8 (0.040 mi.)	D18	54	
YOUNG ROBERT E	421 NO GATEWAY DR	SW 0 - 1/8 (0.072 mi.)	E26	67	
RODRIQUEZ & SONS SUN	500 N GATEWAY DR	WSW 0 - 1/8 (0.081 mi.)	E29	76	
Lower Elevation	Address	Direction / Distance	Map ID	Page	
EARLS UNION 76 SERV	300 N GATEWAY	S 0 - 1/8 (0.114 mi.)	G41	105	
LEES CONCRETE MATERI	225 N GATEWAY	SSE 0 - 1/8 (0.121 mi.)	G48	134	

Due to poor or inadequate address information, the following sites were not mapped. Count: 3 records.

Site Name	Database(s)
LEON'S PLACE AND FIX IT LOT SOUTH OF VALLEY WHOLESALE BLDG LANDFILL #1	ENVIROSTOR ENVIROSTOR ENVIROSTOR

OVERVIEW MAP - 5620993.2S

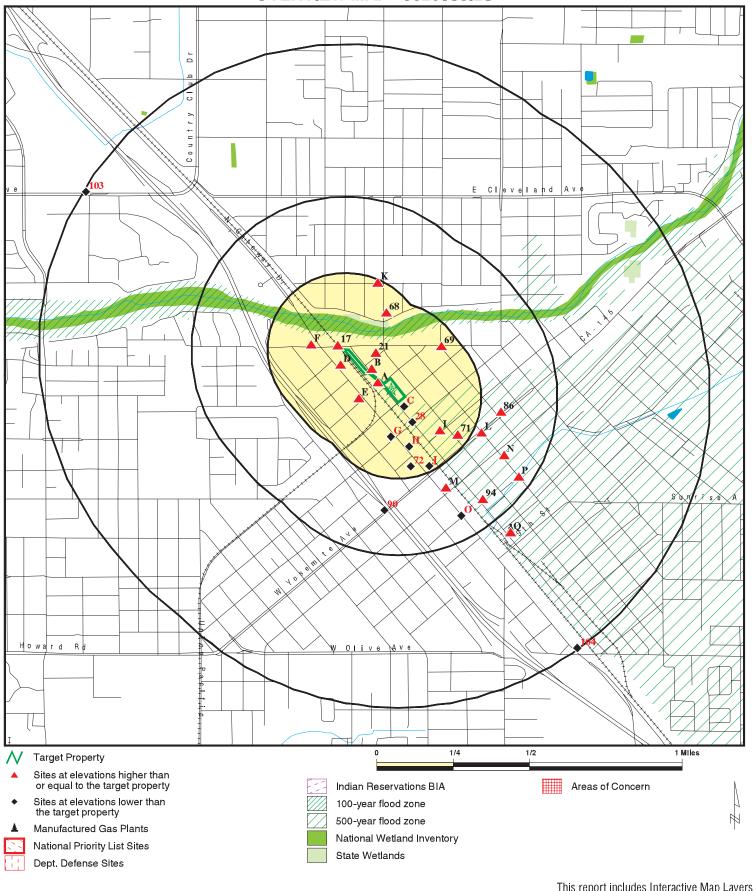

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Madera Industrial Warehouse Buildings

ADDRESS: 401-425 & 610 North E Street


MADERA CA 93638 LAT/LONG: 36.965317 / 120.062753 CLIENT: CONTACT: Partner Engineering and Science, Inc.

Colleen Tubridy INQUIRY #: 5620993.2s

DATE: April 15, 2019 12:00 pm

Copyright © 2019 EDR, Inc. © 2015 TomTom Rel. 2015.

DETAIL MAP - 5620993.2S

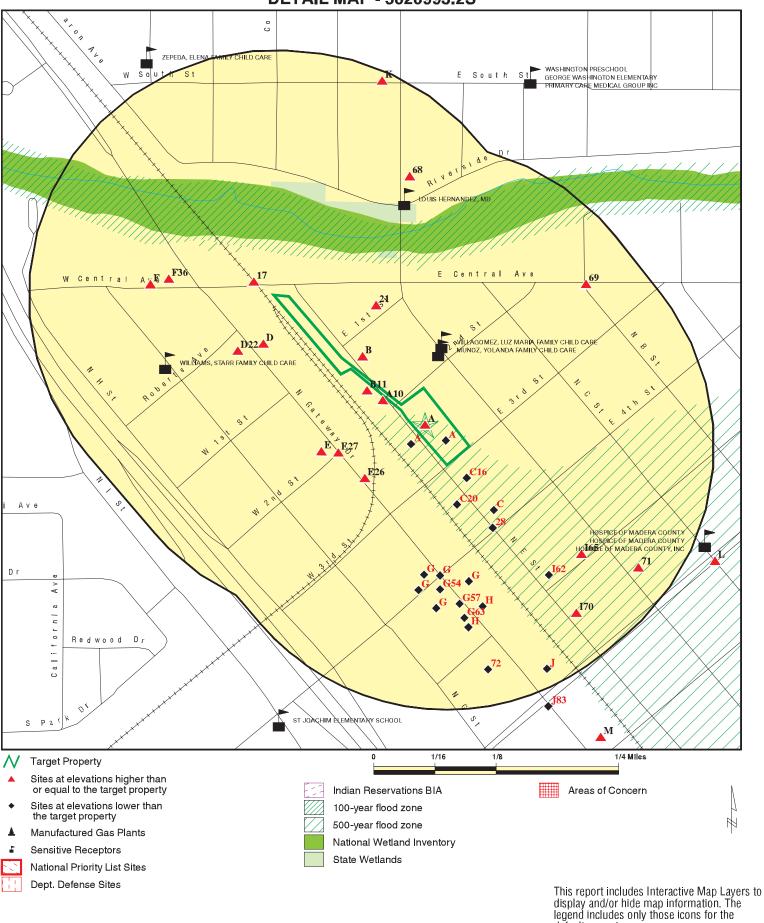

SITE NAME: Madera Industrial Warehouse Buildings
ADDRESS: 401-425 & 610 North E Street MADERA CA 93638

CLIENT: Partner Engineering and Science, Inc. CONTACT: Colleen Tubridy INQUIRY#: 5620993.2s

LAT/LONG: 36.965317 / 120.062753 | DATE: April 15, 2019 12:06 pm

default map view.

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMEN	TAL RECORDS							
Federal NPL site list								
NPL Proposed NPL NPL LIENS	1.000 1.000 1.000		0 0 0	0 0 0	0 0 0	0 0 0	NR NR NR	0 0 0
Federal Delisted NPL sit	e list							
Delisted NPL	1.000		0	0	0	0	NR	0
Federal CERCLIS list								
FEDERAL FACILITY SEMS	0.500 0.500		0 0	0 0	0 0	NR NR	NR NR	0 0
Federal CERCLIS NFRA	P site list							
SEMS-ARCHIVE	0.500		0	0	0	NR	NR	0
Federal RCRA CORRACTS facilities list								
CORRACTS	1.000		0	0	0	0	NR	0
Federal RCRA non-COR	RACTS TSD f	acilities list						
RCRA-TSDF	0.500		0	0	0	NR	NR	0
Federal RCRA generator	rs list							
RCRA-LQG RCRA-SQG RCRA-CESQG	0.250 0.250 0.250		0 2 0	0 1 0	NR NR NR	NR NR NR	NR NR NR	0 3 0
Federal institutional controls / engineering controls registries								
LUCIS US ENG CONTROLS US INST CONTROL	0.500 0.500 0.500		0 0 0	0 0 0	0 0 0	NR NR NR	NR NR NR	0 0 0
Federal ERNS list								
ERNS	TP		NR	NR	NR	NR	NR	0
State- and tribal - equiva	alent NPL							
RESPONSE	1.000		0	0	1	0	NR	1
State- and tribal - equiva	alent CERCLIS	6						
ENVIROSTOR	1.000		0	1	3	3	NR	7
State and tribal landfill and/or solid waste disposal site lists								
SWF/LF	0.500		0	0	0	NR	NR	0
State and tribal leaking	storage tank l	ists						
LUST	0.500		7	5	10	NR	NR	22

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
INDIAN LUST CPS-SLIC	0.500 0.500		0	0 0	0 2	NR NR	NR NR	0 2
State and tribal registere	ed storage tar	nk lists						
FEMA UST UST AST INDIAN UST	0.250 0.250 0.250 0.250		0 2 0 0	0 6 1 0	NR NR NR NR	NR NR NR NR	NR NR NR NR	0 8 1 0
State and tribal voluntary	y cleanup site	es						
VCP INDIAN VCP	0.500 0.500		0 0	0 0	0 0	NR NR	NR NR	0 0
State and tribal Brownfie	elds sites							
BROWNFIELDS	0.500		0	0	0	NR	NR	0
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500		0	0	0	NR	NR	0
Local Lists of Landfill / Solid Waste Disposal Sites								
WMUDS/SWAT SWRCY HAULERS INDIAN ODI DEBRIS REGION 9 ODI IHS OPEN DUMPS	0.500 0.500 TP 0.500 0.500 0.500 0.500		0 1 NR 0 0 0	0 1 NR 0 0 0	0 0 NR 0 0 0	NR NR NR NR NR NR	NR NR NR NR NR NR	0 2 0 0 0 0
Local Lists of Hazardous Contaminated Sites	s waste /							
US HIST CDL HIST Cal-Sites SCH CDL CERS HAZ WASTE Toxic Pits US CDL	TP 1.000 0.250 TP 0.250 1.000 TP	2	NR 0 0 NR 8 0 NR	NR 0 0 NR 4 0 NR	NR 0 NR NR NR 0 NR	NR 1 NR NR NR 0 NR	NR NR NR NR NR NR	0 1 0 0 14 0
Local Lists of Registered Storage Tanks								
SWEEPS UST HIST UST CERS TANKS CA FID UST	0.250 0.250 0.250 0.250		4 14 2 3	5 7 4 5	NR NR NR NR	NR NR NR NR	NR NR NR NR	9 21 6 8
Local Land Records								
LIENS LIENS 2	TP TP		NR NR	NR NR	NR NR	NR NR	NR NR	0 0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
DEED	0.500		0	0	1	NR	NR	1
Records of Emergency F		rts						
HMIRS CHMIRS LDS MCS SPILLS 90	TP TP TP TP TP		NR NR NR NR NR	NR NR NR NR NR	NR NR NR NR NR	NR NR NR NR NR	NR NR NR NR NR	0 0 0 0
Other Ascertainable Rec	ords							
RCRA NonGen / NLR FUDS DOD SCRD DRYCLEANERS US FIN ASSUR EPA WATCH LIST 2020 COR ACTION TSCA TRIS SSTS ROD RMP RAATS PRP PADS ICIS FTTS MLTS COAL ASH DOE COAL ASH EPA PCB TRANSFORMER RADINFO HIST FTTS DOT OPS CONSENT INDIAN RESERV FUSRAP UMTRA LEAD SMELTERS US AIRS US MINES ABANDONED MINES FINDS UXO DOCKET HWC ECHO FUELS PROGRAM CA BOND EXP. PLAN	0.250 1.000 1.000 1.000 0.500 TP TP 0.250 TP TP 1.000 TP	2	0 0 0 0 0 RR 0 RR R 0 RR RR RR RR 0 RR RR	1 0 0 0 RR 0 RR 0 RR RR RR RR O RR RR O O O O	$N \circ \circ \circ RRRRRRRRRRRRRRRRRRR \circ SRRRRRRRRRR$	N O O R R R R R R O R R R R R R R R R R	N N N N N N N N N N N N N N N N N N N	1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
Cortese CUPA Listings DRYCLEANERS	0.500 0.250 0.250	2	1 5 0	0 6 0	1 NR NR	NR NR NR	NR NR NR	2 13 0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
EMI ENF Financial Assurance HAZNET ICE HIST CORTESE HWP HWT MINES MWMP NPDES PEST LIC PROC Notify 65 UIC UIC GEO WASTEWATER PITS WDS MILITARY PRIV SITES PROJECT WDR CIWQS CERS WIP NON-CASE INFO OTHER OIL GAS PROD WATER PONDS SAMPLING POINT	TP TP TP TP 0.500 1.000 0.250 0.250 0.250 TP TP 0.500 1.000 TP	2	NR R R R S O O O O R R O O R R O R R R R	NR R R R 4 0 0 0 0 R R 0 0 R R 0 R R R R	NR R R R A O R R R R R O O R R O R R R R	R R R R R O R R R R R A R R R R R R R R	N N N N N N N N N N N N N N N N N N N	0 0 0 0 0 13 0 0 0 0 0 0 0 0 0 0 0 0 0 0
WELL STIM PROJ EDR HIGH RISK HISTORICA	TP		NR	NR	NR	NR	NR	0
EDR Exclusive Records								
EDR MGP EDR Hist Auto EDR Hist Cleaner	1.000 0.125 0.125		0 5 0	0 NR NR	0 NR NR	1 NR NR	NR NR NR	1 5 0
EDR RECOVERED GOVERNMENT ARCHIVES								
Exclusive Recovered Govt. Archives								
RGA LF RGA LUST	TP TP	1	NR NR	NR NR	NR NR	NR NR	NR NR	1 0
- Totals		11	59	51	22	6	0	149

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

Α1 **MADERA AUTO TIRES & REPAIRS** CERS HAZ WASTE \$119002567 **Target** 610 N E ST STE 112 **CUPA Listings** N/A

MADERA, CA 93638 **Property CERS**

Site 1 of 12 in cluster A

CERS HAZ WASTE: Actual:

273 ft. Site ID: 360924 CERS ID: 10650358

> CERS Description: Hazardous Waste Generator

Violations:

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

22 CCR 15 66265.174 - California Code of Regulations, Title 22, Citation:

Chapter 15, Section(s) 66265.174

Violation Description: Failure to inspect hazardous waste storage areas at least weekly. Returned to compliance on 03/30/2016. HW14: Make sure containers are Violation Notes:

inspected weekly: with no oil residues around barrels or on the

Violation Division: Madera County Environmental Health

Violation Program: HW **CERS** Violation Source:

Site ID: 360924

Madera Auto Tires & Repairs Site Name:

Violation Date: 02-29-2016

Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

6.95. Section(s) 25505(a)(4)

Violation Description: Failure to provide initial and annual training to all employees in

safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training

records for a minimum of three years.

Violation Notes: Returned to compliance on 03/30/2016. HM10B: Cesar Ortiz is the only

employee currently, he needs to be familiar with SDS for all chemicals on site, how to properly clean up a spill with the correct personal

protective equipment, needs to be familiar with the Emergency Response

Violation Division: Madera County Environmental Health

Violation Program: **HMRRP CERS** Violation Source:

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: 22 CCR 16 66266.81(a)(1) - California Code of Regulations, Title 22,

Chapter 16, Section(s) 66266.81(a)(1)

Violation Description: Failure to meet hazardous waste requirements, as a generator, when

handling, storing, and transporting more than 10 lead acid batteries

at any one time.

Violation Notes: Returned to compliance on 03/30/2016. HW26: Make sure to label all

spent lead acid batteries with date since first spent.

Violation Division: Madera County Environmental Health

Violation Program: HW **CERS** Violation Source:

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA AUTO TIRES & REPAIRS (Continued)

S119002567

EDR ID Number

Citation: 22 CCR 12 66262.23(a) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.23(a)

Violation Description: Failure to properly complete the Hazardous Waste manifest.

Violation Notes: Returned to compliance on 03/30/2016. HW05: Need to observe manifests

from 2013, 2014, & 2015 & 2016.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: 22 CCR 15 66265.173 - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.173

Violation Description: Failure to properly close hazardous waste containers when not in

active use.

Violation Notes: Returned to compliance on 03/30/2016. HW12: Make sure oil filter 55 G

drum tank is closed at all times.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: HSC 6.95 25508.1(a)-(e) - California Health and Safety Code, Chapter

6.95, Section(s) 25508.1(a)-(e)

Violation Description: Failure to electronically update business plan within 30 days of any

one of the following events: A 100 percent or more increase in the quantity of a previously disclosed material. Any handling of a previously undisclosed hazardous materials at or above reportable quantities. A change of business address, business ownership, or

business name.

Violation Notes: Returned to compliance on 03/30/2016. HM03: Observed: Waste Oil: 55 G

drum tank Transmission Fluid: 55 G Drum tank Used Oil Filters: 55 G Drum tank Used Antifreeze: 55 G Drum tank. Need to update Inventory

List on CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: 22 CCR 15 66265.52 - California Code of Regulations, Title 22, Chapter

15, Section(s) 66265.52

Violation Description: Failure to include all of the following in the Contingency Plan: 1) A

description of actions the facility personnel shall take response to fires, explosions, or any unplanned sudden or non-sudden release of hazardous waste or hazardous waste constituents to air, soil, or surface water at the facility; 2) The plan shall describe arrangements agreed to by local police departments, fire departments, hospitals, contractors, and State and local emergency response teams to coordinate emergency services; 3) The plan shall list names, addresses, and phone numbers (office and home) of all persons qualified to act as emergency coordinator and this list shall be kept up to date. Where more than one person is listed, one shall be named

Direction Distance Elevation

ion Site Database(s) EPA ID Number

MADERA AUTO TIRES & REPAIRS (Continued)

S119002567

EDR ID Number

as primary emergency coordinator and others shall be listed in the order in which they will assume responsibility as alternates; 4) The plan shall include a list of all emergency equipment at the facility (such as fire extinguishing systems, spill control equipment, communications and alarm systems (internal and external), and decontamination equipment), where this equipment is required. This list shall be kept up to date. In addition, the plan shall include the location and a physical description of each item on the list, and a brief outline of its capabilities; 5) The plan shall include an evacuation plan for facility personnel where there is a possibility that evacuation could be necessary. This plan shall describe signal(s) to be used to begin evacuation, evacuation routes, and alternate evacuation routes (in cases where the primary routes could be blocked by releases of hazardous waste or fires). 6) The plan shall include the current telephone number of the California Emergency Management Agency; and 7) If the owner or operator has already prepared a Spill Prevention, Control, and Countermeasures (SPCC) or some other emergency or contingency plan, the owner or operator need only amend that plan to incorporate hazardous waste management provisions that are sufficient to comply with the re

Violation Notes: Returned to compliance on 03/30/2016. HW03: Need to post contingency

plan near phone. Corrected on Site 02/29/16

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 03/30/2016. HW26: Make sure all hazardous

waste labels have the correct EPA ID#. For used oil the accumulation start date begins when 27 G are reached. For the antifreeze the

accumulation start date begins with the first drop of oil.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 02-29-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 02-29-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA AUTO TIRES & REPAIRS (Continued)

S119002567

EDR ID Number

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 03-31-2016

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Enforcement Action:

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Site Address: 610 N E ST STE 112

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 02-29-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HMRRP Enf Action Source: CERS

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Site Address: 610 N E ST STE 112

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 02-29-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Affiliation:

Affiliation Type Desc: Document Preparer

Entity Name: Cesar Ortiz Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer

Entity Name: Cesar Ortiz
Entity Title: Owner
Affiliation Address: Not reported

Direction Distance Elevation

vation Site Database(s) EPA ID Number

MADERA AUTO TIRES & REPAIRS (Continued)

S119002567

EDR ID Number

Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 675-7823

Affiliation Type Desc:

Entity Name:

Entity Title:

Affiliation Address:

Legal Owner

Cesar Ortiz

Not reported

610 N E St Ste 112

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 93638
Affiliation Phone: (559) 674-1515

Affiliation Type Desc: Operator **Entity Name:** Cesar Ortiz Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported (559) 363-0886 Affiliation Phone:

Affiliation Type Desc: Environmental Contact

Entity Name: Cesar Ortiz
Entity Title: Not reported
Affiliation Address: 610 N E St Ste 112

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93638

Affiliation Phone: (559) 674-1515

Affiliation Type Desc: Facility Mailing Address

Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 610 N E St Ste 112

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation

MAP FINDINGS Map ID

Direction Distance

Elevation Site Database(s) **EPA ID Number**

MADERA AUTO TIRES & REPAIRS (Continued)

S119002567

EDR ID Number

Entity Name: Madera Auto Tires & Repairs

Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

CUPA MADERA:

Cesar Ortiz Contact Name: MADERA Region: Facility Id: FA0103688 Contact Phone: 5596741515

Detail:

FA0103688 Facility Id: Common Name: Transimission Fluid

Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1 2111

PE1:

Decode for c status: Not reported

FA0103688 Facility Id: Common Name: Used Antifreeze

Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111 Not reported Decode for c status:

Facility Id: FA0103688 Common Name: Used Oil **Current Status:**

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111

Decode for c status: Not reported

Facility Id: FA0103688

Common Name: Used Oil Filters (Drained)

Current Status:

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111 Decode for c status: Not reported

CERS TANKS:

360924 Site ID: 10650358 CERS ID:

CERS Description: Chemical Storage Facilities

Violations:

Site ID: 360924

Madera Auto Tires & Repairs Site Name:

Violation Date: 02-29-2016

Citation: 22 CCR 15 66265.174 - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.174

Map ID MAP FINDINGS
Direction

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

MADERA AUTO TIRES & REPAIRS (Continued)

S119002567

Violation Description: Failure to inspect hazardous waste storage areas at least weekly.

Violation Notes: Returned to compliance on 03/30/2016. HW14: Make sure containers are

inspected weekly: with no oil residues around barrels or on the

surfaces.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

6.95, Section(s) 25505(a)(4)

Violation Description: Failure to provide initial and annual training to all employees in

safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training

records for a minimum of three years.

Violation Notes: Returned to compliance on 03/30/2016. HM10B: Cesar Ortiz is the only

employee currently, he needs to be familiar with SDS for all chemicals on site, how to properly clean up a spill with the correct personal

protective equipment, needs to be familiar with the Emergency Response

Plan.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: 22 CCR 16 66266.81(a)(1) - California Code of Regulations, Title 22,

Chapter 16, Section(s) 66266.81(a)(1)

Violation Description: Failure to meet hazardous waste requirements, as a generator, when

handling, storing, and transporting more than 10 lead acid batteries

at any one time.

Violation Notes: Returned to compliance on 03/30/2016. HW26: Make sure to label all

spent lead acid batteries with date since first spent.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: 22 CCR 12 66262.23(a) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.23(a)

Violation Description: Failure to properly complete the Hazardous Waste manifest.

Violation Notes: Returned to compliance on 03/30/2016. HW05: Need to observe manifests

from 2013, 2014, & 2015 & 2016.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: 22 CCR 15 66265.173 - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.173

Map ID MAP FINDINGS
Direction

Distance Flevation Site

Elevation Site Database(s) EPA ID Number

MADERA AUTO TIRES & REPAIRS (Continued)

S119002567

EDR ID Number

Violation Description: Failure to properly close hazardous waste containers when not in

active use.

Violation Notes: Returned to compliance on 03/30/2016. HW12: Make sure oil filter 55 G

drum tank is closed at all times.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: HSC 6.95 25508.1(a)-(e) - California Health and Safety Code, Chapter

6.95, Section(s) 25508.1(a)-(e)

Violation Description: Failure to electronically update business plan within 30 days of any

one of the following events: A 100 percent or more increase in the quantity of a previously disclosed material. Any handling of a previously undisclosed hazardous materials at or above reportable quantities. A change of business address, business ownership, or

business name.

Violation Notes: Returned to compliance on 03/30/2016. HM03: Observed: Waste Oil: 55 G

drum tank Transmission Fluid: 55 G Drum tank Used Oil Filters: 55 G Drum tank Used Antifreeze: 55 G Drum tank. Need to update Inventory

List on CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: 22 CCR 15 66265.52 - California Code of Regulations, Title 22, Chapter

15, Section(s) 66265.52

Violation Description: Failure to include all of the following in the Contingency Plan: 1) A

description of actions the facility personnel shall take response to fires, explosions, or any unplanned sudden or non-sudden release of hazardous waste or hazardous waste constituents to air, soil, or surface water at the facility; 2) The plan shall describe arrangements agreed to by local police departments, fire departments, hospitals, contractors, and State and local emergency response teams to coordinate emergency services; 3) The plan shall list names, addresses, and phone numbers (office and home) of all persons qualified to act as emergency coordinator and this list shall be kept up to date. Where more than one person is listed, one shall be named as primary emergency coordinator and others shall be listed in the order in which they will assume responsibility as alternates; 4) The plan shall include a list of all emergency equipment at the facility (such as fire extinguishing systems, spill control equipment, communications and alarm systems (internal and external), and decontamination equipment), where this equipment is required. This list shall be kept up to date. In addition, the plan shall include the location and a physical description of each item on the list, and a brief outline of its capabilities; 5) The plan shall include an evacuation plan for facility personnel where there is a possibility that evacuation could be necessary. This plan shall describe signal(s) to be used to begin evacuation, evacuation routes, and alternate

evacuation routes (in cases where the primary routes could be blocked by releases of hazardous waste or fires). 6) The plan shall include Map ID MAP FINDINGS Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA AUTO TIRES & REPAIRS (Continued)

S119002567

the current telephone number of the California Emergency Management Agency; and 7) If the owner or operator has already prepared a Spill Prevention, Control, and Countermeasures (SPCC) or some other emergency or contingency plan, the owner or operator need only amend that plan to incorporate hazardous waste management provisions that

are sufficient to comply with the re

Returned to compliance on 03/30/2016. HW03: Need to post contingency Violation Notes:

plan near phone. Corrected on Site 02/29/16

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

Violation Date: 02-29-2016

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the

generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 03/30/2016. HW26: Make sure all hazardous

waste labels have the correct EPA ID#. For used oil the accumulation start date begins when 27 G are reached. For the antifreeze the

accumulation start date begins with the first drop of oil.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 02-29-2016

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

HMRRP Eval Program: Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 02-29-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW **Eval Source: CERS**

Eval General Type: Other/Unknown Eval Date: 03-31-2016

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Madera County Environmental Health **Eval Division:**

Eval Program: **HMRRP Eval Source: CERS**

MAP FINDINGS Map ID

Direction Distance

Elevation Site Database(s) **EPA ID Number**

MADERA AUTO TIRES & REPAIRS (Continued)

S119002567

EDR ID Number

Enforcement Action:

Site ID: 360924

Site Name: Madera Auto Tires & Repairs Site Address: 610 N E ST STE 112

Site City: **MADERA** Site Zip: 93638 Enf Action Date: 02-29-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP CERS** Enf Action Source:

Site ID: 360924

Site Name: Madera Auto Tires & Repairs

610 N E ST STE 112 Site Address:

Site City: **MADERA** Site Zip: 93638 Enf Action Date: 02-29-2016

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

HW Enf Action Program: Enf Action Source: **CERS**

Affiliation:

Affiliation Type Desc: **Document Preparer**

Entity Name: Cesar Ortiz Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer

Entity Name: Cesar Ortiz Entity Title: Owner Affiliation Address: Not reported Not reported Affiliation City: Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: **CUPA District**

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA AUTO TIRES & REPAIRS (Continued)

S119002567

EDR ID Number

Affiliation Phone: (559) 675-7823

Affiliation Type Desc:

Entity Name:

Entity Title:

Affiliation Address:

Legal Owner

Cesar Ortiz

Not reported

610 N E St Ste 112

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 674-1515

Affiliation Type Desc: Operator Entity Name: Cesar Ortiz Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: (559) 363-0886

Affiliation Type Desc: Environmental Contact

Entity Name: Cesar Ortiz
Entity Title: Not reported
Affiliation Address: 610 N E St Ste 112

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93638

Affiliation Phone: (559) 674-1515

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 610 N E St Ste 112

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93638
Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation

Entity Name: Madera Auto Tires & Repairs

Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

MAP FINDINGS Map ID

Direction Distance

Elevation Site Database(s) **EPA ID Number**

A2 MADERA AUTO TIRES & REPAIRS FINDS 1024630523 **ECHO** N/A

Target 610 N E ST STE 112 MADERA, CA 93638 **Property**

Site 2 of 12 in cluster A

Actual: 273 ft.

FINDS:

110070418910 Registry ID:

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1024630523 Registry ID: 110070418910

DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110070418910

A3 SCHOETTLER TIRE INC. **Target 401 NORTH E**

MADERA, CA **Property**

Site 3 of 12 in cluster A

Actual: 273 ft.

RGA LF:

SCHOETTLER TIRE INC. 401 NORTH E 2004 2003 SCHOETTLER TIRE INC. 401 NORTH E SCHOETTLER TIRE INC. 401 NORTH E 2002 2001 SCHOETTLER TIRE INC. 401 NORTH E 2000 SCHOETTLER TIRE INC. 401 NORTH E 1997 SCHOETTLER TIRE INC. 401 NORTH E

Α4 ANDY'S TRANSMISSION SHOP **Target** 425 N E ST

MADERA, CA 93638 **Property**

Site 4 of 12 in cluster A

Actual: 273 ft.

FINDS:

Registry ID: 110065265581

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

RGA LF

FINDS

ECHO

S114732485

1023238918

N/A

N/A

EDR ID Number

Direction Distance

EDR ID Number Elevation **EPA ID Number** Site Database(s)

ANDY'S TRANSMISSION SHOP (Continued)

1023238918

CERS

N/A

STATE MASTER

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

1023238918 Envid: Registry ID: 110065265581

DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110065265581

ANDY'S TRANSMISSION SHOP CERS HAZ WASTE \$121788635

Target 425 N E ST **Property MADERA, CA 93638**

Site 5 of 12 in cluster A

CERS HAZ WASTE: Actual:

273 ft.

Site ID: 5874 CERS ID: 10426282

CERS Description: Hazardous Waste Generator

Violations:

Site ID: 5874

Site Name: ANDY'S TRANSMISSION SHOP

Violation Date: 06-27-2017

40 CFR 1 265.173 - U.S. Code of Federal Regulations, Title 40, Chapter Citation:

1, Section(s) 265.173

Violation Description: Failure to meet the following container management requirements: (a) A

container holding hazardous waste must always be closed during storage, except when it is necessary to add or remove waste. (b) A container holding hazardous waste must not be opened, handled, or stored in a manner which may rupture the container or cause it to

leak.

Violation Notes: Returned to compliance on 06/27/2017. HW12: Used oil 55 G drum

containers on site (X2) were not actively being used and had funnels through opening. Container @ 55 G for oil filters did not have

removable lid. Containers shall be closed except when adding/removing

waste. Corrected on site.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 5874

Site Name: ANDY'S TRANSMISSION SHOP

Violation Date: 06-27-2017

40 CFR 1 265.174 - U.S. Code of Federal Regulations, Title 40, Chapter Citation:

1, Section(s) 265.174

Violation Description: Failure to inspect hazardous waste storage areas at least weekly and

look for leaking and deteriorating containers.

Violation Notes: Returned to compliance on 11/30/2017. HW14: Areas around hazardous

waste containers are surrounded by sharp scrap metal/ metal parts, personnel must inspect areas weekly for any hazards involving leaks &

spills that can potentially occur. Inspect containers weekly,

responding immediately to any spills & minimizing hazards. Provide pictures of clean and non-hazardous secondary containment area.

Violation Division: Madera County Environmental Health

Violation Program: HW Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s)

ANDY'S TRANSMISSION SHOP (Continued)

S121788635

EDR ID Number

EPA ID Number

Violation Source: CERS

Site ID: 5874

Site Name: ANDY'S TRANSMISSION SHOP

Violation Date: 06-27-2017

Citation: 22 CCR 12 66262.40(a) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.40(a)

Violation Description: Failure to keep a copy of each properly signed manifest for at least

three years from the date the waste was accepted by the initial transporter. The manifest signed at the time the waste was accepted for transport shall be kept until receiving a signed copy from the

designated facility which received the waste.

Violation Notes: Returned to compliance on 11/30/2017. HW05: No manifests were

observed; provide all manifests for the past 3 years (2014-2017).

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 5874

Site Name: ANDY'S TRANSMISSION SHOP

Violation Date: 06-27-2017

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain an Identification Number prior to treating, storing,

disposing of, transporting or offering for transportation any

hazardous waste.

Violation Notes: Returned to compliance on 06/27/2017. HW01: Reactivate EPA ID#.

Operator signed DTSC form 1358, inspector emailed form to DTSC.

Corrected on Site.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 5874

Site Name: ANDY'S TRANSMISSION SHOP

Violation Date: 06-27-2017

Citation: 22 CCR 12 66262.34(e) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(e)

Violation Description: Failed to meet the conditions of satellite accumulation regulations,

including but not limited to the following: accumulate up to 55

gallons of hazardous waste or one quart of acute hazardous waste at or near the initial point of accumulation which was under the control of the operator the container must be clearly marked with the initial date that hazardous waste is first placed in the container and labelled with the words Hazardous Waste including specified information container must be labelled with the date the satellite accumulation limit is reached and moved within three days after reaching the 55 gallon (or one quart) limit to a 90 day accumulation area 55 gallons (or one quart of acute hazardous waste) of waste per process may be accumulated Total time hazardous waste can be accumulated onsite in any generator accumulation area is one year, i.e., the combined accumulation time at a satellite accumulation point and at a 90/180/270 accumulation area (depending on size of generator

and distance transported), whichever comes first.

Violation Notes: Returned to compliance on 11/30/2017. ***Facility failed to meet the

conditions of satellite accumulation regulations. Label all 5 gallon bucket satellite accumulation areas containing used oil throughout

Direction Distance

EDR ID Number Elevation **EPA ID Number** Site Database(s)

ANDY'S TRANSMISSION SHOP (Continued)

S121788635

facility. It is recommended to label them as: Satellite Accumulation Area, Hazardous Waste, Used Oil, Emptied Out Weekly. 22 CCR 12

66262.34(e) (Minor Violation)

Violation Division: Madera County Environmental Health

Violation Program: HW **CERS** Violation Source:

Site ID: 5874

ANDY'S TRANSMISSION SHOP Site Name:

Violation Date: 06-27-2017

22 CCR 12 66262.34(f) - California Code of Regulations, Title 22, Citation:

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers and

portable tanks with the following requirements: "Hazardous Waste",

name and address of the generator, physical and chemical

characteristics of the Hazardous Waste, and starting accumulation

date.

Returned to compliance on 11/30/2017. HW 26: Facility used one Violation Notes:

> hazardous waste label for both used oil containers. Oil filters @ 55G drum tank had no HW label. Properly label each individual container.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 5874

Site Name: ANDY'S TRANSMISSION SHOP

Violation Date: 06-27-2017

Citation: 40 CFR 1 262.34(d)(5)(ii) - U.S. Code of Federal Regulations, Title

40, Chapter 1, Section(s) 262.34(d)(5)(ii)

Failure to post the following information next to the telephone: (A) Violation Description:

The name and telephone number of the emergency coordinator; (B) Location of fire extinguishers and spill control material, and, if present, fire alarm; and (C) The telephone number of the fire

department, unless the facility has a direct alarm.

Violation Notes: Returned to compliance on 11/30/2017. HW03: Create & post contingency

plan where all personnel can see. Operator mentioned that facility has expanded in last 3 months (Since April 2017). Provide pictures of new

updated contingency plan.

Violation Division: Madera County Environmental Health

Violation Program: ΗW Violation Source: **CERS**

Evaluation:

Eval General Type: Compliance Evaluation Inspection

06-27-2017 Eval Date: Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Madera County Environmental Health **Eval Division:**

Eval Program: HW **Eval Source: CERS**

Eval General Type: Compliance Evaluation Inspection

11-30-2017 Eval Date:

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

ANDY'S TRANSMISSION SHOP (Continued)

S121788635

EDR ID Number

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Enforcement Action:

Site ID: 5874

Site Name: ANDY'S TRANSMISSION SHOP

 Site Address:
 425 N E ST

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 06-27-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Coordinates:

Site ID: 5874

Facility Name: ANDY'S TRANSMISSION SHOP

Env Int Type Code: HWG
Program ID: 10426282
Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.964940 Longitude: -120.062620

Affiliation:

Affiliation Type Desc: Environmental Contact

Entity Name: ANDY LOPEZ
Entity Title: Not reported
Affiliation Address: 425 N "E" STREET

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported

Affiliation Zip: 93638
Affiliation Phone: (559) 673-1778

Identification Signer Affiliation Type Desc: Entity Name: ANDY LOPEZ Entity Title: **OWNER** Not reported Affiliation Address: Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported

Distance

Elevation Site Database(s) EPA ID Number

ANDY'S TRANSMISSION SHOP (Continued)

S121788635

EDR ID Number

Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: **Document Preparer** ANDY LOPEZ **Entity Name:** Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc:

Entity Name:

Entity Title:

Affiliation Address:

Legal Owner

LOPEZ, ANDY

Not reported

425 N "E" STREET

Affiliation City: MADERA

Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 673-1778

Affiliation Type Desc: Operator ANDY LOPEZ **Entity Name:** Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 408-0960

Affiliation Type Desc: Facility Mailing Address

Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 425 N E ST
Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported

Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation

Entity Name: ANDY'S TRANSMISSION SHOP

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Map ID MAP FINDINGS
Direction

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

A6 ANDY'S TRANSMISSION SHOP CUPA Listings S123302102

Target 425 E N/A

Property MADERA, CA

Site 6 of 12 in cluster A

Actual: CUPA MADERA: Contact Name:

Contact Name: LOPEZ, ANDY
Region: MADERA
Facility Id: FA0102839
Contact Phone: 5596731778

Detail:

Facility Id: FA0102839

Common Name: WASTE TRANSMISSION FILTERS

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165
Decode for c status: Not reported

Facility Id: FA0102839

Common Name: WASTE TRANSMISSION OIL

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165
Decode for c status: Not reported

SINAI AUTO REPAIR CERS HAZ WASTE S121746981
401 N E ST STE N CERS N/A

401 N E ST STE N MADERA, CA 93638

< 1/8 1 ft.

Α7

Site 7 of 12 in cluster A

Relative: CERS HAZ WASTE:

 Lower
 Site ID:
 153795

 Actual:
 CERS ID:
 10425367

272 ft. CERS Description: Hazardous Waste Generator

Violations:

Site ID: 153795

Site Name: SINAI AUTO REPAIR

Violation Date: 02-20-2015

Citation: 22 CCR 15 66265.53 - California Code of Regulations, Title 22, Chapter

15, Section(s) 66265.53

Violation Description: Failure to maintain at the facility a copy of the contingency plan and

all its revisions and to submit a copy to the local police departments, fire departments, hospitals, and State and local

emergency response teams that may be called upon to provide emergency

services.

Violation Notes: Returned to compliance on 02/20/2015.
Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 153795

Site Name: SINAI AUTO REPAIR

Violation Date: 02-20-2015

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain and/or maintain an Active EPA ID.

Direction Distance Elevation

tion Site Database(s) EPA ID Number

SINAI AUTO REPAIR (Continued)

S121746981

EDR ID Number

Violation Notes: Returned to compliance on 03/25/2015. Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 153795

Site Name: SINAI AUTO REPAIR

Violation Date: 02-20-2015

Citation: 40 CFR 1 265.173 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.173

Violation Description: Failure to properly close hazardous waste containers when not in

active use.

Violation Notes: Returned to compliance on 03/25/2015.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 153795

Site Name: SINAI AUTO REPAIR

Violation Date: 02-20-2015

Citation: 40 CFR 1 265.171 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.171

Violation Description: Failure to accumulate hazardous waste in a container that is in good

condition.

Violation Notes: Returned to compliance on 03/25/2015.
Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 153795

Site Name: SINAI AUTO REPAIR

Violation Date: 02-20-2015

Citation: 22 CCR 12 66262.40(a) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.40(a)

Violation Description: Failure to maintain uniform hazardous waste manifest, consolidated

manifest, or bills of lading copies for three years.

Violation Notes: Returned to compliance on 03/25/2015.
Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 153795

Site Name: SINAI AUTO REPAIR

Violation Date: 02-20-2015

Citation: 40 CFR 1 265.201(c)(5) - U.S. Code of Federal Regulations, Title 40,

Chapter 1, Section(s) 265.201(c)(5)

Violation Description: Failure to conduct weekly inspections of the construction materials,

fixtures, and surrounding areas of the hazardous waste tanks.

Violation Notes: Returned to compliance on 03/25/2015.
Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 02-20-2015 Violations Found: Yes

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SINAI AUTO REPAIR (Continued)

S121746981

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW **Eval Source: CERS**

Other/Unknown Eval General Type: Eval Date: 03-24-2015

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Madera County Environmental Health **Eval Division:**

Eval Program: HW **Eval Source: CERS**

Enforcement Action:

Site ID: 153795

Site Name: SINAI AUTO REPAIR Site Address: 401 N E ST STE N

Site City: MADERA Site Zip: 93638 Enf Action Date: 02-20-2015

Enf Action Type: Notice of Violation (Unified Program)

Notice of Violation Issued by the Inspector at the Time of Inspection Enf Action Description:

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW Enf Action Source: **CERS**

Affiliation:

Affiliation Type Desc: **Document Preparer Entity Name:** PAULINO SILVA Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: **Environmental Contact**

Entity Name: Paulino Silva Entity Title: Not reported

Affiliation Address: 1224 OWENS STREET

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93638 Affiliation Phone: (559) 474-5610

Affiliation Type Desc: **CUPA** District

Madera County Env Health **Entity Name:**

Entity Title: Not reported

200 W. 4th StreetSuite 3100 Affiliation Address:

Affiliation City: Madera Affiliation State: CA

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SINAI AUTO REPAIR (Continued)

S121746981

Affiliation Country: Not reported 93637 Affiliation Zip: Affiliation Phone: (559) 675-7823

Parent Corporation Affiliation Type Desc: SINAI AUTO REPAIR Entity Name:

Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address **Entity Name:** Mailing Address

Entity Title: Not reported

Affiliation Address: 401 N "E" ST, Suite N

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93638 Affiliation Phone: Not reported

Identification Signer Affiliation Type Desc: Entity Name: PAULINA SILVA Entity Title: **OWNER** Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner Entity Name: SILVA, PAULINO Entity Title: Not reported Affiliation Address: 401 N E ST N Affiliation City: MADERA Affiliation State: CA

United States Affiliation Country: Affiliation Zip: 93638

Affiliation Phone: (559) 474-5610

Affiliation Type Desc: Operator Entity Name: Paulino Silva **Entity Title:** Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Not reported Affiliation Country: Affiliation Zip: Not reported Affiliation Phone: (559) 474-5610

Direction Distance

Distance EDR ID Number
Elevation Site EPA ID Number

A8 MARTINS ELECTRICAL&AUTO REPAIR CERS HAZ WASTE S121786309
401 N E ST STE C CERS N/A

< 1/8 MADERA, CA 93638 1 ft.

Site 8 of 12 in cluster A

Relative: CERS HAZ WASTE:

 Lower
 Site ID:
 46933

 Actual:
 CERS ID:
 10471105

272 ft. CERS Description: Hazardous Waste Generator

Violations:

Site ID: 46933

Site Name: MARTINS ELECTRICAL&AUTO REPAIR

Violation Date: 07-27-2017

Citation: 40 CFR 1 265.174 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.174

Violation Description: Failure to inspect hazardous waste storage areas at least weekly and

look for leaking and deteriorating containers.

Violation Notes: Returned to compliance on 11/30/2017. Containers and area around

containers should be inspected for spills. Oil spill was observed in secondary containment area, which is a potential corrosion hazard. Personnel must be trained on inspecting for oil spills and potential

oil spills on site & respond to immediately.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 46933

Site Name: MARTINS ELECTRICAL&AUTO REPAIR

Violation Date: 07-27-2017

Citation: 40 CFR 1 265.173 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.173

Violation Description: Failure to meet the following container management requirements: (a) A

container holding hazardous waste must always be closed during storage, except when it is necessary to add or remove waste. (b) A container holding hazardous waste must not be opened, handled, or stored in a manner which may rupture the container or cause it to

leak.

Violation Notes: Returned to compliance on 11/30/2017. Antifreeze waste and used motor

waste 55 gallon drum containers need to be closed except when adding or removing waste. Perforated holes were observed on removable lids for these containers. Even though containers are secondary contained,

must provide leak proof containers. Madera County Environmental Health

Violation Division: Madera County Environment Violation Program: HW

Violation Source: CERS

Site ID: 46933

Site Name: MARTINS ELECTRICAL&AUTO REPAIR

Violation Date: 07-27-2017

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers and

portable tanks with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical

characteristics of the Hazardous Waste, and starting accumulation

date.

Violation Notes: Returned to compliance on 07/27/2017. Properly label antifreeze waste

container at 55 gallon oil filter (used) container at 55 gallons

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

MARTINS ELECTRICAL&AUTO REPAIR (Continued)

S121786309

EDR ID Number

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 46933

Site Name: MARTINS ELECTRICAL&AUTO REPAIR

Violation Date: 07-27-2017

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain an Identification Number prior to treating, storing,

disposing of, transporting or offering for transportation any

hazardous waste.

Violation Notes: Returned to compliance on 07/27/2017. Reactivate EPA ID# and provide

proof. Corrected on Site

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 46933

Site Name: MARTINS ELECTRICAL&AUTO REPAIR

Violation Date: 07-27-2017

Citation: 40 CFR 1 265.32 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.32

Violation Description: Failure of the facility to maintain the following emergency equipment

or equivalents: 1) An internal communications or alarm system; 2) A device, such as a telephone (immediately available at the scene of Operations/ Maintenance) or a hand-held two-way radio, capable of summoning emergency assistance from local police departments, fire departments, or State or local emergency response teams; 3) Portable fire extinguishers, fire control equipment, spill control equipment, and decontamination equipment; and 4) Water at adequate volume and pressure to supply water hose streams, or foam producing equipment, or

automatic sprinklers, or water spray systems.

Violation Notes: Returned to compliance on 07/27/2017. Create and post contingency plan

where personnel can see. Include the emergency contact name and phone

number, fire department number, location of fire extinguishers and

spill equipment. Corrected on Site

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 46933

Site Name: MARTINS ELECTRICAL&AUTO REPAIR

Violation Date: 07-27-2017

Citation: HSC 6.5 25123.3(h)(1)(c) - California Health and Safety Code, Chapter

6.5, Section(s) 25123.3(h)(1)(c)

Violation Description: Failure to send hazardous waste offsite for treatment, storage, or

disposal of acute/extremely hazardous waste after the first 1-kilogram threshold amount was accumulated within a 90 day period.

Violation Notes: Returned to compliance on 11/30/2017. No manifests for oil-filters

pick-up were observed. Label on oil filters indicated last time it was picked up was in 2015. Observed 55 gallon drum container full of oil filters, these filters must be picked up. Provide manifest for over a year in 2015. Two consecutive pick-up dates observed were the

following. 08/31/15 & 11/23/16.

Violation Division: Madera County Environmental Health

Violation Program: HW

Direction Distance

Elevation Site Database(s) EPA ID Number

MARTINS ELECTRICAL&AUTO REPAIR (Continued)

S121786309

EDR ID Number

Violation Source:

CERS

Evaluation:

Eval General Type: Other/Unknown
Eval Date: 11-30-2017

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 07-27-2017

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Enforcement Action:

Site ID: 46933

Site Name: MARTINS ELECTRICAL&AUTO REPAIR

Site Address: 401 N E ST STE C

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 07-27-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 46933

Site Name: MARTINS ELECTRICAL&AUTO REPAIR

Site Address: 401 N E ST STE C

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 11-22-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Affiliation:

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported

Map ID MAP FINDINGS
Direction

Distance Elevation Sit

Site Database(s) EPA ID Number

MARTINS ELECTRICAL&AUTO REPAIR (Continued)

S121786309

EDR ID Number

Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Environmental Contact
Entity Name: MARTIN GALVAN
Entity Title: Not reported
Affiliation Address: 401 N E St Ste C

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: (559) 474-5679

Affiliation Type Desc: Facility Mailing Address

Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 401 N E St Ste C

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: Not reported

Affiliation Type Desc:
Entity Name:
Entity Title:
Affiliation Address:
Legal Owner
MARTIN GALVAN
Not reported
401 N E St Ste C

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 474-5679

Affiliation Type Desc: Operator

MARTIN GALVAN Entity Name: Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 474-5679

Document Preparer Affiliation Type Desc: Entity Name: MARTIN GALVAN Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer Entity Name: MARTIN GALVAN

Entity Title: Owner
Affiliation Address: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

MARTINS ELECTRICAL&AUTO REPAIR (Continued)

S121786309

Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation

Entity Name: MARTINS ELECTRICAL&AUTO REPAIR

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Not reported

Not reported

Not reported

Not reported

Not reported

A9 D & F BODY & PAINT CERS HAZ WASTE S121738779
401 N E ST CERS N/A

< 1/8 MADERA, CA 93638

1 ft.

Site 9 of 12 in cluster A

Relative: CERS HAZ WASTE:

 Lower
 Site ID:
 109881

 Actual:
 CERS ID:
 10425385

272 ft. CERS Description: Hazardous Waste Generator

Violations:

Site ID: 109881

Site Name: D & F BODY & PAINT

Violation Date: 04-02-2015

Citation: 40 CFR 1 265.173 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.173

Violation Description: Failure to properly close hazardous waste containers when not in

active use.

Violation Notes: Returned to compliance on 04/03/2015.
Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 04-02-2015 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Enforcement Action:

Site ID: 109881

Site Name: D & F BODY & PAINT

 Site Address:
 401 N E ST

 Site City:
 MADERA

 Site Zip:
 93638

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

D & F BODY & PAINT (Continued)

S121738779

EDR ID Number

Enf Action Date: 04-02-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Affiliation:

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Operator Entity Name: DIANA ORTIZ Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: (559) 363-2823

Affiliation Type Desc: **Document Preparer** Entity Name: DIANA ORTIZ Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner
Entity Name: ORTIZ, DIANA
Entity Title: Not reported

Affiliation Address: 27349 PERKINS ROAD

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 363-2823

Affiliation Type Desc: Parent Corporation
Entity Name: D & F BODY & PAINT

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

(559) 363-2823

D & F BODY & PAINT (Continued)

Affiliation Phone:

S121738779

Affiliation Phone: Not reported

Environmental Contact Affiliation Type Desc: Entity Name: DIANA ORTIZ **Entity Title:** Not reported

Affiliation Address: 27349 PERKINS ROAD

Affiliation City: MADERA Affiliation State: CA Affiliation Country: Not reported Affiliation Zip: 93636-6

Affiliation Type Desc: Facility Mailing Address **Entity Name:** Mailing Address Entity Title: Not reported

27349 PERKINS ROAD Affiliation Address:

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637 Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer Entity Name: DIANA ORTIZ

Entity Title: **OWNER** Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

A10 **CASEY'S DISCOUNT AUTOMOTIVE CERS HAZ WASTE** S121749520 **CERS** N/A

WNW 508 N "E" ST < 1/8 **MADERA, CA 93638**

0.004 mi.

20 ft. Site 10 of 12 in cluster A **CERS HAZ WASTE:** Relative:

Higher Site ID: 16949 CERS ID: 10426297 Actual:

CERS Description: Hazardous Waste Generator 274 ft.

Violations:

Site ID: 16949

Site Name: CASEY'S DISCOUNT AUTOMOTIVE

Violation Date: 09-24-2013

22 CCR 15 66265.52 - California Code of Regulations, Title 22, Chapter Citation:

15, Section(s) 66265.52

Violation Description: Failure to include all of the following in the Contingency Plan: 1) A

description of actions the facility personnel shall take response to fires, explosions, or any unplanned sudden or non-sudden release of hazardous waste or hazardous waste constituents to air, soil, or surface water at the facility; 2) The plan shall describe arrangements agreed to by local police departments, fire departments, hospitals, contractors, and State and local emergency response teams to coordinate emergency services; 3) The plan shall list names,

Map ID MAP FINDINGS Direction

Distance

EDR ID Number Elevation **EPA ID Number** Site Database(s)

CASEY'S DISCOUNT AUTOMOTIVE (Continued)

S121749520

addresses, and phone numbers (office and home) of all persons qualified to act as emergency coordinator and this list shall be kept up to date. Where more than one person is listed, one shall be named as primary emergency coordinator and others shall be listed in the order in which they will assume responsibility as alternates; 4) The plan shall include a list of all emergency equipment at the facility (such as fire extinguishing systems, spill control equipment, communications and alarm systems (internal and external), and decontamination equipment), where this equipment is required. This list shall be kept up to date. In addition, the plan shall include the location and a physical description of each item on the list, and a brief outline of its capabilities; 5) The plan shall include an evacuation plan for facility personnel where there is a possibility that evacuation could be necessary. This plan shall describe signal(s) to be used to begin evacuation, evacuation routes, and alternate evacuation routes (in cases where the primary routes could be blocked by releases of hazardous waste or fires). 6) The plan shall include the current telephone number of the California Emergency Management Agency; and 7) If the owner or operator has already prepared a Spill Prevention, Control, and Countermeasures (SPCC) or some other emergency or contingency plan, the owner or operator need only amend that plan to incorporate hazardous waste management provisions that are sufficient to comply with the re

Violation Notes: Returned to compliance on 10/16/2013. Operator failed to post a copy

of their contingency plan next to a working phone number.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 16949

CASEY'S DISCOUNT AUTOMOTIVE Site Name:

Violation Date: 02-08-2016

22 CCR 16 66266.130 - California Code of Regulations, Title 22, Citation:

Chapter 16, Section(s) 66266.130

Violation Description: Failure to properly handle, manage, label, and recycle used oil and

fuel filters.

Returned to compliance on 02/10/2016. Make sure oil filters (used) has Violation Notes:

lid on all the time except when adding/removing waste and don't let

them drain all day.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 16949

Site Name: CASEY'S DISCOUNT AUTOMOTIVE

Violation Date: 02-08-2016

22 CCR 15 66265.171 - California Code of Regulations, Title 22, Citation:

Chapter 15, Section(s) 66265.171

Violation Description: Failure to accumulate hazardous waste in a container that is in good

condition.

Violation Notes: Returned to compliance on 02/15/2016. Make sure draining pans are not

draining over used oil tanks all day, make sure after as empty as

possible it drains, elsewhere, i.e. kitty litter, absorbent

containers.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Direction Distance

Elevation Site Database(s) EPA ID Number

CASEY'S DISCOUNT AUTOMOTIVE (Continued)

S121749520

EDR ID Number

Site ID: 16949

Site Name: CASEY'S DISCOUNT AUTOMOTIVE

Violation Date: 02-08-2016

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 02/10/2016. Make sure all containers have

been properly labeled.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 16949

Site Name: CASEY'S DISCOUNT AUTOMOTIVE

Violation Date: 09-24-2013

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the

generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date. Returned to compliance on 10/16/2013. Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Violation Notes:

Violation Division:

Site ID: 16949

Site Name: CASEY'S DISCOUNT AUTOMOTIVE

Violation Date: 02-08-2016

Citation: 22 CCR 15 66265.174 - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.174

Violation Description: Failure to inspect hazardous waste storage areas at least weekly.

Violation Notes: Returned to compliance on 02/10/2016. Make sure draining pans are not

draining over used oil tanks all day, make sure after as empty as

possible it drains, elsewhere, i.e. kitty litter, absorbent

containers.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 16949

Site Name: CASEY'S DISCOUNT AUTOMOTIVE

Violation Date: 02-08-2016

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain and/or maintain an Active EPA ID.

Violation Notes: Returned to compliance on 02/09/2016. Need to verify EPA ID number.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 16949

Site Name: CASEY'S DISCOUNT AUTOMOTIVE

Violation Date: 09-24-2013

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CASEY'S DISCOUNT AUTOMOTIVE (Continued)

S121749520

Citation: 40 CFR 1 265.173 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.173

Violation Description: Failure to properly close hazardous waste containers when not in

active use.

Violation Notes: Returned to compliance on 10/16/2013. Inspector observed 2 55 gallon

drums without lid.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 16949

CASEY'S DISCOUNT AUTOMOTIVE Site Name:

Violation Date: 02-08-2016

22 CCR 15 66265.173 - California Code of Regulations, Title 22, Citation:

Chapter 15, Section(s) 66265.173

Violation Description: Failure to properly close hazardous waste containers when not in

active use.

Violation Notes: Returned to compliance on 02/10/2016. Make sure oil filters (used) has

lid on all the time except when adding/removing waste.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 16949

Site Name: CASEY'S DISCOUNT AUTOMOTIVE

Violation Date: 02-08-2016

Citation: 22 CCR 12 66262.23(a) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.23(a)

Violation Description: Failure to properly complete the Hazardous Waste manifest.

Returned to compliance on 02/09/2016. Provide 2013-2026 Hazardous Violation Notes:

Wastes Manifests.

Violation Division: Madera County Environmental Health

Violation Program: Violation Source: **CERS**

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 02-08-2016

Violations Found: Yes

Routine done by local agency Eval Type:

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-24-2013 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Madera County Environmental Health **Eval Division:**

Eval Program: HW **Eval Source: CERS**

Enforcement Action:

Site ID: 16949

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CASEY'S DISCOUNT AUTOMOTIVE (Continued)

S121749520

CASEY'S DISCOUNT AUTOMOTIVE Site Name:

Site Address: 508 N "E" ST Site City: **MADERA** Site Zip: 93638 Enf Action Date: 02-08-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW Enf Action Source: **CERS**

Site ID: 16949

Site Name: CASEY'S DISCOUNT AUTOMOTIVE

Site Address: 508 N "E" ST Site City: **MADERA** 93638 Site Zip: Enf Action Date: 09-24-2013

Enf Action Type: Notice of Violation (Unified Program)

Notice of Violation Issued by the Inspector at the Time of Inspection Enf Action Description:

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW Enf Action Source: **CERS**

Affiliation:

Affiliation Type Desc: **Environmental Contact Entity Name:** CLARIDGE KELLY WASEM

Entity Title: Not reported

Affiliation Address: 508 NORTH "E" STREET

Affiliation City: **MADERA** Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93638

Affiliation Phone: (559) 664-0600

Affiliation Type Desc: Property Owner

Entity Name: Ruth Lyon, client of Newton Property Management Inc.

Entity Title: Not reported Affiliation Address: 1629 Howard Road

Affiliation City: Madera Affiliation State: CA

Affiliation Country: **United States**

Affiliation Zip: 93637 Affiliation Phone: (559) 673-7576

Affiliation Type Desc: **CUPA District**

Madera County Env Health **Entity Name:**

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera Affiliation State: CA Affiliation Country: Not reported Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Facility Mailing Address

Direction Distance

Elevation Site Database(s) EPA ID Number

CASEY'S DISCOUNT AUTOMOTIVE (Continued)

S121749520

EDR ID Number

Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 508 N "E" STREET

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner

Entity Name: WASEM, CLARIDGE KELLY

Entity Title: Not reported
Affiliation Address: 508 N "E" ST
Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 664-0600

Affiliation Type Desc: Operator

Entity Name: CLARIDGE KELLY WASEM

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Zip:

Affiliation Zip:

Affiliation Phone:

Not reported

Affiliation Type Desc: Parent Corporation

Entity Name: CASEY'S DISCOUNT AUTOMOTIVE

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: **Document Preparer** Entity Name: Atheena Jones Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer Entity Name: CLARIDGE WASEM

Entity Title: OWNER
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

CASEY'S DISCOUNT AUTOMOTIVE (Continued)

S121749520

Not reported

AUTO SERVICE LABS CERS HAZ WASTE S121794838 B11 WNW

520 N E ST **CERS** N/A

< 1/8 MADERA, CA 93638

0.006 mi.

34 ft. Site 1 of 3 in cluster B

Relative: CERS HAZ WASTE: Higher 9657 Site ID: CERS ID: 10425328

Affiliation Phone:

Actual: 274 ft. **CERS** Description: Hazardous Waste Generator

Violations:

Site ID: 9657

AUTO SERVICE LABS Site Name:

Violation Date: 01-23-2014

22 CCR 12 66262.34(f) - California Code of Regulations, Title 22, Citation:

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the

generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date. Violation Notes: Returned to compliance on 02/27/2014. Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 9657

Site Name: AUTO SERVICE LABS

Violation Date: 05-31-2018

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Failure to obtain an Identification Number prior to treating, storing, Violation Description:

disposing of, transporting or offering for transportation any

hazardous waste.

Returned to compliance on 06/04/2018. EPA ID number was inactive and Violation Notes:

needs to be renewed by sending application to DTSC. Receive active EPA

ID number.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Evaluation:

Eval General Type: Compliance Evaluation Inspection

01-23-2014 Eval Date: Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW **Eval Source: CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 05-31-2018 Violations Found: Yes

Eval Type: Routine done by local agency

Direction Distance

Elevation Site Database(s) EPA ID Number

AUTO SERVICE LABS (Continued)

S121794838

EDR ID Number

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Enforcement Action:

Site ID: 9657

Site Name: AUTO SERVICE LABS

 Site Address:
 520 N E ST

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 01-23-2014

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 9657

Site Name: AUTO SERVICE LABS

 Site Address:
 520 N E ST

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 05-31-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Coordinates:

Site ID: 9657

Facility Name: AUTO SERVICE LABS

Env Int Type Code: HWG
Program ID: 10425328
Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.965770 Longitude: -120.063620

Affiliation:

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 520 N "E" STREET

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: Not reported

Affiliation Type Desc: Operator

Entity Name: ALFONSO MOLINA Entity Title: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

AUTO SERVICE LABS (Continued)

S121794838

EDR ID Number

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Not reported

Not reported

Not reported

Not reported

(559) 674-3520

Affiliation Type Desc: Parent Corporation
Entity Name: AUTO SERVICE LABS

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc:
Entity Name:
Entity Title:
Affiliation Address:
Environmental Contact
ALFONSO MOLINA
Not reported
520 N "E" STREET

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: (559) 674-5054

Affiliation Type Desc:

Entity Name:
Entity Title:
Affiliation Address:

Legal Owner
ALFONSO MOLINA
Not reported
520 N E ST

Affiliation Address: 520 N E S
Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 674-3520

Affiliation Type Desc: Document Preparer Entity Name: ALFONSO MOLINA

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

AUTO SERVICE LABS (Continued)

S121794838

Affiliation Type Desc: Identification Signer Entity Name: ALFONSO MOLINA

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

OWNER

Not reported

Not reported

Not reported

Not reported

Not reported

A12 SAN JOAQUIN PEST CONTROL HIST UST S118415071

SW 416 NORTH E STREET < 1/8 MADERA, CA 93637 N/A

0.014 mi.

72 ft. Site 11 of 12 in cluster A

Tank Num:

Relative: HIST UST:
Lower File Number: 00028E7C

Actual: URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028E7C.pdf

272 ft. Region: Not reported
Facility ID: Not reported
Facility Type: Not reported
Other Type: Not reported
Contact Name: Not reported
Telephone: Not reported
Owner Name: Not reported
Not reported

Owner Address: Not reported Owner City,St,Zip: Not reported Total Tanks: Not reported

Container Num:
Year Installed:
Not reported
Year Installed:
Not reported
Not reported
Not reported
Tank Used for:
Not reported
Type of Fuel:
Not reported

Click here for Geo Tracker PDF:

A13 SAN JOAQUIN PEST CONTROL HIST UST U001589405

Not reported

SW 416 N E ST

< 1/8 MADERA, CA 93637

0.014 mi.

72 ft. Site 12 of 12 in cluster A

Relative: HIST UST: Lower File Number:

 Lower
 File Number:
 Not reported

 Actual:
 URL:
 Not reported

 272 ft.
 Region:
 STATE

 Facility ID:
 00000001306

Facility Type: Other
Other Type: PEST CONTROL

Contact Name: PEST CONTROL
CALVIN J. MORGAN

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SAN JOAQUIN PEST CONTROL (Continued)

U001589405

Telephone: 2096745740

MORGAN BROTHERS, INC. Owner Name: Owner Address: 4688 EAST HEDGES Owner City,St,Zip: FRESNO, CA 93703

Total Tanks: 0001

001 Tank Num: Container Num:

Year Installed: Not reported Tank Capacity: 00000550 **PRODUCT** Tank Used for: UNLEADED Type of Fuel: Container Construction Thickness: Not reported Leak Detection: Stock Inventor

B14 MULLER IRRIGATION, INC. HIST UST U001589569 N/A

525 N E ST

NW MADERA, CA 93638 < 1/8

0.015 mi.

77 ft. Site 2 of 3 in cluster B

Relative: HIST UST: Higher File Number: Not reported URL: Not reported Actual: Region: STATE 274 ft. Facility ID: 00000006926

> Facility Type: Other

IRRIGATION SYSTEMS Other Type: Contact Name: RICHARD T. DANKS

Telephone: 2096739269

Owner Name: MULLER IRRIGATION, INC.

Owner Address: 525 NO. 'E' ST. Owner City, St, Zip: MADERA, CA 93638

Total Tanks: 0001

Tank Num: 001 Container Num: 673 1970 Year Installed: Tank Capacity: 00001000 Tank Used for: **PRODUCT** Type of Fuel: **REGULAR** Container Construction Thickness: 10 Leak Detection: None

B15 **MULLER IRRIGATION INC** HIST UST S118413217

NW **525 NO E ST** N/A

< 1/8 MADERA, CA 93638

0.015 mi.

77 ft. Site 3 of 3 in cluster B

Relative: HIST UST: Higher File Number:

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028E90.pdf Actual:

Region: Not reported 274 ft. Facility ID: Not reported Facility Type: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MULLER IRRIGATION INC (Continued)

S118413217

1000472925

CAD982435554

RCRA-SQG

FINDS

ECHO

HAZNET

Other Type: Not reported Not reported Contact Name: Telephone: Not reported Owner Name: Not reported Owner Address: Not reported Owner City, St, Zip: Not reported Not reported Total Tanks:

Tank Num: Not reported Container Num: Not reported Year Installed: Not reported Tank Capacity: Not reported Tank Used for: Not reported Type of Fuel: Not reported Container Construction Thickness: Not reported Leak Detection: Not reported

Click here for Geo Tracker PDF:

C16 **HEARTLAND OPPORTUNITY CENTER**

SE 323 N E ST < 1/8

0.023 mi.

MADERA, CA 93638

121 ft. Site 1 of 5 in cluster C

RCRA-SQG: Relative:

Lower Date form received by agency: 11/20/1990

HEARTLAND OPPORTUNITY CENTER Facility name: Actual:

Facility address: 323 N E ST 272 ft.

MADERA, CA 93638

EPA ID: CAD982435554 Mailing address: P O BOX 566

MADERA, CA 93639

ENVIRONMENTAL MANAGER Contact:

Contact address: 323 N E ST

MADERA, CA 93638

Contact country: US

Contact telephone: 209-674-8824 Contact email: Not reported

EPA Region:

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous

waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of

hazardous waste at any time

Owner/Operator Summary:

JOSEPH COULOMBE Owner/operator name: Owner/operator address: NOT REQUIRED

NOT REQUIRED, ME 99999

Owner/operator country: Not reported Owner/operator telephone: 415-555-1212 Owner/operator email: Not reported Owner/operator fax: Not reported Owner/operator extension: Not reported Private Legal status:

Distance EDR ID Number
Elevation Site EDR ID Number
Database(s) EPA ID Number

HEARTLAND OPPORTUNITY CENTER (Continued)

1000472925

Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED Owner/operator address: NOT REQUIRED

NOT REQUIRED, ME 99999

Owner/operator country: Not reported Owner/operator telephone: 415-555-1212 Owner/operator email: Not reported Not reported Owner/operator fax: Not reported Owner/operator extension: Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: Mixed waste (haz. and radioactive): No Recycler of hazardous waste: Nο Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: Nο Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Violation Status: No violations found

FINDS:

Registry ID: 110008277756

Environmental Interest/Information System

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

Direction Distance

Elevation Site Database(s) EPA ID Number

HEARTLAND OPPORTUNITY CENTER (Continued)

1000472925

EDR ID Number

ECHO:

Envid: 1000472925 Registry ID: 110008277756

DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110008277756

HAZNET:

Facility Name: HEARTLAND OPPORTUNITY CENTER

envid: 1000472925 Year: 2006

GEPAID: CAD982435554
Contact: ROBERT J. HAND
Telephone: 2096748828
Mailing Name: Not reported
Mailing Address: PO BOX 566

Mailing City, St, Zip: MADERA, CA 936390566

Gen County: Not reported
TSD EPA ID: CAD028409019
TSD County: Not reported
Waste Category: Pesticide rinse water
Disposal Method: Transfer Station

Tons: 0.01

Cat Decode: Not reported Method Decode: Not reported Facility County: Madera

envid: 1000472925 Year: 2006

GEPAID: CAD982435554
Contact: ROBERT J. HAND
Telephone: 2096748828
Mailing Name: Not reported
Mailing Address: PO BOX 566

Mailing City, St, Zip: MADERA, CA 936390566

Gen County: Not reported
TSD EPA ID: CAD097030993
TSD County: Not reported

Waste Category: Unspecified oil-containing waste

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Tons: 0.45
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Madera

envid: 1000472925

Year: 2006
GEPAID: CAD982435554
Contact: ROBERT J. HAND
Telephone: 2096748828
Mailing Name: Not reported
Mailing Address: PO BOX 566

Mailing City, St, Zip: MADERA, CA 936390566

Gen County: Not reported
TSD EPA ID: CAD097030993
TSD County: Not reported

Waste Category: Unspecified organic liquid mixture

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HEARTLAND OPPORTUNITY CENTER (Continued)

1000472925

Disposal Method: Disposal, Other

0.06 Tons: Cat Decode: Not reported Method Decode: Not reported

Facility County:

1000472925 envid: Year: 2006

GEPAID: CAD982435554 Contact: ROBERT J. HAND 2096748828 Telephone: Mailing Name: Not reported Mailing Address: PO BOX 566

Mailing City, St, Zip: MADERA, CA 936390566

Madera

Gen County: Not reported TSD EPA ID: CAT080013352 TSD County: Not reported

Waste Category: Unspecified solvent mixture Disposal Method: Recycler

Tons: 0.18 Cat Decode: Not reported Method Decode: Not reported Facility County: Madera

envid: 1000472925

Year: 2006

GEPAID: CAD982435554 Contact: ROBERT J. HAND Telephone: 2096748828 Mailing Name: Not reported Mailing Address: PO BOX 566

Mailing City, St, Zip: MADERA, CA 936390566

Gen County: Not reported TSD EPA ID: CAT080013352 TSD County: Not reported

Unspecified solvent mixture Waste Category:

Disposal Method: Fuel Blending Prior To Energy Recovery At Another Site

Tons: 0.5

Cat Decode: Not reported Method Decode: Not reported Facility County: Madera

> Click this hyperlink while viewing on your computer to access 2 additional CA_HAZNET: record(s) in the EDR Site Report.

MADERA GLASS & BODY WORKS

105 E CENTRAL MADERA, CA 93638

0.024 mi. 129 ft.

17

NW

< 1/8

Relative: **CERS HAZ WASTE:**

Higher 45987 Site ID: 10426315 CERS ID: Actual:

CERS Description: Hazardous Waste Generator 274 ft.

Violations:

45987 Site ID:

S119002531

N/A

CERS HAZ WASTE

CUPA Listings

Map ID MAP FINDINGS
Direction

Direction

Elevation Site Database(s) EPA ID Number

MADERA GLASS & BODY WORKS (Continued)

S119002531

EDR ID Number

Site Name: MADERA GLASS & BODY WORKS

Violation Date: 09-28-2016

Citation: 40 CFR 1 262.34(d)(5)(ii) - U.S. Code of Federal Regulations, Title

40, Chapter 1, Section(s) 262.34(d)(5)(ii)

Violation Description: Failure to post the following information next to the telephone: (A)

The name and telephone number of the emergency coordinator; (B) Location of fire extinguishers and spill control material, and, if present, fire alarm; and (C) The telephone number of the fire

department, unless the facility has a direct alarm.

Violation Notes: Returned to compliance on 09/28/2016. HW:03: Provide Contingency Plan.

(Corrected on Site)

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 45987

Site Name: MADERA GLASS & BODY WORKS

Violation Date: 09-28-2016

Citation: 22 CCR 12 66262.34(d) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(d)

Violation Description: Failure to send hazardous waste offsite for treatment, storage, or

disposal within 180 days (or 270 days if waste is transported over 200 miles) for a generator who generates less than 1000 kilogram per month

if all of the following conditions are met: (1) The quantity of

hazardous waste accumulated onsite never exceeds 6,000 kilograms. (2) The generator complies with the requirements of 40 Code of Federal Regulations section 262.34(d), (e) and (f). (3) The generator does not hold acutely hazardous waste or extremely hazardous waste in an amount

greater than one kilogram for more than 90 days.

Violation Notes: Returned to compliance on 09/29/2016. HW20: Used Oil must be picked up

as soon as possible. Observed: Used Oil @ 175 G on 09/11/14 manifest, no pick-ups since then. Facility states that 275 G tote and 55 G drum container will be picked up by hazardous waste transporter by

09/29/16.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 45987

Site Name: MADERA GLASS & BODY WORKS

Violation Date: 09-28-2016

Citation: 40 CFR 1 265.173 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.173

Violation Description: Failure to meet the following container management requirements: (a) A

container holding hazardous waste must always be closed during storage, except when it is necessary to add or remove waste. (b) A container holding hazardous waste must not be opened, handled, or stored in a manner which may rupture the container or cause it to

leak.

Violation Notes: Returned to compliance on 09/28/2016. HW12: Used Oil @ 55G needs lid.

Hazardous Paint Waste @ 55G X2 needs lid. COS

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 45987

Site Name: MADERA GLASS & BODY WORKS

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

MADERA GLASS & BODY WORKS (Continued)

S119002531

EDR ID Number

Violation Date: 09-28-2016

Citation: HSC 6.5 25250.22 - California Health and Safety Code, Chapter 6.5,

Section(s) 25250.22

Violation Description: Failure to properly manage used oil and/or fuel filters in accordance

with the requirements.

Violation Notes: Returned to compliance on 11/14/2016. HW34: Shall mark empty

containers with date emptied, applies to all empty container on

site(the gasoline tanks at approximately 300 G.)

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 45987

Site Name: MADERA GLASS & BODY WORKS

Violation Date: 09-28-2016

Citation: 22 CCR 12 66262.40(a) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.40(a)

Violation Description: Failure to keep a copy of each properly signed manifest for at least

three years from the date the waste was accepted by the initial transporter. The manifest signed at the time the waste was accepted for transport shall be kept until receiving a signed copy from the

designated facility which received the waste.

Violation Notes: Returned to compliance on 09/29/2016. HW12: Make sure to keep records

for past 3 years of any hazardous waste; not limited to used oil, oil

filters, spend batteries, paint waste. COS Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Violation Division:

Site ID: 45987

Site Name: MADERA GLASS & BODY WORKS

Violation Date: 09-28-2016

Citation: HSC 6.5 25250.22 - California Health and Safety Code, Chapter 6.5,

Section(s) 25250.22

Violation Description: Failure to properly manage used oil and/or fuel filters in accordance

with the requirements.

Violation Notes: Returned to compliance on 09/28/2016. HW32: Mark "Used Oil" on 55 G

hazardous waste container. COS

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 45987

Site Name: MADERA GLASS & BODY WORKS

Violation Date: 09-28-2016

Citation: HSC 6.5 25250.22 - California Health and Safety Code, Chapter 6.5,

Section(s) 25250.22

Violation Description: Failure to properly manage used oil and/or fuel filters in accordance

with the requirements.

Violation Notes: Returned to compliance on 09/28/2016. HW26: Make sure all containers

are properly labeled with an accumulation start date. Applies to paint

waste containers. COS

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA GLASS & BODY WORKS (Continued)

S119002531

EDR ID Number

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-28-2016

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Enforcement Action:

Site ID: 45987

Site Name: MADERA GLASS & BODY WORKS

 Site Address:
 105 E CENTRAL

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 09-28-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Affiliation:

Affiliation Type Desc: Document Preparer Entity Name: DANA LENNEMANN

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation City:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Not reported

Not reported

Not reported

Affiliation Type Desc: Parent Corporation

Entity Name: MADERA GLASS & BODY WORKS

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Not reported

Not reported

Not reported

Not reported

Affiliation Type Desc: Facility Mailing Address

Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: 105 E CENTRAL AVE

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: Not reported

Affiliation Type Desc: Operator

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA GLASS & BODY WORKS (Continued)

S119002531

EDR ID Number

AARON PIPES Entity Name: Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 363-3157

Affiliation Type Desc: Environmental Contact Entity Name: DANA LENNEMANN

Entity Title: Not reported

Affiliation Address: 105 E CENTRAL AVE

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93638

Affiliation Phone: (559) 674-8559

Affiliation Type Desc: Legal Owner

Entity Name: MADERA GLASS & BODY, INC

Entity Title: Not reported

Affiliation Address: 105 E CENTRAL AVE

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 93638
Affiliation Phone: (559) 363-3157

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Identification Signer Entity Name: DANA LENNEMANN

Entity Title: CHIEF FINANCIAL OFFICER (CFO)

Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

CUPA MADERA:

Contact Name: MADERA GLASS & BODY, INC

Region: MADERA Facility Id: FA0102949 Contact Phone: 5596748559

Detail:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA GLASS & BODY WORKS (Continued)

Facility Id: FA0102949 Common Name: PAINT WASTE

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165

Decode for c status: Not reported

D18 MC GEE W A **EDR Hist Auto** 1021581987 N/A

WNW **625 N GATEWAY DR** MADERA, CA 93637

< 1/8

0.040 mi.

209 ft.

Site 1 of 3 in cluster D

Relative: Higher

EDR Hist Auto

Year: Name:

Type: Actual: 274 ft. 1969 MC GEE WILLIAM A Gasoline Service Stations

1970 MC GEE WILLIAM A Gasoline Service Stations 1971 MC GEE W A Gasoline Service Stations 1972 MC GEE W A **Gasoline Service Stations** 1973 MC GEE W A **Gasoline Service Stations**

D19 **GL PEREZ INC** SWRCY S107137617 WNW **625 N GATEWAY DR** N/A

< 1/8 **MADERA, CA 93638**

0.040 mi.

209 ft. Site 2 of 3 in cluster D

Relative: SWRCY:

Higher Reg Id: 27866 Cert Id: RC14169 Actual: Mailing Address: 510 South C St 274 ft. Mailing City: Madera Mailing State: CA

93638 Mailing Zip Code: Not reported Website: Email: Not reported Phone Number: (559) 416-7687

Rural: Ν

Operation Begin Date: 01/03/2009

Aluminium: Υ Glass: Υ Plastic: Υ Bimetal:

Hours of Operation: Mon - Sun 8:00 am - 4:00 pm, Closed 12:00 pm - 1:00 pm

18956 Organization ID: Organization Name: GL Perez Inc S119002531

Direction Distance

Elevation **EPA ID Number** Site Database(s)

C20 **BARAJAS BODY SHOP CERS HAZ WASTE** S121738708 **CERS** N/A

SSE 314 N E

< 1/8 **MADERA, CA 93638**

0.041 mi.

219 ft. Site 2 of 5 in cluster C

Relative: CERS HAZ WASTE:

Lower Site ID: 10928 10426309 CERS ID: Actual:

CERS Description: Hazardous Waste Generator 272 ft.

Violations:

Site ID: 10928

Site Name: **BARAJAS BODY SHOP**

Violation Date: 04-08-2014

Citation: 22 CCR 15 66265.52 - California Code of Regulations, Title 22, Chapter

15, Section(s) 66265.52

Violation Description: Failure to include all of the following in the Contingency Plan: 1) A

description of actions the facility personnel shall take response to fires, explosions, or any unplanned sudden or non-sudden release of hazardous waste or hazardous waste constituents to air, soil, or surface water at the facility; 2) The plan shall describe arrangements agreed to by local police departments, fire departments, hospitals, contractors, and State and local emergency response teams to coordinate emergency services; 3) The plan shall list names, addresses, and phone numbers (office and home) of all persons qualified to act as emergency coordinator and this list shall be kept up to date. Where more than one person is listed, one shall be named as primary emergency coordinator and others shall be listed in the order in which they will assume responsibility as alternates: 4) The plan shall include a list of all emergency equipment at the facility (such as fire extinguishing systems, spill control equipment, communications and alarm systems (internal and external), and decontamination equipment), where this equipment is required. This list shall be kept up to date. In addition, the plan shall include the location and a physical description of each item on the list, and a brief outline of its capabilities; 5) The plan shall include an evacuation plan for facility personnel where there is a possibility that evacuation could be necessary. This plan shall describe signal(s) to be used to begin evacuation, evacuation routes, and alternate evacuation routes (in cases where the primary routes could be blocked by releases of hazardous waste or fires). 6) The plan shall include the current telephone number of the California Emergency Management Agency; and 7) If the owner or operator has already prepared a Spill Prevention, Control, and Countermeasures (SPCC) or some other emergency or contingency plan, the owner or operator need only amend

that plan to incorporate hazardous waste management provisions that

are sufficient to comply with the re

Violation Notes: Returned to compliance on 04/09/2014. Operator failed to post a copy

of the contingency plan next to a working phone.

Violation Division: Madera County Environmental Health

HW Violation Program: Violation Source: **CERS**

Site ID: 10928

Site Name: **BARAJAS BODY SHOP**

Violation Date: 04-08-2014

Citation: 40 CFR 1 265.173 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.173

Violation Description: Failure to properly close hazardous waste containers when not in **EDR ID Number**

Direction Distance

Elevation Site Database(s) EPA ID Number

BARAJAS BODY SHOP (Continued)

S121738708

EDR ID Number

active use.

Violation Notes: Returned to compliance on 04/09/2014.
Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 10928

Site Name: BARAJAS BODY SHOP

Violation Date: 04-08-2014

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the

generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 04/09/2014. Operator failed to put

accumulation start date on containers.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 10928

Site Name: BARAJAS BODY SHOP

Violation Date: 04-08-2014

Citation: 40 CFR 1 265.201(c)(5) - U.S. Code of Federal Regulations, Title 40,

Chapter 1, Section(s) 265.201(c)(5)

Violation Description: Failure to conduct weekly inspections of the construction materials,

fixtures, and surrounding areas of the hazardous waste tanks.

Violation Notes: Returned to compliance on 04/09/2014.
Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 04-08-2014

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Enforcement Action:

Site ID: 10928

Site Name: BARAJAS BODY SHOP

 Site Address:
 314 N E

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 04-08-2014

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Distance Elevation

ion Site Database(s) EPA ID Number

BARAJAS BODY SHOP (Continued)

S121738708

EDR ID Number

Affiliation:

Affiliation Type Desc: Document Preparer Entity Name: BENIGNO BARAJAS

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Environmental Contact Entity Name: BENIGNO BARAJAS

Entity Title: Not reported
Affiliation Address: 314 N "E" STREET

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93638

Affiliation Phone: (559) 675-3505

Affiliation Type Desc: Legal Owner
Entity Name: BARAJAS BENI

Entity Name: BARAJAS BENIGNO
Entity Title: Not reported
Affiliation Address: 314 N "E" STREET

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 317-2141

Affiliation Type Desc: Operator

Entity Name: BENIGNO BARAJAS

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (559) 317-2141

Affiliation Type Desc: Parent Corporation
Entity Name: BARAJAS BODY SHOP

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BARAJAS BODY SHOP (Continued)

S121738708

Affiliation Country: Not reported Affiliation Zip: 93637 Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Facility Mailing Address Mailing Address **Entity Name:** Not reported Entity Title:

Affiliation Address: 314 NORTH E STREET

Affiliation City: **MADERA** Affiliation State: CA Affiliation Country: Not reported Affiliation Zip: 93638 Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer **Entity Name: BENIGNO BARAJAS**

Entity Title: **OWNER** Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

21 **VANS STUDIO** RCRA-SQG 1000856974 NNW CA0000010892 600 N D ST **FINDS**

MADERA, CA 93638 < 1/8

0.062 mi. 327 ft.

Relative: RCRA-SQG:

Higher Date form received by agency: 09/16/1993 Facility name: VANS STUDIO Actual: Facility address: 600 N D ST 275 ft.

MADERA, CA 93638 EPA ID: CA0000010892

Mailing address: N D ST

MADERA, CA 93638

VAN NEELY Contact: Contact address: 600 N D ST

MADERA, CA 93638

Contact country: US

Contact telephone: 209-673-8400 Contact email: Not reported

EPA Region: 09

Small Small Quantity Generator Classification:

Handler: generates more than 100 and less than 1000 kg of hazardous Description:

> waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of

hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: VAN NEELY Owner/operator address: 600 N D ST

MADERA, CA 93638

ECHO

HAZNET

Direction Distance Elevation

vation Site Database(s) EPA ID Number

VANS STUDIO (Continued) 1000856974

Owner/operator country: Not reported 209-673-8400 Owner/operator telephone: Owner/operator email: Not reported Owner/operator fax: Not reported Owner/operator extension: Not reported Private Legal status: Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Violation Status: No violations found

FINDS:

Registry ID: 110002610639

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

<u>Click this hyperlink</u> while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000856974 Registry ID: 110002610639

DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110002610639

HAZNET:

Facility Name: VANS STUDIO envid: 1000856974 Year: 2000

GEPAID: CA0000010892
Contact: VAN NEELY

EDR ID Number

Direction
Distance

Elevation Site Database(s) EPA ID Number

VANS STUDIO (Continued)

1000856974

EDR ID Number

Telephone: 2096738400
Mailing Name: Not reported
Mailing Address: 600 N D ST

Mailing City, St, Zip: MADERA, CA 936383117

Gen County: Not reported
TSD EPA ID: CAD093459485
TSD County: Not reported

Waste Category: Photochemicals/photoprocessing waste

Disposal Method: Recycler
Tons: 0.25
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Madera

envid: 1000856974 Year: 1997

GEPAID: CA0000010892
Contact: VAN NEELY
Telephone: 2096738400
Mailing Name: Not reported
Mailing Address: 600 N D ST

Mailing City, St, Zip: MADERA, CA 936383117

Gen County: Not reported
TSD EPA ID: CAT000613976
TSD County: Not reported

Waste Category: Photochemicals/photoprocessing waste

Disposal Method: Transfer Station

Tons: .3753
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Madera

envid: 1000856974 Year: 1996

GEPAID: CA0000010892
Contact: VAN NEELY
Telephone: 2096738400
Mailing Name: Not reported
Mailing Address: 600 N D ST

Mailing City, St, Zip: MADERA, CA 936383117

Gen County: Not reported
TSD EPA ID: CAT000613976
TSD County: Not reported

Waste Category: Photochemicals/photoprocessing waste

Disposal Method: Transfer Station

Tons: .2502
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Madera

envid: 1000856974 Year: 1995 GEPAID: CA0000010892 Contact: VAN NEELY

Telephone: 2096738400
Mailing Name: Not reported
Mailing Address: 600 N D ST

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

VANS STUDIO (Continued) 1000856974

Mailing City, St, Zip: MADERA, CA 936383117

Gen County: Not reported TSD EPA ID: CAT000613976 TSD County: Not reported

Waste Category: Photochemicals/photoprocessing waste

Disposal Method: **Transfer Station**

Tons: .1251

Cat Decode: Not reported Method Decode: Not reported Facility County: Madera

D22 **FEARLESS AUTO AND OFF ROAD** CERS HAZ WASTE \$121759989

WNW **624 N GATEWAY DR** < 1/8 MADERA, CA 93637

0.064 mi.

Site 3 of 3 in cluster D 339 ft.

Relative: CERS HAZ WASTE:

Higher Site ID: 29834 CERS ID: 10425523 Actual:

CERS Description: Hazardous Waste Generator 274 ft.

Violations:

Site ID: 29834

Site Name: FEARLESS AUTO AND OFF ROAD

Violation Date: 03-04-2014

Citation: 22 CCR 12 66262.34(d) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(d)

Failure to dispose of hazardous waste within 180 days (or 270 if waste Violation Description:

is transported over 200 miles) for the generator who generates less than 1000 kilogram per month, but more than 100 kilograms per month.

Returned to compliance on 03/25/2014. Operator failed to notify CUPA Violation Notes:

of their waste monthly generation. Per the receipts they generate

between 100 - 1000 kg per month. Inspector change from CESQG to SQG.

Violation Division: Madera County Environmental Health

HW Violation Program: Violation Source: **CERS**

Site ID: 29834

Site Name: FEARLESS AUTO AND OFF ROAD

Violation Date: 03-04-2014

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Failure to obtain and/or maintain an Active EPA ID. Violation Description:

Violation Notes: Returned to compliance on 03/25/2014. Operator failed to provide an

active EPA ID number for new owner. Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 29834

Violation Division:

FEARLESS AUTO AND OFF ROAD Site Name:

Violation Date: 03-04-2014

Citation: 22 CCR 15 66265.16 - California Code of Regulations, Title 22, Chapter

15. Section(s) 66265.16

Violation Description: Failure to provide employees within the first six months after the

> date of their employment, or assignment to the facility, or to work unsupervised, or to a new position at a facility with hazardous waste

CERS

N/A

Direction Distance Elevation

tion Site Database(s) EPA ID Number

FEARLESS AUTO AND OFF ROAD (Continued)

S121759989

EDR ID Number

training to ensure employees are competent in the following areas: hazardous waste management procedures (including contingency plan implementation) relevant to the positions in which they are employed, emergency response and emergency equipment, and procedures for using, inspecting, repairing, and replacing facility emergency and monitoring equipment. In addition, the owner/operator shall ensure facility personnel take part in an annual review of the initial training and training records training records on current personnel shall be kept until closure of the facility. Training records on former employees shall be kept for at least three years from the date the employee last worked at the facility. The records shall include the following: the job title for each position at the facility related to hazardous waste management, and the name of the employee filling each job; a written job description for each position, duties of facility personnel

assigned to each position, and a written description of the type and amount of both introductory and continuing training that will be given

to each person filling a position.

Violation Notes: Returned to compliance on 03/25/2014. Operator failed to train staff

regarding to handling hazardous waste. Madera County Environmental Health

Violation Division: Madera Violation Program: HW

Violation Source: CERS

Site ID: 29834

Site Name: FEARLESS AUTO AND OFF ROAD

Violation Date: 03-04-2014

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 03/25/2014.
Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 29834

Site Name: FEARLESS AUTO AND OFF ROAD

Violation Date: 03-04-2014

Citation: 40 CFR 1 265.174 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.174

Violation Description: Failure to inspect hazardous waste storage areas at least weekly.

Violation Notes: Returned to compliance on 03/25/2014.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 29834

Site Name: FEARLESS AUTO AND OFF ROAD

Violation Date: 03-04-2014

Citation: 22 CCR 15 66265.52 - California Code of Regulations, Title 22, Chapter

15, Section(s) 66265.52

Violation Description: Failure to include all of the following in the Contingency Plan: 1) A

description of actions the facility personnel shall take response to fires, explosions, or any unplanned sudden or non-sudden release of hazardous waste or hazardous waste constituents to air, soil, or

Map ID MAP FINDINGS
Direction

Distance Elevation Sit

ation Site Database(s) EPA ID Number

FEARLESS AUTO AND OFF ROAD (Continued)

S121759989

EDR ID Number

surface water at the facility; 2) The plan shall describe arrangements agreed to by local police departments, fire departments, hospitals, contractors, and State and local emergency response teams to coordinate emergency services; 3) The plan shall list names, addresses, and phone numbers (office and home) of all persons qualified to act as emergency coordinator and this list shall be kept up to date. Where more than one person is listed, one shall be named as primary emergency coordinator and others shall be listed in the order in which they will assume responsibility as alternates; 4) The plan shall include a list of all emergency equipment at the facility (such as fire extinguishing systems, spill control equipment, communications and alarm systems (internal and external), and decontamination equipment), where this equipment is required. This list shall be kept up to date. In addition, the plan shall include the location and a physical description of each item on the list, and a brief outline of its capabilities; 5) The plan shall include an evacuation plan for facility personnel where there is a possibility that evacuation could be necessary. This plan shall describe signal(s) to be used to begin evacuation, evacuation routes, and alternate evacuation routes (in cases where the primary routes could be blocked by releases of hazardous waste or fires). 6) The plan shall include the current telephone number of the California Emergency Management Agency: and 7) If the owner or operator has already prepared a Spill Prevention, Control, and Countermeasures (SPCC) or some other emergency or contingency plan, the owner or operator need only amend that plan to incorporate hazardous waste management provisions that are sufficient to comply with the re

Violation Notes: Returned to compliance on 03/25/2014. Operator failed to post a copy

of the contingency plan next to a working phone.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-04-2014

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Enforcement Action:

Site ID: 29834

Site Name: FEARLESS AUTO AND OFF ROAD

Site Address: 624 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 03-04-2014

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FEARLESS AUTO AND OFF ROAD (Continued)

S121759989

Coordinates:

Site ID:

FEARLESS AUTO AND OFF ROAD Facility Name:

Env Int Type Code: **HWG** Program ID: 10425523 Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

36.966300 Latitude: Longitude: -120.066370

Affiliation:

Affiliation Type Desc: **Document Preparer** Entity Name: MAYRA B VALENCIA

Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation

FEARLESS AUTO AND OFF ROAD Entity Name:

Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Operator

Entity Name: MAYRA B. VALENCIA

Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 232-5626

Affiliation Type Desc: **Environmental Contact** Entity Name: MAYRA B. VALENCIA

Entity Title: Not reported

Affiliation Address: 624 N GATEWAY DRIVE

Affiliation City: **MADERA** Affiliation State: CA Affiliation Country: Not reported Affiliation Zip: 93637 Affiliation Phone: (559) 232-5626

Affiliation Type Desc: Facility Mailing Address Entity Name: Mailing Address Entity Title: Not reported

Affiliation Address: 2425 W 3 RD STREET

Affiliation City: MADERA

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FEARLESS AUTO AND OFF ROAD (Continued)

S121759989

Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637 Affiliation Phone: Not reported

Identification Signer Affiliation Type Desc: MAYRA B VALENCIA Entity Name:

Entity Title: **PRESIDENT** Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: **CUPA District**

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Legal Owner

Entity Name: VALENCIA, MAYRA B.

Entity Title: Not reported

Affiliation Address: 624 N GATEWAY DRIVE

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: **United States** Affiliation Zip: 93637

Affiliation Phone: (559) 232-5626

S113894865 C23 **MADERA TRANSPORTATION** Cortese **CUPA Listings 305 NORTH E STREET** SE N/A

CORTESE

< 1/8 0.066 mi.

348 ft. Site 3 of 5 in cluster C

MADERA, CA 93736

CORTESE: Relative: Lower Region:

Envirostor Id: Not reported Actual: Site/Facility Type: Not reported 272 ft. Cleanup Status: Not reported Status Date:

Not reported Not reported Site Code: Not reported Latitude: Longitude: Not reported Not reported Owner: Enf Type: Not reported Swat R: Not reported Flag: CORTESE Order No: Not reported Waste Discharge System No: Not reported Effective Date: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA TRANSPORTATION (Continued)

S113894865

N/A

Region 2: Not reported WID Id: Not reported Solid Waste Id No: Not reported Waste Management Uit Name: Not reported

File Name: Cease Desist Orders & Cleanup Abatement Orders

CUPA MADERA:

SMITH, MILDRED Contact Name: Region: MADERA Facility Id: FA0100225 2096742411 Contact Phone:

Detail:

Facility Id: FA0100225 Common Name: Gasoline **Current Status:**

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165 Decode for c status: Not reported

C24 HIST UST S118412590 **MADERA COB INC**

SE 305 NORTH E < 1/8 MADERA, CA 93638

0.066 mi.

272 ft.

348 ft. Site 4 of 5 in cluster C

Relative: HIST UST: Lower 00028DC7 File Number:

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028DC7.pdf Actual:

Region: Not reported Facility ID: Not reported Facility Type: Not reported Not reported Other Type: Contact Name: Not reported Telephone: Not reported Owner Name: Not reported Owner Address: Not reported Owner City, St, Zip: Not reported Total Tanks: Not reported

Tank Num: Not reported Container Num: Not reported Year Installed: Not reported Tank Capacity: Not reported Tank Used for: Not reported Type of Fuel: Not reported Container Construction Thickness: Not reported Leak Detection: Not reported

Click here for Geo Tracker PDF:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

C25 **MADERA TRANSPORTATION SVCS SWEEPS UST** U001589562 **HIST UST** N/A

SE 305 N E ST

< 1/8 MADERA, CA 93638

0.066 mi.

348 ft. Site 5 of 5 in cluster C

SWEEPS UST: Relative:

Lower Status: Active Comp Number: 100225 Actual: Number: 9 272 ft.

Board Of Equalization: 44-013724 Referral Date: 06-30-92 07-22-92 Action Date: Created Date: 02-29-88

Owner Tank Id:

SWRCB Tank Id: 20-000-100225-001297

Tank Status: 1000 Capacity: Active Date: Not reported Tank Use: M.V. FUEL STG:

OTHER Content: Number Of Tanks: 1

HIST UST:

Not reported File Number: URL: Not reported Region: STATE Facility ID: 00000002384 Facility Type: Other Other Type: TAXI Contact Name: Not reported Telephone: 2096742411

Owner Name: MADERA CAB CO. INC.

Owner Address: 305 NORTH E Owner City, St, Zip: MADERA, CA 93638

Total Tanks: 0001

Tank Num: 001 Container Num: MC.1. Year Installed: 1982 Tank Capacity: 00001000 Tank Used for: **PRODUCT** Type of Fuel: **UNLEADED** Container Construction Thickness: Not reported Leak Detection: Stock Inventor

E26 YOUNG ROBERT E **EDR Hist Auto** 1021618620

SW **421 NO GATEWAY DR** < 1/8 MADERA, CA 93637

0.072 mi.

380 ft. Site 1 of 9 in cluster E

Relative: Higher

EDR Hist Auto

Year: Name: Type: Actual:

1969 YOUNG ROBERT E Gasoline Service Stations 273 ft. 1970 YOUNG ROBERT E Gasoline Service Stations

1971 YOUNG ROBERT E Gasoline Service Stations N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

YOUNG ROBERT E (Continued)

1021618620

1972 YOUNG ROBERT E

Gasoline Service Stations

E27 **HARMIN'S LIQUOR & GAS** LUST S104404494 **WSW 500 GATEWAY DR N** HIST CORTESE N/A MADERA, CA 93637

< 1/8 0.074 mi.

391 ft.

Site 2 of 9 in cluster E

Relative: LUST:

Higher CENTRAL VALLEY RWQCB (REGION 5F) Lead Agency:

Case Type: **LUST Cleanup Site** Actual:

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900177 274 ft.

Global Id: T0603900177 Latitude: 36.964869 Longitude: -120.064735

Completed - Case Closed Status:

Status Date: 06/24/2009 Case Worker: JWH 5T20000181 RB Case Number: MADERA COUNTY Local Agency: File Location: Regional Board Local Case Number: Not reported

Potential Media Affect: Aquifer used for drinking water supply

Potential Contaminants of Concern: Gasoline Site History: Not reported

LUST:

T0603900177 Global Id:

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN Organization Name: MADERA COUNTY Address: 2037 WEST CLEVELAND

City: **MADERA**

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900177

Regional Board Caseworker Contact Type:

Contact Name: JEFFREY HANNEL

CENTRAL VALLEY RWQCB (REGION 5F) Organization Name:

Address: 1685 E STREET City: **FRESNO**

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

Global Id: T0603900177 RESPONSE Action Type: Date: 08/01/2005

Action: Monitoring Report - Quarterly

Global Id: T0603900177 **RESPONSE** Action Type: Date: 02/01/2006

Action: Monitoring Report - Quarterly

T0603900177 Global Id: Action Type: **RESPONSE**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HARMIN'S LIQUOR & GAS (Continued)

S104404494

Date: 08/02/2005

Monitoring Report - Quarterly Action:

Global Id: T0603900177 Action Type: **RESPONSE** 02/02/2006 Date:

Action: Monitoring Report - Quarterly

Global Id: T0603900177 Action Type: **ENFORCEMENT** Date: 06/09/2004 Action: Staff Letter

Global Id: T0603900177 Action Type: **ENFORCEMENT** Date: 12/01/2008 Action: Staff Letter

Global Id: T0603900177 **ENFORCEMENT** Action Type: Date: 10/07/2008 Action: Staff Letter

Global Id: T0603900177 Action Type: Other 03/31/1998 Date: Action: Leak Reported

T0603900177 Global Id: **RESPONSE** Action Type: 02/01/2007 Date:

Action: Monitoring Report - Quarterly

Global Id: T0603900177 RESPONSE Action Type: 11/01/2007 Date:

Action: Monitoring Report - Quarterly

T0603900177 Global Id: RESPONSE Action Type: Date: 05/01/2006

Action: Monitoring Report - Quarterly

Global Id: T0603900177 Action Type: **RESPONSE** Date: 02/01/2008

Action: Monitoring Report - Quarterly

Global Id: T0603900177 Action Type: **ENFORCEMENT** Date: 03/17/2009

Action: Notification - Preclosure

Global Id: T0603900177 Action Type: RESPONSE Date: 11/01/2006

Action: Monitoring Report - Quarterly

Direction Distance

Elevation Site Database(s) EPA ID Number

HARMIN'S LIQUOR & GAS (Continued)

S104404494

EDR ID Number

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 05/01/2007

Action: Monitoring Report - Quarterly

 Global Id:
 T0603900177

 Action Type:
 ENFORCEMENT

 Date:
 05/23/2002

 Action:
 Staff Letter

Global Id: T0603900177
Action Type: ENFORCEMENT
Date: 06/24/2009

Action: Closure/No Further Action Letter

 Global Id:
 T0603900177

 Action Type:
 ENFORCEMENT

 Date:
 06/04/2009

 Action:
 Staff Letter

Global Id: T0603900177
Action Type: RESPONSE
Date: 03/15/2008

Action: Other Report / Document

Global Id: T0603900177
Action Type: RESPONSE
Date: 01/05/2009

Action: Other Report / Document

Global Id: T0603900177
Action Type: RESPONSE
Date: 08/01/2008

Action: Monitoring Report - Quarterly

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 08/01/2006

Action: Monitoring Report - Quarterly

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 05/01/2005

Action: Monitoring Report - Quarterly

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 11/01/2005

Action: Monitoring Report - Quarterly

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 02/01/2009

Action: Monitoring Report - Quarterly

Global Id: T0603900177
Action Type: RESPONSE

Distance

Elevation Site Database(s) EPA ID Number

HARMIN'S LIQUOR & GAS (Continued)

S104404494

EDR ID Number

Date: 07/06/2009

Action: Well Destruction Report

Global Id: T0603900177
Action Type: REMEDIATION
Date: 05/21/2003

Action: Soil Vapor Extraction (SVE)

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 08/01/2004

Action: Monitoring Report - Quarterly

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 04/01/2003

Action: Monitoring Report - Quarterly

Global Id: T0603900177
Action Type: RESPONSE
Date: 05/01/2004

Action: Monitoring Report - Quarterly

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 11/01/2003

Action: Monitoring Report - Quarterly

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 09/02/2002

Action: Remedial Progress Report

 Global Id:
 T0603900177

 Action Type:
 ENFORCEMENT

 Date:
 12/13/2007

 Action:
 Staff Letter

 Global Id:
 T0603900177

 Action Type:
 ENFORCEMENT

 Date:
 02/01/2008

 Action:
 Staff Letter

 Global Id:
 T0603900177

 Action Type:
 Other

 Date:
 03/27/1998

 Action:
 Leak Discovery

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 05/02/2004

Action: Monitoring Report - Quarterly

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 06/01/2005

Action: Well Installation Report

Direction Distance Elevation

evation Site Database(s) EPA ID Number

HARMIN'S LIQUOR & GAS (Continued)

S104404494

EDR ID Number

 Global Id:
 T0603900177

 Action Type:
 Other

 Date:
 03/27/1998

 Action:
 Leak Stopped

 Global Id:
 T0603900177

 Action Type:
 RESPONSE

 Date:
 02/01/2005

Action: Monitoring Report - Quarterly

Global Id: T0603900177
Action Type: RESPONSE
Date: 11/01/2004

Action: Monitoring Report - Quarterly

Global Id: T0603900177
Action Type: RESPONSE
Date: 05/02/2005

Action: Monitoring Report - Quarterly

LUST:

Global Id: T0603900177

Status: Completed - Case Closed

Status Date: 06/24/2009

Global Id: T0603900177

Status: Open - Case Begin Date

Status Date: 03/27/1998

Global Id: T0603900177
Status: Open - Remediation

Status Date: 09/08/2003

Global Id: T0603900177

Status: Open - Site Assessment

Status Date: 03/31/1998

LUST REG 5:

Region: 5

Status: Remedial action (cleanup) Underway

Case Number: 5T20000181

Case Type: Drinking Water Aquifer affected

Substance: GASOLINE
Staff Initials: JWH
Lead Agency: Regional
Program: LUST
MTBE Code: N/A

HIST CORTESE:

Region: CORTESE
Facility County Code: 20
Reg By: LTNKA
Reg Id: 5T20000181

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

28 **MADERA TRANSPORTATION** LUST S102432876

HIST CORTESE SSE 305 E ST N N/A

MADERA, CA 93638 < 1/8 **CERS**

0.079 mi. 419 ft.

Relative: LUST:

Lower Lead Agency: CENTRAL VALLEY RWQCB (REGION 5F)

Case Type: **LUST Cleanup Site** Actual:

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900162 272 ft.

Global Id: T0603900162 Latitude: 36.9637007 -120.0613835 Longitude:

Completed - Case Closed Status:

12/23/2010 Status Date: Case Worker: JWH 5T20000165 RB Case Number: MADERA COUNTY Local Agency: File Location: Regional Board Local Case Number: Not reported Potential Media Affect: Soil

Potential Contaminants of Concern: Gasoline

Site History: The case was opened following an unauthorized release from an

underground storage tank system at the subject site. Corrective

action is underway as directed by the CVRWQCB. Corrective action may

consist of preliminary site investigation, planning and implementation of remedial action, verification monitoring, or a

combination thereof. A summary of the site history is available by clicking on either the "Cleanup Status History", "Regulatory Activities" or the "Site Maps/Documents" tab. For a complete site history the case file at the CVRWQCB should be consulted.

LUST:

Global Id: T0603900162

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN Organization Name: MADERA COUNTY Address: 2037 WEST CLEVELAND City: **MADERA**

Email: arolan@madera-county.com

Phone Number: Not reported

T0603900162 Global Id:

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

CENTRAL VALLEY RWQCB (REGION 5F) Organization Name:

1685 E STREET Address: City: **FRESNO**

jhannel@waterboards.ca.gov Email:

Phone Number: Not reported

LUST:

T0603900162 Global Id: Action Type: Other 05/15/1996 Date: Action: Leak Reported

Global Id: T0603900162 Action Type: **ENFORCEMENT**

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA TRANSPORTATION (Continued)

S102432876

EDR ID Number

Date: 03/23/2009

Action: Administrative Civil Liabilities Complaint

 Global Id:
 T0603900162

 Action Type:
 ENFORCEMENT

 Date:
 04/29/2009

 Action:
 Staff Letter

 Global Id:
 T0603900162

 Action Type:
 ENFORCEMENT

 Date:
 09/10/2002

 Action:
 Staff Letter

 Global Id:
 T0603900162

 Action Type:
 ENFORCEMENT

 Date:
 06/25/2009

 Action:
 Staff Letter

 Global Id:
 T0603900162

 Action Type:
 ENFORCEMENT

 Date:
 12/23/2010

Action: Closure/No Further Action Letter

Global Id: T0603900162
Action Type: ENFORCEMENT
Date: 11/15/2010

Action: Notification - Preclosure

 Global Id:
 T0603900162

 Action Type:
 ENFORCEMENT

 Date:
 09/13/2010

Action: Administrative Civil Liabilities Order

Global Id: T0603900162
Action Type: ENFORCEMENT
Date: 11/04/2010

Action: Administrative Civil Liabilities Order

 Global Id:
 T0603900162

 Action Type:
 RESPONSE

 Date:
 05/29/2009

 Action:
 Correspondence

 Global Id:
 T0603900162

 Action Type:
 RESPONSE

 Date:
 10/15/2002

Action: Other Report / Document

Global Id: T0603900162
Action Type: ENFORCEMENT
Date: 09/19/2007

Action: Clean-up and Abatement Order - #r5-2007-0726

 Global Id:
 T0603900162

 Action Type:
 ENFORCEMENT

 Date:
 02/11/2008

 Action:
 Warning Letter

Direction
Distance

Elevation Site Database(s) EPA ID Number

MADERA TRANSPORTATION (Continued)

S102432876

EDR ID Number

 Global Id:
 T0603900162

 Action Type:
 ENFORCEMENT

 Date:
 04/25/2003

Action: Site Visit / Inspection / Sampling

 Global Id:
 T0603900162

 Action Type:
 ENFORCEMENT

 Date:
 03/16/2007

 Action:
 Warning Letter

 Global Id:
 T0603900162

 Action Type:
 Other

 Date:
 04/29/1996

 Action:
 Leak Discovery

 Global Id:
 T0603900162

 Action Type:
 Other

 Date:
 04/29/1996

 Action:
 Leak Stopped

LUST:

Global Id: T0603900162

Status: Completed - Case Closed

Status Date: 12/23/2010

Global Id: T0603900162

Status: Open - Case Begin Date

Status Date: 04/29/1996

Global Id: T0603900162

Status: Open - Site Assessment

Status Date: 05/15/1996

Global Id: T0603900162

Status: Open - Site Assessment

Status Date: 07/17/2006

LUST REG 5:

Region: 5

Status: Preliminary site assessment underway

Case Number: 5T20000165
Case Type: Soil only
Substance: GASOLINE
Staff Initials: JWH
Lead Agency: Regional
Program: LUST
MTBE Code: N/A

HIST CORTESE:

Region: CORTESE
Facility County Code: 20
Reg By: LTNKA
Reg Id: 5T20000165

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA TRANSPORTATION (Continued)

S102432876

CERS TANKS:

Site ID: 209662 CERS ID: T0603900162

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F) Entity Name:

Entity Title: Not reported Affiliation Address: 1685 E STREET **FRESNO** Affiliation City: Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

ANN ROLAN - MADERA COUNTY **Entity Name:**

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

E29 **RODRIQUEZ & SONS SUNLAND SV**

EDR Hist Auto 1020221837 wsw **500 N GATEWAY DR** N/A MADERA, CA 93637

< 1/8 0.081 mi.

428 ft. Site 3 of 9 in cluster E

EDR Hist Auto

Relative:

Higher

Year: Name: Type: Actual:

274 ft. 1975 **RODRIQUEZ & SONS SUNLAND SV Gasoline Service Stations** 1976 **RODRIQUEZ & SONS SUNLAND SV** Gasoline Service Stations **RODRIQUEZ & SONS SUNLAND SV** 1977 **Gasoline Service Stations RODRIQUEZ & SONS SUNLAND SV** 1978 **Gasoline Service Stations** 1979 **RODRIQUEZ & SONS SUNLAND SV** Gasoline Service Stations 1980 **RODRIQUEZ & SONS SUNLAND SV** Gasoline Service Stations

> 1982 **RODRIQUEZ & SONS SUNLAND SV** Gasoline Service Stations 1983 **RODRIQUEZ & SONS SUNLAND SV** Gasoline Service Stations **RODRIQUEZ & SONS SUNLAND SV** 1985 Gasoline Service Stations 1989 JJ JETTY MINI MART Gasoline Service Stations, NEC JJ JETTY MINI MART 1991 Gasoline Service Stations, NEC JJ JETTY MINI MART Gasoline Service Stations, NEC 1992 1993 JJ JETTY MINI MART Gasoline Service Stations, NEC

> 1994 JJ JETTY MINI MART Gasoline Service Stations, NEC 1995 JJ JETTY MINI MART Gasoline Service Stations, NEC **Grocery Stores**

2000 HARMINS LIQUOR & GAS **Grocery Stores** 2001 HARMINS LIQUOR & GAS **Grocery Stores** 2002 HARMINS LIQUOR & GAS 2003 HARMINS LIQUOR & GAS **Grocery Stores Grocery Stores** 2004 HARMINS LIQUOR & GAS 2005 HARMINS LIQUOR & GAS **Grocery Stores** 2006 HARYS LIQUOR & GAS **Grocery Stores**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RODRIQUEZ & SONS SUNLAND SV (Continued)

1020221837

2007	HARYS LIQUOR & GAS	Grocery Stores
2008	HARYS LIQUOR & GAS	Grocery Stores
2009	HARYS LIQUOR & GAS	Grocery Stores
2010	HARYS LIQUOR & GAS	Grocery Stores
2011	HARYS LIQUOR & GAS	Grocery Stores
2012	HARYS LIQUOR & GAS	Grocery Stores
2013	HARYS LIQUOR & GAS	Grocery Stores
2014	HARYS LIQUOR & GAS	Grocery Stores

E30 **AMIRK GILL CUPA Listings** S112980980 wsw **500 N GATEWAY DR HAZNET** N/A

< 1/8 MADERA, CA 93637

0.081 mi.

428 ft. Site 4 of 9 in cluster E

Relative: **CUPA MADERA:** Higher Contact Name:

Kaur, Ravinder MADERA Region: Actual: Facility Id: FA0100264 274 ft. Contact Phone: 5594167465

Detail:

Facility Id: FA0100264 Common Name: Premium Gasoline

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165 Decode for c status: Not reported

Facility Id: FA0100264

Common Name: Regular Unleaded Gasoline

Current Status:

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165 Decode for c status: Not reported

HAZNET:

AMIRK GILL Facility Name: envid: S112980980 Year: 2009

GEPAID: CAC002647305 Contact: **AMIRK GILL** Telephone: 5596751966 Mailing Name: Not reported

Mailing Address: 500 N GATEWAY DR Mailing City, St, Zip: MADERA, CA 936373144

Gen County: Not reported TSD EPA ID: CAD982444481 TSD County: Not reported

Waste Category: Unspecified oil-containing waste

Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery Disposal Method:

(H010-H129) Or (H131-H135)

0.10425 Tons: Cat Decode: Not reported Method Decode: Not reported Facility County: Madera

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

AMIRK GILL (Continued) S112980980

envid: \$112980980 Year: 2009

GEPAID: CAC002647305
Contact: AMIRK GILL
Telephone: 5596751966
Mailing Name: Not reported

Mailing Address: 500 N GATEWAY DR
Mailing City, St, Zip: MADERA, CA 936373144

Gen County: Not reported
TSD EPA ID: CAD982444481
TSD County: Not reported

Waste Category: Aqueous solution with total organic residues less than 10 percent Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Tons: 0.105
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Madera

E31 HARRY'S LIQUOR & GAS UST U004264528 WSW 500 N GATEWAY DR N/A

WSW 500 N GATEWAY DR < 1/8 MADERA, CA 93637

0.081 mi.

428 ft. Site 5 of 9 in cluster E

Relative: UST:

Higher Facility ID: FA0100264

Actual: Permitting Agency: Madera County Environmental Health

274 ft. Latitude: 36.96487 Longitude: -120.06474

E32 RODRIQUEZ AND SONS HIST UST U001589386

Not reported

WSW < 1/8 0.081 mi.

MADERA, CA 93637

500 N GATEWAY DR

428 ft. Site 6 of 9 in cluster E

Relative: HIST UST: Higher File Number:

URL: Not reported Actual: Region: STATE 274 ft. Facility ID: 00000064681 Facility Type: Gas Station Other Type: Not reported Contact Name: AL BIANCHI Telephone: 2096748402

Owner Name: ALFRED BIANCHI
Owner Address: 25121 AVE. 12 1/2
Owner City, St, Zip: MADERA, CA 93637

Total Tanks: 0005

Tank Num: 001 Container Num: #I

Year Installed: Not reported Tank Capacity: 00004000 Tank Used for: PRODUCT

N/A

Direction Distance

Elevation Site Database(s) EPA ID Number

RODRIQUEZ AND SONS (Continued)

U001589386

EDR ID Number

Type of Fuel: REGULAR Container Construction Thickness: 3/16

Leak Detection: Stock Inventor, None

Tank Num: 002 Container Num: #2

Year Installed: Not reported
Tank Capacity: 00001000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED

Container Construction Thickness: 12

Leak Detection: Stock Inventor

Tank Num: 003 Container Num: #3

Year Installed: Not reported Tank Capacity: 00000550 Tank Used for: WASTE Type of Fuel: WASTE OIL

Container Construction Thickness: 12

Leak Detection: Visual, None

Tank Num: 004 Container Num: #4

Year Installed:

Tank Capacity:

O0002000

Tank Used for:

Type of Fuel:

Container Construction Thickness:

Not reported
00002000

PRODUCT
PREMIUM

3/16

Leak Detection: Stock Inventor, None

Tank Num: 005
Container Num: #5
Year Installed: 1982
Tank Capacity: 00002000
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: 3/16

Leak Detection: Stock Inventor, None

E33 GIL AMERIC WSW 500 N GATEWAY < 1/8 MADERA, CA 93637

0.081 mi.

428 ft. Site 7 of 9 in cluster E

Relative: HIST UST:
Higher File Number: 000289E8

Actual: URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/000289E8.pdf
274 ft. Region: Not reported

Region: Not reported Facility ID: Not reported Facility Type: Not reported Not reported Other Type: Contact Name: Not reported Telephone: Not reported Owner Name: Not reported Owner Address: Not reported Owner City,St,Zip: Not reported S112889481

N/A

HIST UST

HAZNET

Map ID MAP FINDINGS Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

GIL AMERIC (Continued) S112889481

Total Tanks: Not reported

Tank Num: Not reported Not reported Container Num: Year Installed: Not reported Tank Capacity: Not reported Tank Used for: Not reported Not reported Type of Fuel: Container Construction Thickness: Not reported Leak Detection: Not reported

Click here for Geo Tracker PDF:

HAZNET:

GIL AMERIC Facility Name: S112889481 envid: Year: 1998

GEPAID: CAC001414280 Contact: GIL AMERIC 000000000 Telephone: Mailing Name: Not reported Mailing Address: 500 N GATEWAY Mailing City, St, Zip: MADERA, CA 936370000

Gen County: Not reported TSD EPA ID: CAD980673842 TSD County: Not reported

Unspecified oil-containing waste Waste Category:

Disposal Method: Recycler Tons: 2.0850 Cat Decode: Not reported Method Decode: Not reported Facility County: Madera

HARRY'S LIQUOR & GAS **CERS TANKS** S121765386 E34 **WSW 500 N GATEWAY DR CERS** N/A

< 1/8 0.081 mi.

428 ft. Site 8 of 9 in cluster E

MADERA, CA 93637

CERS TANKS: Relative:

Higher Site ID: 35592 CERS ID: 10425673 Actual:

Underground Storage Tank CERS Description: 274 ft.

Violations:

Site ID: 35592

HARRY'S LIQUOR & GAS Site Name:

Violation Date: 09-28-2017

Citation: HSC 6.7 25290.1(c)(3), 25290.2(c)(3) - California Health and Safety

Code, Chapter 6.7, Section(s) 25290.1(c)(3), 25290.2(c)(3)

Violation Description: Failure to keep water out of the secondary containment of UST systems

installed on or after July 1, 2003 and before July 1, 2004, or on or

after July 1, 2004.

Violation Notes: Returned to compliance on 09/28/2017. Observed 1/2 gallon of water in

the 87 stp sump. Tester removed water at time of inspection.

Violation Division: Madera County Environmental Health

UST Violation Program: Violation Source: **CERS**

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

HARRY'S LIQUOR & GAS (Continued)

S121765386

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

23 CCR 16 2712(i) - California Code of Regulations, Title 23, Chapter Citation:

16, Section(s) 2712(i)

Failure to have a UST Response Plan available on site. Violation Description:

Violation Notes: Returned to compliance on 10/04/2017. Provide UST response plan to

CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-23-2016

Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2665

Violation Description: Failure to comply with one or more of the following: Failure to

> install or maintain a liquid-tight spill bucket. Have a minimum capacity of five gallons. Have a functional drain valve or other method for the removal of liquid from the spill bucket/spill

container. Be resistant to galvanic corrosion. Violation Notes: Returned to compliance on 11/02/2016. Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

09-25-2015 Violation Date:

23 CCR 16 2632, 2634, 2636, 2666 - California Code of Regulations, Citation:

Title 23, Chapter 16, Section(s) 2632, 2634, 2636, 2666

Violation Description: Failure of the leak detection equipment to be properly programmed or

properly operated.

Returned to compliance on 10/01/2015. 91 LLD Failed. Repair or Violation Notes:

Replace.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-23-2016

23 CCR 16 2641(j) - California Code of Regulations, Title 23, Chapter Citation:

16, Section(s) 2641(j)

Violation Description: Failure of the leak detection equipment to be installed, calibrated,

operated, and/or maintained properly.

Returned to compliance on 10/18/2016. 87 LLD FAILED. REPAIR AND RETEST Violation Notes:

AND SUBMIT DOCUMENTATION IN 30 DAYS.

Madera County Environmental Health Violation Division:

Violation Program: UST Violation Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-23-2016

Citation: HSC 6.7 25290.1(c)(3), 25290.2(c)(3) - California Health and Safety Map ID MAP FINDINGS
Direction

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

HARRY'S LIQUOR & GAS (Continued)

S121765386

Code, Chapter 6.7, Section(s) 25290.1(c)(3), 25290.2(c)(3)

Violation Description: Failure to keep water out of the secondary containment of UST systems

installed on or after July 1, 2003 and before July 1, 2004, or on or

after July 1, 2004.

Violation Notes: Returned to compliance on 10/18/2016. INSPECTOR OBSERVED LIQUID IN 87

SUMP. REMOVE LIQUID AND PROPERLY DISPOSE OF LIQUID PROPERLY. SUBMIT

DOCUMENTATION IN 30 DAYS

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

Citation: 23 CCR 16 2641(j) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(j)

Violation Description: Failure of the leak detection equipment to be installed, calibrated,

operated, and/or maintained properly.

Violation Notes: Returned to compliance on 09/28/2017. UDC #1/2 - 87 float & chain the

chain is loose. UDC #3/4-87 & 91 float & chain are loose. Tester

repair, retest, pass.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

Citation: 23 CCR 16 2715(f) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2715(f)

Violation Description: Failure to have at least one employee present during operating hours

that has been trained in the proper operation and maintenance of the

UST system by a designated operator (DO).

Violation Notes: Returned to compliance on 10/04/2017. Operator failed to have at least

one trained staff on site at all time. Owner and Kavisher Singh need

DO training.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

Citation: 23 CCR 6.7 25284, 25286 - California Code of Regulations, Title 23,

Chapter 6.7, Section(s) 25284, 25286

Violation Description: Failure to submit a complete and accurate application for a permit to

operate a UST, or for renewal of the permit.

Violation Notes: Returned to compliance on 10/04/2017. Update BOE number to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST
Violation Source: CERS

Site ID: 35592 Site Name: HARRY'S

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-23-2016

Citation: 23 CCR 16 2641(a) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(a)

Map ID MAP FINDINGS Direction

Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

HARRY'S LIQUOR & GAS (Continued)

S121765386

Violation Description: Failure of leak detection equipment to be located such that equipment

is capable of detecting a leak at the earliest possible opportunity.

Returned to compliance on 10/18/2016. INSPECTOR OBSERVED 87 AND 91 Violation Notes:

SUMP SENSOR NOT AT LOWEST PART OF SUMP, SENSOR LINE TOO SHORT, PLACE

SENSOR AT LOWEST PART OF SUMP. SUBMIT DOCUMENTATION IN 30 DAYS

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2665

Violation Description: Failure to comply with one or more of the following: Failure to

> install or maintain a liquid-tight spill bucket. Have a minimum capacity of five gallons. Have a functional drain valve or other method for the removal of liquid from the spill bucket/spill

container. Be resistant to galvanic corrosion.

Violation Notes: Returned to compliance on 10/12/2017. 91 spill bucket failed test. Cap

has a leak.

Violation Division: Madera County Environmental Health

UST Violation Program: Violation Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Failure to submit and maintain complete and current Certification of Violation Description:

Financial Responsibility or other mechanism of financial assurance. Returned to compliance on 10/04/2017. Update CFO letter to CERS.

Violation Division: Madera County Environmental Health

UST Violation Program: **CERS** Violation Source:

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 07-13-2016

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95,

Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the

business plan is complete and accurate on or before the annual due

Violation Notes: Returned to compliance on 09/28/2016. Violation Division: Madera County Environmental Health

Violation Program: **HMRRP** Violation Source: **CERS**

Evaluation:

Violation Notes:

Eval General Type: Compliance Evaluation Inspection

08-05-2013 Eval Date:

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Distance

Elevation Site Database(s) EPA ID Number

HARRY'S LIQUOR & GAS (Continued)

S121765386

EDR ID Number

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-23-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 10-18-2016

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-25-2014

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-23-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-28-2017 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 10-01-2015

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HARRY'S LIQUOR & GAS (Continued)

S121765386

Enforcement Action:

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS Site Address: 500 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 09-23-2016 Enf Action Date:

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP CERS** Enf Action Source:

Site ID: 35592

HARRY'S LIQUOR & GAS Site Name: Site Address: 500 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 09-23-2016

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS 500 N GATEWAY DR Site Address:

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 09-25-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS Site Address: 500 N GATEWAY DR

Site City: **MADERA** 93637 Site Zip: Enf Action Date: 09-28-2017

Enf Action Type: Notice of Violation (Unified Program)

Notice of Violation Issued by the Inspector at the Time of Inspection Enf Action Description:

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

UST Enf Action Program: Enf Action Source: **CERS**

Coordinates:

35592 Site ID:

Facility Name: HARRY'S LIQUOR & GAS

Distance Elevation S

vation Site Database(s) EPA ID Number

HARRY'S LIQUOR & GAS (Continued)

S121765386

EDR ID Number

Env Int Type Code: HMBP
Program ID: 10425673
Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.964870 Longitude: -120.064740

Affiliation:

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 500 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: Not reported

Affiliation Type Desc: Operator

RAVINDER KAUR Entity Name: Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Not reported Affiliation Country: Affiliation Zip: Not reported Affiliation Phone: (559) 232-5681

Affiliation Type Desc: **Document Preparer** RAVINDER KAUR Entity Name: Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: HARRY'S LIQUOR & GAS

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: UST Property Owner Name

Entity Name: RAVINDER KAUR
Entity Title: Not reported
Affiliation Address: 500 N GATEWAY

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 416-7465

Distance

Elevation Site Database(s) EPA ID Number

HARRY'S LIQUOR & GAS (Continued)

S121765386

EDR ID Number

Affiliation Type Desc:
Entity Name:
Entity Title:
Affiliation Address:
Legal Owner
RAVINDER KAUR
Not reported
5784 W MAGILL AVE

Affiliation City: FRESNO Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93722

Affiliation Phone: (559) 416-7465

Affiliation Type Desc: Property Owner
Entity Name: RAVINDER KAUR
Entity Title: Not reported

Affiliation Address: 500 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States

Affiliation Zip: 93637

Affiliation Phone: (559) 416-7465

Affiliation Type Desc:
UST Tank Owner
Entity Name:
RAVINDER KAUR
Entity Title:
Not reported
Affiliation Address:
500 N GATEWAY

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 93637
Affiliation Phone: (559) 416-7465

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: Not reported

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Environmental Contact
Entity Name: DALER SINGH
Entity Title: Not reported

Affiliation Address: 500 N GATEWAY DR.

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

Affiliation Phone: (559) 416-7465

Affiliation Type Desc: Identification Signer
Entity Name: RAVINDER KAUR
Entity Title: OWNER/OPERATOR

Affiliation Address:

Affiliation City:

Affiliation City:

Affiliation State:

Affiliation Country:

Not reported

Not reported

Not reported

Direction

Elevation Site Database(s) EPA ID Number

HARRY'S LIQUOR & GAS (Continued)

S121765386

EDR ID Number

Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: UST Permit Applicant
Entity Name: DALER SINGH
Entity Title: OWNER / OPERATOR

Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (559) 416-7465

Affiliation Type Desc: UST Tank Operator Entity Name: RAVINDER KAUR Entity Title: Not reported

Affiliation Address: 500 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 416-7465

CERS TANKS:

Site ID: 35592 CERS ID: 10425673

CERS Description: Chemical Storage Facilities

Violations:

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

Citation: HSC 6.7 25290.1(c)(3), 25290.2(c)(3) - California Health and Safety

Code, Chapter 6.7, Section(s) 25290.1(c)(3), 25290.2(c)(3)

Violation Description: Failure to keep water out of the secondary containment of UST systems

installed on or after July 1, 2003 and before July 1, 2004, or on or

after July 1, 2004.

Violation Notes: Returned to compliance on 09/28/2017. Observed 1/2 gallon of water in

the 87 stp sump. Tester removed water at time of inspection.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

Citation: 23 CCR 16 2712(i) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2712(i)

Violation Description: Failure to have a UST Response Plan available on site.

Violation Notes: Returned to compliance on 10/04/2017. Provide UST response plan to

CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 35592

Direction Distance

Elevation Site Database(s) EPA ID Number

HARRY'S LIQUOR & GAS (Continued)

S121765386

EDR ID Number

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-23-2016

Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2665

Violation Description: Failure to comply with one or more of the following: Failure to

install or maintain a liquid-tight spill bucket. Have a minimum capacity of five gallons. Have a functional drain valve or other method for the removal of liquid from the spill bucket/spill

container. Be resistant to galvanic corrosion.

Violation Notes: Returned to compliance on 11/02/2016.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-25-2015

Citation: 23 CCR 16 2632, 2634, 2636, 2666 - California Code of Regulations,

Title 23, Chapter 16, Section(s) 2632, 2634, 2636, 2666

Violation Description: Failure of the leak detection equipment to be properly programmed or

properly operated.

Violation Notes: Returned to compliance on 10/01/2015. 91 LLD Failed. Repair or

Replace.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-23-2016

Citation: 23 CCR 16 2641(j) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(j)

Violation Description: Failure of the leak detection equipment to be installed, calibrated,

operated, and/or maintained properly.

Violation Notes: Returned to compliance on 10/18/2016. 87 LLD FAILED. REPAIR AND RETEST

AND SUBMIT DOCUMENTATION IN 30 DAYS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-23-2016

Citation: HSC 6.7 25290.1(c)(3), 25290.2(c)(3) - California Health and Safety

Code, Chapter 6.7, Section(s) 25290.1(c)(3), 25290.2(c)(3)

Violation Description: Failure to keep water out of the secondary containment of UST systems

installed on or after July 1, 2003 and before July 1, 2004, or on or

after July 1, 2004.

Violation Notes: Returned to compliance on 10/18/2016. INSPECTOR OBSERVED LIQUID IN 87

SUMP. REMOVE LIQUID AND PROPERLY DISPOSE OF LIQUID PROPERLY. SUBMIT

DOCUMENTATION IN 30 DAYS

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Direction Distance

EDR ID Number Elevation **EPA ID Number** Site Database(s)

HARRY'S LIQUOR & GAS (Continued)

S121765386

Violation Date: 09-28-2017

Citation: 23 CCR 16 2641(j) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(j)

Violation Description: Failure of the leak detection equipment to be installed, calibrated,

operated, and/or maintained properly.

Returned to compliance on 09/28/2017. UDC #1/2 - 87 float & chain the Violation Notes:

chain is loose. UDC #3/4-87 & 91 float & chain are loose. Tester

repair, retest, pass.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

Citation: 23 CCR 16 2715(f) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2715(f)

Violation Description: Failure to have at least one employee present during operating hours

that has been trained in the proper operation and maintenance of the

UST system by a designated operator (DO).

Violation Notes: Returned to compliance on 10/04/2017. Operator failed to have at least

one trained staff on site at all time. Owner and Kavisher Singh need

DO training.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

23 CCR 6.7 25284, 25286 - California Code of Regulations, Title 23, Citation:

Chapter 6.7, Section(s) 25284, 25286

Violation Description: Failure to submit a complete and accurate application for a permit to

operate a UST, or for renewal of the permit.

Returned to compliance on 10/04/2017. Update BOE number to CERS. Violation Notes:

Violation Division: Madera County Environmental Health

UST Violation Program: Violation Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-23-2016

Citation: 23 CCR 16 2641(a) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(a)

Failure of leak detection equipment to be located such that equipment Violation Description:

is capable of detecting a leak at the earliest possible opportunity.

Violation Notes: Returned to compliance on 10/18/2016. INSPECTOR OBSERVED 87 AND 91

SUMP SENSOR NOT AT LOWEST PART OF SUMP. SENSOR LINE TOO SHORT. PLACE

SENSOR AT LOWEST PART OF SUMP. SUBMIT DOCUMENTATION IN 30 DAYS

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16,

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

HARRY'S LIQUOR & GAS (Continued)

S121765386

Section(s) 2665

Violation Description: Failure to comply with one or more of the following: Failure to

install or maintain a liquid-tight spill bucket. Have a minimum capacity of five gallons. Have a functional drain valve or other method for the removal of liquid from the spill bucket/spill

container. Be resistant to galvanic corrosion.

Violation Notes: Returned to compliance on 10/12/2017. 91 spill bucket failed test. Cap

has a leak.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 09-28-2017

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance.

Violation Notes: Returned to compliance on 10/04/2017. Update CFO letter to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS

Violation Date: 07-13-2016

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95,

Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the

business plan is complete and accurate on or before the annual due

date.

Violation Notes: Returned to compliance on 09/28/2016.
Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-05-2013

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-23-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Other/Unknown

Direction Distance

Elevation Site Database(s) EPA ID Number

HARRY'S LIQUOR & GAS (Continued)

S121765386

EDR ID Number

Eval Date: 10-18-2016

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-25-2014

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-23-2016

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-28-2017 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 10-01-2015 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Enforcement Action:

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS
Site Address: 500 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 09-23-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HMRRP Enf Action Source: CERS

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HARRY'S LIQUOR & GAS (Continued)

S121765386

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS Site Address: 500 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 09-23-2016

Notice of Violation (Unified Program) Enf Action Type:

Notice of Violation Issued by the Inspector at the Time of Inspection Enf Action Description:

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS 500 N GATEWAY DR Site Address:

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 09-25-2015

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST **CERS** Enf Action Source:

Site ID: 35592

Site Name: HARRY'S LIQUOR & GAS Site Address: 500 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 09-28-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

UST Enf Action Program: Enf Action Source: **CERS**

Coordinates:

Site ID: 35592

Facility Name: HARRY'S LIQUOR & GAS

Env Int Type Code: **HMBP** 10425673 Program ID: Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.964870 Longitude: -120.064740

Affiliation:

Affiliation Type Desc: Facility Mailing Address Entity Name: Mailing Address **Entity Title:** Not reported Affiliation Address: 500 N GATEWAY DR

Affiliation City: **MADERA** Affiliation State: CA

Direction Distance Elevation

vation Site Database(s) EPA ID Number

HARRY'S LIQUOR & GAS (Continued)

S121765386

EDR ID Number

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: Not reported

Affiliation Type Desc: Operator

Entity Name: RAVINDER KAUR Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 232-5681

Affiliation Type Desc: **Document Preparer** RAVINDER KAUR **Entity Name:** Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Not reported Affiliation State: Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: HARRY'S LIQUOR & GAS

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: UST Property Owner Name

Entity Name: RAVINDER KAUR
Entity Title: Not reported
Affiliation Address: 500 N GATEWAY

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 416-7465

Affiliation Type Desc:
Entity Name:
Entity Title:
Affiliation Address:
Legal Owner
RAVINDER KAUR
Not reported
5784 W MAGILL AVE

Affiliation City: FRESNO
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 93722
Affiliation Phone: (559) 416-7465

Affiliation Type Desc: Property Owner
Entity Name: RAVINDER KAUR
Entity Title: Not reported

Distance

Elevation Site Database(s) EPA ID Number

HARRY'S LIQUOR & GAS (Continued)

S121765386

EDR ID Number

Affiliation Address: 500 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 416-7465

Affiliation Type Desc:

Entity Name:
Entity Title:
Affiliation Address:

UST Tank Owner
RAVINDER KAUR
Not reported
500 N GATEWAY

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637
Affiliation Phone: (559) 416-7465

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Environmental Contact
Entity Name: DALER SINGH
Entity Title: Not reported

Affiliation Address: 500 N GATEWAY DR.

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported

Affiliation Zip: 93637 Affiliation Phone: (559) 416-7465

Affiliation Type Desc: Identification Signer
Entity Name: RAVINDER KAUR
Entity Title: OWNER/OPERATOR

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Not reported

Not reported

Not reported

Not reported

Affiliation Type Desc: UST Permit Applicant Entity Name: DALER SINGH Entity Title: OWNER / OPERATOR

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HARRY'S LIQUOR & GAS (Continued)

S121765386

S101588438

N/A

SWEEPS UST

CA FID UST

Affiliation Type Desc: **UST Tank Operator** RAVINDER KAUR **Entity Name:** Entity Title: Not reported

Affiliation Address: 500 N GATEWAY DR

Affiliation City: **MADERA** Affiliation State: CA

Affiliation Country: **United States** Affiliation Zip: 93637

Affiliation Phone: (559) 416-7465

E35 J. J. JETTY/SALOK S. PUNGHLIA

wsw **500 N GATEWAY DR** < 1/8 MADERA, CA 93637

0.081 mi.

428 ft. Site 9 of 9 in cluster E

SWEEPS UST: Relative: Higher Status:

Active 100264 Comp Number: Actual: Number: 9 274 ft.

Board Of Equalization: Not reported 06-30-92 Referral Date: 07-22-92 Action Date: Created Date: 02-29-88 Owner Tank Id: Not reported

SWRCB Tank Id: 20-000-100264-001338

Tank Status: Α 2000 Capacity:

Active Date: Not reported Tank Use: M.V. FUEL STG:

OTHER Content: Number Of Tanks:

Status: Active Comp Number: 100264 Number: 9

Board Of Equalization: Not reported 06-30-92 Referral Date: Action Date: 07-22-92 Created Date: 02-29-88 Owner Tank Id: Not reported

SWRCB Tank Id: 20-000-100264-001339

Tank Status: Α Capacity: 1000 Not reported Active Date: M.V. FUEL Tank Use: STG: Ρ Content: **OTHER**

Number Of Tanks: Not reported Active Status:

100264 Comp Number: Number:

Not reported Board Of Equalization: 06-30-92 Referral Date: Action Date: 07-22-92

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

J. J. JETTY/SALOK S. PUNGHLIA (Continued)

S101588438

Created Date: 02-29-88 Owner Tank Id: Not reported

SWRCB Tank Id: 20-000-100264-001340

Tank Status: Α Capacity: 2000 Not reported Active Date: M.V. FUEL Tank Use: STG: OTHER Content: Number Of Tanks: Not reported

Status: Active Comp Number: 100264 Number:

Board Of Equalization: Not reported 06-30-92 Referral Date: 07-22-92 Action Date: Created Date: 02-29-88 Owner Tank Id: Not reported

20-000-100264-001341 SWRCB Tank Id:

Tank Status: Α Capacity: 4000 Active Date: Not reported M.V. FUEL Tank Use: STG:

OTHER Content: Number Of Tanks: Not reported

CA FID UST:

Facility ID: 20000686 Regulated By: UTNKA Regulated ID: Not reported Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2096743284 Mail To: Not reported

Mailing Address: 500 N GATEWAY DR Mailing Address 2: Not reported **MADERA 93637** Mailing City, St, Zip: Not reported Contact: Not reported Contact Phone: **DUNs Number:** Not reported NPDES Number: Not reported EPA ID: Not reported Comments: Not reported Status: Active

F36 **VALLEY WHOLESALE BUILDING MATE**

105 W CENTRAL AVE

HIST UST U001589596

N/A

< 1/8 MADERA, CA 93638

0.108 mi.

WNW

572 ft. Site 1 of 5 in cluster F

Relative: HIST UST:

Higher File Number:

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028F2D.pdf Actual:

STATE Region: 274 ft.

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

VALLEY WHOLESALE BUILDING MATE (Continued)

U001589596

Facility ID: 00000014199 Facility Type: Other Other Type: **PRIVATE**

Contact Name: JERRY SHERROD Telephone: 2096739261 Owner Name: **RALPH STOETZL** Owner Address: 101 E. CENTRAL AVE. Owner City, St, Zip: MADERA, CA 93638

Total Tanks: 0002

001 Tank Num: Container Num: 01 1965 Year Installed: Tank Capacity: 00010000 **PRODUCT** Tank Used for: Type of Fuel: DIESEL Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Tank Num: 002 Container Num: 02 Year Installed: 1965 Tank Capacity: 00005000 Tank Used for: **PRODUCT** Type of Fuel: **REGULAR** Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Click here for Geo Tracker PDF:

G37 RAMIREZ SERVICE & GARAGE LUST S104404461

CUPA Listings South **300 GATEWAY** N/A

HIST CORTESE < 1/8

MADERA, CA 93637 0.113 mi. **CERS**

597 ft. Site 1 of 21 in cluster G

Relative: LUST:

Lower MADERA COUNTY Lead Agency: Case Type: LUST Cleanup Site Actual:

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900039 271 ft.

Global Id: T0603900039 Latitude: 36.958812 Longitude: -120.0586

Status: Completed - Case Closed

10/27/1987 Status Date: Case Worker: **ADR** RB Case Number: 5T20000039 Local Agency: MADERA COUNTY File Location: Not reported Local Case Number: Not reported Potential Media Affect: Soil Potential Contaminants of Concern: Gasoline Site History: Not reported

LUST:

Global Id: T0603900039

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN

Direction Distance Elevation

evation Site Database(s) EPA ID Number

RAMIREZ SERVICE & GARAGE (Continued)

S104404461

EDR ID Number

Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900039

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603900039

 Action Type:
 Other

 Date:
 10/27/1987

 Action:
 Leak Reported

 Global Id:
 T0603900039

 Action Type:
 Other

 Date:
 04/01/1987

 Action:
 Leak Discovery

LUST:

Global Id: T0603900039

Status: Completed - Case Closed

Status Date: 10/27/1987

Global Id: T0603900039

Status: Open - Case Begin Date

Status Date: 04/01/1987

LUST REG 5:

Region:

Case Closed Status: Case Number: 5T20000039 Case Type: Soil only Substance: **GASOLINE** JWH Staff Initials: Lead Agency: Local LUST Program: MTBE Code: N/A

CUPA MADERA:

Contact Name: HERNANDEZ, ALEX MARCOS

Region: MADERA Facility Id: FA0102925 Contact Phone: 5596618392

Detail:

Facility Id: FA0102925 Common Name: ANTIFREEZE

Direction Distance

Elevation Site Database(s) EPA ID Number

RAMIREZ SERVICE & GARAGE (Continued)

Current Status: IN

Program/Elements: Haz Waste CESQG-0 to 99 kg/mo.

PE1: 2209 Decode for c status: Inactive

Facility Id: FA0102925
Common Name: USED MOTOR OIL

Current Status: IN

Program/Elements: Haz Mat Inventory

PE1: 2164 Decode for c status: Inactive

Contact Name: UNOCAL
Region: MADERA
Facility Id: FA0100207
Contact Phone: 2096747676

Detail:

Facility Id: FA0100207 Common Name: Unleaded Gasoline

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165
Decode for c status: Not reported

Facility Id: FA0100207
Common Name: Waste Oil
Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165

Decode for c status: Not reported

Contact Name: Monica Tapia
Region: MADERA
Facility Id: FA0103448
Contact Phone: 5597183036

Detail:

Facility Id: FA0103448
Common Name: Carbon Dioxide

Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111

Decode for c status: Not reported

Facility Id: FA0103448
Common Name: waste Motor Oil

Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111
Decode for c status: Not reported

HIST CORTESE:

Region: CORTESE Facility County Code: 20

EDR ID Number

S104404461

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RAMIREZ SERVICE & GARAGE (Continued)

S104404461

Reg By: **LTNKA** 5T20000123 Reg Id: CORTESE Region: Facility County Code: 20 Reg By: **LTNKA** 5T20000039 Reg Id:

CERS TANKS:

Site ID: 224550 CERS ID: T0603900039

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F) Entity Name:

Entity Title: Not reported Affiliation Address: 1685 E STREET Affiliation City: **FRESNO** Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

G38 **UNOCAL S/S #5936** LUST S107504205 South 300 GATEWAY N **CERS** N/A

< 1/8 MADERA, CA 93637

0.113 mi.

597 ft. Site 2 of 21 in cluster G

Relative: LUST:

Lower Lead Agency: MADERA COUNTY Case Type: **LUST Cleanup Site** Actual: Geo Track: 271 ft.

http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900122

T0603900122 Global Id: 36.962977 Latitude: Longitude: -120.06294

Completed - Case Closed Status:

Status Date: 07/01/1993 Case Worker: **ADR** 5T20000123 RB Case Number: Local Agency: MADERA COUNTY File Location: Not reported Local Case Number: Not reported

Potential Media Affect: Soil

Potential Contaminants of Concern: Waste Oil / Motor / Hydraulic / Lubricating

Site History: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

UNOCAL S/S #5936 (Continued)

S107504205

EDR ID Number

LUST:

Global Id: T0603900122

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900122

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603900122

 Action Type:
 Other

 Date:
 02/25/1993

 Action:
 Leak Reported

 Global Id:
 T0603900122

 Action Type:
 Other

 Date:
 11/13/1992

 Action:
 Leak Discovery

 Global Id:
 T0603900122

 Action Type:
 Other

 Date:
 11/13/1992

 Action:
 Leak Stopped

LUST:

Global Id: T0603900122

Status: Completed - Case Closed

Status Date: 07/01/1993

Global Id: T0603900122

Status: Open - Case Begin Date

Status Date: 11/13/1992

LUST REG 5:

Region: 5

Status: Case Closed 5T20000123 Case Number: Case Type: Soil only WASTE OIL Substance: JWH Staff Initials: Lead Agency: Local Program: LUST MTBE Code: N/A

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

UNOCAL S/S #5936 (Continued)

S107504205

CERS TANKS:

 Site ID:
 210080

 CERS ID:
 T0603900122

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported
Affiliation Address: 1685 E STREET
Affiliation City: FRESNO
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

G39 UNION OIL SS# 5936 HIST UST 1000167348

South 300 N GATEWAY DR < 1/8 MADERA, CA 93637

0.114 mi.

604 ft. Site 3 of 21 in cluster G

Relative: HIST UST:

 Lower
 File Number:
 Not reported

 Actual:
 URL:
 Not reported

 270 ft.
 Region:
 STATE

 Facility ID:
 00000060726

Facility ID: 0000060720
Facility Type: Gas Station
Other Type: Not reported

Contact Name: KENNETH K. MARTIN

Telephone: 2096747676 Owner Name: UNION OIL CO.

Owner Address: 1 CALIFORNIA ST., SUITE 2700
Owner City,St,Zip: SAN FRANCISCO, CA 94111

Total Tanks: 0001

Tank Num: 001
Container Num: 5936-10-1
Year Installed: Not reported
Tank Capacity: 00000000
Tank Used for: WASTE
Type of Fuel: Not reported

Container Construction Thickness: 6 Leak Detection: Visual N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

G40 **UNION OIL SS#5936** HIST UST U001589448 N/A

South 300 N GATEWAY DR MADERA, CA 93637 < 1/8

0.114 mi.

604 ft. Site 4 of 21 in cluster G

Other Type:

HIST UST: Relative: Lower Not reported File Number: URL: Not reported Actual: STATE Region: 270 ft. Facility ID: 00000021159 Facility Type: Gas Station

> Contact Name: KENNETH K. MARTIN

Telephone: 2096747676 Owner Name: UNION OIL CO.

1 CALIFORNIA ST. SUITE 2700 Owner Address: Owner City, St, Zip: SAN FRANCISCO, CA 94111

Not reported

Total Tanks: 0006

Tank Num: 001 5936-1-1 Container Num: Year Installed: 1967 Tank Capacity: 00010000 Tank Used for: **PRODUCT** Type of Fuel: UNLEADED Container Construction Thickness: Not reported

Leak Detection: Stock Inventor, 10

Tank Num: 002 Container Num: 5936-2-1 Year Installed: 1967 Tank Capacity: 00010000 Tank Used for: **PRODUCT** Type of Fuel: PREMIUM Container Construction Thickness: Not reported Leak Detection: Stock Inventor, 10

Tank Num: 003 Container Num: 5936-4-1 Not reported Year Installed: 00000550 Tank Capacity: Tank Used for: WASTE Type of Fuel: WASTE OIL Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Tank Num: 004 Container Num: 5936-1-1 Year Installed: 1967 Tank Capacity: 00010000 Tank Used for: **PRODUCT** UNLEADED Type of Fuel: Container Construction Thickness: Not reported Leak Detection: Stock Inventor, 10

Tank Num: 005 Container Num: 5936-2-1 Year Installed: 1967

Direction Distance

EDR ID Number Elevation **EPA ID Number** Site Database(s)

UNION OIL SS#5936 (Continued)

U001589448

1021410510

N/A

EDR Hist Auto

Tank Capacity: 00010000 Tank Used for: **PRODUCT** Type of Fuel: **PREMIUM** Container Construction Thickness: Not reported Leak Detection: Stock Inventor, 10

Tank Num: 006 Container Num: 5936-4-1 Year Installed: Not reported Tank Capacity: 00000550 WASTE Tank Used for: WASTE OIL Type of Fuel: Container Construction Thickness: Not reported Leak Detection: Stock Inventor

G41 **EARLS UNION 76 SERVICE STN**

South **300 N GATEWAY** < 1/8 MADERA, CA 93637

0.114 mi.

Site 5 of 21 in cluster G 604 ft.

Relative: Lower

EDR Hist Auto

1993

Year: Name: Type: Actual: 1969 GOMEZ RUBIN C Gasoline Service Stations 270 ft. 1970 GOMEZ RUBIN C Gasoline Service Stations **GOMEZ RUBIN C** Gasoline Service Stations 1971 1972 GOMEZ RUBIN C Gasoline Service Stations

1973 **Gasoline Service Stations** GOMEZ RUBIN C 1974 GOMEZ RUBIN C Gasoline Service Stations 1975 GOMEZ RUBIN C Gasoline Service Stations 1977 EARLS UNION 76 SERVICE STN Gasoline Service Stations 1977 GOMEZ RUBIN C **Gasoline Service Stations** 1978 EARLS UNION 76 SERVICE STN Gasoline Service Stations

1979 EARLS UNION 76 SERVICE STN Gasoline Service Stations Gasoline Service Stations 1980 EARLS UNION 76 SERVICE STN 1982 EARLS UNION 76 SERVICE STN **Gasoline Service Stations** 1983 EARLS UNION 76 SERVICE STN Gasoline Service Stations 1983 KENS RED CARPET UNION SERVICE Gasoline Service Stations 1985 KENS RED CARPET UNION SERVICE Gasoline Service Stations 1985 EARLS UNION 76 SERVICE STN Gasoline Service Stations 1986 EARLS UNION 76 SERVICE STN Gasoline Service Stations 1986 KENS RED CARPET UNION SERVICE **Gasoline Service Stations** 1987 KENS RED CARPET UNION SERVICE Gasoline Service Stations 1987 EARLS UNION 76 SERVICE STN Gasoline Service Stations 1988 EARLS UNION 76 SERVICE STN Gasoline Service Stations

1988 KENS RED CARPET UNION SERVICE **Gasoline Service Stations** KENS RED CARPET UNION SERVICE 1989 **Gasoline Service Stations** 1990 KENS RED CARPET UNION SERVICE Gasoline Service Stations 1991 KENS RED CARPET UNION SERVICE Gasoline Service Stations 1992 KENS RED CARPET UNION SERVICE Gasoline Service Stations

Gasoline Service Stations

KENS RED CARPET UNION SERVICE

TC5620993.2s Page 105

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

 G42
 RED CARPET UNION #5936
 SWEEPS UST
 \$101588401

 South
 300 N GATEWAY DR
 HIST UST
 N/A

< 1/8 MADERA, CA 93637

0.114 mi.

604 ft. Site 6 of 21 in cluster G

Relative: SWEEPS UST: Lower Status:

 Lower
 Status:
 Active

 Actual:
 Comp Number:
 100207

 270 ft.
 Number:
 9

Board Of Equalization: Not reported Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88 Owner Tank Id: 5936-1-1

SWRCB Tank ld: 20-000-100207-001262

Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL

STG: F

Content: OTHER

Number Of Tanks: 3

Status: Active Comp Number: 100207 Number: 9

Board Of Equalization: Not reported Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88 Owner Tank Id: 5936-2-1

SWRCB Tank ld: 20-000-100207-001263

Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P

Content: OTHER
Number Of Tanks: Not reported

Status: Active
Comp Number: 100207
Number: 9

Board Of Equalization: Not reported Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88 Owner Tank Id: 5936-4-1

SWRCB Tank ld: 20-000-100207-001264

Tank Status: A

Capacity: 550
Active Date: Not reported Tank Use: OIL STG: W

Content: Not reported Number Of Tanks: Not reported

CA FID UST

Distance Elevation Site

Site Database(s) EPA ID Number

RED CARPET UNION #5936 (Continued)

S101588401

EDR ID Number

HIST UST:

File Number: 00029070

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00029070.pdf

Region: Not reported Facility ID: Not reported Not reported Facility Type: Not reported Other Type: Contact Name: Not reported Telephone: Not reported Owner Name: Not reported Owner Address: Not reported Owner City, St, Zip: Not reported Total Tanks: Not reported

Tank Num: Not reported Not reported Container Num: Year Installed: Not reported Not reported Tank Capacity: Tank Used for: Not reported Type of Fuel: Not reported Container Construction Thickness: Not reported Leak Detection: Not reported

Not reported Tank Num: Not reported Container Num: Year Installed: Not reported Tank Capacity: Not reported Tank Used for: Not reported Type of Fuel: Not reported Container Construction Thickness: Not reported Leak Detection: Not reported

Click here for Geo Tracker PDF:

CA FID UST:

Facility ID: 20000315 Regulated By: **UTNKA** 00002115 Regulated ID: Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2096747676 Mail To: Not reported 300 N GATEWAY DR Mailing Address:

Mailing Address 2: Not reported Mailing City, St, Zip: **MADERA 93637** Contact: Not reported Contact Phone: Not reported **DUNs Number:** Not reported NPDES Number: Not reported Not reported EPA ID: Comments: Not reported Status: Active

Direction Distance

Elevation Site Database(s) EPA ID Number

G43 GATEWAY RENTALS HIST UST U001589180
SSE 225 N GATEWAY DR N/A

SSE 225 N GATEWAY DR < 1/8 MADERA, CA 93637

0.121 mi.

638 ft. Site 7 of 21 in cluster G

 Relative:
 HIST UST:

 Lower
 File Number:
 Not reported

 Actual:
 URL:
 Not reported

 272 ft.
 Region:
 STATE

 Facility ID:
 00000019596

 Facility Type:
 Other

Other Type: EQUIPMENT RENTAL

Contact Name: Not reported 2096737061

Owner Name: NORMAN W. HAIRE
Owner Address: 205 SASSAFRAS DR
Owner City,St,Zip: MADERA, CA 93637

Total Tanks: 0004

Tank Num: 001 Container Num: 1

Year Installed:

Tank Capacity:

Tank Used for:

Type of Fuel:

Container Construction Thickness:

Not reported

REGULAR

Not reported

Leak Detection: None

Tank Num: 002 Container Num: 2

Year Installed:

Tank Capacity:

Tank Used for:

Type of Fuel:

Container Construction Thickness:

Leak Detection:

Not reported
00008000
PRODUCT
DIESEL
Not reported
None

Tank Num: 003 Container Num: 3

Year Installed:
Tank Capacity:
00008000
Tank Used for:
Type of Fuel:
Container Construction Thickness:
Leak Detection:
Not reported
UNLEADED
None

Tank Num: 004 Container Num: 4

Year Installed:

Tank Capacity:

O0001000

Tank Used for:

Type of Fuel:

Container Construction Thickness:

Leak Detection:

Not reported

Not reported

Not reported

None

EDR ID Number

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

G44 BJ'S GAS AND LIQUOR CUPA Listings S107620260 SSE 225 N GATEWAY DR EMI N/A

SSE 225 N GATEWAY DR < 1/8 MADERA, CA 93637

0.121 mi.

638 ft. Site 8 of 21 in cluster G

Relative: CUPA MADERA:

Lower Contact Name: KULDIP SINGH BAGRI

 Actual:
 Region:
 MADERA

 272 ft.
 Facility ld:
 FA0100182

 Contact Phone:
 5596750112

Detail:

Facility Id: FA0100182
Common Name: PLUS UNLEADED

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165
Decode for c status: Not reported

Facility Id: FA0100182

Common Name: REGULAR UNLEADED

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165
Decode for c status: Not reported

Facility Id: FA0100182
Common Name: SUPER UNLEADED

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165

Decode for c status: Not reported

EMI:

 Year:
 2004

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1717

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.561303398 Reactive Organic Gases Tons/Yr: 0.558509188

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2005

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1717

 Air District Name:
 SJU

 SIC Code:
 5541

Direction Distance Elevation

nce EDR ID Number ation Site Database(s) EPA ID Number

BJ'S GAS AND LIQUOR (Continued)

S107620260

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: .5613033984509310810

Reactive Organic Gases Tons/Yr: .5585091875

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2006

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1717

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: .3835917871761638187
Reactive Organic Gases Tons/Yr: .3815628302917477

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2007

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1717

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: .3430028054677782529
Reactive Organic Gases Tons/Yr: .34118853851318289

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2008

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1717

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: .3427396286495869250 Reactive Organic Gases Tons/Yr: .34092633544921887

Carbon Monoxide Emissions Tons/Yr: 0

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BJ'S GAS AND LIQUOR (Continued)

S107620260

NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: O Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2009 Year: County Code: 20 Air Basin: SJV Facility ID: 1717 Air District Name: SJU SIC Code: 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 0.32517582178458598 Reactive Organic Gases Tons/Yr: 0.32341018148803602

Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2010 Year: County Code: 20 Air Basin: SJV Facility ID: 1717 Air District Name: SJU SIC Code:

SAN JOAQUIN VALLEY UNIFIED APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 0.32514956113344801

Reactive Organic Gases Tons/Yr: 0.323384018

Carbon Monoxide Emissions Tons/Yr: NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2011 Year: County Code: 20 Air Basin: SJV Facility ID: 1717 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY UNIFIED APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.39761583033 Reactive Organic Gases Tons/Yr: 0.39545685513

Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: n Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 2012

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BJ'S GAS AND LIQUOR (Continued)

S107620260

County Code: 20 SJV Air Basin: Facility ID: 1717 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY UNIFIED APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.38561125593 Reactive Organic Gases Tons/Yr: 0.3835174632

Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2013 Year: County Code: 20 Air Basin: SJV Facility ID: 1717 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY UNIFIED APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.406479067 Reactive Organic Gases Tons/Yr: 0.406479067

Carbon Monoxide Emissions Tons/Yr: NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 2014 County Code: 20 Air Basin: SJV Facility ID: 1717 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.40949683054 Reactive Organic Gases Tons/Yr: 0.40949683054

Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2015 Year: County Code: 20 SJV Air Basin: Facility ID: 1717 Air District Name: SJU SIC Code: 5541

Air District Name: SAN JOAQUIN VALLEY APCD

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BJ'S GAS AND LIQUOR (Continued)

S107620260

Community Health Air Pollution Info System: Not reported Not reported Consolidated Emission Reporting Rule: Total Organic Hydrocarbon Gases Tons/Yr: 0.38186475 Reactive Organic Gases Tons/Yr: 0.38186475

Carbon Monoxide Emissions Tons/Yr: NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2016 Year: County Code: 20 Air Basin: SJV Facility ID: 1717 Air District Name: SJU SIC Code: 5541

Air District Name: SAN JOAQUIN VALLEY APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.335970472 Reactive Organic Gases Tons/Yr: 0.335970472 Carbon Monoxide Emissions Tons/Yr: Not reported NOX - Oxides of Nitrogen Tons/Yr: Not reported SOX - Oxides of Sulphur Tons/Yr: Not reported Particulate Matter Tons/Yr: Not reported Part. Matter 10 Micrometers and Smllr Tons/Yr:Not reported

S101588373 G45 **B-J LIQUOR** LUST SSE 225 GATEWAY N **SWEEPS UST** N/A

< 1/8 MADERA, CA 93637 **HIST UST** 0.121 mi. **CA FID UST**

638 ft. Site 9 of 21 in cluster G **HIST CORTESE CERS**

Relative:

Lower LUST:

Lead Agency: MADERA COUNTY Actual: 272 ft. Case Type: LUST Cleanup Site

> Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900159

Global Id: T0603900159 36.962991 Latitude: Longitude: -120.061944

Status: Completed - Case Closed

Status Date: 05/23/1996 Case Worker: **ADR** 5T20000162 RB Case Number: MADERA COUNTY Local Agency: File Location: Not reported Not reported Local Case Number: Potential Media Affect: Soil Potential Contaminants of Concern: Gasoline Site History: Not reported

LUST:

Global Id: T0603900159

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN MADERA COUNTY Organization Name: Address: 2037 WEST CLEVELAND

Direction Distance

Elevation Site Database(s) EPA ID Number

B-J LIQUOR (Continued) S101588373

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900159

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603900159

 Action Type:
 Other

 Date:
 03/25/1996

 Action:
 Leak Reported

 Global Id:
 T0603900159

 Action Type:
 Other

 Date:
 03/19/1996

 Action:
 Leak Discovery

 Global Id:
 T0603900159

 Action Type:
 Other

 Date:
 03/19/1996

 Action:
 Leak Stopped

LUST:

Global Id: T0603900159

Status: Completed - Case Closed

Status Date: 05/23/1996

Global Id: T0603900159

Status: Open - Case Begin Date

Status Date: 03/19/1996

Global Id: T0603900159

Status: Open - Site Assessment

Status Date: 03/25/1996

Lead Agency: MADERA COUNTY
Case Type: LUST Cleanup Site

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900018

 Global Id:
 T0603900018

 Latitude:
 36.962991

 Longitude:
 -120.061944

Status: Completed - Case Closed

Status Date: 10/27/1987
Case Worker: ADR
RB Case Number: 5T20000018
Local Agency: MADERA COUNTY
File Location: Not reported
Local Case Number: Not reported

EDR ID Number

Direction Distance

Elevation Site Database(s) EPA ID Number

B-J LIQUOR (Continued) S101588373

Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0603900018

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900018

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603900018

 Action Type:
 Other

 Date:
 03/11/1986

 Action:
 Leak Reported

 Global Id:
 T0603900018

 Action Type:
 ENFORCEMENT

 Date:
 07/21/2010

Action: Closure/No Further Action Letter

LUST:

Global Id: T0603900018

Status: Completed - Case Closed

Status Date: 10/27/1987

Global Id: T0603900018

Status: Open - Case Begin Date

Status Date: 03/11/1986

Global Id: T0603900018

Status: Open - Site Assessment

Status Date: 03/11/1986

LUST REG 5:

Region: 5

Status: Case Closed
Case Number: 5T20000018
Case Type: Soil only

Substance: REGULR GASOLINE

Staff Initials: JWH Lead Agency: Local **EDR ID Number**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

B-J LIQUOR (Continued)

S101588373

Program: LUST MTBE Code: N/A

SWEEPS UST:

Status: Active 100182 Comp Number: Number:

Board Of Equalization: Not reported Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88

Owner Tank Id: 2

SWRCB Tank Id: 20-000-100182-001193

Tank Status: Capacity: 8000 Active Date: Not reported Tank Use: M.V. FUEL STG: Content: **OTHER**

Number Of Tanks: 2

Status: Active Comp Number: 100182 Number:

Not reported Board Of Equalization: Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88

Owner Tank Id: 3

20-000-100182-001194 SWRCB Tank Id:

Tank Status: Α Capacity: 8000 Not reported Active Date: M.V. FUEL Tank Use: STG: OTHER Content: Number Of Tanks: Not reported

HIST UST:

File Number: 00028EBA

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028EBA.pdf

Region: Not reported Facility ID: Not reported Facility Type: Not reported Other Type: Not reported Contact Name: Not reported Telephone: Not reported Owner Name: Not reported Owner Address: Not reported Owner City, St, Zip: Not reported Total Tanks: Not reported

Tank Num: Not reported Container Num: Not reported Year Installed: Not reported Tank Capacity: Not reported

Direction
Distance

Elevation Site Database(s) EPA ID Number

B-J LIQUOR (Continued) S101588373

Tank Used for:

Type of Fuel:

Container Construction Thickness:
Leak Detection:

Not reported
Not reported
Not reported

Click here for Geo Tracker PDF:

CA FID UST:

Facility ID: 20000016
Regulated By: UTNKA
Regulated ID: 00001959
Cortese Code: Not reported
SIC Code: Not reported
Facility Phone: 2096750112
Mail To: Not reported

Mailing Address: 225 N GATEWAY DR
Mailing Address 2: Not reported
Mailing City,St,Zip: MADERA 93637
Contact: Not reported
Contact Phone: Not reported
DUNs Number: Not reported
NPDES Number: Not reported

EPA ID: Not reported Comments: Not reported Status: Active

HIST CORTESE:

Region: CORTESE
Facility County Code: 20
Reg By: LTNKA
Reg Id: 5T20000018

Region: CORTESE
Facility County Code: 20
Reg By: LTNKA
Reg Id: 5T20000162

CERS TANKS:

 Site ID:
 193989

 CERS ID:
 T0603900018

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Not reported

Not reported

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

EDR ID Number

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

B-J LIQUOR (Continued) S101588373

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

CERS TANKS G46 **BJ'S GAS & LIQUOR** S121795382 CERS N/A

SSE 225 N GATEWAY DR < 1/8 MADERA, CA 93637

0.121 mi.

638 ft. Site 10 of 21 in cluster G

Relative: **CERS TANKS:**

Lower Site ID: 99014 CERS ID: 10425448 Actual:

CERS Description: Underground Storage Tank 272 ft.

Violations:

Site ID: 99014

Site Name: **BJ'S GAS & LIQUOR**

Violation Date: 11-16-2017

Citation: 23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(h)

Violation Description: Failure to have an approved UST Response Plan.

Violation Notes: Returned to compliance on 11/18/2017. Submit the missing ust response

plan to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 99014

BJ'S GAS & LIQUOR Site Name:

Violation Date: 05-20-2016

HSC 6.7 25292.5 - California Health and Safety Code, Chapter 6.7, Citation:

Section(s) 25292.5

Violation Description: Failure to conduct the required enhanced leak detection testing for

single and double walled UST systems located within 1,000 feet of a

public drinking water well.

Returned to compliance on 06/16/2016. PROVIDE WRITTEN PROGRAM OF ELD Violation Notes:

(TESTING PROGRAM WORK PLAN FOR REVIEW AND APPROVAL)

Violation Division: Madera County Environmental Health

Violation Program: UST **CERS** Violation Source:

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

12-07-2015 Violation Date:

Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

6.95, Section(s) 25505(a)(4)

Violation Description: Failure to provide initial and annual training to all employees in

> safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training

records for a minimum of three years.

Violation Notes: Returned to compliance on 01/08/2016. Failed to provide training logs.

Violation Division: Madera County Environmental Health

HMRRP Violation Program:

Distance

Elevation Site Database(s) EPA ID Number

BJ'S GAS & LIQUOR (Continued)

S121795382

EDR ID Number

Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 11-16-2017

Citation: 23 CCR 16 2715(a) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2715(a)

Violation Description: Failure to submit the UPA. of the designated operator (DO)

identification and/or change of the DO within 30 days.

Violation Notes: Returned to compliance on 11/18/2017. Update DO form to CERS to

include Evan Brewer.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 11-16-2017

Citation: 23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(h)

Violation Description: Failure to have an approved UST Monitoring Plan.

Violation Notes: Returned to compliance on 11/16/2017. 1. UDC monitoring shall be YES

to UDC monitoring stops flow of product at dispenser. 2. Select NO for

periodic system testing for ELD testing.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 12-07-2015

Citation: HSC 6.7 25292.5 - California Health and Safety Code, Chapter 6.7,

Section(s) 25292.5

Violation Description: Failure to conduct the required enhanced leak detection testing for

single and double walled UST systems located within 1,000 feet of a

public drinking water well.

Violation Notes: Returned to compliance on 06/16/2016.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 11-16-2017

Citation: 23 CCR 16 2641(j) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(j)

Violation Description: Failure of the leak detection equipment to be installed, calibrated,

operated, and/or maintained properly.

Violation Notes: Returned to compliance on 11/16/2017. 87-6,000gallon turbine didn't

turn on. The line leak detector and positive shut down didn't get tester. Tester will repair the turbine, test the line leak detector

and test positive shut down.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Direction Distance

Elevation Site Database(s) EPA ID Number

BJ'S GAS & LIQUOR (Continued)

S121795382

EDR ID Number

Site Name: BJ'S GAS & LIQUOR

Violation Date: 11-16-2017

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance.

Violation Notes: Returned to compliance on 11/16/2017. Update CFO letter to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 09-05-2014

Citation: HSC 6.7 25292.5 - California Health and Safety Code, Chapter 6.7,

Section(s) 25292.5

Violation Description: Failure to conduct the required enhanced leak detection testing for

single and double walled UST systems located within 1,000 feet of a

public drinking water well.

Violation Notes: Returned to compliance on 07/14/2016. Facility failed to perform ELD.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 05-20-2016

Citation: HSC 6.7 25299 - California Health and Safety Code, Chapter 6.7,

Section(s) 25299

Violation Description: Failure to comply with one or more of the operating permit conditions.

Violation Notes: Returned to compliance on 06/16/2016.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 11-16-2017

Citation: 23 CCR 16 2715(f)(2) - California Code of Regulations, Title 23,

Chapter 16, Section(s) 2715(f)(2)

Violation Description: Failure to have at least one facility employee present during

operating hours that has been trained in the proper operation and maintenance of the UST system by a designated operator (DO).

Violation Notes: Returned to compliance on 11/16/2017. Provide staff training. Assure a

trained staff by the DO is on site at all time.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 12-07-2015

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance.

Violation Notes: Returned to compliance on 01/28/2016. Upload Financial Responsibility

Distance

Elevation Site Database(s) EPA ID Number

BJ'S GAS & LIQUOR (Continued)

S121795382

EDR ID Number

Certification to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-19-2014

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 12-07-2015

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 01-05-2016

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 05-20-2016

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-05-2014

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-05-2014 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

MAP FINDINGS Map ID Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BJ'S GAS & LIQUOR (Continued)

S121795382

Eval Program: UST Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 11-16-2017 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 11-23-2016

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **CERS** Eval Source:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 12-07-2015

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Compliance Evaluation Inspection Eval General Type:

Eval Date: 08-21-2013

Violations Found:

Eval Type: Routine done by local agency

Not reported Eval Notes:

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Enforcement Action:

Site ID: 99014

Site Name: **BJ'S GAS & LIQUOR** Site Address: 225 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 05-20-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Not reported Enf Action Notes:

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 99014

Site Name: **BJ'S GAS & LIQUOR** Site Address: 225 N GATEWAY DR

Site City: **MADERA**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BJ'S GAS & LIQUOR (Continued)

S121795382

Site Zip: 93637 Enf Action Date: 09-05-2014

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

UST Enf Action Program: Enf Action Source: **CERS**

Site ID: 99014

Site Name: **BJ'S GAS & LIQUOR** Site Address: 225 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 11-16-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

UST Enf Action Program: Enf Action Source: **CERS**

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR Site Address: 225 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 12-07-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP** Enf Action Source: CERS

Site ID: 99014

Site Name: **BJ'S GAS & LIQUOR** Site Address: 225 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 12-07-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

UST Enf Action Program: Enf Action Source: **CERS**

Coordinates:

Site ID: 99014

Facility Name: **BJ'S GAS & LIQUOR**

Env Int Type Code: **HMBP** Program ID: 10425448 Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.962990 Longitude: -120.061940

MAP FINDINGS Map ID Direction

Distance Elevation

Site Database(s) **EPA ID Number**

BJ'S GAS & LIQUOR (Continued)

S121795382

EDR ID Number

Affiliation:

Affiliation Type Desc: **CUPA** District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: **Document Preparer** Entity Name: Kuldip Singh Bagri **Entity Title:** Not reported Not reported Affiliation Address: Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: **Environmental Contact** Entity Name: KULDIP SINGH BAGRI

Entity Title: Not reported Affiliation Address: 225 N GATEWAY

Affiliation City: **MADERA** Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

(559) 232-3494 Affiliation Phone:

Affiliation Type Desc: Operator

KULDIP SINGH BAGRI **Entity Name:**

Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 232-3494

Affiliation Type Desc: Property Owner Entity Name: Kuldip Singh Bagri Entity Title: Not reported 225 N GATEWAY DR

Affiliation Address:

Affiliation City: **MADERA** Affiliation State: CA

Affiliation Country: **United States** Affiliation Zip: 93637 Affiliation Phone: (559) 675-0112

UST Tank Owner Affiliation Type Desc: KULDIP SINGH BAGRI Entity Name:

Entity Title: Not reported Affiliation Address: 225 N. Gateway Dr.

Affiliation City: Madera Affiliation State: CA

Direction Distance Elevation

on Site Database(s) EPA ID Number

BJ'S GAS & LIQUOR (Continued)

S121795382

EDR ID Number

Affiliation Country: United States
Affiliation Zip: 93637
Affiliation Phone: (559) 675-0112

Affiliation Type Desc: Identification Signer
Entity Name: Kuldip Singh Bagri
Entity Title: OWNER/OPERATOR

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Not reported

Not reported

Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: BJ'S GAS & LIQUOR

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: UST Tank Operator Entity Name: KULDIP SINGH BAGRI

Entity Title: Not reported
Affiliation Address: 225 N Gateway Dr

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 675-0112

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: 225 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner

Entity Name: KULDIP SINGH BAGRI

Entity Title: Not reported

Affiliation Address: 225 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 93637
Affiliation Phone: (559) 232-3494

Affiliation Type Desc: UST Property Owner Name

Entity Name: Kuldip Singh Bagri
Entity Title: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

BJ'S GAS & LIQUOR (Continued)

S121795382

EDR ID Number

Affiliation Address: 225 N Gateway Dr

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637
Affiliation Phone: (559) 675-0112

CERS TANKS:

Site ID: 99014 CERS ID: 10425448

CERS Description: Chemical Storage Facilities

Violations:

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 11-16-2017

Citation: 23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(h)

Violation Description: Failure to have an approved UST Response Plan.

Violation Notes: Returned to compliance on 11/18/2017. Submit the missing ust response

plan to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 05-20-2016

Citation: HSC 6.7 25292.5 - California Health and Safety Code, Chapter 6.7,

Section(s) 25292.5

Violation Description: Failure to conduct the required enhanced leak detection testing for

single and double walled UST systems located within 1,000 feet of a

public drinking water well.

Violation Notes: Returned to compliance on 06/16/2016. PROVIDE WRITTEN PROGRAM OF ELD

(TESTING PROGRAM WORK PLAN FOR REVIEW AND APPROVAL)

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 12-07-2015

Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

6.95, Section(s) 25505(a)(4)

Violation Description: Failure to provide initial and annual training to all employees in

safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training

records for a minimum of three years.

Violation Notes: Returned to compliance on 01/08/2016. Failed to provide training logs.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 11-16-2017

Direction

Elevation Site Database(s) EPA ID Number

BJ'S GAS & LIQUOR (Continued)

S121795382

EDR ID Number

Citation: 23 CCR 16 2715(a) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2715(a)

Violation Description: Failure to submit the UPA. of the designated operator (DO)

identification and/or change of the DO within 30 days.

Violation Notes: Returned to compliance on 11/18/2017. Update DO form to CERS to

include Evan Brewer.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 11-16-2017

Citation: 23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(h)

Violation Description: Failure to have an approved UST Monitoring Plan.

Violation Notes: Returned to compliance on 11/16/2017. 1. UDC monitoring shall be YES

to UDC monitoring stops flow of product at dispenser. 2. Select NO for

periodic system testing for ELD testing.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 12-07-2015

Citation: HSC 6.7 25292.5 - California Health and Safety Code, Chapter 6.7,

Section(s) 25292.5

Violation Description: Failure to conduct the required enhanced leak detection testing for

single and double walled UST systems located within 1,000 feet of a

public drinking water well.

Violation Notes: Returned to compliance on 06/16/2016.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 11-16-2017

Citation: 23 CCR 16 2641(j) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(j)

Violation Description: Failure of the leak detection equipment to be installed, calibrated,

operated, and/or maintained properly.

Violation Notes: Returned to compliance on 11/16/2017. 87-6,000gallon turbine didn't

turn on. The line leak detector and positive shut down didn't get tester. Tester will repair the turbine, test the line leak detector

and test positive shut down.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 11-16-2017

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Distance EDR ID Number
Elevation Site EPA ID Number

BJ'S GAS & LIQUOR (Continued)

S121795382

Financial Responsibility or other mechanism of financial assurance. Returned to compliance on 11/16/2017. Update CFO letter to CERS.

Violation Notes: Returned to compliance on 11/16/2017. Update CFO letter to C

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 09-05-2014

Citation: HSC 6.7 25292.5 - California Health and Safety Code, Chapter 6.7,

Section(s) 25292.5

Violation Description: Failure to conduct the required enhanced leak detection testing for

single and double walled UST systems located within 1,000 feet of a

public drinking water well.

Violation Notes: Returned to compliance on 07/14/2016. Facility failed to perform ELD.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 05-20-2016

Citation: HSC 6.7 25299 - California Health and Safety Code, Chapter 6.7,

Section(s) 25299

Violation Description: Failure to comply with one or more of the operating permit conditions.

Violation Notes: Returned to compliance on 06/16/2016.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 11-16-2017

Citation: 23 CCR 16 2715(f)(2) - California Code of Regulations, Title 23,

Chapter 16, Section(s) 2715(f)(2)

Violation Description: Failure to have at least one facility employee present during

operating hours that has been trained in the proper operation and maintenance of the UST system by a designated operator (DO).

Violation Notes: Returned to compliance on 11/16/2017. Provide staff training. Assure a

trained staff by the DO is on site at all time.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR

Violation Date: 12-07-2015

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance. Returned to compliance on 01/28/2016. Upload Financial Responsibility

Certification to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Violation Notes:

MAP FINDINGS Map ID Direction

Elevation

Distance

Site Database(s) **EPA ID Number**

BJ'S GAS & LIQUOR (Continued)

S121795382

EDR ID Number

Evaluation:

Eval General Type: Compliance Evaluation Inspection

09-19-2014 Eval Date:

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Madera County Environmental Health **Eval Division:**

HMRRP Eval Program: Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 12-07-2015

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

HMRRP Eval Program: Eval Source: CERS

Eval General Type: Other/Unknown 01-05-2016 Eval Date:

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Madera County Environmental Health Eval Division:

Eval Program: **HMRRP** Eval Source: **CERS**

Eval General Type: Other/Unknown 05-20-2016 Eval Date:

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

09-05-2014 Eval Date:

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: **HMRRP** Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

09-05-2014 Eval Date: Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

UST Eval Program: Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 11-16-2017

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BJ'S GAS & LIQUOR (Continued)

S121795382

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 11-23-2016

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Madera County Environmental Health Eval Division:

Eval Program: Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 12-07-2015

Violations Found: Yes

Routine done by local agency Eval Type:

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-21-2013

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Enforcement Action:

Site ID: 99014

Site Name: **BJ'S GAS & LIQUOR** Site Address: 225 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 05-20-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

UST Enf Action Program: Enf Action Source: **CERS**

Site ID: 99014

BJ'S GAS & LIQUOR Site Name: Site Address: 225 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 09-05-2014

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BJ'S GAS & LIQUOR (Continued)

Site ID:

S121795382

Enf Action Division: Madera County Environmental Health

99014

Enf Action Program: UST Enf Action Source: **CERS**

BJ'S GAS & LIQUOR Site Name: Site Address: 225 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 11-16-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST **CERS** Enf Action Source:

Site ID: 99014

Site Name: BJ'S GAS & LIQUOR Site Address: 225 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 12-07-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Site ID: 99014

Site Name: **BJ'S GAS & LIQUOR** Site Address: 225 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 12-07-2015 Enf Action Date:

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Coordinates:

Site ID: 99014

BJ'S GAS & LIQUOR Facility Name:

Env Int Type Code: **HMBP** Program ID: 10425448 Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.962990 Longitude: -120.061940

Affiliation:

Affiliation Type Desc: **CUPA District**

Entity Name: Madera County Env Health

Distance

Elevation Site Database(s) EPA ID Number

BJ'S GAS & LIQUOR (Continued)

S121795382

EDR ID Number

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: **Document Preparer** Entity Name: Kuldip Singh Bagri Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: Not reported

Affiliation Type Desc: Environmental Contact Entity Name: KULDIP SINGH BAGRI

Entity Title: Not reported
Affiliation Address: 225 N GATEWAY

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported

Affiliation Zip: 93637 Affiliation Phone: (559) 232-3494

Affiliation Type Desc: Operator

Entity Name: KULDIP SINGH BAGRI

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (559) 232-3494

Affiliation Type Desc: Property Owner
Entity Name: Kuldip Singh Bagri
Entity Title: Not reported

Affiliation Address: 225 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States

Affiliation Zip: 93637 Affiliation Phone: (559) 675-0112

Affiliation Type Desc: UST Tank Owner

Entity Name: KULDIP SINGH BAGRI
Entity Title: Not reported

Affiliation Address: 225 N. Gateway Dr.
Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 675-0112

Distance EDR ID Number
Elevation Site EDR ID Number
Database(s) EPA ID Number

BJ'S GAS & LIQUOR (Continued)

S121795382

Affiliation Type Desc: Identification Signer
Entity Name: Kuldip Singh Bagri
Entity Title: OWNER/OPERATOR

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Not reported

Not reported

Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: BJ'S GAS & LIQUOR

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: UST Tank Operator Entity Name: KULDIP SINGH BAGRI

Entity Title: Not reported
Affiliation Address: 225 N Gateway Dr

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 93637
Affiliation Phone: (559) 675-0112

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: 225 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner

Entity Name: KULDIP SINGH BAGRI

Entity Title: Not reported

Affiliation Address: 225 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 232-3494

Affiliation Type Desc: UST Property Owner Name

Entity Name: Kuldip Singh Bagri Entity Title: Not reported Affiliation Address: 225 N Gateway Dr

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BJ'S GAS & LIQUOR (Continued)

S121795382

N/A

Affiliation Zip: 93637

Affiliation Phone: (559) 675-0112

G47 UST U003971460 **BJ'S MART & DELI** N/A

SSE 225 N GATEWAY DR MADERA, CA 93637 < 1/8

0.121 mi.

638 ft. Site 11 of 21 in cluster G

Relative: UST:

Lower Facility ID: FA0100182 Permitting Agency: MADERA COUNTY Actual: 272 ft. Latitude: 36.964352

Longitude: -120.060549

Facility ID: FA0100182 Permitting Agency: Madera County Environmental Health

Latitude: 36.96299 Longitude: -120.06194

LEES CONCRETE MATERIALS INC 1020195589 G48 **EDR Hist Auto**

Type:

SSE 225 N GATEWAY

MADERA, CA 93637 < 1/8

0.121 mi.

638 ft. Site 12 of 21 in cluster G

Year:

Name:

EDR Hist Auto Relative:

Lower

Actual: **ROBERTSONS RENTALS** 1976 Not reported 272 ft. Carwashes 1976 LEES CONCRETE MATERIALS INC

ROBERTSONS RENTALS Not reported 1977 LEES CONCRETE MATERIALS INC Carwashes 1977 1978 LEES CONCRETE MATERIALS INC Carwashes 1978 **GATEWAY ENTERPRISES** Liquor Stores 1979 **GATEWAY ENTERPRISES** Not reported 1979 LEES CONCRETE MATERIALS INC Carwashes 1980 **GATEWAY ENTERPRISES** Not reported 1980 LEES CONCRETE MATERIALS INC Carwashes 1986 **B JS LIQUOR** Liquor Stores Liquor Stores 1987 **B JS LIQUOR** Liquor Stores 1988 **B JS LIQUOR** 1989 **B JS LIQUOR** Liquor Stores 1990 **B JS LIQUOR** Liquor Stores 1991 **B JS LIQUOR** Liquor Stores Liquor Stores 1992 **B JS LIQUOR** 1993 Liquor Stores

B JS LIQUOR 2011 BJS Gasoline Service Stations 2012 BJS **Gasoline Service Stations** 2013 BJS Gasoline Service Stations 2014 **BJS** Gasoline Service Stations

Direction Distance

Distance EDR ID Number

Elevation Site EDA ID Number

G49 VALLEE FOODSTORE / BJ LIQUORS LUST S104404488
SSE 225 GATEWAY N CERS N/A

SSE 225 GATEWAY N < 1/8 MADERA, CA 93637

0.121 mi.

272 ft.

639 ft. Site 13 of 21 in cluster G

Relative: LUST REG 5:

Lower Region: 5
Actual: Status: Case Closed

Case Number: 5T20000162
Case Type: Soil only
Substance: GASOLINE
Staff Initials: JWH
Lead Agency: Local
Program: LUST
MTBE Code: N/A

CERS TANKS:

 Site ID:
 187067

 CERS ID:
 T0603900159

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker
Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Not reported

1685 E STREET

FRESNO

CA

Not reported

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

F50 VALEY WHOLESALE LUMBER LUST S105174100 WNW 101 CENTRAL E CERS N/A

< 1/8 MADERA, CA 93663 0.124 mi.

657 ft. Site 2 of 5 in cluster F

Relative: LUST:

HigherLead Agency:MADERA COUNTYActual:Case Type:LUST Cleanup Site

274 ft. Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603991983

 Global Id:
 T0603991983

 Latitude:
 35.499626

 Longitude:
 -119.277207

Status: Completed - Case Closed

Status Date: 03/13/2004 Case Worker: ADR

Direction Distance

Elevation Site Database(s) EPA ID Number

VALEY WHOLESALE LUMBER (Continued)

S105174100

EDR ID Number

RB Case Number: 5T20000121*
Local Agency: MADERA COUNTY
File Location: Not reported
Local Case Number: Not reported
Potential Media Affect: Under Investigation
Potential Contaminants of Concern: Gasoline

Potential Contaminants of Concern: Gasoline Site History: Not reported

LUST:

Global Id: T0603991983

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603991983

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603991983

 Action Type:
 Other

 Date:
 12/29/1992

 Action:
 Leak Reported

Global Id: T0603991983
Action Type: ENFORCEMENT
Date: 03/13/2004

Action: Closure/No Further Action Letter

LUST:

Global Id: T0603991983

Status: Completed - Case Closed

Status Date: 03/13/2004

Global Id: T0603991983

Status: Open - Case Begin Date

Status Date: 12/29/1992

Global Id: T0603991983

Status: Open - Site Assessment

Status Date: 06/30/1998

LUST REG 5:

Region: 5

Status: Case Closed Case Number: 5T20000121*

Direction Distance

Elevation Site Database(s) **EPA ID Number**

VALEY WHOLESALE LUMBER (Continued)

S105174100

EDR ID Number

Case Type: Undefined **GASOLINE** Substance: Staff Initials: JWH Lead Agency: Local Program: LUST MTBE Code: N/A

CERS TANKS:

Site ID: 253219 CERS ID: T0603991983

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker

ANN ROLAN - MADERA COUNTY Entity Name:

Entity Title: Not reported

2037 WEST CLEVELAND Affiliation Address:

Affiliation City: MADERA Affiliation State: CA

Not reported Affiliation Country: Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Regional Board Caseworker

CA

JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F) Entity Name:

Entity Title: Not reported Affiliation Address: 1685 E STREET Affiliation City: **FRESNO**

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

F51 **VALLEY WHOLESALE BLDG** HIST CORTESE S104404497

WNW **101 CENTRAL**

MADERA, CA < 1/8

0.124 mi.

Site 3 of 5 in cluster F 657 ft. Relative: HIST CORTESE:

Higher Region:

Affiliation State:

CORTESE Facility County Code: 20 Actual: Reg By: **LTNKA** 274 ft. 5T20000188 Reg Id:

VALLEY WHOLESALE BLDG. MAT. **SWEEPS UST** S101588382 F52 WNW **105 W CENTRAL CA FID UST** N/A

1/8-1/4 MADERA, CA 93639

0.126 mi.

666 ft. Site 4 of 5 in cluster F Relative: SWEEPS UST:

Higher Status: Active Comp Number: 100088 Actual:

Number: 9 274 ft.

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

VALLEY WHOLESALE BLDG. MAT. (Continued)

Board Of Equalization: 44-013691 06-30-92 Referral Date: Action Date: 07-22-92 Created Date: 02-29-88 Owner Tank Id: 01

SWRCB Tank Id: 20-000-100088-000970

Tank Status: Α 10000 Capacity: Active Date: Not reported Tank Use: M.V. FUEL

STG: OTHER Content: Number Of Tanks:

Status: Active Comp Number: 100088 Number: 9

Board Of Equalization: 44-013691 Referral Date: 06-30-92 07-22-92 Action Date: Created Date: 02-29-88

Owner Tank Id: 02

SWRCB Tank Id: 20-000-100088-000971 Α

Tank Status:

500 Capacity: Active Date: Not reported Tank Use: M.V. FUEL STG: OTHER Content: Number Of Tanks: Not reported

CA FID UST:

20000071 Facility ID: Regulated By: UTNKA Regulated ID: 00001419 Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2096739261 Not reported Mail To: Mailing Address: 105 W CENTRAL Mailing Address 2: Not reported Mailing City, St, Zip: **MADERA 93639** Contact: Not reported Contact Phone: Not reported Not reported **DUNs Number:** NPDES Number: Not reported EPA ID: Not reported Not reported Comments: Status: Active

S101588382

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

F53 **VALEY WHOLESALE LUMBER** HIST CORTESE \$101298562

N/A

WNW **105 CENTRAL** 1/8-1/4 MADERA, CA 93663

0.126 mi.

666 ft. Site 5 of 5 in cluster F

HIST CORTESE: Relative: Higher Region:

CORTESE Facility County Code: 20 Actual: Reg By: **LTNKA** 274 ft. Reg Id: 5T20000121

G54 **BUGGY SHOWER CAR WASH** UST U003786964

South 230 GATEWAY DR N/A

1/8-1/4 MADERA, CA 93639

0.127 mi.

672 ft. Site 14 of 21 in cluster G

Relative: UST:

Lower Facility ID: FA0100166 Permitting Agency: MADERA COUNTY Actual: Latitude: 36.96273096 270 ft. Longitude: -120.062465

U001589346 **G55** POLICE DEPARTMENT **HIST UST**

South 203 W 4TH N/A

1/8-1/4 MADERA, CA 93637

0.131 mi.

691 ft. Site 15 of 21 in cluster G

Relative: HIST UST: Lower File Number: 00028DD3

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028DD3.pdf Actual:

Region: STATE 269 ft. Facility ID: 00000042553 Facility Type: Gas Station

Other Type: POLICE DEPARTMENT

Contact Name: Not reported Telephone: 2096745611

MADERA CITY POLICE Owner Name:

Owner Address: 203 W. 4TH

Owner City, St, Zip: MADERA, CA 93637

Total Tanks: 0001

Tank Num: 001 Container Num: 1 Year Installed: 1978 Tank Capacity: 00000500 Tank Used for: **PRODUCT** Type of Fuel: DIESEL Container Construction Thickness: Not reported Leak Detection: Not reported

Click here for Geo Tracker PDF:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

G56 MADERA CITY-POLICE DEPT./GORDON E. SKEELS S101588436

South 203 W 4TH ST 1/8-1/4 MADERA, CA 93637

0.131 mi.

691 ft. Site 16 of 21 in cluster G

SWEEPS UST: Relative:

Lower Status: Active Comp Number: 100226 Actual: Number: 269 ft. Board Of Equalization: 44-013725

Referral Date: 06-30-92 07-22-92 Action Date: Created Date: 02-29-88

Owner Tank Id:

SWRCB Tank Id: 20-000-100226-001298

Tank Status: 500 Capacity:

Active Date: Not reported Tank Use: M.V. FUEL

STG:

OTHER Content: Number Of Tanks: 1

CA FID UST:

20000682 Facility ID: Regulated By: UTNKA Regulated ID: 00004255 Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2096765611 Not reported Mail To: Mailing Address: 205 W 4TH ST Mailing Address 2: Not reported Mailing City, St, Zip: **MADERA 93637** Contact: Not reported Contact Phone: Not reported DUNs Number: Not reported NPDES Number: Not reported EPA ID: Not reported Not reported Comments: Active Status:

G57 MADERA AUTO RADIATOR SERVICE South

226 NORTH GATEWAY DRIVE

1/8-1/4 MADERA, CA 93637

0.142 mi.

751 ft. Site 17 of 21 in cluster G

Relative: **ENVIROSTOR:**

Lower Facility ID: 20750002

Status: Refer: Other Agency Actual: Status Date: 11/16/1994 271 ft.

Site Code: Not reported Site Type: Historical Site Type Detailed: * Historical Acres: Not reported NPL: NO

Regulatory Agencies: NONE SPECIFIED

SWEEPS UST

CA FID UST

N/A

ENVIROSTOR

S101481124

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA AUTO RADIATOR SERVICE (Continued)

S101481124

Lead Agency: NONE SPECIFIED Program Manager: Not reported

Supervisor: Referred - Not Assigned Division Branch: Cleanup Sacramento

Assembly: 05 Senate: 12

Special Program: * Rural County Survey Program

Restricted Use: NO

Site Mgmt Req: NONE SPECIFIED Funding: Not reported 36.9625 Latitude: -120.0613 Longitude: NONE SPECIFIED APN:

Past Use: NONE SPECIFIED NONE SPECIFIED Potential COC: NONE SPECIFIED Confirmed COC: Potential Description: NONE SPECIFIED Alias Name: 20750002

Alias Type: **Envirostor ID Number**

Completed Info:

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported Completed Document Type: * Discovery Completed Date: 08/15/1988

FACILITY IDENTIFIED POLK'S DIRECTORY 1946. CLEANED RADIATORS; GAS Comments:

TANKS REAMED.

Completed Area Name: **PROJECT WIDE** Completed Sub Area Name: Not reported Completed Document Type: Site Screening Completed Date: 01/24/1989

Comments: SITE SCREENING DONE.RATIONALE FOR PRELIMINARY ASSESSMENT LOW PRIORITY

BASED ON BUSINESS TYPE. NEED TO CLARIFY HISTORY OF SITE; SEND

QUESTIONNAIRE TO CURRENT PROPERTY OWNER.

Future Area Name: Not reported Future Sub Area Name: Not reported Future Document Type: Not reported Not reported Future Due Date: Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported

G58 BUGGY SHOWER CAR WASH HIST UST U001589089 South 230 N GATEWAY DR N/A

1/8-1/4 MADERA, CA 93637 0.147 mi.

774 ft. Site 18 of 21 in cluster G

Relative: HIST UST: File Number: Lower Not reported URL: Not reported Actual: Region: STATE 268 ft.

Facility ID: 00000013173 Facility Type: Gas Station

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BUGGY SHOWER CAR WASH (Continued)

U001589089

Other Type: Not reported

RICHARD JONES, MANAGER Contact Name:

Telephone: 2696739189

Owner Name: LEE & ANNA DA SILVA DBA BUGGY

Owner Address: 230 N. GATEWAY DRIVE Owner City, St, Zip: MADERA, CA 93637

Total Tanks: 0003

Tank Num: 001 Container Num: 01 Year Installed: 1976 00010000 Tank Capacity: Tank Used for: WASTE Type of Fuel: **UNLEADED**

Container Construction Thickness:

Leak Detection: Stock Inventor

002 Tank Num: Container Num: 02 Year Installed: 1976 Tank Capacity: 00010000 PRODUCT Tank Used for: Type of Fuel: UNLEADED

Container Construction Thickness: 1/4

Leak Detection: Stock Inventor

Tank Num: 003 Container Num: 03 Year Installed: 1976 00007000 Tank Capacity: Tank Used for: **PRODUCT** Type of Fuel: **REGULAR** Container Construction Thickness: 1/4

Leak Detection: Stock Inventor

G59 **BUGGY SHOWERS** South 230 N GATEWAY DR 1/8-1/4 **MADERA, CA 93637** 0.147 mi.

774 ft. Site 19 of 21 in cluster G

Relative: Lower

SWEEPS UST: Actual:

Status: Active 268 ft. Comp Number: 100166 9 Number:

> Not reported Board Of Equalization: Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88

Owner Tank Id:

SWRCB Tank Id: 20-000-100166-001170

Tank Status: 10000 Capacity: Active Date: Not reported M.V. FUEL Tank Use:

STG: Ρ S101621169

N/A

SWEEPS UST

HIST UST

EMI

CERS

CA FID UST

CERS TANKS

CUPA Listings

Direction Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

Content: OTHER Number Of Tanks: 3

Status: Active
Comp Number: 100166
Number: 9

Board Of Equalization: Not reported Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88

Owner Tank Id: 2

SWRCB Tank Id: 20-000-100166-001171

Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P

Content: OTHER
Number Of Tanks: Not reported

Status: Active
Comp Number: 100166
Number: 9

Board Of Equalization: Not reported Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88 Owner Tank Id: 3

SWRCB Tank Id: 20-000-100166-001172

Tank Status: A
Capacity: 7000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P

Content: OTHER
Number Of Tanks: Not reported

HIST UST:

File Number: 00028D58

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028D58.pdf

Not reported Region: Facility ID: Not reported Facility Type: Not reported Not reported Other Type: Contact Name: Not reported Not reported Telephone: Owner Name: Not reported Not reported Owner Address: Owner City, St, Zip: Not reported Total Tanks: Not reported

Tank Num:

Container Num:

Year Installed:

Tank Capacity:

Tank Used for:

Type of Fuel:

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BUGGY SHOWERS (Continued)

S101621169

Container Construction Thickness: Not reported Not reported Leak Detection:

Click here for Geo Tracker PDF:

CA FID UST:

Facility ID: 20000488 Regulated By: UTNKA Regulated ID: 00001317 Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2096739189 Mail To: Not reported

Mailing Address: 230 N GATEWAY DR Mailing Address 2: Not reported

Mailing City, St, Zip: **MADERA 93639** Contact: Not reported Contact Phone: Not reported **DUNs Number:** Not reported Not reported NPDES Number: Not reported EPA ID: Comments: Not reported Status: Active

CERS TANKS:

Site ID: 100481 CERS ID: 10425403

CERS Description: Underground Storage Tank

Violations:

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Violation Date: 05-20-2016

HSC 6.7 25292.5 - California Health and Safety Code, Chapter 6.7, Citation:

Section(s) 25292.5

Violation Description: Failure to conduct the required enhanced leak detection testing for

single and double walled UST systems located within 1,000 feet of a

public drinking water well.

Returned to compliance on 07/07/2016. PROVIDE WRITTEN PROGRAM OF ELD Violation Notes:

(TESTING PROGRAM WORK PLAN FOR REVIEW AND APPROVAL)

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 100481

BUGGY SHOWER CAR WASH Site Name:

Violation Date: 03-09-2016

23 CCR 16 2712(i) - California Code of Regulations, Title 23, Chapter Citation:

16, Section(s) 2712(i)

Violation Description: Failure to maintain on site an approved monitoring plan.

Violation Notes: Returned to compliance on 06/16/2016. Provide missing monitoring plan

and submit to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 100481

Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 04-11-2016

Citation: HSC 6.7 25292(e) - California Health and Safety Code, Chapter 6.7,

Section(s) 25292(e)

Violation Description: Failure to maintain secondary containment, as evidenced by failure of

secondary containment testing.

Violation Notes: Regular UDC failed.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95,

Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the

business plan is complete and accurate on or before the annual due

date

Violation Notes: Returned to compliance on 03/23/2018. Update the emergency response

plan to CERS to include the local CUPA phone number.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 10-03-2016

Citation: 23 CCR 6.7 25284, 25286 - California Code of Regulations, Title 23,

Chapter 6.7, Section(s) 25284, 25286

Violation Description: Failure to submit a complete and accurate application for a permit to

operate a UST, or for renewal of the permit. Returned to compliance on 10/11/2016.

Violation Notes: Returned to compliance on 10/11/201
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-09-2016

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance. Returned to compliance on 06/16/2016. Provide missing financial

responsibility and submit to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Violation Notes:

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-22-2017

Citation: 23 CCR 16 2636(f)(1) - California Code of Regulations, Title 23,

Chapter 16, Section(s) 2636(f)(1)

Violation Description: Failure of the double-walled pressurized piping to be continuously

monitored with a system that activates an audible and visual alarm or

Direction Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

Violation Notes:

S101621169

EDR ID Number

stops flow at the dispenser when a leak is detected.

Violation Notes: Returned to compliance on 03/22/2017. 87 STP SENSOR FAILED.

REPAIR/REPLACE AND RETEST. CORRECTED ONSITE

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 09-11-2013

Citation: HSC 6.95 25505(a) - California Health and Safety Code, Chapter 6.95,

Section(s) 25505(a)

Violation Description: Owner/Operator failed to complete and/or submit a Hazardous Materials

Business Plan when storing hazardous materials at or above the

thresholds quantities of 55 gallons/500 lbs/200 cubic feet.

Returned to compliance on 04/13/2015. Operator failed to provide a

copy of HMBP. Please submit an updated HMBP on CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: 23 CCR 16 2637 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2637

Violation Description: Failure to conduct secondary containment testing, or one or more of

the following requirements: Perform the test within six months of installation and every 36 months thereafter. Use a procedure that demonstrates the system works as well as at installation. Use applicable manufacturer guidelines, industry codes, engineering standard, or professional engineer approval. Performed by a certified

service technician or a licensed tank tester.

Violation Notes: Last done on 4/10/2017.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to complete and electronically submit a site map with all

required content.

Violation Notes: Returned to compliance on 03/23/2018. Update site map to include,

evacuation area, exit/entry, fourth street, storm/sewage drains and $% \left(1\right) =\left(1\right) \left(1\right)$

emergency spill/clean up equipment to CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 04-15-2015

Citation: HSC 6.7 25291 - California Health and Safety Code, Chapter 6.7,

Section(s) 25291

Distance EDR ID Number
Elevation Site EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

Violation Description: Failure to maintain under-dispenser containment, sumps, and/or other

secondary containment in good condition and/or free of debris/liquid.

Violation Notes: Failed SB989 componets.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-22-2017

Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2665

Violation Description: Failure to comply with one or more of the following: Failure to

install or maintain a liquid-tight spill bucket. Have a minimum capacity of five gallons. Have a functional drain valve or other method for the removal of liquid from the spill bucket/spill

container. Be resistant to galvanic corrosion.

Violation Notes: Returned to compliance on 03/22/2017. 87 OVERSPILL BUCKET FAILED.

REPAIR/REPLACE AND RETEST. SUBMIT DOCUMENTATION WITHIN 30 DAYS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to establish and electronically submit an adequate training

program in safety procedures in the event of a release or threatened

release of a hazardous material.

Violation Notes: Provide a training program.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-09-2016

Citation: HSC 6.7 25292.5 - California Health and Safety Code, Chapter 6.7,

Section(s) 25292.5

Violation Description: Failure to conduct the required enhanced leak detection testing for

single and double walled UST systems located within 1,000 feet of a

public drinking water well.

Violation Notes: Returned to compliance on 07/14/2016.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.95 25508.1(a)-(f) - California Health and Safety Code, Chapter

6.95, Section(s) 25508.1(a)-(f)

Violation Description: Failure to electronically update business plan within 30 days of any

one of the following events: A 100 percent or more increase in the quantity of a previously disclosed material. Any handling of a

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

previously undisclosed hazardous materials at or above reportable quantities. A change of business address, business ownership, or business name. A substantial change in the handler's operations that

requires modification to any portion of the business plan.

Violation Notes: Returned to compliance on 03/23/2018. Update inventory list to include

the new federal hazard categories in CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: 23 CCR 16 2632(d)(1)(c),2641(h),2711(a)(8) - California Code of

Regulations, Title 23, Chapter 16, Section(s)

2632(d)(1)(c),2641(h),2711(a)(8)

Violation Description: Failure to submit or maintain a current facility plot plan.

Violation Notes: Returned to compliance on 03/23/2018. Update ust site map to include

all the ust monitoring components to CERS>

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.7 25290.1(c),25290.2(c),25291(a)(2),2529.1(e) - California

Health and Safety Code, Chapter 6.7, Section(s) 25290.1(c),25290.2(c),25291(a)(2),2529.1(e)

Violation Description: Failure to maintain secondary containment (e.g., failure of secondary

containment testing).

Violation Notes: Failed to repair/retest failed sb989 components - all four udcs

failed.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.7 25284 - California Health and Safety Code, Chapter 6.7,

Section(s) 25284

Violation Description: Failure to obtain a valid permit to operate from the UPA including but

not limited to unpaid permit fees.

Violation Notes: Not reported

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-22-2017

Citation: 23 CCR 16 2715(a) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2715(a)

Violation Description: Failure to notify the CUPA of the designated operator (DO)

identification and/or change of the DO within 30 days.

Violation Notes: Returned to compliance on 04/26/2017. UPDATED DESIGNATED OPERATOR

Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

Violation Notes:

S101621169

EDR ID Number

CERTIFICATION NOT SUBMITTED ON CERS. UPDATED CERTIFICATION ONSITE.

UPDATE CERS WITHIN 30 DAYS

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance. Returned to compliance on 03/23/2018. Update CFO letter to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-09-2016

Citation: HSC 6.7 25292(e) - California Health and Safety Code, Chapter 6.7,

Section(s) 25292(e)

Violation Description: Failure to maintain secondary containment, as evidenced by failure of

secondary containment testing.

Violation Notes: Operator failed to provide the retest result of the failed UDC test in

4.10.2014.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

6.95, Section(s) 25505(a)(4)

Violation Description: Failure to provide initial and annual training to all employees in

safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training

records for a minimum of three years.

Violation Notes: Provide missing training.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 05-20-2016

Citation: HSC 6.7 25286(a) - California Health and Safety Code, Chapter 6.7,

Section(s) 25286(a)

Violation Description: Failure to submit an complete and accurate application for a permit to

operate an underground storage tank, or for renewal of the permit.

Violation Notes: Returned to compliance on 10/11/2016.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Direction Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-09-2016

Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2665

Violation Description: Failure of the spill bucket to have a minimum capacity of five

gallons.

Violation Notes: Returned to compliance on 03/09/2016. Spill bucket failed to hold 5

gallons at time of inspection.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-21-2018 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 04-11-2016

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 04-15-2015

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-09-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-21-2018 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP

Direction Distance

Elevation Site Database(s) **EPA ID Number**

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 05-20-2016 Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **CERS** Eval Source:

Eval General Type: Other/Unknown 05-20-2016 Eval Date:

Violations Found:

Eval Type: Other, not routine, done by local agency CERS submittal 10/11/16 accepted 10/12/16 **Eval Notes: Eval Division:** Madera County Environmental Health

Eval Program: UST Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-11-2013

Violations Found:

Eval Type: Routine done by local agency

Eval Notes: Not reported

Madera County Environmental Health **Eval Division:**

Eval Program: **HMRRP Eval Source: CERS**

Eval General Type: Other/Unknown Eval Date: 10-03-2016

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Madera County Environmental Health Eval Division:

Eval Program: UST Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

03-22-2017 Eval Date: Violations Found: Yes

Routine done by local agency Eval Type:

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 04-15-2015

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Madera County Environmental Health Eval Division:

Eval Program: UST **CERS Eval Source:**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BUGGY SHOWERS (Continued)

S101621169

Enforcement Action:

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 03-09-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST **CERS** Enf Action Source:

Site ID: 100481

BUGGY SHOWER CAR WASH Site Name:

Site Address: 230 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 03-21-2018

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

230 N GATEWAY DR Site Address:

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 03-21-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

Site City: **MADERA** 93637 Site Zip: Enf Action Date: 03-22-2017

Enf Action Type: Notice of Violation (Unified Program)

Notice of Violation Issued by the Inspector at the Time of Inspection Enf Action Description:

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

UST Enf Action Program: Enf Action Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

Site City: **MADERA**

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

BUGGY SHOWERS (Continued)

S101621169

Site Zip: 93637 Enf Action Date: 04-11-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 04-15-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

MADERA Site City: Site Zip: 93637 Enf Action Date: 05-20-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 09-11-2013

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

HMRRP Enf Action Program: Enf Action Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 10-03-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: CERS

Coordinates:

Site ID: 100481

Facility Name: BUGGY SHOWER CAR WASH

Env Int Type Code: HMBP
Program ID: 10425403
Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.962300 Longitude: -120.062240

Affiliation:

Affiliation Type Desc: Legal Owner

Entity Name: SINGH, HARKHEWAL

Entity Title: Not reported

Affiliation Address: 230 N GATEWAY AVE

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (510) 940-3602

Affiliation Type Desc: **UST Permit Applicant Entity Name:** MANJEET KAUR Entity Title: **SECRETARY** Affiliation Address: Not reported Affiliation City: Not reported Not reported Affiliation State: Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 673-5511

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Identification Signer

Entity Name: **OWNER** Entity Title: **HARKHEWAL** Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BUGGY SHOWERS (Continued)

S101621169

Entity Name: **BUGGY SHOWER CAR WASH**

Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: **UST Tank Operator** HARKHEWAL SINGH **Entity Name:**

Entity Title: Not reported

Affiliation Address: 230 N Gateway Drive

Affiliation City: **MADERA** Affiliation State:

United States Affiliation Country: Affiliation Zip: 93637

Affiliation Phone: (510) 940-3602

Affiliation Type Desc: **UST Tank Owner Entity Name:** HARKHEWAL SINGH

Entity Title: Not reported

Affiliation Address: 230 N GATEWAY DR

Affiliation City: MADERA Affiliation State: CA Affiliation Country: **United States** Affiliation Zip: 93637 Affiliation Phone: (510) 940-3602

Affiliation Type Desc: **Document Preparer** Entity Name: Manjeet Kaur **Entity Title:** Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address

Entity Name: Mailing Address Entity Title: Not reported

Affiliation Address: 230 N GATEWAY DR Affiliation City: **MADERA**

Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637 Affiliation Phone: Not reported

Affiliation Type Desc: Operator

Entity Name: **BUGGY SHOWER CAR WASH**

Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

Affiliation Phone: (559) 673-5511

Affiliation Type Desc: Property Owner
Entity Name: HARKHEWAL SINGH

Entity Title: Not reported
Affiliation Address: buggyshower@gmail.com

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (510) 940-3602

Affiliation Type Desc: UST Property Owner Name Entity Name: HARKHEWAL SINGH

Entity Title: Not reported

Affiliation Address: 230 N Gateway Drive

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States

Affiliation Zip: 93637 Affiliation Phone: (510) 940-3602

Affiliation Type Desc: Environmental Contact

Entity Name: HARK SINGH
Entity Title: Not reported
Affiliation Address: 230 N GATEWAY

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 673-5511

CUPA MADERA:

Contact Name: SINGH, HARKHEWAL

Region: MADERA Facility Id: FA0100166 Contact Phone: 5596735511

Detail:

Facility Id: FA0100166
Common Name: Premium Gasoline

Current Status: 01

Program/Elements: HMBP - UST/AST Only

PE1: 2166

Decode for c status: Not reported

Facility Id: FA0100166 Common Name: Regular Gasoline

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165
Decode for c status: Not reported

EMI:

Year: 2006

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BUGGY SHOWERS (Continued)

S101621169

County Code: 20 SJV Air Basin: Facility ID: 2770 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY UNIFIED APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: .0142964139368195557 Reactive Organic Gases Tons/Yr: .014220794988632192

Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2007 Year: County Code: 20 Air Basin: SJV Facility ID: 2770 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY UNIFIED APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: .2154395147567663425 Reactive Organic Gases Tons/Yr: .21429997657775871

Carbon Monoxide Emissions Tons/Yr: NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: O Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 2008 County Code: 20 Air Basin: SJV Facility ID: 2770 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY UNIFIED APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: .1979486630463557233 Reactive Organic Gases Tons/Yr: .19687384101867661

Carbon Monoxide Emissions Tons/Yr: O NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2009 Year: County Code: 20 SJV Air Basin: Facility ID: 2770 Air District Name: SJU SIC Code: 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BUGGY SHOWERS (Continued)

S101621169

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.197948663046355

Reactive Organic Gases Tons/Yr: 0.196873841018676

Carbon Monoxide Emissions Tons/Yr: NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2010 Year: County Code: 20 Air Basin: SJV Facility ID: 2770 Air District Name: SJU SIC Code: 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

0.12515962628836699 Total Organic Hydrocarbon Gases Tons/Yr: Reactive Organic Gases Tons/Yr: 0.12447999999999999

Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 2011 County Code: 20 Air Basin: SJV Facility ID: 2770 Air District Name: SJU SIC Code: 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.12517471445 Reactive Organic Gases Tons/Yr: 0.12449504054

Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: O SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2012 Year: County Code: 20 Air Basin: SJV Facility ID: 2770 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY UNIFIED APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.12517471445 Reactive Organic Gases Tons/Yr: 0.12449504054

Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: 0

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BUGGY SHOWERS (Continued)

S101621169

SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 2013 County Code: 20 Air Basin: SJV Facility ID: 2770 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY UNIFIED APCD Air District Name: Not reported

Community Health Air Pollution Info System: Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.12448 Reactive Organic Gases Tons/Yr: 0.12448 Carbon Monoxide Emissions Tons/Yr: NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 2014 County Code: 20 Air Basin: SJV Facility ID: 2770 Air District Name: SJU SIC Code: 5541

Air District Name: SAN JOAQUIN VALLEY APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.22175162637 Reactive Organic Gases Tons/Yr: 0.22175162637

Carbon Monoxide Emissions Tons/Yr: NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2015 Year: County Code: 20 Air Basin: SJV Facility ID: 2770 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.22164 Reactive Organic Gases Tons/Yr: 0.22164 Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: 0

SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2016 Year: County Code: 20

Direction Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

 Air Basin:
 SJV

 Facility ID:
 2770

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.22164 Reactive Organic Gases Tons/Yr: 0.22164 Carbon Monoxide Emissions Tons/Yr: Not reported NOX - Oxides of Nitrogen Tons/Yr: Not reported SOX - Oxides of Sulphur Tons/Yr: Not reported Not reported Particulate Matter Tons/Yr: Part. Matter 10 Micrometers and Smllr Tons/Yr:Not reported

CERS TANKS:

Site ID: 100481 CERS ID: 10425403

CERS Description: Chemical Storage Facilities

Violations:

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 05-20-2016

Citation: HSC 6.7 25292.5 - California Health and Safety Code, Chapter 6.7,

Section(s) 25292.5

Violation Description: Failure to conduct the required enhanced leak detection testing for

single and double walled UST systems located within 1,000 feet of a

public drinking water well.

Violation Notes: Returned to compliance on 07/07/2016. PROVIDE WRITTEN PROGRAM OF ELD

(TESTING PROGRAM WORK PLAN FOR REVIEW AND APPROVAL)

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-09-2016

Citation: 23 CCR 16 2712(i) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2712(i)

Violation Description: Failure to maintain on site an approved monitoring plan.

Violation Notes: Returned to compliance on 06/16/2016. Provide missing monitoring plan

and submit to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 04-11-2016

Citation: HSC 6.7 25292(e) - California Health and Safety Code, Chapter 6.7,

Section(s) 25292(e)

Violation Description: Failure to maintain secondary containment, as evidenced by failure of

secondary containment testing.

Violation Notes: Regular UDC failed.

Violation Division: Madera County Environmental Health

Violation Program: UST

Map ID MAP FINDINGS Direction

Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

BUGGY SHOWERS (Continued)

S101621169

Violation Source: **CERS**

Site ID: 100481

BUGGY SHOWER CAR WASH Site Name:

Violation Date: 03-21-2018

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95,

Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the

business plan is complete and accurate on or before the annual due

Returned to compliance on 03/23/2018. Update the emergency response Violation Notes:

plan to CERS to include the local CUPA phone number.

Violation Division: Madera County Environmental Health

Violation Program: **HMRRP** Violation Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Violation Date: 10-03-2016

23 CCR 6.7 25284, 25286 - California Code of Regulations, Title 23, Citation:

Chapter 6.7, Section(s) 25284, 25286

Violation Description: Failure to submit a complete and accurate application for a permit to

> operate a UST, or for renewal of the permit. Returned to compliance on 10/11/2016.

Violation Notes: Violation Division: Madera County Environmental Health Violation Program: UST

Violation Source: **CERS**

Site ID: 100481

BUGGY SHOWER CAR WASH Site Name:

Violation Date: 03-09-2016

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance.

Returned to compliance on 06/16/2016. Provide missing financial Violation Notes:

responsibility and submit to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Violation Date: 03-22-2017

23 CCR 16 2636(f)(1) - California Code of Regulations, Title 23, Citation:

Chapter 16, Section(s) 2636(f)(1)

Violation Description: Failure of the double-walled pressurized piping to be continuously

monitored with a system that activates an audible and visual alarm or

stops flow at the dispenser when a leak is detected.

Violation Notes: Returned to compliance on 03/22/2017. 87 STP SENSOR FAILED.

REPAIR/REPLACE AND RETEST. CORRECTED ONSITE

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH** Map ID MAP FINDINGS
Direction

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

Violation Date: 09-11-2013

Citation: HSC 6.95 25505(a) - California Health and Safety Code, Chapter 6.95,

Section(s) 25505(a)

Violation Description: Owner/Operator failed to complete and/or submit a Hazardous Materials

Business Plan when storing hazardous materials at or above the

thresholds quantities of 55 gallons/500 lbs/200 cubic feet.

Violation Notes: Returned to compliance on 04/13/2015. Operator failed to provide a

copy of HMBP. Please submit an updated HMBP on CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: 23 CCR 16 2637 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2637

Violation Description: Failure to conduct secondary containment testing, or one or more of

the following requirements: Perform the test within six months of installation and every 36 months thereafter. Use a procedure that demonstrates the system works as well as at installation. Use applicable manufacturer guidelines, industry codes, engineering standard, or professional engineer approval. Performed by a certified

service technician or a licensed tank tester.

Violation Notes: Last done on 4/10/2017.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to complete and electronically submit a site map with all

required content.

Violation Notes: Returned to compliance on 03/23/2018. Update site map to include,

evacuation area, exit/entry, fourth street, storm/sewage drains and

emergency spill/clean up equipment to CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 04-15-2015

Citation: HSC 6.7 25291 - California Health and Safety Code, Chapter 6.7,

Section(s) 25291

Violation Description: Failure to maintain under-dispenser containment, sumps, and/or other

secondary containment in good condition and/or free of debris/liquid.

Violation Notes: Failed SB989 componets.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Map ID MAP FINDINGS
Direction

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

Violation Date: 03-22-2017

Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2665

Violation Description: Failure to comply with one or more of the following: Failure to

install or maintain a liquid-tight spill bucket. Have a minimum capacity of five gallons. Have a functional drain valve or other method for the removal of liquid from the spill bucket/spill

container. Be resistant to galvanic corrosion.

Violation Notes: Returned to compliance on 03/22/2017. 87 OVERSPILL BUCKET FAILED.

REPAIR/REPLACE AND RETEST. SUBMIT DOCUMENTATION WITHIN 30 DAYS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to establish and electronically submit an adequate training

program in safety procedures in the event of a release or threatened

release of a hazardous material.

Violation Notes: Provide a training program.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-09-2016

Citation: HSC 6.7 25292.5 - California Health and Safety Code, Chapter 6.7,

Section(s) 25292.5

Violation Description: Failure to conduct the required enhanced leak detection testing for

single and double walled UST systems located within 1,000 feet of a

public drinking water well.

Violation Notes: Returned to compliance on 07/14/2016.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.95 25508.1(a)-(f) - California Health and Safety Code, Chapter

6.95, Section(s) 25508.1(a)-(f)

Violation Description: Failure to electronically update business plan within 30 days of any

one of the following events: A 100 percent or more increase in the quantity of a previously disclosed material. Any handling of a previously undisclosed hazardous materials at or above reportable quantities. A change of business address, business ownership, or business name. A substantial change in the handler's operations that

requires modification to any portion of the business plan.

Violation Notes: Returned to compliance on 03/23/2018. Update inventory list to include

the new federal hazard categories in CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Direction Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: 23 CCR 16 2632(d)(1)(c),2641(h),2711(a)(8) - California Code of

Regulations, Title 23, Chapter 16, Section(s)

2632(d)(1)(c),2641(h),2711(a)(8)

Violation Description: Failure to submit or maintain a current facility plot plan.

Violation Notes: Returned to compliance on 03/23/2018. Update ust site map to include

all the ust monitoring components to CERS>

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.7 25290.1(c),25290.2(c),25291(a)(2),2529.1(e) - California

Health and Safety Code, Chapter 6.7, Section(s) 25290.1(c),25290.2(c),25291(a)(2),2529.1(e)

Violation Description: Failure to maintain secondary containment (e.g., failure of secondary

containment testing).

Violation Notes: Failed to repair/retest failed sb989 components - all four udcs

failed.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.7 25284 - California Health and Safety Code, Chapter 6.7,

Section(s) 25284

Violation Description: Failure to obtain a valid permit to operate from the UPA including but

not limited to unpaid permit fees.

Violation Notes: Not reported

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-22-2017

Citation: 23 CCR 16 2715(a) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2715(a)

Violation Description: Failure to notify the CUPA of the designated operator (DO)

identification and/or change of the DO within 30 days.

Violation Notes: Returned to compliance on 04/26/2017. UPDATED DESIGNATED OPERATOR

CERTIFICATION NOT SUBMITTED ON CERS. UPDATED CERTIFICATION ONSITE.

UPDATE CERS WITHIN 30 DAYS

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Map ID MAP FINDINGS
Direction

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

Violation Notes:

S101621169

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance. Returned to compliance on 03/23/2018. Update CFO letter to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-09-2016

Citation: HSC 6.7 25292(e) - California Health and Safety Code, Chapter 6.7,

Section(s) 25292(e)

Violation Description: Failure to maintain secondary containment, as evidenced by failure of

secondary containment testing.

Violation Notes: Operator failed to provide the retest result of the failed UDC test in

4.10.2014.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-21-2018

Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

6.95, Section(s) 25505(a)(4)

Violation Description: Failure to provide initial and annual training to all employees in

safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training

records for a minimum of three years.

Violation Notes: Provide missing training.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 05-20-2016

Citation: HSC 6.7 25286(a) - California Health and Safety Code, Chapter 6.7,

Section(s) 25286(a)

Violation Description: Failure to submit an complete and accurate application for a permit to

operate an underground storage tank, or for renewal of the permit.

Violation Notes: Returned to compliance on 10/11/2016.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Violation Date: 03-09-2016

Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2665

Violation Description: Failure of the spill bucket to have a minimum capacity of five

gallons

Violation Notes: Returned to compliance on 03/09/2016. Spill bucket failed to hold 5

gallons at time of inspection.

Violation Division: Madera County Environmental Health

Direction Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

Violation Program: UST Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-21-2018

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Other/Unknown
Eval Date: 04-11-2016
Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 04-15-2015

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-09-2016

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-21-2018 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 05-20-2016 Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Direction Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

Eval General Type: Other/Unknown
Eval Date: 05-20-2016

Violations Found: Yes

Eval Type: Other, not routine, done by local agency
Eval Notes: CERS submittal 10/11/16 accepted 10/12/16
Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-11-2013 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 10-03-2016

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-22-2017 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 04-15-2015 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Enforcement Action:

Site ID: 100481

Site Name: BUGGY SHOWER CAR WASH

Site Address: 230 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 03-09-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BUGGY SHOWERS (Continued)

S101621169

Enf Action Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 03-21-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 03-21-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 03-22-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Not reported Enf Action Notes:

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 04-11-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST **CERS** Enf Action Source:

Site ID: 100481

BUGGY SHOWER CAR WASH Site Name:

Site Address: 230 N GATEWAY DR

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BUGGY SHOWERS (Continued)

S101621169

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 04-15-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST **CERS** Enf Action Source:

Site ID: 100481

BUGGY SHOWER CAR WASH Site Name:

Site Address: 230 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 05-20-2016

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 100481

BUGGY SHOWER CAR WASH Site Name:

Site Address: 230 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 09-11-2013

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP CERS** Enf Action Source:

Site ID: 100481

Site Name: **BUGGY SHOWER CAR WASH**

Site Address: 230 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 10-03-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Coordinates:

Site ID: 100481

BUGGY SHOWER CAR WASH Facility Name:

Env Int Type Code: **HMBP** Program ID: 10425403 Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.962300

Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

Longitude: -120.062240

Affiliation:

Affiliation Type Desc: Legal Owner

Entity Name: SINGH, HARKHEWAL

Entity Title: Not reported

Affiliation Address: 230 N GATEWAY AVE

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States

Affiliation Zip: 93637

Affiliation Phone: (510) 940-3602

UST Permit Applicant Affiliation Type Desc: Entity Name: MANJEET KAUR Entity Title: **SECRETARY** Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 673-5511

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Identification Signer

Entity Name: **OWNER** Entity Title: HARKHEWAL Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation

Entity Name: BUGGY SHOWER CAR WASH

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: UST Tank Operator Entity Name: HARKHEWAL SINGH

Entity Title: Not reported

Affiliation Address: 230 N Gateway Drive

Direction Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWERS (Continued)

S101621169

EDR ID Number

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States

Affiliation Zip: 93637 Affiliation Phone: (510) 940-3602

Affiliation Type Desc: UST Tank Owner Entity Name: HARKHEWAL SINGH

Entity Title: Not reported

Affiliation Address: 230 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States

Affiliation Zip: 93637

Affiliation Phone: (510) 940-3602

Affiliation Type Desc: **Document Preparer Entity Name:** Manjeet Kaur Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: 230 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: Not reported

Affiliation Type Desc: Operator

Entity Name: BUGGY SHOWER CAR WASH

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (559) 673-5511

Affiliation Type Desc: Property Owner
Entity Name: HARKHEWAL SINGH

Entity Title: Not reported

Affiliation Address: buggyshower@gmail.com

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: United S

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (510) 940-3602

Affiliation Type Desc: UST Property Owner Name

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BUGGY SHOWERS (Continued)

Entity Name: HARKHEWAL SINGH

Entity Title: Not reported

Affiliation Address: 230 N Gateway Drive

Affiliation City: **MADERA** Affiliation State: CA

Affiliation Country: **United States** Affiliation Zip: 93637

Affiliation Phone: (510) 940-3602

Affiliation Type Desc: **Environmental Contact**

Entity Name: HARK SINGH Entity Title: Not reported Affiliation Address: 230 N GATEWAY

Affiliation City: **MADERA** Affiliation State:

Not reported Affiliation Country: 93637 Affiliation Zip:

Affiliation Phone: (559) 673-5511

G60 **BUGGY SHOWER CAR WASH** South

230 N GATEWAY DR 1/8-1/4 MADERA, CA 93637

0.147 mi.

774 ft. Site 20 of 21 in cluster G

Relative: UST:

Lower Facility ID: 100166

Permitting Agency: Madera County Environmental Health Actual:

Latitude: 36.9623 268 ft. Longitude: -120.06224

H61 **AUTOZONE #2874 CERS HAZ WASTE** S113081395 SSE 211 N GATEWAY DR **HAZNET** N/A

1/8-1/4 **MADERA, CA 93637**

0.149 mi.

786 ft. Site 1 of 4 in cluster H

CERS HAZ WASTE: Relative:

Lower Site ID: 386871 10139663 CERS ID: Actual:

Hazardous Waste Generator CERS Description: 272 ft.

Violations:

Site ID: 386871 AutoZone #2874 Site Name: Violation Date: 01-23-2014

Citation: HSC 6.95 25504(c) - California Health and Safety Code, Chapter 6.95,

Section(s) 25504(c)

Violation Description: Failure to include provisions in the business plan to ensure that

appropriate personnel receive initial and annual training.

Returned to compliance on 02/10/2014. Operator failed to keep copies Violation Notes:

of the last three years training records.

Violation Division: Madera County Environmental Health

HMRRP Violation Program: Violation Source: **CERS**

S101621169

U004261612

N/A

CERS

Map ID MAP FINDINGS
Direction

Distance EDR ID Number
Elevation Site EPA ID Number

AUTOZONE #2874 (Continued)

S113081395

Site ID: 386871

Site Name: AutoZone #2874 Violation Date: 05-25-2017

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to establish and electronically submit an adequate emergency

response plan and procedures for a release or threatened release of a

hazardous material.

Violation Notes: Returned to compliance on 06/21/2017. Assure facility is implementing

appropriate emergency response procedures.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 386871

Site Name: AutoZone #2874 Violation Date: 01-23-2014

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the

generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 01/29/2014. Provide missing accumulation

start date on used oil filter.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 386871

Site Name: AutoZone #2874 Violation Date: 01-23-2014

Citation: 19 CCR 4 2729.2(a)(3) - California Code of Regulations, Title 19,

Chapter 4, Section(s) 2729.2(a)(3)

Violation Description: Failure to complete and/or submit an annotated site map if required by

CUPA.

Violation Notes: Returned to compliance on 02/10/2014. Operator failed to update site

map and notify CUPA when there's a change of material's location.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

 Site ID:
 386871

 Site Name:
 AutoZone #2874

 Violation Date:
 05-25-2017

Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

6.95, Section(s) 25505(a)(4)

Violation Description: Failure to provide initial and annual training to all employees in

safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training

records for a minimum of three years.

Violation Notes: Returned to compliance on 06/21/2017. Observed 2016 and 2017, not 2014

and 2015 training records covering emergency action plan. Facility employees trained to meet at "76 Gas Station parking Lot and not front parking lot as mentioned on the "Consolidated Emergency Response Contingency Plan. Operator has decided to meet for emergencies as designated on site map. Provide 2017 training training records

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AUTOZONE #2874 (Continued)

S113081395

covering change in procedures for the Emergency Action Plan. (HM10B).

Madera County Environmental Health Violation Division:

Violation Program: **HMRRP** Violation Source: **CERS**

Evaluation:

Eval General Type: Compliance Evaluation Inspection

01-23-2014 Eval Date:

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: **HMRRP Eval Source:** CERS

Eval General Type: Compliance Evaluation Inspection

05-25-2017 Eval Date:

Violations Found:

Eval Type: Routine done by local agency

Eval Notes: Not reported

Madera County Environmental Health **Eval Division:**

Eval Program: HW **Eval Source: CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 01-23-2014 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Madera County Environmental Health Eval Division:

Eval Program: HW **Eval Source: CERS**

Eval General Type: Compliance Evaluation Inspection

05-25-2017 Eval Date:

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Madera County Environmental Health **Eval Division:**

HMRRP Eval Program: Eval Source: **CERS**

Enforcement Action:

386871 Site ID:

Site Name: AutoZone #2874 Site Address: 211 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 01-23-2014

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AUTOZONE #2874 (Continued)

S113081395

Site ID: 386871 Site Name: AutoZone #2874 Site Address: 211 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 01-23-2014

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW Enf Action Source: **CERS**

Site ID: 386871

AutoZone #2874 Site Name: Site Address: 211 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 05-25-2017

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Coordinates:

Site ID: 386871

Facility Name: AutoZone #2874

Env Int Type Code: **HMBP** Program ID: 10139663 Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.962680 -120.061610 Longitude:

Affiliation:

Affiliation Type Desc: Identification Signer Deborah Williams Entity Name:

Entity Title: **Environmental Coordinator**

Affiliation Address: Not reported Affiliation City: Not reported Not reported Affiliation State: Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation

Entity Name: Auto Zone Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Distance

Elevation Site Database(s) EPA ID Number

AUTOZONE #2874 (Continued)

S113081395

EDR ID Number

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: Not repo

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Environmental Contact Entity Name: Andrew Beaven Entity Title: Not reported

Affiliation Address: Dept 8190, 123 South Front Street

Affiliation City: Memphis
Affiliation State: TN
Affiliation Country: Not reported
Affiliation Zip: 38103

Affiliation Phone: (901) 495-6949

Affiliation Type Desc: Property Owner
Entity Name: AUTOZONE, INC.
Entity Title: Not reported

Affiliation Address: 123 South Front Street

Affiliation City: MEMPHIS
Affiliation State: TN

Affiliation Country: United States
Affiliation Zip: 38101
Affiliation Phone: (901) 495-6500

Affiliation Type Desc: **Document Preparer** Entity Name: Deborah Williams Entity Title: Not reported Affiliation Address: Not reported Not reported Affiliation City: Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address

Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: Dept 8190, 123 South Front Street

Affiliation City: Memphis
Affiliation State: TN

Affiliation Country: Not reported
Affiliation Zip: 38103
Affiliation Phone: Not reported

Affiliation Type Desc:

Entity Name:

Entity Title:

Legal Owner

AutoZone Stores Inc

Not reported

Affiliation Address: 123 South Front Street

Affiliation City: Memphis
Affiliation State: TN

Affiliation Country: United States

Direction Distance

Elevation Site Database(s) EPA ID Number

AUTOZONE #2874 (Continued)

S113081395

EDR ID Number

Affiliation Zip: 38103

Affiliation Phone: (901) 495-6500

Affiliation Type Desc: Operator **Entity Name:** Autozone **Entity Title:** Not reported Not reported Affiliation Address: Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 229-8076

HAZNET:

Facility Name: AUTOZONE #2874 envid: S113081395

Year: 2017

GEPAID: CAL000147970
Contact: BRYAN BLAIR
Telephone: 9014957217
Mailing Name: Not reported

Mailing Address: DEPT 8190, 123 S FRONT ST Mailing City,St,Zip: MEMPHIS, TN 381033607

Gen County: Madera
TSD EPA ID: CAD980884183
TSD County: Sacramento

Waste Category: Alkaline solution without metals pH >= 12.5

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Tons: 0.0035

Cat Decode: Alkaline solution without metals pH >= 12.5

Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Facility County: Madera

envid: \$113081395 Year: 2017 GEPAID: CAL000147970 Contact: BRYAN BLAIR Telephone: 9014957217

Mailing Name: Not reported
Mailing Address: DEPT 8190, 123 S FRONT ST

Mailing City,St,Zip: MEMPHIS, TN 381033607 Gen County: Madera TSD EPA ID: UTD981552177

TSD County: 99

Waste Category: Unspecified oil-containing waste

Disposal Method: Incineration--Thermal Destruction Other Than Use As A Fuel

Tons: 0.075

Cat Decode: Unspecified oil-containing waste

Method Decode: Incineration--Thermal Destruction Other Than Use As A Fuel

Facility County: Madera

envid: \$113081395 Year: 2017

GEPAID: CAL000147970

Direction Distance

Elevation Site Database(s) EPA ID Number

AUTOZONE #2874 (Continued)

S113081395

EDR ID Number

Contact: BRYAN BLAIR
Telephone: 9014957217
Mailing Name: Not reported

Mailing Address: DEPT 8190, 123 S FRONT ST Mailing City,St,Zip: MEMPHIS, TN 381033607

Gen County: Madera
TSD EPA ID: CAD980884183
TSD County: Sacramento

Waste Category: Other inorganic solid waste

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Tons: 0.0015

Cat Decode: Other inorganic solid waste

Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Facility County: Madera

envid: \$113081395 Year: 2017

GEPAID: CAL000147970
Contact: BRYAN BLAIR
Telephone: 9014957217
Mailing Name: Not reported

Mailing Address: DEPT 8190, 123 S FRONT ST Mailing City,St,Zip: MEMPHIS, TN 381033607

Gen County: Madera
TSD EPA ID: UTD981552177

TSD County: 99

Waste Category: Unspecified oil-containing waste

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Tons: 0.1

Cat Decode: Unspecified oil-containing waste

Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Facility County: Madera

envid: \$113081395 Year: 2017

GEPAID: CAL000147970
Contact: BRYAN BLAIR
Telephone: 9014957217
Mailing Name: Not reported

Mailing Address: DEPT 8190, 123 S FRONT ST Mailing City,St,Zip: MEMPHIS, TN 381033607

Gen County: Madera
TSD EPA ID: NED981723513

TSD County: 99

Waste Category: Unspecified oil-containing waste

Disposal Method: Incineration--Thermal Destruction Other Than Use As A Fuel

Tons: 0

Cat Decode: Unspecified oil-containing waste

Method Decode: Incineration--Thermal Destruction Other Than Use As A Fuel

Facility County: Madera

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

AUTOZONE #2874 (Continued)

S113081395

EDR ID Number

Click this hyperlink while viewing on your computer to access 36 additional CA_HAZNET: record(s) in the EDR Site Report.

CERS TANKS:

Site ID: 386871 CERS ID: 10139663

CERS Description: Chemical Storage Facilities

Violations:

Site ID: 386871

Site Name: AutoZone #2874 Violation Date: 01-23-2014

Citation: HSC 6.95 25504(c) - California Health and Safety Code, Chapter 6.95,

Section(s) 25504(c)

Violation Description: Failure to include provisions in the business plan to ensure that

appropriate personnel receive initial and annual training.

Violation Notes: Returned to compliance on 02/10/2014. Operator failed to keep copies

of the last three years training records.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 386871

Site Name: AutoZone #2874 Violation Date: 05-25-2017

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to establish and electronically submit an adequate emergency

response plan and procedures for a release or threatened release of a

hazardous material.

Violation Notes: Returned to compliance on 06/21/2017. Assure facility is implementing

appropriate emergency response procedures.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

 Site ID:
 386871

 Site Name:
 AutoZone #2874

 Violation Date:
 01-23-2014

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the

generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 01/29/2014. Provide missing accumulation

start date on used oil filter.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

 Site ID:
 386871

 Site Name:
 AutoZone #2874

 Violation Date:
 01-23-2014

Citation: 19 CCR 4 2729.2(a)(3) - California Code of Regulations, Title 19,

Chapter 4, Section(s) 2729.2(a)(3)

Violation Description: Failure to complete and/or submit an annotated site map if required by

Map ID MAP FINDINGS
Direction

Distance EDR ID Number
Elevation Site EDR ID Number
Database(s) EPA ID Number

AUTOZONE #2874 (Continued)

S113081395

CUPA.

Violation Notes: Returned to compliance on 02/10/2014. Operator failed to update site

map and notify CUPA when there's a change of material's location.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 386871

Site Name: AutoZone #2874 Violation Date: 05-25-2017

Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

6.95, Section(s) 25505(a)(4)

Violation Description: Failure to provide initial and annual training to all employees in

safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training

records for a minimum of three years.

Violation Notes: Returned to compliance on 06/21/2017. Observed 2016 and 2017, not 2014

and 2015 training records covering emergency action plan. Facility employees trained to meet at "76 Gas Station parking Lot and not front parking lot as mentioned on the "Consolidated Emergency Response Contingency Plan. Operator has decided to meet for emergencies as designated on site map. Provide 2017 training training records

covering change in procedures for the Emergency Action Plan. (HM10B).

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 01-23-2014

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 05-25-2017

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 01-23-2014 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 05-25-2017

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AUTOZONE #2874 (Continued)

S113081395

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Enforcement Action:

Site ID: 386871

Site Name: AutoZone #2874 Site Address: 211 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 01-23-2014

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Site ID: 386871

Site Name: AutoZone #2874 211 N GATEWAY DR Site Address:

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 01-23-2014

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Not reported Enf Action Notes:

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW Enf Action Source: **CERS**

Site ID: 386871

AutoZone #2874 Site Name: Site Address: 211 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 05-25-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Coordinates:

Site ID: 386871 Facility Name: AutoZone #2874

Env Int Type Code: **HMBP** Program ID: 10139663 Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

36.962680 Latitude: Longitude: -120.061610

Direction Distance Elevation

tion Site Database(s) EPA ID Number

AUTOZONE #2874 (Continued)

S113081395

EDR ID Number

Affiliation:

Affiliation Type Desc: Identification Signer Entity Name: Deborah Williams

Entity Title: Environmental Coordinator

Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation

Entity Name: Auto Zone **Entity Title:** Not reported Not reported Affiliation Address: Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Environmental Contact
Entity Name: Andrew Beaven
Entity Title: Not reported

Affiliation Address: Dept 8190, 123 South Front Street

Affiliation City: Memphis
Affiliation State: TN
Affiliation Country: Not reported
Affiliation Zip: 38103
Affiliation Phone: (901) 495-6949

Affiliation Type Desc: Property Owner
Entity Name: AUTOZONE, INC.
Entity Title: Not reported

Affiliation Address: 123 South Front Street

Affiliation City: MEMPHIS
Affiliation State: TN

Affiliation Country: United States
Affiliation Zip: 38101

Affiliation Phone: (901) 495-6500

Affiliation Type Desc:

Entity Name:

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Deborah Williams

Not reported

Not reported

Not reported

Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

AUTOZONE #2874 (Continued)

S113081395

EDR ID Number

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: Dept 8190, 123 South Front Street

Affiliation City: Memphis
Affiliation State: TN
Affiliation Country: Not reported
Affiliation Zip: 38103
Affiliation Phone: Not reported

Affiliation Type Desc:

Entity Name:

Entity Title:

Legal Owner

AutoZone Stores Inc

Not reported

Affiliation Address: 123 South Front Street

Affiliation City: Memphis
Affiliation State: TN

Affiliation Country: United States
Affiliation Zip: 38103

Affiliation Phone: (901) 495-6500

Affiliation Type Desc: Operator Entity Name: Autozone **Entity Title:** Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 229-8076

 I62
 COMMUNITY INTEGRATED WORK PROG
 RCRA-SQG
 1004677390

 SE
 201 N E ST
 FINDS
 CAR000096636

1/8-1/4 MADERA, CA 93638

0.153 mi.

806 ft. Site 1 of 3 in cluster I

Relative: RCRA-SQG:

Lower Date form received by agency: 05/14/2001

Actual: Facility name: COMMUNITY INTEGRATED WORK PROG

272 ft. Facility address: 201 N E ST

MADERA, CA 93638
EPA ID: CAR000096636
Contact: ARTHUR TYREE

Contact address: 1600 S MAIN ST STE 100

WALNUT CREEK, CA 94596

Contact country: US

Contact telephone: 559-662-1150 Contact email: Not reported

EPA Region: 09

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous

waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous

ECHO

Distance Elevation Site

ite Database(s) EPA ID Number

COMMUNITY INTEGRATED WORK PROG (Continued)

1004677390

EDR ID Number

waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: COMMUNITY INTEGRATED WORK PG

Owner/operator address: 1600 S MAIN ST STE 100

WALNUT CREEK, CA 94596

Owner/operator country: Not reported Owner/operator telephone: 800-246-7251 Owner/operator email: Not reported Owner/operator fax: Not reported Owner/operator extension: Not reported Private Legal status: Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

. Waste code: D000
. Waste name: Not Defined

Waste code: D006
Waste name: CADMIUM

Waste code: D008 Waste name: LEAD

Waste code: D027

Waste name: 1,4-DICHLOROBENZENE

Waste code: D039

Waste name: TETRACHLOROETHYLENE

. Waste code: D040

Waste name: TRICHLOROETHYLENE

Violation Status: No violations found

FINDS:

Registry ID: 110012240529

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COMMUNITY INTEGRATED WORK PROG (Continued)

1004677390

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1004677390 Registry ID: 110012240529

DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110012240529

G63 JIM BARSETTI **CUPA Listings** S112866942 SSE 220 NORTH GATEWAY **HAZNET** N/A

1/8-1/4 MADERA, CA 93637

0.157 mi.

Site 21 of 21 in cluster G 829 ft.

Relative: CUPA MADERA:

Lower Contact Name: **ROCK, HARRY & DAVID**

Region: **MADERA** Actual: Facility Id: FA0101112 271 ft. Contact Phone: 5596746767

Detail:

Facility Id: FA0101112 Common Name: Acrylic enamels

Current Status: IN

Program/Elements: Haz Mat Inventory

PE1: 2164 Inactive Decode for c status:

HAZNET:

Facility Name: JIM BARSETTI envid: S112866942 Year: 1995

GEPAID: CAC001106080 JIM BARSETTI Contact: Telephone: 2096748698 Mailing Name: Not reported Mailing Address: 108 CREST

Mailing City, St, Zip: MADERA, CA 936370000

Gen County: Not reported TSD EPA ID: CAL000027741 TSD County: Not reported

Waste Category: Asbestos containing waste

Disposal Method: Disposal, Land Fill

Tons: 10.1136 Cat Decode: Not reported Method Decode: Not reported Madera Facility County:

Direction Distance

Elevation Site Database(s) EPA ID Number

H64 BUGGY SHOWER LUST S104161519

SSE 230 GATEWAY DR N CUPA Listings N/A

1/8-1/4 MADERA, CA 93637 HIST CORTESE 0.158 mi. CERS

836 ft. Site 2 of 4 in cluster H

Relative: LUST:

Lower Lead Agency: MADERA COUNTY
Actual: Case Type: LUST Cleanup Site

271 ft. Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900160

Global Id: T0603900160
Latitude: 36.962595
Longitude: -120.062545

Status: Completed - Case Closed

04/21/1997 Status Date: Case Worker: **ADR** 5T20000163 RB Case Number: Local Agency: MADERA COUNTY File Location: Not reported Local Case Number: Not reported Potential Media Affect: Soil Potential Contaminants of Concern: Gasoline Site History: Not reported

LUST:

Global Id: T0603900160

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900160

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET

City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

Global Id: T0603900160
Action Type: Other
Date: 04/12/1996
Action: Leak Reported

 Global Id:
 T0603900160

 Action Type:
 ENFORCEMENT

 Date:
 04/21/1997

Action: Closure/No Further Action Letter

 Global Id:
 T0603900160

 Action Type:
 Other

 Date:
 02/27/1996

 Action:
 Leak Discovery

EDR ID Number

Direction Distance Elevation

evation Site Database(s) EPA ID Number

BUGGY SHOWER (Continued)

S104161519

EDR ID Number

LUST:

Global Id: T0603900160

Status: Completed - Case Closed

Status Date: 04/21/1997

Global Id: T0603900160

Status: Open - Case Begin Date

Status Date: 02/27/1996

Global Id: T0603900160

Status: Open - Site Assessment

Status Date: 04/12/1996

LUST REG 5:

Region: 5

Status: Case Closed 5T20000163 Case Number: Case Type: Soil only Substance: **GASOLINE** JWH Staff Initials: Lead Agency: Local Program: LUST MTBE Code: N/A

CUPA MADERA:

Contact Name: SMOG EXPRESS
Region: MADERA
Facility Id: FA0102956
Contact Phone: 5597069550

Detail:

Facility Id: FA0102956 Common Name: OIL FILTER

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165
Decode for c status: Not reported

Facility Id: FA0102956

Common Name: WASTE MOTOR OIL

Current Status: 01

Program/Elements: Haz Mat Inventory

PE1: 2164

Decode for c status: Not reported

Contact Name: MOIT, EDWARD
Region: MADERA
Facility Id: FA0100844
Contact Phone: 5596732462

Detail:

Facility Id: FA0100844
Common Name: Acetylene
Current Status:

Current Status: IN

Program/Elements: Haz Mat Inventory - Exempt

Direction Distance

Elevation Site Database(s) EPA ID Number

BUGGY SHOWER (Continued)

S104161519

EDR ID Number

PE1: 2165 Decode for c status: Inactive

Facility Id: FA0100844
Common Name: Oxygen
Current Status: IN

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165 Decode for c status: Inactive

HIST CORTESE:

Region: CORTESE
Facility County Code: 20
Reg By: LTNKA
Reg Id: 5T20000163

CERS TANKS:

Site ID: 246550 CERS ID: T0603900160

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported
Affiliation Address: 1685 E STREET
Affiliation City: FRESNO
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Net report

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

 I65
 SERVICE STATION
 LUST
 \$104404458

 SE
 200 D ST N
 HIST CORTESE
 N/A

1/8-1/4 MADERA, CA 93639

0.159 mi.

837 ft. Site 2 of 3 in cluster I

Relative: LUST:

HigherLead Agency:MADERA COUNTYActual:Case Type:LUST Cleanup Site

273 ft. Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900033

 Global Id:
 T0603900033

 Latitude:
 36.963402

 Longitude:
 -120.059866

CERS

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SERVICE STATION (Continued)

S104404458

Completed - Case Closed Status:

10/26/1989 Status Date: Case Worker: ADR RB Case Number: 5T20000033 MADERA COUNTY Local Agency: File Location: Not reported Local Case Number: Not reported Potential Media Affect: Soil Potential Contaminants of Concern: Gasoline Site History: Not reported

LUST:

T0603900033 Global Id:

Contact Type: Local Agency Caseworker

ANN ROLAN Contact Name: Organization Name: MADERA COUNTY Address: 2037 WEST CLEVELAND

City: **MADERA**

Email: arolan@madera-county.com

Phone Number: Not reported

T0603900033 Global Id:

Regional Board Caseworker Contact Type:

Contact Name: JEFFREY HANNEL

CENTRAL VALLEY RWQCB (REGION 5F) Organization Name:

1685 E STREET Address: City: **FRESNO**

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

Global Id: T0603900033 Action Type: Other Date: 10/27/1987 Leak Reported Action:

Global Id: T0603900033 Action Type: Other 07/08/1987 Date: Action: Leak Discovery

LUST:

Global Id: T0603900033

Completed - Case Closed Status:

10/26/1989 Status Date:

Global Id: T0603900033

Open - Case Begin Date Status:

07/08/1987 Status Date:

Global Id: T0603900033

Status: Open - Site Assessment

10/27/1987 Status Date:

LUST REG 5:

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SERVICE STATION (Continued)

S104404458

Region: 5

Case Closed Status: Case Number: 5T20000033 Case Type: Soil only

UNLEAD GASOLINE Substance:

Staff Initials: JWH Lead Agency: Local Program: LUST MTBE Code: N/A

HIST CORTESE:

CORTESE Region: Facility County Code: 20 LTNKA Reg By: Reg Id: 5T20000033

CERS TANKS:

Site ID: 258202 CERS ID: T0603900033

Leaking Underground Storage Tank Cleanup Site **CERS** Description:

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F) **Entity Name:**

Entity Title: Not reported 1685 É STREET Affiliation Address: Affiliation City: **FRESNO** Affiliation State: CA Affiliation Country: Not reported

Not reported Affiliation Zip: Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA Affiliation State: CA Affiliation Country: Not reported Affiliation Zip: Not reported Not reported Affiliation Phone:

OIL STOP-DRIVE THRU OIL CHANGE CERS HAZ WASTE S121787631

SSE 212 N GATEWAY DR **CERS TANKS** N/A **CERS**

1/8-1/4 MADERA, CA 93637

0.167 mi.

H66

883 ft. Site 3 of 4 in cluster H Relative: CERS HAZ WASTE:

Lower 53558 Site ID: CERS ID: 10426093 Actual:

Hazardous Waste Generator **CERS** Description: 271 ft.

Violations:

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Violation Date: 04-11-2018

Distance Elevation

ation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Citation: 22 CCR 15 66265.192(h) - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.192(h)

Violation Description: Failure of generator to obtain assessment or reassessment every five

(5) years or the remaining service life of the tank system, as stated in the engineer's assessment, whichever is less. This assessment applies to onground or aboveground tank systems containing only non-RCRA hazardous wastes generated onsite, or for a small quantity generator onground or aboveground tank systems containing RCRA

hazardous wastes generated onsite.

Violation Notes: Required for new tank systems as defined by CCR 66160.10. Obtain

assessment or reassessment every five (5) years or the remaining service life of the waste oil tank system, as stated in the engineer's assessment, whichever is less. This assessment applies to onground or aboveground tank systems containing only non-RCRA hazardous wastes

generated onsite, or for a small quantity generator onground or

aboveground tank systems containing RCRA hazardous wastes generated onsite. Submit a copy of the waste oil tank assessment to this office

by 06/11/2018.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 04-11-2018

Citation: 22 CCR 15 66265.192(k) - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.192(k)

Violation Description: Failure to include all required information in the tank system

assessment.

Violation Notes: See 3010025: Required for new tank systems as defined by CCR 66160.10.

Obtain assessment or reassessment every five (5) years or the remaining service life of the waste oil tank system, as stated in the engineer's assessment, whichever is less. This assessment applies to onground or aboveground tank systems containing only non-RCRA hazardous wastes generated onsite, or for a small quantity generator onground or aboveground tank systems containing RCRA hazardous wastes

generated onsite. Submit a copy of the waste oil tank assessment to

this office by 06/11/2018.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Failure to address in the SPCC Plan discharge prevention measures,

including procedures for routine handling of products such as

loading/unloading and facility transfers.

Violation Notes: Returned to compliance on 04/11/2018. For portable containers, either

provide the type of oil & storage capacity for each container or provide an estimate of the potential number of mobile or portable containers, the types of oil, and the anticipated storage capacities. Include on Table G-4 of SPCC plan the unknown quantities of SAE

80/W-90 and Gear Oil tanks inside compressor room.

Violation Division: Madera County Environmental Health

Elevation

Distance

EPA ID Number Site Database(s)

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

APSA Violation Program: Violation Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Failure to comply with one or more of the following requirements: 1. Violation Description:

> Have record of inspections and integrity tests signed by the appropriate supervisor or inspector. 2. Keep written procedures and records of inspections and integrity tests for at least three years.

3. Keep comparison records.

Violation Notes: Returned to compliance on 04/11/2018. Periodic inspections on

> aboveground oil storage containers, weekly waste oil tank inspections, and monthly spill kit inspections not available for review. Provide inspection records since last APSA inspection conducted on 10/23/15.

If no inspection records available, provide copies of newly

implemented inspection records within the next 30 days. Also, provide

copy of 1,100 G waste oil tank specification sheet.

Violation Division: Madera County Environmental Health

Violation Program: **APSA CERS** Violation Source:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: HSC 6.5 25160.2 - California Health and Safety Code, Chapter 6.5,

Section(s) 25160.2

Failure to meet any of the following consolidated manifest Violation Description:

requirements: 1) Legible receipts for each quantity of hazardous waste that is received from a generator, 2) The generator's information (name, address, identification number, contact person, telephone number of the generator, the signature of the generator or the generator's representative), 3) Date of the shipment, 4) The manifest number, 5) The volume or quantity of each waste stream received, 6) The name, address, and identification number of the authorized facility to which the hazardous waste will be transported, 7) The transporter's information (name, address, and identification number, the driver's signature), 8) A statement, signed by the generator, certifying that the generator has established a program to reduce the volume or quantity and toxicity of the hazardous waste to the degree economically practicable. 9) The generator shall retain each receipt

for at least three years. Returned to compliance on 10/23/2015. Provide the last three years of

manifest receipts.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Violation Notes:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 04-11-2018

22 CCR 15 66265.16 - California Code of Regulations, Title 22, Chapter Citation:

15, Section(s) 66265.16

Violation Description: Failure to provide employees with hazardous waste training program of

class room instructions or on-the-job training within the first six

Distance

Elevation **EPA ID Number** Site Database(s)

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

months after the date of their employment or assignment to a facility, or to a new position at a facility and annually thereafter. Training records on current personnel shall be kept until closure of the facility and for former employees the record shall be kept for at least three years from the date the employee last worked at the facility. The records shall include the following: the job title for each position at the facility related to hazardous waste management, and the name of the employee filling each job; a written job description for each position, duties of facility personnel assigned to each position, and a written description of the type and amount of both introductory and continuing training that will be given to each

person filling a position.

Violation Notes: 3020002: Facility personnel shall successfully complete a program of

> classroom instruction or on-the-job training that teaches them to perform their duties in a way that ensures the facility's compliance with the requirements of Large Quantity Generators. See Section 22 CCR

15 66265.16 (a)(1)-(e). Assure training records indicate the following: -job title for each position related to Hazardous Waste Management, and the name of the employee filling each job. -written description for each position listed. -written description of the type and amount of initial and continuing training for each position.

Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Violation Division:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Failure to properly label hazardous waste accumulation containers with Violation Description:

the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 05/02/2016. Operator failed to label used

oil and empty containers.

Madera County Environmental Health Violation Division:

Violation Program: HW Violation Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 10-23-2015

22 CCR 16 66266.130 - California Code of Regulations, Title 22, Citation:

Chapter 16, Section(s) 66266.130

Violation Description: Failure to properly handle, manage, label, and recycle used oil and fuel filters.

Violation Notes: Returned to compliance on 05/02/2016. Failed to properly label used

drained oil filters.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

22 CCR 12 66262.34(f) - California Code of Regulations, Title 22, Citation:

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers and

portable tanks with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation

date.

Violation Notes: Returned to compliance on 04/11/2018. Antifreeze waste missing

accumulation start date. Corrected On Site. In hazardous waste pick-up

area: 55 G Non-metal filter & oily absorbent @ 55 G missing

accumulation start date. In basement, 30 G used oil container missing accumulation start date and name and address of the generator. Provide

proof of correction.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain and/or maintain an Active EPA ID.

Violation Notes: Returned to compliance on 05/02/2016. Failed to activate EPA ID

number.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 04-11-2018

Citation: 40 CFR 1 265.32 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.32

Violation Description: Failure of the facility to maintain the following emergency equipment

or equivalents: 1) An internal communications or alarm system; 2) A device, such as a telephone (immediately available at the scene of Operations/ Maintenance) or a hand-held two-way radio, capable of summoning emergency assistance from local police departments, fire departments, or State or local emergency response teams; 3) Portable fire extinguishers, fire control equipment, spill control equipment, and decontamination equipment; and 4) Water at adequate volume and pressure to supply water hose streams, or foam producing equipment, or

automatic sprinklers, or water spray systems.

Violation Notes: Equip facility with portable fire extinguishers in working order.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to establish and electronically submit an adequate emergency

response plan and procedures for a release or threatened release of a

hazardous material.

Violation Notes: Returned to compliance on 04/03/2018. Operator stated in case of

Distance

Elevation **EPA ID Number** Site Database(s)

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

emergency, personnel will meet approximately 20 feet Southeast from

hazardous waste pick-up area. Consolidated Emergency

Response/Contingency plan states personnel will evacuate to the area

by the oil stop sign. Update Consolidated Emergency

Response/Contingency Plan + Upload to CERS. NOV Sent 03-06-18.

Violation escalated to a Class II. Madera County Environmental Health

Violation Program: **HMRRP** Violation Source: **CERS**

Violation Division:

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Violation Date: 08-11-2017

HSC 6.67 Multiple - California Health and Safety Code, Chapter 6.67, Citation:

Section(s) Multiple

Violation Description: APSA Program - Operations/Maintenance - General

Returned to compliance on 04/11/2018. Failure to properly permanently Violation Notes:

> close all/any tanks under the definition of Permanently Closed in 40 CFR 112.2. All empty/out-of-service tanks that facility will no longer be using must have conspicuous signs posted on each tank stating that it is a permanently closed container and noting the date of closure, otherwise, include all tanks annotated in most recent approved site

map submitted on 04/26/17, 40 CFR 112.2; HSC 6.67 25270.4.5(a)

Violation Division: Madera County Environmental Health

Violation Program: **APSA** Violation Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain and/or maintain an Active EPA ID.

Violation Notes: Returned to compliance on 05/02/2016. Operator failed to obtained an

active EPA ID number.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: 22 CCR 11 66261.7 - California Code of Regulations, Title 22, Chapter

11, Section(s) 66261.7

Failure to manage empty containers greater than 5 gallons in capacity Violation Description:

that previously held a hazardous material/waste in accordance with 22 CCR 11 66261.7 including but not limited to the following: (e)(2)By reclaiming its scrap value onsite or shipping the container or inner

liner to a person who reclaims its scrap value; or (3) By

reconditioning or remanufacturing the container or inner liner onsite for subsequent reuse, or shipping the container or inner liner to a person who reconditions or remanufactures the container or inner liner; or (4) By shipping the container or inner liner to a supplier or to another intermediate collection location for accumulation prior to managing the container or inner liner pursuant to subsections (e)(2) or (e)(3) of this section; or (i) By shipping the container or inner liner back to the supplier for the purpose of being refilled.

Direction

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

(f) A container or an inner liner removed from a container larger than five gallons in capacity which is managed pursuant to subsection (e) of this section shall be marked with the date it has been emptied and

shall be managed within one year of being emptied.

Violation Notes: Returned to compliance on 04/11/2018. Approximately 10 containers with

30-55 G shell capacity that were previously used for degreasing or windshield wiping solution were unlabeled. Mark as empty and the date

when 1st emptied. Manage within a year.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 06-07-2016

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Failure to prepare and implement a Spill Prevention Control and

Countermeasure (SPCC) Plan.

Violation Notes: Returned to compliance on 06/16/2016.
Violation Division: Madera County Environmental Health

Violation Program: APSA
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to complete and electronically submit hazardous material

inventory information for all reportable hazardous materials on site

at or above reportable quantities.

Violation Notes: Returned to compliance on 04/03/2018. Update "Max. Daily" values for

all hazardous materials/waste. Include chemical location of all

hazardous materials/waste. Include the following: New Antifreeze @ 55 G SAE 80W-90 & Gear Oil tanks inside compressor room. NOV Sent

03-06-18. Violation escalated to a Class II.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

6.95, Section(s) 25505(a)(4)

Violation Description: Failure to provide initial and annual training to all employees in

safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training

records for a minimum of three years.

Violation Notes: Training records indicate supplemental information for the following

is located in an orange-colored binder: -Emergency Response -SPCC Training -MSDS Update binder color or proof read training material before personnel sign-off. NOV Sent 03-06-18. Violation escalated to a

Class II.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP

Direction Distance Elevation

ation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: HSC 6.95 25503.5(a) - California Health and Safety Code, Chapter 6.95,

Section(s) 25503.5(a)

Violation Description: Owner/Operator failed to establish and implement a Hazardous Materials

Business Plan when storing hazardous materials at or above the

thresholds quantities of 55 gallons/500 lbs/200 cubic feet.

Violation Notes: Returned to compliance on 12/18/2015. HMBP is not available at time of

inspection. Provide and submit a copy on CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 10-23-2015

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Failure to obtain facility management approval to fully implement the

SPCC Plan

Violation Notes: Returned to compliance on 06/16/2016. Operator failed to have a

complete SPCC plan on site at time of inspeciton.

Violation Division: Madera County Environmental Health

Violation Program: APSA Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to complete and electronically submit a site map with all

required content.

Violation Notes: Returned to compliance on 04/03/2018. Update site map to include

internal roads, adjacent streets, storm & sewer drains, access and exit pints, emergency shut offs, evacuation staging areas, additional hazardous waste storage area, emergency response equipment. NOV Sent

03-06-18. Violation escalated to a Class II.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: 40 CFR 1 265.173 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.173

Violation Description: Failure to meet the following container management requirements: (a) A

container holding hazardous waste must always be closed during storage, except when it is necessary to add or remove waste. (b) A container holding hazardous waste must not be opened, handled, or stored in a manner which may rupture the container or cause it to

leak.

Violation Notes: Returned to compliance on 08/11/2017. In hazardous waste pick-up area,

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

Violation Division:

S121787631

used oil filters @ 55 G & used oil absorbent @ 55 G were observed

without removable lid. Corrected On Site.

Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: 19 CCR 4 2729.2(a)(3) - California Code of Regulations, Title 19,

Chapter 4, Section(s) 2729.2(a)(3)

Violation Description: Failure to complete and/or submit an annotated site map if required by

CUPA.

Violation Notes: Returned to compliance on 12/18/2015. Provide an updated site map and

upload into CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Not reported

Violation Notes: Returned to compliance on 04/11/2018. In downstairs level, below guard

railed ares of operation, there is accumulation of oil on the surface of most aboveground oil storage tanks, as well as above the 1,100 G waste oil tank. Provide proof of correction of visible oil spills over

these areas.

Violation Division: Madera County Environmental Health

Violation Program: APSA Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: HSC 6.95 25504(c) - California Health and Safety Code, Chapter 6.95,

Section(s) 25504(c)

Violation Description: Failure to include provisions in the business plan to ensure that

appropriate personnel receive initial and annual training.

Violation Notes: Returned to compliance on 12/18/2015. Training record was not

available at time of inspection.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 05/02/2016. Failed to provide accumulation

Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

start date on used oil and empty containers.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Evaluation:

Eval General Type: Other/Unknown Eval Date: 04-11-2018

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-11-2017 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: APSA Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-11-2017 Violations Found: Yes

Eval Type: Routine done by local agency Eval Notes: Transitioning into an LQG.

Eval Division: Madera County Environmental Health

Eval Program: HW Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 10-23-2015

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: APSA Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 04-11-2018

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: APSA Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 04-11-2018 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

MAP FINDINGS Map ID

Direction Distance

Elevation Site Database(s) **EPA ID Number**

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Eval Program: HW Eval Source: **CERS**

Eval General Type: Other/Unknown Eval Date: 06-07-2016

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: NOV letter mailed out.

Eval Division: Madera County Environmental Health

Eval Program: **APSA Eval Source: CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-11-2017 Violations Found:

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: **HMRRP CERS** Eval Source:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-11-2013

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: **HMRRP Eval Source: CERS**

Compliance Evaluation Inspection Eval General Type:

Eval Date: 09-11-2013 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW **Eval Source: CERS**

Other/Unknown Eval General Type: Eval Date: 10-23-2015

Violations Found:

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Madera County Environmental Health **Eval Division:**

Eval Program: **HMRRP Eval Source: CERS**

Eval General Type: Other/Unknown Eval Date: 10-23-2015 Yes

Violations Found:

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW **Eval Source: CERS**

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Enforcement Action:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 03-06-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: APSA Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 03-06-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HMRRP Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 03-06-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 04-11-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

Site City: MADERA

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

 Site Zip:
 93637

 Enf Action Date:
 06-07-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: APSA Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 08-11-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: APSA Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 08-11-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HMRRP Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 08-11-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 09-11-2013

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

Enf Action Division: Madera County Environmental Health

HMRRP Enf Action Program: **CERS** Enf Action Source:

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 09-11-2013

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW Enf Action Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 10-23-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **APSA** Enf Action Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 10-23-2015 Enf Action Date:

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW Enf Action Source: **CERS**

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 12-18-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Not reported Enf Action Notes:

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW Enf Action Source: **CERS**

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Coordinates:

Site ID: 53558

Facility Name: OIL STOP-DRIVE THRU OIL CHANGE

Env Int Type Code: HWG
Program ID: 10426093
Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.962190 Longitude: -120.062130

Affiliation:

Affiliation Type Desc: Environmental Contact

Entity Name: AES
Entity Title: Not reported
Affiliation Address: 1300 Santa Fe
Affiliation City: COMPTON

Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 90221

Affiliation Phone: (559) 498-0240

Affiliation Type Desc: Facility Mailing Address

Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: 212 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner

Entity Name: SINGH, HARKHEWAL

Entity Title: Not reported

Affiliation Address: 230 N GATEWAY AVE

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (510) 940-3602

Affiliation Type Desc: Identification Signer Entity Name: JR MENDOZA Entity Title: **MANAGER** Not reported Affiliation Address: Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 675-7823

Affiliation Type Desc: **Document Preparer** Entity Name: Manjeet Kaur **Entity Title:** Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Operator

Entity Name: SINGH, HARKHEWAL

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (559) 479-8318

Affiliation Type Desc: Parent Corporation

Entity Name: OIL STOP-DRIVE THRU OIL CHANGE

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

CERS TANKS:

Site ID: 53558 CERS ID: 10426093

CERS Description: Aboveground Petroleum Storage

Violations:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 04-11-2018

Citation: 22 CCR 15 66265.192(h) - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.192(h)

Violation Description: Failure of generator to obtain assessment or reassessment every five

(5) years or the remaining service life of the tank system, as stated in the engineer's assessment, whichever is less. This assessment applies to onground or aboveground tank systems containing only non-RCRA hazardous wastes generated onsite, or for a small quantity generator onground or aboveground tank systems containing RCRA

hazardous wastes generated onsite.

Violation Notes: Required for new tank systems as defined by CCR 66160.10. Obtain

assessment or reassessment every five (5) years or the remaining service life of the waste oil tank system, as stated in the engineer's

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

assessment, whichever is less. This assessment applies to onground or aboveground tank systems containing only non-RCRA hazardous wastes

generated onsite, or for a small quantity generator onground or

aboveground tank systems containing RCRA hazardous wastes generated onsite. Submit a copy of the waste oil tank assessment to this office

by 06/11/2018.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 04-11-2018

Citation: 22 CCR 15 66265.192(k) - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.192(k)

Violation Description: Failure to include all required information in the tank system

assessment.

Violation Notes: See 3010025: Required for new tank systems as defined by CCR 66160.10.

Obtain assessment or reassessment every five (5) years or the remaining service life of the waste oil tank system, as stated in the engineer's assessment, whichever is less. This assessment applies to onground or aboveground tank systems containing only non-RCRA hazardous wastes generated onsite, or for a small quantity generator

onground or aboveground tank systems containing RCRA hazardous wastes

generated onsite. Submit a copy of the waste oil tank assessment to

this office by 06/11/2018.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Failure to address in the SPCC Plan discharge prevention measures,

including procedures for routine handling of products such as

loading/unloading and facility transfers.

Violation Notes: Returned to compliance on 04/11/2018. For portable containers, either

provide the type of oil & storage capacity for each container or provide an estimate of the potential number of mobile or portable containers, the types of oil, and the anticipated storage capacities. Include on Table G-4 of SPCC plan the unknown quantities of SAE

80/W-90 and Gear Oil tanks inside compressor room.

Violation Division: Madera County Environmental Health

Violation Program: APSA Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Failure to comply with one or more of the following requirements: 1.

Have record of inspections and integrity tests signed by the appropriate supervisor or inspector. 2. Keep written procedures and records of inspections and integrity tests for at least three years.

Direction Distance Elevation

ation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

3. Keep comparison records.

Violation Notes: Returned to compliance on 04/11/2018. Periodic inspections on

aboveground oil storage containers, weekly waste oil tank inspections, and monthly spill kit inspections not available for review. Provide inspection records since last APSA inspection conducted on 10/23/15.

If no inspection records available, provide copies of newly

implemented inspection records within the next 30 days. Also, provide

copy of 1,100 G waste oil tank specification sheet.

Violation Division: Madera County Environmental Health

Violation Program: APSA Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: HSC 6.5 25160.2 - California Health and Safety Code, Chapter 6.5,

Section(s) 25160.2

Violation Description: Failure to meet any of the following consolidated manifest

requirements: 1) Legible receipts for each quantity of hazardous waste that is received from a generator, 2) The generator's information (name, address, identification number, contact person, telephone number of the generator, the signature of the generator or the generator's representative), 3) Date of the shipment, 4) The manifest number, 5) The volume or quantity of each waste stream received, 6) The name, address, and identification number of the authorized facility to which the hazardous waste will be transported, 7) The transporter's information (name, address, and identification number, the driver's signature), 8) A statement, signed by the generator, certifying that the generator has established a program to reduce the volume or quantity and toxicity of the hazardous waste to the degree economically practicable. 9) The generator shall retain each receipt

for at least three years.

Violation Notes: Returned to compliance on 10/23/2015. Provide the last three years of

manifest receipts.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 04-11-2018

Citation: 22 CCR 15 66265.16 - California Code of Regulations, Title 22, Chapter

15, Section(s) 66265.16

Violation Description: Failure to provide employees with hazardous waste training program of

class room instructions or on-the-job training within the first six months after the date of their employment or assignment to a facility, or to a new position at a facility and annually thereafter. Training records on current personnel shall be kept until closure of the facility and for former employees the record shall be kept for at least three years from the date the employee last worked at the facility. The records shall include the following: the job title for each position at the facility related to hazardous waste management, and the name of the employee filling each job; a written job description for each position, duties of facility personnel assigned to each position, and a written description of the type and amount of

both introductory and continuing training that will be given to each

person filling a position.

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Violation Notes: 3020002: Facility personnel shall successfully complete a program of

classroom instruction or on-the-job training that teaches them to perform their duties in a way that ensures the facility's compliance with the requirements of Large Quantity Generators. See Section 22 CCR

15 66265.16 (a)(1)-(e). Assure training records indicate the following: -job title for each position related to Hazardous Waste Management, and the name of the employee filling each job. -written description for each position listed. -written description of the type and amount of initial and continuing training for each position.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the

generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 05/02/2016. Operator failed to label used

oil and empty containers.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 10-23-2015

Citation: 22 CCR 16 66266.130 - California Code of Regulations, Title 22,

Chapter 16, Section(s) 66266.130

Violation Description: Failure to properly handle, manage, label, and recycle used oil and

fuel filters.

Violation Notes: Returned to compliance on 05/02/2016. Failed to properly label used

drained oil filters.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers and

portable tanks with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation

date.

Violation Notes: Returned to compliance on 04/11/2018. Antifreeze waste missing

accumulation start date. Corrected On Site. In hazardous waste pick-up

area: 55 G Non-metal filter & oily absorbent @ 55 G missing

accumulation start date. In basement, 30 G used oil container missing accumulation start date and name and address of the generator. Provide

proof of correction.

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain and/or maintain an Active EPA ID.

Violation Notes: Returned to compliance on 05/02/2016. Failed to activate EPA ID

number.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 04-11-2018

Citation: 40 CFR 1 265.32 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.32

Violation Description: Failure of the facility to maintain the following emergency equipment

or equivalents: 1) An internal communications or alarm system; 2) A device, such as a telephone (immediately available at the scene of Operations/ Maintenance) or a hand-held two-way radio, capable of summoning emergency assistance from local police departments, fire departments, or State or local emergency response teams; 3) Portable fire extinguishers, fire control equipment, spill control equipment, and decontamination equipment; and 4) Water at adequate volume and pressure to supply water hose streams, or foam producing equipment, or

automatic sprinklers, or water spray systems.

Violation Notes: Equip facility with portable fire extinguishers in working order.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to establish and electronically submit an adequate emergency

response plan and procedures for a release or threatened release of a

hazardous material.

Violation Notes: Returned to compliance on 04/03/2018. Operator stated in case of

emergency, personnel will meet approximately 20 feet Southeast from

hazardous waste pick-up area. Consolidated Emergency

Response/Contingency plan states personnel will evacuate to the area

by the oil stop sign. Update Consolidated Emergency

Response/Contingency Plan + Upload to CERS. NOV Sent 03-06-18.

Violation escalated to a Class II.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Violation Date: 08-11-2017

Citation: HSC 6.67 Multiple - California Health and Safety Code, Chapter 6.67,

Section(s) Multiple

Violation Description: APSA Program - Operations/Maintenance - General

Violation Notes: Returned to compliance on 04/11/2018. Failure to properly permanently

close all/any tanks under the definition of Permanently Closed in 40 CFR 112.2. All empty/out-of-service tanks that facility will no longer be using must have conspicuous signs posted on each tank stating that it is a permanently closed container and noting the date of closure, otherwise, include all tanks annotated in most recent approved site map submitted on 04/26/17. 40 CFR 112.2; HSC 6.67 25270.4.5(a)

Violation Division: Madera County Environmental Health

Violation Program: APSA Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain and/or maintain an Active EPA ID.

Violation Notes: Returned to compliance on 05/02/2016. Operator failed to obtained an

active EPA ID number.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: 22 CCR 11 66261.7 - California Code of Regulations, Title 22, Chapter

11, Section(s) 66261.7

Violation Description: Failure to manage empty containers greater than 5 gallons in capacity

that previously held a hazardous material/waste in accordance with 22 CCR 11 66261.7 including but not limited to the following: (e)(2)By reclaiming its scrap value onsite or shipping the container or inner

liner to a person who reclaims its scrap value; or (3) By

reconditioning or remanufacturing the container or inner liner onsite for subsequent reuse, or shipping the container or inner liner to a person who reconditions or remanufactures the container or inner liner; or (4) By shipping the container or inner liner to a supplier or to another intermediate collection location for accumulation prior to managing the container or inner liner pursuant to subsections (e)(2) or (e)(3) of this section; or (i) By shipping the container or inner liner back to the supplier for the purpose of being refilled. (f) A container or an inner liner removed from a container larger than five gallons in capacity which is managed pursuant to subsection (e) of this section shall be marked with the date it has been emptied and

shall be managed within one year of being emptied.

Violation Notes: Returned to compliance on 04/11/2018. Approximately 10 containers with

30-55 G shell capacity that were previously used for degreasing or windshield wiping solution were unlabeled. Mark as empty and the date

when 1st emptied. Manage within a year.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 06-07-2016

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Failure to prepare and implement a Spill Prevention Control and

Countermeasure (SPCC) Plan.

Violation Notes: Returned to compliance on 06/16/2016.
Violation Division: Madera County Environmental Health

Violation Program: APSA Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to complete and electronically submit hazardous material

inventory information for all reportable hazardous materials on site

at or above reportable quantities.

Violation Notes: Returned to compliance on 04/03/2018. Update "Max. Daily" values for

all hazardous materials/waste. Include chemical location of all

hazardous materials/waste. Include the following: New Antifreeze @ 55 G SAE 80W-90 & Gear Oil tanks inside compressor room. NOV Sent

03-06-18. Violation escalated to a Class II. Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Violation Division:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

6.95, Section(s) 25505(a)(4)

Violation Description: Failure to provide initial and annual training to all employees in

safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training

records for a minimum of three years.

Violation Notes: Training records indicate supplemental information for the following

is located in an orange-colored binder: -Emergency Response -SPCC Training -MSDS Update binder color or proof read training material before personnel sign-off. NOV Sent 03-06-18. Violation escalated to a

Class II.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: HSC 6.95 25503.5(a) - California Health and Safety Code, Chapter 6.95,

Section(s) 25503.5(a)

Violation Description: Owner/Operator failed to establish and implement a Hazardous Materials

Business Plan when storing hazardous materials at or above the

thresholds quantities of 55 gallons/500 lbs/200 cubic feet.

Violation Notes: Returned to compliance on 12/18/2015. HMBP is not available at time of

inspection. Provide and submit a copy on CERS.

Direction Distance

Elevation **EPA ID Number** Site Database(s)

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Violation Division: Madera County Environmental Health

Violation Program: **HMRRP CERS** Violation Source:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 10-23-2015

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Failure to obtain facility management approval to fully implement the

SPCC Plan.

Returned to compliance on 06/16/2016. Operator failed to have a Violation Notes:

complete SPCC plan on site at time of inspeciton.

Violation Division: Madera County Environmental Health

Violation Program: **APSA** Violation Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter Citation:

6.95, Section(s) 25508(a)(1)

Failure to complete and electronically submit a site map with all Violation Description:

required content.

Violation Notes: Returned to compliance on 04/03/2018. Update site map to include

internal roads, adjacent streets, storm & sewer drains, access and exit pints, emergency shut offs, evacuation staging areas, additional hazardous waste storage area, emergency response equipment. NOV Sent

03-06-18. Violation escalated to a Class II.

Violation Division: Madera County Environmental Health

HMRRP Violation Program: Violation Source: **CERS**

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Violation Date: 08-11-2017

Citation: 40 CFR 1 265.173 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.173

Violation Description: Failure to meet the following container management requirements: (a) A

container holding hazardous waste must always be closed during storage, except when it is necessary to add or remove waste. (b) A container holding hazardous waste must not be opened, handled, or stored in a manner which may rupture the container or cause it to

Violation Notes: Returned to compliance on 08/11/2017. In hazardous waste pick-up area,

used oil filters @ 55 G & used oil absorbent @ 55 G were observed

without removable lid. Corrected On Site.

Violation Division: Madera County Environmental Health Violation Program: HW

CERS Violation Source:

Site ID:

53558 OIL STOP-DRIVE THRU OIL CHANGE Site Name:

09-11-2013 Violation Date:

Citation: 19 CCR 4 2729.2(a)(3) - California Code of Regulations, Title 19,

Chapter 4. Section(s) 2729.2(a)(3)

Violation Description: Failure to complete and/or submit an annotated site map if required by

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

CUPA.

Violation Notes: Returned to compliance on 12/18/2015. Provide an updated site map and

upload into CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Not reported

Violation Notes: Returned to compliance on 04/11/2018. In downstairs level, below guard

railed ares of operation, there is accumulation of oil on the surface of most aboveground oil storage tanks, as well as above the 1,100 G waste oil tank. Provide proof of correction of visible oil spills over

these areas.

Violation Division: Madera County Environmental Health

Violation Program: APSA Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: HSC 6.95 25504(c) - California Health and Safety Code, Chapter 6.95,

Section(s) 25504(c)

Violation Description: Failure to include provisions in the business plan to ensure that

appropriate personnel receive initial and annual training.

Violation Notes: Returned to compliance on 12/18/2015. Training record was not

available at time of inspection.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the $\,$

generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 05/02/2016. Failed to provide accumulation

start date on used oil and empty containers.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Evaluation:

Eval General Type: Other/Unknown Eval Date: 04-11-2018

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-11-2017 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: APSA Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-11-2017 Violations Found: Yes

Eval Type: Routine done by local agency Eval Notes: Transitioning into an LQG.

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 10-23-2015

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: APSA Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 04-11-2018

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: APSA Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 04-11-2018

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Eval General Type: Other/Unknown
Eval Date: 06-07-2016

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: NOV letter mailed out.

Eval Division: Madera County Environmental Health

Eval Program: APSA Eval Source: CERS

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-11-2017 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-11-2013 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-11-2013 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 010-23-2015

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Other/Unknown
Eval Date: 10-23-2015

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Enforcement Action:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 03-06-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: APSA

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

Enf Action Source: **CERS**

53558 Site ID:

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

MADERA Site City: Site Zip: 93637 Enf Action Date: 03-06-2018

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

HMRRP Enf Action Program: Enf Action Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 03-06-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

Enf Action Program: HW Enf Action Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 04-11-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Not reported Enf Action Notes:

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW Enf Action Source: **CERS**

Site ID:

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

MADERA Site City: Site Zip: 93637 Enf Action Date: 06-07-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **APSA CERS** Enf Action Source: Site ID:

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Site Address: 212 N GATEWAY DR

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 08-11-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: APSA **CERS** Enf Action Source:

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 08-11-2017

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

HMRRP Enf Action Program: Enf Action Source: **CERS**

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 08-11-2017

Notice of Violation (Unified Program) Enf Action Type:

Notice of Violation Issued by the Inspector at the Time of Inspection Enf Action Description:

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW **CERS** Enf Action Source:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 09-11-2013

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 09-11-2013

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 10-23-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: APSA Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 10-23-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 12-18-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Coordinates:

Site ID: 53558

Facility Name: OIL STOP-DRIVE THRU OIL CHANGE

Env Int Type Code: HWG
Program ID: 10426093
Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.962190 Longitude: -120.062130

Affiliation:

Affiliation Type Desc: Environmental Contact

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Entity Name: AES

Entity Title: Not reported
Affiliation Address: 1300 Santa Fe
Affiliation City: COMPTON

Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 90221

Affiliation Phone: (559) 498-0240

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address

Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: 212 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner

Entity Name: SINGH, HARKHEWAL

Entity Title: Not reported

Affiliation Address: 230 N GATEWAY AVE

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (510) 940-3602

Affiliation Type Desc: Identification Signer Entity Name: JR MENDOZA **Entity Title: MANAGER** Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: **Document Preparer** Entity Name: Manjeet Kaur **Entity Title:** Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Affiliation Phone: Not reported

Affiliation Type Desc: Operator

Entity Name: SINGH, HARKHEWAL

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (559) 479-8318

Affiliation Type Desc: Parent Corporation

Entity Name: OIL STOP-DRIVE THRU OIL CHANGE

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

CERS TANKS:

Site ID: 53558 CERS ID: 10426093

CERS Description: Chemical Storage Facilities

Violations:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 04-11-2018

Citation: 22 CCR 15 66265.192(h) - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.192(h)

Violation Description: Failure of generator to obtain assessment or reassessment every five

(5) years or the remaining service life of the tank system, as stated in the engineer's assessment, whichever is less. This assessment applies to onground or aboveground tank systems containing only non-RCRA hazardous wastes generated onsite, or for a small quantity generator onground or aboveground tank systems containing RCRA

hazardous wastes generated onsite.

Violation Notes: Required for new tank systems as defined by CCR 66160.10. Obtain

assessment or reassessment every five (5) years or the remaining service life of the waste oil tank system, as stated in the engineer's assessment, whichever is less. This assessment applies to onground or aboveground tank systems containing only non-RCRA hazardous wastes

generated onsite, or for a small quantity generator onground or

aboveground tank systems containing RCRA hazardous wastes generated onsite. Submit a copy of the waste oil tank assessment to this office

by 06/11/2018.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 04-11-2018

Distance Elevation

evation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Citation: 22 CCR 15 66265.192(k) - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.192(k)

Violation Description: Failure to include all required information in the tank system

assessment.

Violation Notes: See 3010025: Required for new tank systems as defined by CCR 66160.10.

Obtain assessment or reassessment every five (5) years or the remaining service life of the waste oil tank system, as stated in the engineer's assessment, whichever is less. This assessment applies to onground or aboveground tank systems containing only non-RCRA hazardous wastes generated onsite, or for a small quantity generator onground or aboveground tank systems containing RCRA hazardous wastes

generated onsite. Submit a copy of the waste oil tank assessment to

this office by 06/11/2018.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Failure to address in the SPCC Plan discharge prevention measures,

including procedures for routine handling of products such as

loading/unloading and facility transfers.

Violation Notes: Returned to compliance on 04/11/2018. For portable containers, either

provide the type of oil & storage capacity for each container or provide an estimate of the potential number of mobile or portable containers, the types of oil, and the anticipated storage capacities. Include on Table G-4 of SPCC plan the unknown quantities of SAE

80/W-90 and Gear Oil tanks inside compressor room.

Violation Division: Madera County Environmental Health

Violation Program: APSA Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Failure to comply with one or more of the following requirements: 1.

Have record of inspections and integrity tests signed by the appropriate supervisor or inspector. 2. Keep written procedures and records of inspections and integrity tests for at least three years.

3. Keep comparison records.

Violation Notes: Returned to compliance on 04/11/2018. Periodic inspections on

aboveground oil storage containers, weekly waste oil tank inspections, and monthly spill kit inspections not available for review. Provide inspection records since last APSA inspection conducted on 10/23/15.

If no inspection records available, provide copies of newly

implemented inspection records within the next 30 days. Also, provide

copy of 1,100 G waste oil tank specification sheet.

Violation Division: Madera County Environmental Health

Violation Program: APSA Violation Source: CERS

Site ID: 53558

Distance Elevation

ation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: HSC 6.5 25160.2 - California Health and Safety Code, Chapter 6.5,

Section(s) 25160.2

Violation Description: Failure to meet any of the following consolidated manifest

requirements: 1) Legible receipts for each quantity of hazardous waste that is received from a generator, 2) The generator's information (name, address, identification number, contact person, telephone number of the generator, the signature of the generator or the generator's representative), 3) Date of the shipment, 4) The manifest number, 5) The volume or quantity of each waste stream received, 6) The name, address, and identification number of the authorized facility to which the hazardous waste will be transported, 7) The transporter's information (name, address, and identification number, the driver's signature), 8) A statement, signed by the generator, certifying that the generator has established a program to reduce the volume or quantity and toxicity of the hazardous waste to the degree economically practicable. 9) The generator shall retain each receipt for at least three years.

Violation Notes: Returned to compliance on 10/23/2015. Provide the last three years of

manifest receipts.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 04-11-2018

Citation: 22 CCR 15 66265.16 - California Code of Regulations, Title 22, Chapter

15, Section(s) 66265.16

Violation Description: Failure to provide employees with hazardous waste training program of

class room instructions or on-the-job training within the first six months after the date of their employment or assignment to a facility, or to a new position at a facility and annually thereafter. Training records on current personnel shall be kept until closure of the facility and for former employees the record shall be kept for at least three years from the date the employee last worked at the facility. The records shall include the following: the job title for each position at the facility related to hazardous waste management, and the name of the employee filling each job; a written job description for each position, duties of facility personnel assigned to each position, and a written description of the type and amount of both introductory and continuing training that will be given to each

person filling a position.

Violation Notes: 3020002: Facility personnel shall successfully complete a program of

classroom instruction or on-the-job training that teaches them to perform their duties in a way that ensures the facility's compliance with the requirements of Large Quantity Generators. See Section 22 CCR

15 66265.16 (a)(1)-(e). Assure training records indicate the following: -job title for each position related to Hazardous Waste Management, and the name of the employee filling each job. -written description for each position listed. -written description of the type and amount of initial and continuing training for each position.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Direction Distance

Elevation **EPA ID Number** Site Database(s)

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Violation Date: 09-11-2013

22 CCR 12 66262.34(f) - California Code of Regulations, Title 22, Citation:

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the

generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date. Violation Notes:

Returned to compliance on 05/02/2016. Operator failed to label used

oil and empty containers.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Violation Date: 10-23-2015

Citation: 22 CCR 16 66266.130 - California Code of Regulations, Title 22,

Chapter 16, Section(s) 66266.130

Violation Description: Failure to properly handle, manage, label, and recycle used oil and

fuel filters.

Violation Notes: Returned to compliance on 05/02/2016. Failed to properly label used

drained oil filters.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Violation Date: 08-11-2017

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers and

> portable tanks with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical

characteristics of the Hazardous Waste, and starting accumulation

Returned to compliance on 04/11/2018. Antifreeze waste missing Violation Notes:

accumulation start date. Corrected On Site. In hazardous waste pick-up

area: 55 G Non-metal filter & oily absorbent @ 55 G missing

accumulation start date. In basement, 30 G used oil container missing accumulation start date and name and address of the generator. Provide

proof of correction.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Violation Date: 09-11-2013

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain and/or maintain an Active EPA ID.

Violation Notes: Returned to compliance on 05/02/2016. Failed to activate EPA ID

number.

Violation Division: Madera County Environmental Health Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 04-11-2018

Citation: 40 CFR 1 265.32 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.32

Violation Description: Failure of the facility to maintain the following emergency equipment

or equivalents: 1) An internal communications or alarm system; 2) A device, such as a telephone (immediately available at the scene of Operations/ Maintenance) or a hand-held two-way radio, capable of summoning emergency assistance from local police departments, fire departments, or State or local emergency response teams; 3) Portable fire extinguishers, fire control equipment, spill control equipment, and decontamination equipment; and 4) Water at adequate volume and pressure to supply water hose streams, or foam producing equipment, or

automatic sprinklers, or water spray systems.

Violation Notes: Equip facility with portable fire extinguishers in working order.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to establish and electronically submit an adequate emergency

response plan and procedures for a release or threatened release of a

hazardous material.

Violation Notes: Returned to compliance on 04/03/2018. Operator stated in case of

emergency, personnel will meet approximately 20 feet Southeast from

hazardous waste pick-up area. Consolidated Emergency

Response/Contingency plan states personnel will evacuate to the area

by the oil stop sign. Update Consolidated Emergency

Response/Contingency Plan + Upload to CERS. NOV Sent 03-06-18.

Violation escalated to a Class II.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.67 Multiple - California Health and Safety Code, Chapter 6.67,

Section(s) Multiple

Violation Description: APSA Program - Operations/Maintenance - General

Violation Notes: Returned to compliance on 04/11/2018. Failure to properly permanently

close all/any tanks under the definition of Permanently Closed in 40 CFR 112.2. All empty/out-of-service tanks that facility will no longer be using must have conspicuous signs posted on each tank stating that it is a permanently closed container and noting the date of closure, otherwise, include all tanks annotated in most recent approved site map submitted on 04/26/17. 40 CFR 112.2; HSC 6.67 25270.4.5(a)

Violation Division: Madera County Environmental Health

Violation Program: APSA

Map ID MAP FINDINGS Direction

Distance

Elevation **EPA ID Number** Site Database(s)

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Violation Source: **CERS**

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Violation Date: 09-11-2013

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain and/or maintain an Active EPA ID.

Violation Notes: Returned to compliance on 05/02/2016. Operator failed to obtained an

active EPA ID number.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID:

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Violation Date: 08-11-2017

Citation: 22 CCR 11 66261.7 - California Code of Regulations, Title 22, Chapter

11, Section(s) 66261.7

Violation Description: Failure to manage empty containers greater than 5 gallons in capacity

> that previously held a hazardous material/waste in accordance with 22 CCR 11 66261.7 including but not limited to the following: (e)(2)By reclaiming its scrap value onsite or shipping the container or inner

liner to a person who reclaims its scrap value; or (3) By

reconditioning or remanufacturing the container or inner liner onsite for subsequent reuse, or shipping the container or inner liner to a person who reconditions or remanufactures the container or inner liner; or (4) By shipping the container or inner liner to a supplier or to another intermediate collection location for accumulation prior to managing the container or inner liner pursuant to subsections (e)(2) or (e)(3) of this section; or (i) By shipping the container or inner liner back to the supplier for the purpose of being refilled. (f) A container or an inner liner removed from a container larger than five gallons in capacity which is managed pursuant to subsection (e)

of this section shall be marked with the date it has been emptied and

shall be managed within one year of being emptied.

Violation Notes: Returned to compliance on 04/11/2018. Approximately 10 containers with

> 30-55 G shell capacity that were previously used for degreasing or windshield wiping solution were unlabeled. Mark as empty and the date

when 1st emptied. Manage within a year. Madera County Environmental Health

Violation Division: Violation Program: HW

Violation Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 06-07-2016

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Failure to prepare and implement a Spill Prevention Control and Violation Description:

Countermeasure (SPCC) Plan.

Violation Notes: Returned to compliance on 06/16/2016. Violation Division: Madera County Environmental Health

Violation Program: **APSA** Violation Source: **CERS**

Site ID: 53558

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to complete and electronically submit hazardous material

inventory information for all reportable hazardous materials on site

at or above reportable quantities.

Violation Notes: Returned to compliance on 04/03/2018. Update "Max. Daily" values for

all hazardous materials/waste. Include chemical location of all

hazardous materials/waste. Include the following: New Antifreeze @ 55 G SAE 80W-90 & Gear Oil tanks inside compressor room. NOV Sent

03-06-18. Violation escalated to a Class II.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

6.95, Section(s) 25505(a)(4)

Violation Description: Failure to provide initial and annual training to all employees in

safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training

records for a minimum of three years.

Violation Notes: Training records indicate supplemental information for the following

is located in an orange-colored binder: -Emergency Response -SPCC Training -MSDS Update binder color or proof read training material before personnel sign-off. NOV Sent 03-06-18. Violation escalated to a

Class II.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: HSC 6.95 25503.5(a) - California Health and Safety Code, Chapter 6.95,

Section(s) 25503.5(a)

Violation Description: Owner/Operator failed to establish and implement a Hazardous Materials

Business Plan when storing hazardous materials at or above the

thresholds quantities of 55 gallons/500 lbs/200 cubic feet.

Violation Notes: Returned to compliance on 12/18/2015. HMBP is not available at time of

inspection. Provide and submit a copy on CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 10-23-2015

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Failure to obtain facility management approval to fully implement the

SPCC Plan.

Violation Notes: Returned to compliance on 06/16/2016. Operator failed to have a

complete SPCC plan on site at time of inspeciton.

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Violation Division: Madera County Environmental Health

Violation Program: APSA Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to complete and electronically submit a site map with all

required content.

Violation Notes: Returned to compliance on 04/03/2018. Update site map to include

internal roads, adjacent streets, storm & sewer drains, access and exit pints, emergency shut offs, evacuation staging areas, additional hazardous waste storage area, emergency response equipment. NOV Sent

03-06-18. Violation escalated to a Class II.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: 40 CFR 1 265.173 - U.S. Code of Federal Regulations, Title 40, Chapter

1, Section(s) 265.173

Violation Description: Failure to meet the following container management requirements: (a) A

container holding hazardous waste must always be closed during storage, except when it is necessary to add or remove waste. (b) A container holding hazardous waste must not be opened, handled, or stored in a manner which may rupture the container or cause it to

leak.

Violation Notes: Returned to compliance on 08/11/2017. In hazardous waste pick-up area,

used oil filters @ 55 G & used oil absorbent @ 55 G were observed

without removable lid. Corrected On Site.

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: 19 CCR 4 2729.2(a)(3) - California Code of Regulations, Title 19,

Chapter 4, Section(s) 2729.2(a)(3)

Violation Description: Failure to complete and/or submit an annotated site map if required by CUPA.

Returned to compliance on 12/18/2015. Provide an updated site map and

upload into CERS.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Violation Notes:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 08-11-2017

Citation: HSC 6.67 25270.4.5(a) - California Health and Safety Code, Chapter

6.67, Section(s) 25270.4.5(a)

Violation Description: Not reported

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Violation Notes: Returned to compliance on 04/11/2018. In downstairs level, below guard

railed ares of operation, there is accumulation of oil on the surface of most aboveground oil storage tanks, as well as above the 1,100 G waste oil tank. Provide proof of correction of visible oil spills over

these areas.

Violation Division: Madera County Environmental Health

Violation Program: APSA Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: HSC 6.95 25504(c) - California Health and Safety Code, Chapter 6.95,

Section(s) 25504(c)

Violation Description: Failure to include provisions in the business plan to ensure that

appropriate personnel receive initial and annual training.

Violation Notes: Returned to compliance on 12/18/2015. Training record was not

available at time of inspection.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Violation Date: 09-11-2013

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 05/02/2016. Failed to provide accumulation

start date on used oil and empty containers.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Evaluation:

Eval General Type: Other/Unknown Eval Date: 04-11-2018

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-11-2017 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: APSA Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

Eval Date:

Violations Found: Yes

Eval Type: Routine done by local agency Eval Notes: Transitioning into an LQG.

Eval Division: Madera County Environmental Health

08-11-2017

Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 10-23-2015 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: APSA Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 04-11-2018

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: APSA Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 04-11-2018 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Eval General Type: Other/Unknown
Eval Date: 06-07-2016
Violations Found: Yes

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: NOV letter mailed out.

Eval Division: Madera County Environmental Health

Eval Program: APSA Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-11-2017

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-11-2013 Violations Found: Yes

Eval Type: Routine done by local agency

EDR ID Number

S121787631

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: **HMRRP** Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

09-11-2013 Eval Date: Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW Eval Source: **CERS**

Eval General Type: Other/Unknown **Eval Date:** 10-23-2015

Violations Found: No

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Madera County Environmental Health Eval Division:

Eval Program: **HMRRP** Eval Source: **CERS**

Eval General Type: Other/Unknown Eval Date: 10-23-2015

Violations Found: Yes

Other, not routine, done by local agency Eval Type:

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HWEval Source: **CERS**

Enforcement Action:

53558 Site ID:

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

212 N GATEWAY DR Site Address:

Site City: **MADERA** Site Zip: 93637 03-06-2018 Enf Action Date:

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **APSA** Enf Action Source: **CERS**

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 03-06-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP**

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 03-06-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 04-11-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 06-07-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: APSA Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 08-11-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: APSA Enf Action Source: CERS

Site ID: 53558
Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 08-11-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

HMRRP Enf Action Program: **CERS** Enf Action Source:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 08-11-2017 Enf Action Date:

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

HW Enf Action Program: Enf Action Source: **CERS**

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 09-11-2013

Notice of Violation (Unified Program) Enf Action Type:

Notice of Violation Issued by the Inspector at the Time of Inspection Enf Action Description:

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP CERS** Enf Action Source:

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 09-11-2013

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Not reported Enf Action Notes:

Enf Action Division: Madera County Environmental Health Enf Action Program: HW

Enf Action Source: **CERS**

Site ID: 53558

OIL STOP-DRIVE THRU OIL CHANGE Site Name:

Site Address: 212 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 10-23-2015

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Direction Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: APSA Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 10-23-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 53558

Site Name: OIL STOP-DRIVE THRU OIL CHANGE

Site Address: 212 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 12-18-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Coordinates:

Site ID: 53558

Facility Name: OIL STOP-DRIVE THRU OIL CHANGE

Env Int Type Code: HWG
Program ID: 10426093
Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.962190 Longitude: -120.062130

Affiliation:

Affiliation Type Desc: Environmental Contact

Entity Name: AES

Entity Title: Not reported
Affiliation Address: 1300 Santa Fe
Affiliation City: COMPTON
Affiliation State:

Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 90221
Affiliation Phone: (559) 498-0240

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: 212 N GATEWAY DR

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

EDR ID Number

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner

Entity Name: SINGH, HARKHEWAL

Entity Title: Not reported

Affiliation Address: 230 N GATEWAY AVE

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States

Affiliation Zip: 93637 Affiliation Phone: (510) 940-3602

Affiliation Type Desc: Identification Signer JR MENDOZA **Entity Name:** Entity Title: MANAGER Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: **Document Preparer Entity Name:** Manjeet Kaur **Entity Title:** Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: Not reported

Affiliation Type Desc: Operator

Entity Name: SINGH, HARKHEWAL

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (559) 479-8318

Affiliation Type Desc: Parent Corporation

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

S121787631

OIL STOP-DRIVE THRU OIL CHANGE Entity Name:

Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

OIL STOP-DRIVE THRU OIL CHANGE AST A100338163 **H67** N/A

SSE 212 N GATEWAY DR MADERA, CA

1/8-1/4

0.167 mi.

883 ft. Site 4 of 4 in cluster H

Relative: AST:

Lower Certified Unified Program Agencies: Not reported

SINGH, HARKHEWAL Owner: Actual:

Total Gallons: Not reported 271 ft. 10426093 CERSID:

Facility ID: fa0102165

OIL STOP-DRIVE THRU OIL CHANGE Business Name:

Phone: (559) 479-8318 Fax: 5103720588 Mailing Address: 212 N GATEWAY DR

Mailing Address City: **MADERA**

Mailing Address State: CA Mailing Address Zip Code: 93637

Operator Name: SINGH, HARKHEWAL Operator Phone: (559) 479-8318 Owner Phone: 510-940-3602

Owner Mail Address: 230 N GATEWAY AVE

Owner State: CA 93637 Owner Zip Code: Owner Country: **United States** Property Owner Name: Not reported Property Owner Phone: Not reported Property Owner Mailing Address: Not reported Property Owner City: Not reported Property Owner Stat: Not reported Property Owner Zip Code: Not reported Property Owner Country: Not reported EPAID: CAL000317584

Certified Unified Program Agencies: Madera

OIL STOP-DRIVE THRU OIL CHANGE Owner:

Total Gallons: 1,839 CERSID: Not reported Not reported Facility ID: Business Name: Not reported Phone: Not reported Not reported Fax: Mailing Address: Not reported Mailing Address City: Not reported Mailing Address State: Not reported Mailing Address Zip Code: Not reported Operator Name: Not reported

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

OIL STOP-DRIVE THRU OIL CHANGE (Continued)

A100338163

Operator Phone: Not reported Owner Phone: Not reported Owner Mail Address: Not reported Owner State: Not reported Owner Zip Code: Not reported Owner Country: Not reported Property Owner Name: Not reported Property Owner Phone: Not reported Property Owner Mailing Address: Not reported Property Owner City: Not reported Property Owner Stat: Not reported Property Owner Zip Code: Not reported Property Owner Country: Not reported EPAID: Not reported

68 JOYEE'S RECYCLING **SWRCY** S116238568 North

705 NORTH D ST MADERA, CA 93638

N/A

1/8-1/4 0.174 mi. 921 ft.

Relative: SWRCY: Higher

Not reported Reg Id: RC193741.001 Cert Id: Actual: Mailing Address: 709 North D St 273 ft. Mailing City: Madera

Mailing State: CA 93638 Mailing Zip Code: Website: Not reported

Email: alimondragon29@yahoo.com

Phone Number: (559) 514-0291

Rural:

01/04/2014 Operation Begin Date: Aluminium: Not reported Glass: Not reported Plastic: Not reported Bimetal: Not reported

Hours of Operation: Mon - Sat 8:00 am - 5:00 pm; Sun 12:00 pm - 5:00 pm

Organization ID: Not reported Organization Name: Joyee's Recycling

69 **CIRCLE K STORE #3603 HIST UST** 1000174191

ΝE 500 B ST RCRA NonGen / NLR CAD981681596

1/8-1/4 MADERA, CA 93637 **FINDS** 0.196 mi. **ECHO**

1036 ft.

HIST UST: Relative:

Higher File Number: Not reported URL: Not reported Actual: Region: STATE 274 ft. 00000058847 Facility ID: Facility Type: Gas Station

Other Type: Not reported Contact Name: Not reported Telephone: 2096739741

Direction Distance

Elevation Site Database(s) EPA ID Number

CIRCLE K STORE #3603 (Continued)

1000174191

EDR ID Number

Owner Name: CIRCLE K CONVENIENCE STORES, I

Owner Address: 4500 S. 40TH ST.
Owner City,St,Zip: PHOENIX, AZ 85040

Total Tanks: 0002

Tank Num: 001
Container Num: 1
Year Installed: 1973
Tank Capacity: 00009950
Tank Used for: PRODUCT
Type of Fuel: REGULAR
Container Construction Thickness: 1/4

Leak Detection: Stock Inventor

 Tank Num:
 002

 Container Num:
 2

 Year Installed:
 1973

 Tank Capacity:
 00009950

 Tank Used for:
 PRODUCT

 Type of Fuel:
 UNLEADED

Container Construction Thickness: 1/4

Leak Detection: Stock Inventor

RCRA NonGen / NLR:

Contact:

Date form received by agency: 06/10/1993

Facility name: CIRCLE K STORE #3603

Facility address: 500 B ST

MADERA, CA 93637
EPA ID: CAD981681596
Mailing address: 5811 MANZANITA AVE
CARMICHAEL, CA 95608

ENVIRONMENTAL MANAGER

Contact address: 500 B ST

MADERA, CA 93637 US

Contact country:

Contact telephone: 916-334-2445
Contact email: Not reported

EPA Region: 09

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: CIRCLE K CORP Owner/operator address: NOT REQUIRED

NOT REQUIRED, ME 99999

Owner/operator country: Not reported Owner/operator telephone: 415-555-1212 Owner/operator email: Not reported Owner/operator fax: Not reported Owner/operator extension: Not reported Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED

Direction Distance

Elevation Site Database(s) EPA ID Number

CIRCLE K STORE #3603 (Continued)

1000174191

EDR ID Number

Owner/operator address: NOT REQUIRED

NOT REQUIRED, ME 99999

Not reported Owner/operator country: Owner/operator telephone: 415-555-1212 Owner/operator email: Not reported Owner/operator fax: Not reported Owner/operator extension: Not reported Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Violation Status: No violations found

FINDS:

Registry ID: 110002750041

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

<u>Click this hyperlink</u> while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000174191 Registry ID: 110002750041

DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110002750041

Direction Distance

Elevation Site Database(s) EPA ID Number

170 MADERA INTERMODAL TRANSPORT. LUST S104404484
SE 123 E ST N CERS N/A

1/8-1/4 MADERA, CA 93637

0.200 mi.

1058 ft. Site 3 of 3 in cluster I

Relative: LUST:

 Higher
 Lead Agency:
 MADERA COUNTY

 Actual:
 Case Type:
 LUST Cleanup Site

273 ft. Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900148

Global Id: T0603900148
Latitude: 36.9623578
Longitude: -120.0599759

Status: Completed - Case Closed

Status Date: 06/04/1998
Case Worker: ADR
RB Case Number: 5T20000151
Local Agency: MADERA COUNTY
File Location: Not reported
Local Case Number: Not reported

Potential Media Affect: Soil

Potential Contaminants of Concern: Heating Oil / Fuel Oil

Site History: Not reported

LUST:

Global Id: T0603900148

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900148

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET

City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603900148

 Action Type:
 Other

 Date:
 11/03/1994

 Action:
 Leak Reported

 Global Id:
 T0603900148

 Action Type:
 ENFORCEMENT

 Date:
 07/21/2010

Action: Closure/No Further Action Letter

 Global Id:
 T0603900148

 Action Type:
 Other

 Date:
 12/03/1993

 Action:
 Leak Discovery

EDR ID Number

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA INTERMODAL TRANSPORT. (Continued)

S104404484

EDR ID Number

LUST:

Global Id: T0603900148

Status: Completed - Case Closed

Status Date: 06/04/1998

Global Id: T0603900148

Status: Open - Case Begin Date

Status Date: 12/03/1993

Global Id: T0603900148

Status: Open - Site Assessment

Status Date: 11/03/1994

LUST REG 5:

Region: 5

Status: Case Closed 5T20000151 Case Number: Case Type: Soil only #4 FUEL OIL Substance: JWH Staff Initials: Lead Agency: Local Program: LUST MTBE Code: N/A

CERS TANKS:

 Site ID:
 228997

 CERS ID:
 T0603900148

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported
Affiliation Address: 1685 E STREET
Affiliation City: FRESNO
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

71 GOODYEAR TIRE CERS HAZ WASTE S121740656 SE 115 N D ST CERS N/A

1/8-1/4 MADERA, CA 93638

0.212 mi. 1121 ft.

Relative: CERS HAZ WASTE:

 Higher
 Site ID:
 120217

 Actual:
 CERS ID:
 10426222

273 ft. CERS Description: Hazardous Waste Generator

Violations:

Site ID: 120217

Site Name: GOODYEAR TIRE Violation Date: 09-12-2017

Citation: 22 CCR 12 66262.34(d) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(d)

Violation Description: Failure to send hazardous waste offsite for treatment, storage, or

disposal within 180 days (or 270 days if waste is transported over 200 miles) for a generator who generates less than 1000 kilogram per month

if all of the following conditions are met: (1) The quantity of

hazardous waste accumulated onsite never exceeds 6,000 kilograms. (2) The generator complies with the requirements of 40 Code of Federal Regulations section 262.34(d), (e) and (f). (3) The generator does not hold acutely hazardous waste or extremely hazardous waste in an amount

greater than one kilogram for more than 90 days.

Violation Notes: Returned to compliance on 03/09/2018. Provide manifest for the pick-up

of the following: -Used Oil @ 120 G last dated 11/10/16. -Waste Antifreeze @ 55 G last dated 08/07/16. -"No paper filters" @ 55G dated

04/07/17. -Paper Filters @ 55G with no label.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 120217

Site Name: GOODYEAR TIRE

Violation Date: 09-12-2017

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain an Identification Number prior to treating, storing,

disposing of, transporting or offering for transportation any

hazardous waste.

Violation Notes: Returned to compliance on 09/13/2017. Owner/operator using the

following EPA ID#: CAL000020297, which is inactive and under different business owner. Provide proof of activation for a new permanent EPA

ID#. Corrected on site.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 120217

Site Name: GOODYEAR TIRE Violation Date: 09-12-2017

Citation: 22 CCR 16 66266.81(a)(4)(B) - California Code of Regulations, Title

22, Chapter 16, Section(s) 66266.81(a)(4)(B)

Violation Description: Failure to retain for at least three years a legible copy of each

manifest or bill of lading which identifies spent lead-acid storage batteries shipped to a person who stores the batteries or who uses, reuses, recycles or reclaims the batteries or their components.

Violation Notes: Provide the last three years worth of Bills of Lading/receipts.

EDR ID Number

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

GOODYEAR TIRE (Continued)

S121740656

EDR ID Number

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 120217

Site Name: GOODYEAR TIRE Violation Date: 09-12-2017

Citation: 40 CFR 1 262.34(d)(5)(ii) - U.S. Code of Federal Regulations, Title

40, Chapter 1, Section(s) 262.34(d)(5)(ii)

Violation Description: Failure to post the following information next to the telephone: (A)

The name and telephone number of the emergency coordinator; (B) Location of fire extinguishers and spill control material, and, if present, fire alarm; and (C) The telephone number of the fire

department, unless the facility has a direct alarm.

Violation Notes: Returned to compliance on 03/09/2018. Create and post contingency plan

where all personnel can see.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 120217

Site Name: GOODYEAR TIRE

Violation Date: 09-12-2017

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers and

portable tanks with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation

date.

Violation Notes: Properly label the paper filters @ 55G with the following: "Hazardous

Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation

date.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 120217

Site Name: GOODYEAR TIRE

Violation Date: 09-12-2017

Citation: 22 CCR 12 66262.40(a) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.40(a)

Violation Description: Failure to keep a copy of each properly signed manifest for at least

three years from the date the waste was accepted by the initial transporter. The manifest signed at the time the waste was accepted for transport shall be kept until receiving a signed copy from the

designated facility which received the waste.

Violation Notes: Provide last 3 years worth of manifests for hazardous waste.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-12-2017 Violations Found: Yes

Direction Distance

Elevation Site Database(s) EPA ID Number

GOODYEAR TIRE (Continued)

S121740656

EDR ID Number

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Enforcement Action:

Site ID: 120217

Site Name: GOODYEAR TIRE
Site Address: 115 N D ST
Site City: MADERA
Site Zip: 93638
Enf Action Date: 03-06-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 120217

 Site Name:
 GOODYEAR TIRE

 Site Address:
 115 N D ST

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 09-12-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Coordinates:

Site ID: 120217

Facility Name: GOODYEAR TIRE

Env Int Type Code: HWG
Program ID: 10426222
Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.963280 Longitude: -120.058700

Affiliation:

Affiliation Type Desc: Identification Signer Entity Name: Rodney Encinas

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Owner

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Affiliation Type Desc: Environmental Contact Entity Name: Rodney Encinas

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

GOODYEAR TIRE (Continued)

S121740656

EDR ID Number

Entity Title: Not reported
Affiliation Address: 115 N "D" STREET
Affiliation City: MADERA

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: (559) 363-2558

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: 115 NORTH D STREET

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: Not reported

Affiliation Type Desc: Operator Rodney Encinas **Entity Name:** Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: (559) 674-5602 Affiliation Phone:

Parent Corporation Affiliation Type Desc: GOODYEAR TIRE **Entity Name:** Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc:

Entity Name:

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Property Owner

Rodney Encinas

Not reported

115 N Dst

MADERA

CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 363-2558

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 675-7823

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

GOODYEAR TIRE (Continued) S121740656

Affiliation Type Desc: **Document Preparer** Rodney Encinas **Entity Name:** Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Not reported Affiliation Country: Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner Entity Name: Rodney Encinas Entity Title: Not reported Affiliation Address: 115 N D st. Affiliation City: **MADERA** Affiliation State: CA

Affiliation Country: **United States** Affiliation Zip: 93638

Affiliation Phone: (559) 363-2558

HI TECH AUTOMOTIVE CERS HAZ WASTE S119002534 SSE 128 N GATEWAY DR **CUPA Listings** N/A

1/8-1/4 0.213 mi. 1124 ft.

72

Relative: CERS HAZ WASTE:

MADERA, CA 93637

Lower 36318 Site ID: CERS ID: 10426330 Actual:

CERS Description: Hazardous Waste Generator 270 ft.

Violations:

36318 Site ID:

HI TECH AUTOMOTIVE Site Name:

Violation Date: 08-19-2015

Citation: 22 CCR 15 66265.173 - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.173

Violation Description: Failure to properly close hazardous waste containers when not in

active use.

Returned to compliance on 11/16/2015. INSPECTOR OBSERVED (3) 55 GALLON Violation Notes:

DRUM OF WASTE OIL WITHOUT A CAP/LID. HAZARDOUS WASTE CONTAINERS SHALL

CERS

BE CLOSED AT ALL TIMES, EXCEPT WHEN ADDING OR REMOVING WASTE.

11/4/2015 - VIOLATION ESCALATED TO CLASS 2

Violation Division: Madera County Environmental Health

Violation Program: HW Violation Source: **CERS**

Site ID: 36318

HI TECH AUTOMOTIVE Site Name:

Violation Date: 08-19-2015

19 CCR 6.95 25508(a)(1) - California Code of Regulations, Title 19, Citation:

Chapter 6.95, Section(s) 25508(a)(1)

Violation Description: Failure to complete and electronically submit the Business Activities

Page and/or Business Owner Operator Identification Page.

Returned to compliance on 11/16/2015. INSPECTOR OBSERVED (3) 55 GALLON Violation Notes:

DRUM OS WASTE OIL. FACILITY IS NOT PERMITTED AS A HMBP. COMPLETE BUSINESS PLAN REQUIREMENTS AND SUBMIT IN CERS. FOLLOWING TEMPLETE

Direction Distance

Elevation Site Database(s) EPA ID Number

HI TECH AUTOMOTIVE (Continued)

S119002534

EDR ID Number

PROVIDED: BLANK SITE MAP AND CERS CONSOLIDATED EMERGENCY RESPONSE

PLAN. 11/4/2015. VIOLATION ESCALATED TO CLASS II

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 06-23-2017

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95,

Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the

business plan is complete and accurate on or before the annual due

date.

Violation Notes: Returned to compliance on 06/29/2017.
Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the

generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 11/16/2015. INSPECTOR OBSERVED (3) 55 GALLON

DRUMS . (1) DRUM WITHOUT AN HAZARDOUS WASTE LABEL AND (1) DRUM WITHOUT AN ACCUMULATION START DATE. HAZARDOUS WASTE CONTAINERS SHALL BE PROPERLY LABELED. HAZARDOUS WASTE LABEL NOT POSTED ON PARTS WASHER.

SEE VIOLATION GUIDE FOR REQUIREMENTS.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 40 CFR 1 262.34(d)(5)(ii) - U.S. Code of Federal Regulations, Title

40, Chapter 1, Section(s) 262.34(d)(5)(ii)

Violation Description: Failure to post, next to the telephone, Emergency Information (SQG)

containing the location of emergency equipment, contact names and

numbers.

Violation Notes: Returned to compliance on 11/16/2015. CONTINGENCY PLAN INFORMATION NOT

POSTED NEXT TO PHONE. SEE VIOLATION GUIDE FOR REQUIREMENTS 11/4/2015 -

VIOLATION ESCALATED TO CLASS 2 Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Violation Division:

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 22 CCR 16 66266.130 - California Code of Regulations, Title 22,

Chapter 16, Section(s) 66266.130

Map ID MAP FINDINGS
Direction

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

HI TECH AUTOMOTIVE (Continued)

S119002534

Violation Description: Failure to properly handle, manage, label, and recycle used oil and

fuel filters.

Violation Notes: Returned to compliance on 11/16/2015. CONTAINER FOR FILTERS SHALL BE

MARKED DRAINED USED FILTER AND DATE OF FIRST ACCUMULATION. FILTERS SHALL BE PICKED UP WITHIN 1 YEAR 11/4/2015 - VIOLATION ESCALATED TO

CLASS 2

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain and/or maintain an Active EPA ID.

Violation Notes: Returned to compliance on 08/25/2015. EPA ID # CAL000268587 INACTIVE.

EPA ID# SHALL BE ACTIVATED. DTSC FORM TO ACTIVATE GIVEN TO OWNER.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 22 CCR 15 66265.174 - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.174

Violation Description: Failure to inspect hazardous waste storage areas at least weekly.

Violation Notes: Returned to compliance on 11/16/2015. INSPECTOR OBSERVED WASTE OIL

ACCUMULATION ON TOP OF CONTAINERS. HAZARDOUS WASTE CONTAINERS SHALL BE

INSPECTED WEEKLY FOR CONDITIONS OF CONTAINERS, SPILLS, ETC 11/4/2015 -

VIOLATION ESCALATED TO CLASS 2 Madera County Environmental Health

Violation Division: Madera
Violation Program: HW

Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: HSC 6.5 25160.2 - California Health and Safety Code, Chapter 6.5,

Section(s) 25160.2

Violation Description: Failure to meet any of the following consolidated manifest

requirements: 1) Legible receipts for each quantity of hazardous waste that is received from a generator, 2) The generator's information (name, address, identification number, contact person, telephone number of the generator, the signature of the generator or the generator's representative), 3) Date of the shipment, 4) The manifest number, 5) The volume or quantity of each waste stream received, 6) The name, address, and identification number of the authorized facility to which the hazardous waste will be transported, 7) The transporter's information (name, address, and identification number, the driver's signature), 8) A statement, signed by the generator, certifying that the generator has established a program to reduce the volume or quantity and toxicity of the hazardous waste to the degree economically practicable. 9) The generator shall retain each receipt

for at least three years.

Violation Notes: Returned to compliance on 08/21/2015. MANIFEST/MANIFEST RECEIPTS NOT

Direction Distance

Elevation Site Database(s) EPA ID Number

HI TECH AUTOMOTIVE (Continued)

S119002534

EDR ID Number

AVAILABLE FOR REVIEW. RECORDS SHALL BE MAINTAINED FOR THREE YEARS.

PROVIDE 3 YEARS OF RECORD TO THIS DIVISION

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Evaluation:

Eval General Type: Other/Unknown
Eval Date: 06-23-2017
Violations Found: Yes

Violations Found.

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-19-2015 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-19-2015 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Enforcement Action:

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE
Site Address: 128 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 06-23-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HMRRP Enf Action Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE Site Address: 128 N GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 08-19-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HI TECH AUTOMOTIVE (Continued)

S119002534

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Site ID: 36318

HI TECH AUTOMOTIVE Site Name: Site Address: 128 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 08-19-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW Enf Action Source: **CERS**

Site ID: 36318

HI TECH AUTOMOTIVE Site Name: Site Address: 128 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 11-04-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE Site Address: 128 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 11-04-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Not reported Enf Action Notes:

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW Enf Action Source: **CERS**

Coordinates:

Site ID: 36318

HI TECH AUTOMOTIVE Facility Name:

Env Int Type Code: **HWG** Program ID: 10426330 Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.961690 Longitude: -120.061590

Affiliation:

Affiliation Type Desc: **Environmental Contact**

MAP FINDINGS Map ID

Direction Distance

Elevation Site Database(s) **EPA ID Number**

HI TECH AUTOMOTIVE (Continued)

S119002534

EDR ID Number

Entity Name: INDERJIT SINGH Entity Title: Not reported

Affiliation Address: 128 N GATEWAY DR SUITE C

Affiliation City: **MADERA** Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637 Affiliation Phone: (559) 661-0966

Affiliation Type Desc: Legal Owner

HI TECH AUTOMOTIVE **Entity Name:**

Entity Title: Not reported

Affiliation Address: 128 N GATEWAY DRIVE SUITE C

Affiliation City: **MADERA** Affiliation State:

United States Affiliation Country: Affiliation Zip: 93637

Affiliation Phone: (559) 240-9334

Affiliation Type Desc: Facility Mailing Address **Entity Name:** Mailing Address

Entity Title: Not reported

Affiliation Address: 128 N GATEWAY DRIVE #c

Affiliation City: MADERA Affiliation State: CA Affiliation Country: Not reported

Affiliation Zip: 93637 Affiliation Phone: Not reported

Affiliation Type Desc: Operator Entity Name: INDERJT SINGH **Entity Title:** Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 240-9334

CUPA District Affiliation Type Desc:

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

(559) 675-7823 Affiliation Phone:

Affiliation Type Desc: **Document Preparer** Entity Name: INDERJIT SINGH **Entity Title:** Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

HITECH AUTOMOTIVE (Continued)

S119002534

EDR ID Number

Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer Entity Name: INDERJIT SINGH **Entity Title: OWNER** Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: HI TECH AUTOMOTIVE

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

CUPA MADERA:

Contact Name: HI TECH AUTOMOTIVE

Region: MADERA Facility Id: FA0102974 Contact Phone: 5596610966

Detail:

Facility Id: FA0102974
Common Name: Used lubricating oils

Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111
Decode for c status: Not reported

Facility Id: FA0102974
Common Name: Used Oil Filters (Drained)

Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111

Decode for c status: Not reported

CERS TANKS:

Site ID: 36318 CERS ID: 10426330

CERS Description: Chemical Storage Facilities

Violations:

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 22 CCR 15 66265.173 - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.173

Violation Description: Failure to properly close hazardous waste containers when not in

Direction Distance

Elevation Site Database(s) EPA ID Number

HI TECH AUTOMOTIVE (Continued)

S119002534

EDR ID Number

active use.

Violation Notes: Returned to compliance on 11/16/2015. INSPECTOR OBSERVED (3) 55 GALLON

DRUM OF WASTE OIL WITHOUT A CAP/LID. HAZARDOUS WASTE CONTAINERS SHALL

BE CLOSED AT ALL TIMES, EXCEPT WHEN ADDING OR REMOVING WASTE.

11/4/2015 - VIOLATION ESCALATED TO CLASS 2

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 19 CCR 6.95 25508(a)(1) - California Code of Regulations, Title 19,

Chapter 6.95, Section(s) 25508(a)(1)

Violation Description: Failure to complete and electronically submit the Business Activities

Page and/or Business Owner Operator Identification Page.

Violation Notes: Returned to compliance on 11/16/2015. INSPECTOR OBSERVED (3) 55 GALLON

DRUM OS WASTE OIL. FACILITY IS NOT PERMITTED AS A HMBP. COMPLETE BUSINESS PLAN REQUIREMENTS AND SUBMIT IN CERS. FOLLOWING TEMPLETE PROVIDED: BLANK SITE MAP AND CERS CONSOLIDATED EMERGENCY RESPONSE

PLAN. 11/4/2015. VIOLATION ESCALATED TO CLASS II

Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 06-23-2017

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95,

Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the

business plan is complete and accurate on or before the annual due

date.

Violation Notes: Returned to compliance on 06/29/2017.
Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Chapter 12, Section(s) 66262.34(f)

Violation Description: Failure to properly label hazardous waste accumulation containers with

the following requirements: "Hazardous Waste", name and address of the

generator, physical and chemical characteristics of the Hazardous

Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 11/16/2015. INSPECTOR OBSERVED (3) 55 GALLON

DRUMS . (1) DRUM WITHOUT AN HAZARDOUS WASTE LABEL AND (1) DRUM WITHOUT AN ACCUMULATION START DATE. HAZARDOUS WASTE CONTAINERS SHALL BE PROPERLY LABELED. HAZARDOUS WASTE LABEL NOT POSTED ON PARTS WASHER.

SEE VIOLATION GUIDE FOR REQUIREMENTS.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 36318

Direction Distance

Elevation Site Database(s) EPA ID Number

HI TECH AUTOMOTIVE (Continued)

S119002534

EDR ID Number

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 40 CFR 1 262.34(d)(5)(ii) - U.S. Code of Federal Regulations, Title

40, Chapter 1, Section(s) 262.34(d)(5)(ii)

Violation Description: Failure to post, next to the telephone, Emergency Information (SQG)

containing the location of emergency equipment, contact names and

numbers.

Violation Notes: Returned to compliance on 11/16/2015. CONTINGENCY PLAN INFORMATION NOT

POSTED NEXT TO PHONE. SEE VIOLATION GUIDE FOR REQUIREMENTS 11/4/2015 -

VIOLATION ESCALATED TO CLASS 2

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 22 CCR 16 66266.130 - California Code of Regulations, Title 22,

Chapter 16, Section(s) 66266.130

Violation Description: Failure to properly handle, manage, label, and recycle used oil and

fuel filters.

Violation Notes: Returned to compliance on 11/16/2015. CONTAINER FOR FILTERS SHALL BE

MARKED DRAINED USED FILTER AND DATE OF FIRST ACCUMULATION. FILTERS SHALL BE PICKED UP WITHIN 1 YEAR 11/4/2015 - VIOLATION ESCALATED TO

CLASS 2

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain and/or maintain an Active EPA ID.

Violation Notes: Returned to compliance on 08/25/2015. EPA ID # CAL000268587 INACTIVE.

EPA ID# SHALL BE ACTIVATED. DTSC FORM TO ACTIVATE GIVEN TO OWNER.

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Violation Date: 08-19-2015

Citation: 22 CCR 15 66265.174 - California Code of Regulations, Title 22,

Chapter 15, Section(s) 66265.174

Violation Description: Failure to inspect hazardous waste storage areas at least weekly.

Violation Notes: Returned to compliance on 11/16/2015. INSPECTOR OBSERVED WASTE OIL

 ${\tt ACCUMULATION} \ {\tt ON} \ {\tt TOP} \ {\tt OF} \ {\tt CONTAINERS}. \ {\tt HAZARDOUS} \ {\tt WASTE} \ {\tt CONTAINERS} \ {\tt SHALL} \ {\tt BE}$

INSPECTED WEEKLY FOR CONDITIONS OF CONTAINERS, SPILLS, ETC 11/4/2015 -

VIOLATION ESCALATED TO CLASS 2

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

Direction Distance

Elevation Site Database(s) EPA ID Number

HI TECH AUTOMOTIVE (Continued)

S119002534

EDR ID Number

Violation Date: 08-19-2015

Citation: HSC 6.5 25160.2 - California Health and Safety Code, Chapter 6.5,

Section(s) 25160.2

Violation Description: Failure to meet any of the following consolidated manifest

requirements: 1) Legible receipts for each quantity of hazardous waste that is received from a generator, 2) The generator's information (name, address, identification number, contact person, telephone number of the generator, the signature of the generator or the generator's representative), 3) Date of the shipment, 4) The manifest number, 5) The volume or quantity of each waste stream received, 6) The name, address, and identification number of the authorized facility to which the hazardous waste will be transported, 7) The transporter's information (name, address, and identification number, the driver's signature), 8) A statement, signed by the generator, certifying that the generator has established a program to reduce the volume or quantity and toxicity of the hazardous waste to the degree economically practicable. 9) The generator shall retain each receipt

for at least three years.

Violation Notes: Returned to compliance on 08/21/2015. MANIFEST/MANIFEST RECEIPTS NOT

AVAILABLE FOR REVIEW. RECORDS SHALL BE MAINTAINED FOR THREE YEARS.

PROVIDE 3 YEARS OF RECORD TO THIS DIVISION

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Evaluation:

Eval General Type: Other/Unknown
Eval Date: 06-23-2017
Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-19-2015

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-19-2015 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Enforcement Action:

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

HI TECH AUTOMOTIVE (Continued)

S119002534

Site Address: 128 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 06-23-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

HMRRP Enf Action Program: Enf Action Source: CERS

Site ID: 36318

HI TECH AUTOMOTIVE Site Name: Site Address: 128 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 08-19-2015 Enf Action Date:

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Site ID: 36318

HI TECH AUTOMOTIVE Site Name: Site Address: 128 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 08-19-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

HW Enf Action Program: Enf Action Source: **CERS**

Site ID: 36318

HI TECH AUTOMOTIVE Site Name: Site Address: 128 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 11-04-2015

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Site ID: 36318

Site Name: HI TECH AUTOMOTIVE Site Address: 128 N GATEWAY DR

MADERA Site City: Site Zip: 93637 11-04-2015 Enf Action Date:

Enf Action Type: Notice of Violation (Unified Program) Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

HI TECH AUTOMOTIVE (Continued)

S119002534

EDR ID Number

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Coordinates:

Site ID: 36318

Facility Name: HI TECH AUTOMOTIVE

Env Int Type Code: HWG
Program ID: 10426330
Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.961690 Longitude: -120.061590

Affiliation:

Affiliation Type Desc: Environmental Contact Entity Name: INDERJIT SINGH Entity Title: Not reported

Affiliation Address: 128 N GATEWAY DR SUITE C

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 661-0966

Affiliation Type Desc: Legal Owner

Entity Name: HI TECH AUTOMOTIVE

Entity Title: Not reported

Affiliation Address: 128 N GATEWAY DRIVE SUITE C

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637
Affiliation Phone: (559) 240-9334

Affiliation Type Desc: Facility Mailing Address

Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: 128 N GATEWAY DRIVE #c

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: Not reported

Affiliation Type Desc: Operator

Entity Name: INDERJT SINGH Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 240-9334

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HI TECH AUTOMOTIVE (Continued)

Affiliation Phone:

S119002534

Affiliation Type Desc: **CUPA District**

Madera County Env Health **Entity Name:**

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera Affiliation State: CA Affiliation Country: Not reported Affiliation Zip: 93637 Affiliation Phone: (559) 675-7823

Affiliation Type Desc: **Document Preparer** INDERJIT SINGH Entity Name: Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported

Affiliation Type Desc: Identification Signer INDERJIT SINGH Entity Name:

Not reported

Entity Title: OWNER Affiliation Address: Not reported Affiliation City: Not reported Not reported Affiliation State: Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Parent Corporation Affiliation Type Desc: Entity Name: HI TECH AUTOMOTIVE

Entity Title: Not reported Affiliation Address: Not reported Not reported Affiliation City: Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

J73 S105033802 **DOWNTOWN SHELL** LUST SSE 101 GATEWAY DR N **CERS** N/A

1/8-1/4 0.232 mi.

1224 ft. Site 1 of 7 in cluster J

MADERA, CA 93637

LUST: Relative:

Lower MADERA COUNTY Lead Agency: Case Type: **LUST Cleanup Site** Actual: Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900127 272 ft.

Global Id: T0603900127 36.961643 Latitude: Longitude: -120.060512

Status: Completed - Case Closed

Status Date: 05/29/1996 Case Worker: **ADR**

RB Case Number: 5T20000128

Direction Distance

Elevation Site Database(s) EPA ID Number

DOWNTOWN SHELL (Continued)

S105033802

EDR ID Number

Local Agency: MADERA COUNTY
File Location: Not reported
Local Case Number: Not reported
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0603900127

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900127

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603900127

 Action Type:
 Other

 Date:
 06/01/1993

 Action:
 Leak Reported

 Global Id:
 T0603900127

 Action Type:
 ENFORCEMENT

 Date:
 05/29/1996

Action: Closure/No Further Action Letter

 Global Id:
 T0603900127

 Action Type:
 Other

 Date:
 05/17/1993

 Action:
 Leak Discovery

LUST:

Global Id: T0603900127

Status: Completed - Case Closed

Status Date: 05/29/1996

Global Id: T0603900127

Status: Open - Case Begin Date

Status Date: 05/17/1993

Lead Agency: MADERA COUNTY
Case Type: LUST Cleanup Site

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603991640

Global Id: T0603991640 Latitude: 36.961643

Direction Distance

Elevation Site Database(s) EPA ID Number

DOWNTOWN SHELL (Continued)

S105033802

EDR ID Number

Longitude: -120.060512

Status: Completed - Case Closed

Status Date: 06/12/2002
Case Worker: ADR
RB Case Number: 5T20000210
Local Agency: MADERA COUNTY
File Location: Not reported
Local Case Number: Not reported
Potential Media Affect: Under Investigation

Potential Contaminants of Concern: Gasoline Site History: Not reported

LUST:

Global Id: T0603991640

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603991640

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603991640

 Action Type:
 Other

 Date:
 01/23/2001

 Action:
 Leak Reported

 Global Id:
 T0603991640

 Action Type:
 ENFORCEMENT

 Date:
 06/12/2002

Action: Closure/No Further Action Letter

 Global Id:
 T0603991640

 Action Type:
 Other

 Date:
 01/04/2001

 Action:
 Leak Discovery

LUST:

Global Id: T0603991640

Status: Completed - Case Closed

Status Date: 06/12/2002

Global Id: T0603991640

Status: Open - Case Begin Date

Status Date: 01/04/2001

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DOWNTOWN SHELL (Continued)

S105033802

LUST REG 5:

Region:

Case Closed Status: Case Number: 5T20000128 Case Type: Soil only **GASOLINE** Substance: JWH Staff Initials: Lead Agency: Local Program: LUST MTBE Code: N/A

CERS TANKS:

Site ID: 228850 T0603900127 CERS ID:

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported Affiliation Address: 1685 E STREET Affiliation City: **FRESNO** Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

ANN ROLAN - MADERA COUNTY Entity Name:

Not reported Entity Title:

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

J74 ARCO AM/PM UST U003786984 SSE **101 GATEWAY DR** N/A

1/8-1/4 MADERA, CA 93637

0.232 mi.

1224 ft. Site 2 of 7 in cluster J

Relative: UST:

Lower Facility ID: FA0101982 Permitting Agency: MADERA COUNTY Actual:

Latitude: 36.94747 272 ft. -120.09211 Longitude:

Direction Distance

Elevation Site Database(s) EPA ID Number

 J75
 ARCO AM/PM
 LUST
 S104891091

 SSE
 101 GATEWAY DR N
 CERS
 N/A

1/8-1/4 MADERA, CA 93637

0.232 mi.

272 ft.

1224 ft. Site 3 of 7 in cluster J

Relative: LUST REG 5: Lower Region:

Lower Region:
Actual: Status:

Status: Case Closed
Case Number: 5T20000210
Case Type: Undefined
Substance: GASOLINE
Staff Initials: JWH
Lead Agency: Local
Program: LUST
MTBE Code: N/A

CERS TANKS:

 Site ID:
 219312

 CERS ID:
 T0603991640

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Not reported

1685 E STREET

FRESNO

CA

Affiliation Country:

Not reported

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zio: Not reported

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

 J76
 MADERA ARCO AM PM
 CERS TANKS
 \$113138352

 SSE
 101 N GATEWAY DR
 CUPA Listings
 N/A

 1/8-1/4
 MADERA, CA 93637
 HAZNET

 0.237 mi.
 CERS

1249 ft. Site 4 of 7 in cluster J

Relative: CERS TANKS:

 Lower
 Site ID:
 93144

 Actual:
 CERS ID:
 10426072

272 ft. CERS Description: Underground Storage Tank

Violations:

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 05-20-2016

Citation: HSC 6.7 25286(a) - California Health and Safety Code, Chapter 6.7,

EDR ID Number

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

Section(s) 25286(a)

Violation Description: Failure to submit an complete and accurate application for a permit to

operate an underground storage tank, or for renewal of the permit.

Violation Notes: Returned to compliance on 06/08/2016.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 06-23-2017

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95,

Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the

business plan is complete and accurate on or before the annual due

date.

Violation Notes: Returned to compliance on 07/14/2017.
Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 02-26-2018

Citation: HSC 6.7 25284 - California Health and Safety Code, Chapter 6.7,

Section(s) 25284

Violation Description: Failure to obtain a valid permit to operate from the UPA including but

not limited to unpaid permit fees.

Violation Notes: Returned to compliance on 05/02/2018.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 09-20-2016

Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23,

Chapter 16, Section(s) 2636(f)(2)

Violation Description: Failure of the line leak detector (LLD) monitoring pressurized piping

to meet one or more of the following requirements:Monitor at least hourly.Be capable of detecting a release of 3.0 gallons per hour at 10 p.s.i.g. Restrict or shut off the flow of product through the piping

when a leak is detected.

Violation Notes: Returned to compliance on 09/20/2016. DIESEL LINE LEAK DETECTOR

FAILED. LINE LEAK DETECTOR REPLACE, RETESTED AND PASSED

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 09-20-2016

Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2665

Violation Description: Failure to comply with one or more of the following: Failure to

install or maintain a liquid-tight spill bucket. Have a minimum capacity of five gallons. Have a functional drain valve or other

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

method for the removal of liquid from the spill bucket/spill

container. Be resistant to galvanic corrosion.

Violation Notes: Returned to compliance on 01/16/2017. DIESEL SPILL BUCKET FAILED.

REPAIR AND RETEST. SUBMIT DOCUMENTATION IN 30 DAYS

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 09-20-2016

Citation: 23 CCR 16 2712(i) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2712(i)

Violation Description: Failure to have a UST Monitoring Plan available on site.

Violation Notes: Returned to compliance on 09/20/2016. UST RESPONSE PLAN NOT ONSITE.

MAINTAIN APPROVED PLAN ONSITE. CORRECTED ONSITE

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 08-23-2017

Citation: 23 CCR 16 2632(d)(1)(C), 2641(h), 2711(a)(8) - California Code of

Regulations, Title 23, Chapter 16, Section(s) 2632(d)(1)(C), 2641(h),

2711(a)(8)

Violation Description: Failure to submit or update a plot plan.

Violation Notes: Returned to compliance on 08/30/2017. Redo UST site map to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 10-20-2016

Citation: 23 CCR 16 2638(d) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2638(d)

Violation Description: Failure to submit the Annual Monitoring System Certification Form to

the CUPA within 30 days of completion of the test.

Violation Notes: Returned to compliance on 01/13/2017.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 08-23-2017

Citation: HSC 6.7 25299(a)(9) - California Health and Safety Code, Chapter 6.7,

Section(s) 25299(a)(9)

Violation Description: Leak detection equipment disabled or tampered with in a manner that

would prevent the monitoring system from detecting and/or alerting the

owner/operator of a leak.

Violation Notes: Returned to compliance on 08/23/2017. 91 STP sump sensor not at the

lowest point in the sump. Tester corrected at time of inspection.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

Violation Notes:

S113138352

EDR ID Number

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 10-31-2016

Citation: 23 CCR 16 2637 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2637

Violation Description: Failure to conduct secondary containment testing, or one or more of

the following requirements: Perform the test within six months of installation and every 36 months thereafter. Use a procedure that demonstrates the system works as well as at installation. Use applicable manufacturer guidelines, industry codes, engineering standard, or professional engineer approval. Performed by a certified

service technician or a licensed tank tester. Returned to compliance on 11/22/2016.

Violation Division: Madera County Environmental Health Violation Program: UST

Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 09-20-2016

Citation: HSC 6.7 25290.1(c)(3), 25290.2(c)(3) - California Health and Safety

Code, Chapter 6.7, Section(s) 25290.1(c)(3), 25290.2(c)(3)

Violation Description: Failure to keep water out of the secondary containment of UST systems

installed on or after July 1, 2003 and before July 1, 2004, or on or

after July 1, 2004.

Violation Notes: Returned to compliance on 09/29/2016. 3 FEET OF WATER IN DIESEL FILL

SUMP. LIQUID SHALL BE PROPERLY DISPOSED OF IN 48 HOURS. PROVIDE PROOF

OF DISPOSAL

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 08-23-2017

Citation: 23 CCR 16 2715(i) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2715(i)

Violation Description: Failure to have a properly qualified service technician test leak

detection equipment as required every 12 months (vapor, pressure, hydrostatic (VPH) system, sensors, line-leak detectors (LLD),

automatic tank gauge (ATG), etc.).

Violation Notes: Returned to compliance on 02/26/2018. All the fill sumps sensors

didn't get tested at time of inspection. Escalate to CLass II

Violations. See enforcement on 2/26/2018. Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Violation Division:

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 02-26-2018

Citation: 23 CCR 16 2641(j) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(j)

Violation Description: Failure of the leak detection equipment to be installed, calibrated,

operated, and/or maintained properly.

Violation Notes: Returned to compliance on 05/02/2018. Failed to installed fill sumps

liquid sensor. 5/2/2018 - confirmed fill sumps sensors installation

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

and operation (ken).

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 10-20-2016

Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23,

Chapter 16, Section(s) 2636(f)(2)

Violation Description: Failure of the line leak detector (LLD) monitoring pressurized piping

to meet one or more of the following requirements:Monitor at least hourly.Be capable of detecting a release of 3.0 gallons per hour at 10 p.s.i.g. Restrict or shut off the flow of product through the piping

when a leak is detected.

Violation Notes: Returned to compliance on 11/15/2016. Failure to test LLD. All LLDs

were not tested with a calibrated LLD testing equipment on 9/20/2016.

testing completed 11/15/2016 with calibrated tester.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 08-23-2017

Citation: 23 CCR 16 2641(j) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(j)

Violation Description: Failure of the leak detection equipment to be installed, calibrated,

operated, and/or maintained properly.

Violation Notes: Returned to compliance on 08/23/2017. The west 87 & diesel spill

bucket failed at time of inspection.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 09-20-2016

Citation: 23 CCR 16 2641(a) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(a)

Violation Description: Failure to maintain secondarily contained piping to allow liquid to

flow into the sump in the event of a leak (i.e., failure to remove

test boot).

Violation Notes: Returned to compliance on 09/20/2016. INSPECTOR OBSERVED SECONDARY

TEST BOOT ON 87, 91, AND DIESEL PIPING SUMP AND VALVE NOT POINTING

DOWNWARD. TEST BOOT REMOVED DURING INSPECTION

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-23-2017 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-27-2014

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 05-02-2018

Violations Found: No

Eval Type: Other, not routine, done by local agency
Eval Notes: fill sump sensor installation inspection
Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 05-20-2016

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-23-2017

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-21-2015

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 10-17-2013

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

Eval General Type: Other/Unknown Eval Date: 01-03-2016

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Other/Unknown
Eval Date: 02-26-2018
Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Other/Unknown
Eval Date: 06-23-2017
Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-27-2014

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-20-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-06-2013

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Enforcement Action:

Site ID: 93144

Site Name: ARCO AM/PM #82032

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA ARCO AM PM (Continued)

S113138352

Site Address: 101 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 02-26-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

UST Enf Action Program: Enf Action Source: **CERS**

Site ID: 93144

ARCO AM/PM #82032 Site Name: Site Address: 101 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 05-20-2016 Enf Action Date:

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 93144 Site Name: ARCO AM/PM #82032

Site Address: 101 N GATEWAY DR Site City: **MADERA**

Site Zip: 93637 Enf Action Date: 06-23-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

HMRRP Enf Action Program: Enf Action Source: **CERS**

Site ID: 93144

ARCO AM/PM #82032 Site Name: Site Address: 101 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 08-23-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 93144

Site Name: ARCO AM/PM #82032 101 N GATEWAY DR Site Address:

MADERA Site City: Site Zip: 93637 09-20-2016 Enf Action Date:

Enf Action Type: Notice of Violation (Unified Program)

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA ARCO AM PM (Continued)

S113138352

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 93144

ARCO AM/PM #82032 Site Name: Site Address: 101 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 11-03-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST **CERS** Enf Action Source:

Coordinates:

Site ID: 93144

ARCO AM/PM #82032 Facility Name:

Env Int Type Code: **HMBP** Program ID: 10426072 Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.961640 Longitude: -120.060520

Affiliation:

Affiliation Type Desc: **Document Preparer Entity Name:** HARJIT SINGH **Entity Title:** Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: **Environmental Contact** Entity Name: HARJIT SINGH Entity Title: Not reported Affiliation Address: 101 N GATEWAY

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637 Affiliation Phone: (559) 977-7803

Affiliation Type Desc: Identification Signer HARJIT SINGH **Entity Name: Entity Title: OWNER** Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported

Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner

Entity Name: H&H DIAMOND BOSS ENT

Entity Title: Not reported

Affiliation Address: 101 N GATEWAY DRIVE

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 674-0845

Affiliation Type Desc: Operator HARJIT SINGH **Entity Name:** Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Not reported Affiliation State: Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 763-4420

Affiliation Type Desc: Property Owner

Entity Name: H &H DIAMOND BOSS ENT

Entity Title: Not reported
Affiliation Address: 101 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 674-0845

Affiliation Type Desc: UST Property Owner Name
Entity Name: H & H DIAMOND BOSS ENT

Entity Title: Not reported
Affiliation Address: 101 N GATEWAY

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 674-0845

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address

Entity Title: Not reported
Affiliation Address: 101 N GATEWAY DR

Affiliation City: MADERA

Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637
Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: ARCO AM/PM #82032

Entity Title: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Not reported

Not reported

Not reported

Affiliation Type Desc: UST Tank Owner

Entity Name: H &H DIAMOND BOSS ENT

Entity Title: Not reported
Affiliation Address: 101 N GATEWAY

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 96367

Affiliation Phone: (559) 674-0845

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 675-7823

Affiliation Type Desc: UST Permit Applicant Entity Name: HARJIT SNGH

Entity Title: PRESIDENT
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (559) 977-7803

Affiliation Type Desc:
UST Tank Operator
Entity Name:
HARJIT SINGH
Not reported
Affiliation Address:
101 N GATEWAY

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 674-0845

CUPA MADERA:

Contact Name: H&H DIAMOND BOSS ENT

Region: MADERA
Facility Id: FA0101982
Contact Phone: 5596740845

Detail:

Facility Id: FA0101982 Common Name: Diesel Fuel No. 2

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

Current Status: 01

Program/Elements: HMBP - UST/AST Only

PE1: 2166
Decode for c status: Not reported

Facility Id: FA0101982

Common Name: PREMIUM UNLEADED GASOLINE

Current Status: 0°

Program/Elements: HMBP - UST/AST Only

PE1: 2166

Decode for c status: Not reported

Facility Id: FA0101982

Common Name: UNLEADED REGULAR GASOLINE

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165

Decode for c status: Not reported

HAZNET:

Facility Name: MADERA ARCO AM PM

envid: S113138352

Year: 2006

GEPAID: CAL000296858
Contact: BALJIT ATWAL
Telephone: 5596628599
Mailing Name: Not reported

Mailing Address: 12199 GOLDEN STATE BLVD Mailing City,St,Zip: MADERA, CA 936379156

Gen County: Not reported
TSD EPA ID: CAD008364432
TSD County: Not reported
Waste Category: Other organic solids
Disposal Method: Transfer Station
Tons: 0.35

Cat Decode: Not reported Method Decode: Not reported Facility County: Madera

envid: \$113138352 Year: 2006

GEPAID: CAL000296858
Contact: BALJIT ATWAL
Telephone: 5596628599
Mailing Name: Not reported

Mailing Address: 12199 GOLDEN STATE BLVD Mailing City,St,Zip: MADERA, CA 936379156

Gen County: Not reported TSD EPA ID: CAD008364432 TSD County: Not reported

Waste Category: Unspecified organic liquid mixture

Disposal Method: Treatment, Tank

Tons: 0.33

Cat Decode: Not reported
Method Decode: Not reported
Facility County: Madera

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

CERS TANKS:

 Site ID:
 93144

 CERS ID:
 10426072

CERS Description: Chemical Storage Facilities

Violations:

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 05-20-2016

Citation: HSC 6.7 25286(a) - California Health and Safety Code, Chapter 6.7,

Section(s) 25286(a)

Violation Description: Failure to submit an complete and accurate application for a permit to

operate an underground storage tank, or for renewal of the permit.

Violation Notes: Returned to compliance on 06/08/2016.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 06-23-2017

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95,

Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the

business plan is complete and accurate on or before the annual due

date.

Violation Notes: Returned to compliance on 07/14/2017.
Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 02-26-2018

Citation: HSC 6.7 25284 - California Health and Safety Code, Chapter 6.7,

Section(s) 25284

Violation Description: Failure to obtain a valid permit to operate from the UPA including but

not limited to unpaid permit fees.

Violation Notes: Returned to compliance on 05/02/2018.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 09-20-2016

Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23,

Chapter 16, Section(s) 2636(f)(2)

Violation Description: Failure of the line leak detector (LLD) monitoring pressurized piping

to meet one or more of the following requirements:Monitor at least hourly.Be capable of detecting a release of 3.0 gallons per hour at 10 p.s.i.g. Restrict or shut off the flow of product through the piping

when a leak is detected.

Violation Notes: Returned to compliance on 09/20/2016. DIESEL LINE LEAK DETECTOR

FAILED. LINE LEAK DETECTOR REPLACE, RETESTED AND PASSED

Violation Division: Madera County Environmental Health

Violation Program: UST

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 09-20-2016

Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2665

Violation Description: Failure to comply with one or more of the following: Failure to

install or maintain a liquid-tight spill bucket. Have a minimum capacity of five gallons. Have a functional drain valve or other method for the removal of liquid from the spill bucket/spill

container. Be resistant to galvanic corrosion.

Violation Notes: Returned to compliance on 01/16/2017. DIESEL SPILL BUCKET FAILED.

REPAIR AND RETEST. SUBMIT DOCUMENTATION IN 30 DAYS

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 09-20-2016

Citation: 23 CCR 16 2712(i) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2712(i)

Violation Description: Failure to have a UST Monitoring Plan available on site.

Violation Notes: Returned to compliance on 09/20/2016. UST RESPONSE PLAN NOT ONSITE.

MAINTAIN APPROVED PLAN ONSITE. CORRECTED ONSITE

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 08-23-2017

Citation: 23 CCR 16 2632(d)(1)(C), 2641(h), 2711(a)(8) - California Code of

Regulations, Title 23, Chapter 16, Section(s) 2632(d)(1)(C), 2641(h),

2711(a)(8)

Violation Description: Failure to submit or update a plot plan.

Violation Notes: Returned to compliance on 08/30/2017. Redo UST site map to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST
Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 10-20-2016

Citation: 23 CCR 16 2638(d) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2638(d)

Violation Description: Failure to submit the Annual Monitoring System Certification Form to

the CUPA within 30 days of completion of the test.

Violation Notes: Returned to compliance on 01/13/2017.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 08-23-2017

Map ID MAP FINDINGS
Direction

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

Citation: HSC 6.7 25299(a)(9) - California Health and Safety Code, Chapter 6.7,

Section(s) 25299(a)(9)

Violation Description: Leak detection equipment disabled or tampered with in a manner that

would prevent the monitoring system from detecting and/or alerting the

owner/operator of a leak.

Violation Notes: Returned to compliance on 08/23/2017. 91 STP sump sensor not at the

lowest point in the sump. Tester corrected at time of inspection.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 10-31-2016

Citation: 23 CCR 16 2637 - California Code of Regulations, Title 23, Chapter 16,

Section(s) 2637

Violation Description: Failure to conduct secondary containment testing, or one or more of

the following requirements: Perform the test within six months of installation and every 36 months thereafter. Use a procedure that demonstrates the system works as well as at installation. Use applicable manufacturer guidelines, industry codes, engineering standard, or professional engineer approval. Performed by a certified

service technician or a licensed tank tester. Returned to compliance on 11/22/2016. Madera County Environmental Health

Violation Program: UST
Violation Source: CERS

Violation Notes:

Violation Division:

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 09-20-2016

Citation: HSC 6.7 25290.1(c)(3), 25290.2(c)(3) - California Health and Safety

Code, Chapter 6.7, Section(s) 25290.1(c)(3), 25290.2(c)(3)

Violation Description: Failure to keep water out of the secondary containment of UST systems

installed on or after July 1, 2003 and before July 1, 2004, or on or

after July 1, 2004.

Violation Notes: Returned to compliance on 09/29/2016. 3 FEET OF WATER IN DIESEL FILL

SUMP. LIQUID SHALL BE PROPERLY DISPOSED OF IN 48 HOURS. PROVIDE PROOF

OF DISPOSAL

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 08-23-2017

Citation: 23 CCR 16 2715(i) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2715(i)

Violation Description: Failure to have a properly qualified service technician test leak

detection equipment as required every 12 months (vapor, pressure, hydrostatic (VPH) system, sensors, line-leak detectors (LLD).

automatic tank gauge (ATG), etc.).

Violation Notes: Returned to compliance on 02/26/2018. All the fill sumps sensors

didn't get tested at time of inspection. Escalate to CLass II

Violations. See enforcement on 2/26/2018.

Violation Division: Madera County Environmental Health

Violation Program: UST

Map ID MAP FINDINGS
Direction

Direction

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 02-26-2018

Citation: 23 CCR 16 2641(j) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(j)

Violation Description: Failure of the leak detection equipment to be installed, calibrated,

operated, and/or maintained properly.

Violation Notes: Returned to compliance on 05/02/2018. Failed to installed fill sumps

liquid sensor. 5/2/2018 - confirmed fill sumps sensors installation

and operation (ken).

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 10-20-2016

Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23,

Chapter 16, Section(s) 2636(f)(2)

Violation Description: Failure of the line leak detector (LLD) monitoring pressurized piping

to meet one or more of the following requirements:Monitor at least hourly.Be capable of detecting a release of 3.0 gallons per hour at 10 p.s.i.g. Restrict or shut off the flow of product through the piping

when a leak is detected.

Violation Notes: Returned to compliance on 11/15/2016. Failure to test LLD. All LLDs

were not tested with a calibrated LLD testing equipment on 9/20/2016.

testing completed 11/15/2016 with calibrated tester.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 08-23-2017

Citation: 23 CCR 16 2641(j) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(j)

Violation Description: Failure of the leak detection equipment to be installed, calibrated,

operated, and/or maintained properly.

Violation Notes: Returned to compliance on 08/23/2017. The west 87 & diesel spill

bucket failed at time of inspection.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 93144

Site Name: ARCO AM/PM #82032

Violation Date: 09-20-2016

Citation: 23 CCR 16 2641(a) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(a)

Violation Description: Failure to maintain secondarily contained piping to allow liquid to

flow into the sump in the event of a leak (i.e., failure to remove

test boot).

Violation Notes: Returned to compliance on 09/20/2016. INSPECTOR OBSERVED SECONDARY

TEST BOOT ON 87, 91, AND DIESEL PIPING SUMP AND VALVE NOT POINTING

DOWNWARD. TEST BOOT REMOVED DURING INSPECTION

Distance

Elevation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-23-2017 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-27-2014

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 05-02-2018

Violations Found: No

Eval Type: Other, not routine, done by local agency
Eval Notes: fill sump sensor installation inspection
Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Other/Unknown
Eval Date: 05-20-2016

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 08-23-2017 Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-21-2015

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA ARCO AM PM (Continued)

S113138352

Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 10-17-2013 Violations Found: No

Routine done by local agency Eval Type:

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: **CERS**

Eval General Type: Other/Unknown 11-03-2016 Eval Date:

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: **CERS**

Eval General Type: Other/Unknown Eval Date: 02-26-2018

Violations Found:

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Madera County Environmental Health **Eval Division:**

Eval Program: UST **Eval Source: CERS**

Eval General Type: Other/Unknown 06-23-2017 Eval Date:

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Madera County Environmental Health Eval Division:

HMRRP Eval Program: Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

08-27-2014 Eval Date:

Violations Found: No

Routine done by local agency Eval Type:

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 09-20-2016

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Madera County Environmental Health Eval Division:

Eval Program: UST **Eval Source: CERS**

Eval General Type: Compliance Evaluation Inspection

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA ARCO AM PM (Continued)

S113138352

Eval Date: 09-06-2013

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: **CERS**

Enforcement Action:

Site ID: 93144

Site Name: ARCO AM/PM #82032 Site Address: 101 N GATEWAY DR

MADERA Site City: Site Zip: 93637 Enf Action Date: 02-26-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 93144

ARCO AM/PM #82032 Site Name: 101 N GATEWAY DR Site Address:

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 05-20-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST **CERS** Enf Action Source:

Site ID: 93144

Site Name: ARCO AM/PM #82032 Site Address: 101 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 06-23-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: **HMRRP** Enf Action Source: **CERS**

Site ID: 93144

ARCO AM/PM #82032 Site Name: Site Address: 101 N GATEWAY DR

Site City: MADERA Site Zip: 93637 Enf Action Date: 08-23-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA ARCO AM PM (Continued)

S113138352

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 93144

ARCO AM/PM #82032 Site Name: Site Address: 101 N GATEWAY DR

Site City: **MADERA** Site Zip: 93637 Enf Action Date: 09-20-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST **CERS** Enf Action Source:

Site ID: 93144

Site Name: ARCO AM/PM #82032 101 N GATEWAY DR Site Address:

Site City: MADERA Site Zip: 93637 Enf Action Date: 11-03-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Coordinates:

Site ID: 93144

ARCO AM/PM #82032 Facility Name:

Env Int Type Code: **HMBP** Program ID: 10426072 Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.961640 -120.060520 Longitude:

Affiliation:

Affiliation Type Desc: **Document Preparer** Entity Name: HARJIT SINGH Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: **Environmental Contact** Entity Name: HARJIT SINGH Entity Title: Not reported Affiliation Address: 101 N GATEWAY Affiliation City: MADERA

Elevation Site

Distance

Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 977-7803

Affiliation Type Desc: Identification Signer HARJIT SINGH Entity Name: Entity Title: **OWNER** Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner

Entity Name: H&H DIAMOND BOSS ENT

Entity Title: Not reported

Affiliation Address: 101 N GATEWAY DRIVE

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 674-0845

Affiliation Type Desc: Operator **Entity Name:** HARJIT SINGH **Entity Title:** Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Not reported Affiliation Country: Affiliation Zip: Not reported Affiliation Phone: (559) 763-4420

Affiliation Type Desc: Property Owner

Entity Name: H &H DIAMOND BOSS ENT

Entity Title: Not reported

Affiliation Address: 101 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 674-0845

Affiliation Type Desc: UST Property Owner Name Entity Name: H & H DIAMOND BOSS ENT

Entity Title: Not reported
Affiliation Address: 101 N GATEWAY

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 674-0845

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address

Distance Elevation

ation Site Database(s) EPA ID Number

MADERA ARCO AM PM (Continued)

S113138352

EDR ID Number

Entity Title: Not reported

Affiliation Address: 101 N GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: ARCO AM/PM #82032

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: UST Tank Owner

Entity Name: H &H DIAMOND BOSS ENT

Entity Title: Not reported
Affiliation Address: 101 N GATEWAY

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 96367
Affiliation Phone: (559) 674-0845

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 675-7823

Affiliation Type Desc: **UST Permit Applicant** HARJIT SNGH Entity Name: Entity Title: **PRESIDENT** Affiliation Address: Not reported Affiliation City: Not reported Not reported Affiliation State: Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 977-7803

Affiliation Type Desc:
UST Tank Operator
Entity Name:
HARJIT SINGH
Entity Title:
Not reported
Affiliation Address:
101 N GATEWAY

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 674-0845

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

J77 **DOWNTOWN SHELL SWEEPS UST** U001589144 SSE **101 N GATEWAY DR HIST UST** N/A

1/8-1/4 MADERA, CA 93637 0.237 mi.

1249 ft. Site 5 of 7 in cluster J

SWEEPS UST: Relative:

Lower Status: Active 100097 Comp Number: Actual: Number: 272 ft.

Board Of Equalization: Not reported Referral Date: 06-30-92 07-22-92 Action Date: Created Date: 02-29-88

Owner Tank Id:

SWRCB Tank Id: 20-000-100097-000995

Tank Status: 10000 Capacity: Active Date: Not reported Tank Use: M.V. FUEL STG:

OTHER Content:

Number Of Tanks: 3

Status: Active Comp Number: 100097 Number:

Board Of Equalization: Not reported 06-30-92 Referral Date: Action Date: 07-22-92 Created Date: 02-29-88 UNKNOWN Owner Tank Id:

SWRCB Tank Id: 20-000-100097-000996

Tank Status: Α Capacity: 8000 Active Date: Not reported M.V. FUEL Tank Use: STG:

Content: OTHER Number Of Tanks: Not reported

Status: Active 100097 Comp Number: Number: 9

Board Of Equalization: Not reported Referral Date: 06-30-92 07-22-92 Action Date: Created Date: 02-29-88

Owner Tank Id:

Number Of Tanks:

20-000-100097-000997 SWRCB Tank Id:

Not reported

Tank Status: 8000 Capacity: Active Date: Not reported Tank Use: M.V. FUEL STG: Content: OTHER

Status: Not reported **CA FID UST**

HIST CORTESE

EMI

Direction Distance

Elevation Site Database(s) EPA ID Number

DOWNTOWN SHELL (Continued)

U001589144

EDR ID Number

Comp Number: 100097

Number: Not reported

Board Of Equalization: Not reported

Referral Date: Not reported

Action Date: Not reported

Created Date: Not reported

Owner Tank Id: Not reported

SWRCB Tank Id: 20-000-100097-000998

Tank Status: Not reported Capacity: 550
Active Date: Not reported Tank Use: OIL STG: WASTE Content: Not reported

Number Of Tanks: 1

HIST UST:

File Number: 00028C28

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028C28.pdf

Region: STATE
Facility ID: 00000018125
Facility Type: Gas Station
Other Type: Not reported
Contact Name: JACK NELSON
Telephone: 2096742131

Owner Name: I.M. MCCULLEY, INC. DBA MCCULL

Owner Address: P.O. BOX 638 Owner City,St,Zip: MADERA, CA 93639

Total Tanks: 0004

Tank Num: 001
Container Num: 1
Year Installed: 1971
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: Not reported

Leak Detection: Stock Inventor, Pressure Test

Tank Num: 002
Container Num: 2
Year Installed: 1971
Tank Capacity: 00008000
Tank Used for: PRODUCT
Type of Fuel: REGULAR
Container Construction Thickness: Not reported

Leak Detection: Stock Inventor, Pressure Test

Tank Num: 003
Container Num: 3
Year Installed: 1971
Tank Capacity: 00008000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: Not reported

Leak Detection: Stock Inventor, Pressure Test

Direction Distance

Elevation Site Database(s) EPA ID Number

DOWNTOWN SHELL (Continued)

U001589144

EDR ID Number

Tank Num: 004 Container Num: 4 Year Installed: 1971 Tank Capacity: 00000550 Tank Used for: WASTE Type of Fuel: WASTE OIL Container Construction Thickness: Not reported Leak Detection: None

Click here for Geo Tracker PDF:

CA FID UST:

Facility ID: 20000074
Regulated By: UTNKA
Regulated ID: 00001812
Cortese Code: Not reported
SIC Code: Not reported
Facility Phone: 2096742131
Mail To: Not reported

Mailing Address: 101 N GATEWAY DR Mailing Address 2: Not reported **MADERA 93639** Mailing City, St, Zip: Contact: Not reported Not reported Contact Phone: Not reported **DUNs Number:** NPDES Number: Not reported EPA ID: Not reported Comments: Not reported Status: Active

Facility ID: 20000074
Regulated By: UTNKA
Regulated ID: 00006178
Cortese Code: Not reported
SIC Code: Not reported
Facility Phone: 2096733101
Mail To: Not reported

Mailing Address: 101 S GATEWAY DR Mailing Address 2: Not reported Mailing City, St, Zip: **MADERA 93637** Contact: Not reported Contact Phone: Not reported **DUNs Number:** Not reported Not reported NPDES Number: EPA ID: Not reported Not reported Comments: Status: Active

EMI:

 Year:
 2008

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 3611

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Direction Distance Elevation

tance EDR ID Number vation Site Database(s) EPA ID Number

DOWNTOWN SHELL (Continued)

U001589144

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 2.385452534717026152

Reactive Organic Gases Tons/Yr:

Carbon Monoxide Emissions Tons/Yr:

0

NOX - Oxides of Nitrogen Tons/Yr:

0

SOX - Oxides of Sulphur Tons/Yr:

0

Particulate Matter Tons/Yr:

0

Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2009

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 3611

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 2.3854525347170199
Reactive Organic Gases Tons/Yr: 2.3725000000000001

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2010

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 3611

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organia Hydrocycles Coses Total Organia Hydrocycles (2008)

Total Organic Hydrocarbon Gases Tons/Yr: 2.3854525347170199
Reactive Organic Gases Tons/Yr: 2.3725000000000001

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2011

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 3611

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 2.3854525347 Reactive Organic Gases Tons/Yr: 2.3725

Carbon Monoxide Emissions Tons/Yr: 2.37

NOX - Oxides of Nitrogen Tons/Yr: 0

Direction
Distance

Elevation Site Database(s) EPA ID Number

DOWNTOWN SHELL (Continued)

SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2012

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 3611

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 2.3854525347 Reactive Organic Gases Tons/Yr: 2.3725 Carbon Monoxide Emissions Tons/Yr: 0

NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2013

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 3611

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 2.3725
Reactive Organic Gases Tons/Yr: 2.3725
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2014

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 3611

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 2.3725 Reactive Organic Gases Tons/Yr: 2.3725 Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 2015 County Code: 20 **EDR ID Number**

U001589144

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DOWNTOWN SHELL (Continued)

U001589144

Air Basin: SJV 3611 Facility ID: Air District Name: SJU SIC Code: 5541

Air District Name: SAN JOAQUIN VALLEY APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 2.3725 Reactive Organic Gases Tons/Yr: 2.3725 Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 2016 County Code: 20 SJV Air Basin: Facility ID: 3611 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 2.3725 Reactive Organic Gases Tons/Yr: 2.3725 Carbon Monoxide Emissions Tons/Yr: Not reported NOX - Oxides of Nitrogen Tons/Yr: Not reported SOX - Oxides of Sulphur Tons/Yr: Not reported Particulate Matter Tons/Yr: Not reported Part. Matter 10 Micrometers and Smllr Tons/Yr:Not reported

HIST CORTESE:

CORTESE Region: Facility County Code: 20 LTNKA Reg By: Reg Id: 5T20000128

J78 ARCO AM/PM #82032 UST U004264543 SSE **101 N GATEWAY DR** N/A

1/8-1/4 MADERA, CA 93637

0.237 mi.

1249 ft. Site 6 of 7 in cluster J

Relative: UST:

Lower Facility ID: FA0101982

Permitting Agency: Madera County Environmental Health Actual:

Latitude: 36.96164 272 ft. Longitude: -120.06052

Direction Distance

Elevation Site Database(s) EPA ID Number

K79 FASTWAY MARKET UST U001589521
North 800 D ST HIST UST N/A

1/8-1/4 MADERA, CA 93638

0.240 mi.

1269 ft. Site 1 of 4 in cluster K

Relative: UST:

 Higher
 Facility ID:
 FA0100187

 Actual:
 Permitting Agency:
 MADERA COUNTY

273 ft. Latitude: 36.99079 Longitude: -120.0241

HIST UST:

File Number:
URL:
Not reported
Region:
STATE
Facility ID:
O000009939
Facility Type:
Gas Station
Other Type:
Not reported

Contact Name: SUNNY NISHIMOTO
Telephone: 2096735896
Owner Name: NISHIMORO CO.
Owner Address: 800 NORTH D ST
Owner City, St, Zip: MADERA, CA 93638

Total Tanks: 0003

Tank Num: 001 Container Num: #3

Year Installed:

Tank Capacity:

Tank Used for:

Type of Fuel:

Container Construction Thickness:

Leak Detection:

Not reported

UNLEADED

Not reported

Stock Inventor

Tank Num: 002 Container Num: #1 1982 Year Installed: Tank Capacity: 00010000 Tank Used for: **PRODUCT REGULAR** Type of Fuel: Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Tank Num: 003 Container Num: #2

Year Installed:

Tank Capacity:

O0010000

Tank Used for:

Type of Fuel:

Container Construction Thickness:

Leak Detection:

Not reported

Not reported

Stock Inventor

EDR ID Number

Direction Distance

Elevation Site Database(s) **EPA ID Number**

K80 **FASTWAY MARKET** UST U004264795 North 800 N D ST

N/A

CERS TANKS

CUPA Listings

CERS

EDR ID Number

1/8-1/4 MADERA, CA 93638

0.240 mi.

1269 ft. Site 2 of 4 in cluster K

UST: Relative:

Higher FA0100187 Facility ID:

Permitting Agency: Madera County Environmental Health Actual:

Latitude: 36.97041 273 ft. Longitude: -120.06355

K81 **FASTWAY MARKET SWEEPS UST** S101621191 **CA FID UST** N/A

North 800 N D ST

1/8-1/4 MADERA, CA 93638

0.240 mi.

1269 ft. Site 3 of 4 in cluster K

Relative: SWEEPS UST:

Higher Status: Active 100187 Comp Number: Actual: Number: 273 ft.

Board Of Equalization: Not reported Referral Date: 06-30-92 07-22-92 Action Date: 02-29-88 Created Date:

Owner Tank Id:

SWRCB Tank Id: 20-000-100187-001209

Tank Status: Capacity: 10000 Not reported Active Date: Tank Use: M.V. FUEL STG:

Content: **OTHER** Number Of Tanks: 3

Active Status: Comp Number:

Number: Not reported Board Of Equalization: Referral Date: 06-30-92 Action Date: 07-22-92

Created Date: 02-29-88 Owner Tank Id:

20-000-100187-001210 SWRCB Tank Id:

100187

Tank Status: 10000 Capacity: Active Date: Not reported M.V. FUEL Tank Use: STG: **OTHER** Content:

Number Of Tanks: Not reported Status: Active 100187 Comp Number:

Board Of Equalization: Not reported Referral Date: 06-30-92 07-22-92 Action Date: Created Date: 02-29-88

Number:

Direction Distance

Elevation Site Database(s) EPA ID Number

FASTWAY MARKET (Continued)

S101621191

EDR ID Number

Owner Tank Id: 2

SWRCB Tank Id: 20-000-100187-001211

Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P

Content: OTHER
Number Of Tanks: Not reported

CA FID UST:

Facility ID: 20000673 UTNKA Regulated By: Regulated ID: 00000993 Cortese Code: Not reported Not reported SIC Code: Facility Phone: 2096735896 Mail To: Not reported 800 N D ST Mailing Address: Mailing Address 2: Not reported Mailing City, St, Zip: **MADERA 93638** Contact: Not reported Contact Phone: Not reported Not reported DUNs Number: Not reported NPDES Number: EPA ID: Not reported Not reported Comments: Status: Active

CERS TANKS:

Site ID: 29802 CERS ID: 10425457

CERS Description: Underground Storage Tank

Violations:

Site ID: 29802

Site Name: FASTWAY MARKET

Violation Date: 05-01-2017

Citation: 23 CCR 16 2632(d)(1)(C), 2641(h), 2711(a)(8) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2632(d)(1)(C), 2641(h),

2711(a)(8)

Violation Description: Failure to submit or update a plot plan.
Violation Notes: Returned to compliance on 05/01/2017.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 29802

Site Name: FASTWAY MARKET

Violation Date: 03-18-2016

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance.

Violation Notes: Returned to compliance on 10/12/2016. Update forms and submit to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST

Direction Distance

Elevation Site Database(s) EPA ID Number

FASTWAY MARKET (Continued)

S101621191

EDR ID Number

Violation Source: CERS

Site ID: 29802

Site Name: FASTWAY MARKET

Violation Date: 03-20-2017

Citation: 23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(h)

Violation Description: Failure to have an approved UST Monitoring Plan.

Violation Notes: Returned to compliance on 05/01/2017. Redo UST monitoring site plan to

CERS

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 29802

Site Name: FASTWAY MARKET

Violation Date: 10-03-2016

Citation: 23 CCR 6.7 25284, 25286 - California Code of Regulations, Title 23,

Chapter 6.7, Section(s) 25284, 25286

Violation Description: Failure to submit a complete and accurate application for a permit to

operate a UST, or for renewal of the permit. Returned to compliance on 10/12/2016.

Violation Notes: Returned to compliance on 10/12/2016
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 29802

Site Name: FASTWAY MARKET

Violation Date: 03-16-2018

Citation: 23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(h)

Violation Description: Failure to have an approved UST Response Plan.

Violation Notes: Submit ust response plan to CERS. Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 29802

Site Name: FASTWAY MARKET

Violation Date: 03-16-2018

Citation: 23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(h)

Violation Description: Failure to have an approved UST Monitoring Plan.

Violation Notes: Update closed BOE number to CERS. Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 29802

Site Name: FASTWAY MARKET

Violation Date: 03-16-2018

Citation: 23 CCR 16 2641(a) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(a)

Violation Description: Failure to maintain secondarily contained piping to allow liquid to

flow into the sump in the event of a leak (i.e., failure to remove

test boot).

Violation Notes: Returned to compliance on 03/21/2018. 91 test boot not pulled back.

Direction Distance

Elevation Site Database(s) EPA ID Number

FASTWAY MARKET (Continued)

S101621191

EDR ID Number

Tester will pulled back and submit correction.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 29802

Site Name: FASTWAY MARKET

Violation Date: 05-01-2017

Citation: 23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(h)

Violation Description: Failure to have an approved UST Monitoring Plan.

Violation Notes: Returned to compliance on 05/01/2017.
Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 29802

Site Name: FASTWAY MARKET

Violation Date: 03-16-2018

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance.

Violation Notes: Update CFO letter to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: CERS

Site ID: 29802

Site Name: FASTWAY MARKET

Violation Date: 03-20-2017

Citation: 23 CCR 6.7 25284, 25286 - California Code of Regulations, Title 23,

Chapter 6.7, Section(s) 25284, 25286

Violation Description: Failure to submit a complete and accurate application for a permit to

operate a UST, or for renewal of the permit.

Violation Notes: Returned to compliance on 05/01/2017. Change the 87 primary

containment tank construction to steel. Madera County Environmental Health

Violation Division: Madera
Violation Program: UST

Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-13-2015

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-07-2014

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FASTWAY MARKET (Continued)

S101621191

Eval Program: UST Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-13-2015

Violations Found: No

Routine done by local agency Eval Type:

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: **HMRRP CERS Eval Source:**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-18-2016 Violations Found:

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **CERS** Eval Source:

Eval General Type: Other/Unknown Eval Date: 10-03-2016

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Compliance Evaluation Inspection Eval General Type:

Eval Date: 03-20-2017 Violations Found:

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Other/Unknown Eval General Type: Eval Date: 05-01-2017

Violations Found:

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-16-2018

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FASTWAY MARKET (Continued)

S101621191

Enforcement Action:

Site ID: 29802

Site Name: **FASTWAY MARKET**

Site Address: 800 N D ST Site City: **MADERA** Site Zip: 93638 Enf Action Date: 03-16-2018

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST **CERS** Enf Action Source:

Site ID: 29802

Site Name: **FASTWAY MARKET**

Site Address: 800 N D ST Site City: **MADERA** Site Zip: 93638 Enf Action Date: 03-18-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Madera County Environmental Health Enf Action Division:

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 29802

Site Name: **FASTWAY MARKET**

Site Address: 800 N D ST Site City: **MADERA** Site Zip: 93638 Enf Action Date: 03-20-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 29802

Site Name: **FASTWAY MARKET**

Site Address: 800 N D ST MADERA Site City: 93638 Site Zip: Enf Action Date: 05-01-2017

Enf Action Type: Notice of Violation (Unified Program)

Notice of Violation Issued by the Inspector at the Time of Inspection Enf Action Description:

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 29802

Site Name: **FASTWAY MARKET**

Site Address: 800 N D ST Site City: **MADERA**

Direction Distance

Elevation Site Database(s) EPA ID Number

FASTWAY MARKET (Continued)

S101621191

EDR ID Number

 Site Zip:
 93638

 Enf Action Date:
 10-03-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: CERS

Coordinates:

Site ID: 29802

Facility Name: FASTWAY MARKET

Env Int Type Code: HMBP
Program ID: 10425457
Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.970410 Longitude: -120.063550

Affiliation:

Affiliation Type Desc:
Entity Name:
Mailing Address
Entity Title:
Not reported
Affiliation Address:
Affiliation City:
MADERA
Affiliation Country:

Facility Mailing Address
Mailing Address
Mot reported

Not reported

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Not reported

Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: FASTWAY MARKET

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Environmental Contact Entity Name: GAYLEN THELANDER

Entity Title: Not reported
Affiliation Address: 800 North D Street

Affiliation City: MADERA
Affiliation State: CA

Distance

Elevation Site Database(s) EPA ID Number

FASTWAY MARKET (Continued)

S101621191

EDR ID Number

Affiliation Country: Not reported
Affiliation Zip: 93638

Affiliation Phone: (559) 706-3590

Affiliation Type Desc: Identification Signer

Entity Name: GAYLEN THELANDER 03/22/2010

Entity Title: GENERAL MANAGER

Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Operator

Entity Name: GAYLEN THELANDER

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (559) 706-3590

Affiliation Type Desc: UST Property Owner Name Entity Name: UST Property Owner Name

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Not reported
748 N D ST
MADERA
CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 674-2922

Affiliation Type Desc:

UST Tank Operator
Entity Name:
OPERATOR
Entity Title:
Not reported
Affiliation Address:
800 North D street

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 673-5896

Affiliation Type Desc: Document Preparer Entity Name: GAYLEN THELANDER

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner

Entity Name: Dorothy Nishimoto DBA Fastway Market

Entity Title: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FASTWAY MARKET (Continued)

S101621191

Affiliation Address: 800 North D Street

Affiliation City: MADERA Affiliation State: CA Affiliation Country: **United States** Affiliation Zip: 93638

Affiliation Phone: (559) 673-5896

Affiliation Type Desc: **UST Permit Applicant** Entity Name: Gaylen Thelander **Entity Title:** Gen Manager Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: (559) 706-3590 Affiliation Phone:

UST Tank Owner Affiliation Type Desc:

Entity Name: **NISHIMOTO COMPANY**

Entity Title: Not reported Affiliation Address: 748 N D ST Affiliation City: MADERA

Affiliation State: CA

United States Affiliation Country: Affiliation Zip: 93638 Affiliation Phone: (559) 674-2922

CUPA MADERA:

Wallace Tadao Nishimoto Contact Name:

MADERA Region: Facility Id: FA0100187 Contact Phone: 5596735896

Detail:

Facility Id: FA0100187

Common Name: Premium Unleaded Gasoline

Current Status:

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165

Decode for c status: Not reported

Facility Id: FA0100187 Common Name: Unleaded Gasoline

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt 2165

PE1:

Decode for c status: Not reported

Facility Id: FA0100187

Common Name: Unleaded Regular Gasoline

Current Status:

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165

Decode for c status: Not reported

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

FASTWAY MARKET (Continued)

S101621191

CERS TANKS:

Site ID: 29802 CERS ID: 10425457

CERS Description: Chemical Storage Facilities

Violations:

Site ID: 29802

Site Name: **FASTWAY MARKET**

Violation Date: 05-01-2017

Citation: 23 CCR 16 2632(d)(1)(C), 2641(h), 2711(a)(8) - California Code of

Regulations, Title 23, Chapter 16, Section(s) 2632(d)(1)(C), 2641(h),

2711(a)(8)

Violation Description: Failure to submit or update a plot plan. Violation Notes: Returned to compliance on 05/01/2017. Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 29802

Site Name: **FASTWAY MARKET**

Violation Date: 03-18-2016

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance.

Violation Notes: Returned to compliance on 10/12/2016. Update forms and submit to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 29802

Site Name: **FASTWAY MARKET**

Violation Date: 03-20-2017

Citation: 23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(h)

Violation Description: Failure to have an approved UST Monitoring Plan.

Returned to compliance on 05/01/2017. Redo UST monitoring site plan to Violation Notes:

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 29802

Site Name: **FASTWAY MARKET**

10-03-2016 Violation Date:

Citation: 23 CCR 6.7 25284, 25286 - California Code of Regulations, Title 23,

Chapter 6.7, Section(s) 25284, 25286

Violation Description: Failure to submit a complete and accurate application for a permit to

> operate a UST, or for renewal of the permit. Returned to compliance on 10/12/2016.

Violation Notes: Violation Division: Madera County Environmental Health Violation Program: UST

CERS Violation Source: Site ID: 29802

FASTWAY MARKET Site Name:

Violation Date: 03-16-2018 Map ID MAP FINDINGS Direction

Distance Elevation Site Database(s)

> **FASTWAY MARKET (Continued)** S101621191

Citation: 23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(h)

Failure to have an approved UST Response Plan. Violation Description:

Submit ust response plan to CERS. Violation Notes: Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

29802 Site ID:

Site Name: **FASTWAY MARKET**

03-16-2018 Violation Date:

23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter Citation:

16, Section(s) 2641(h)

Violation Description: Failure to have an approved UST Monitoring Plan.

Violation Notes: Update closed BOE number to CERS. Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

29802 Site ID:

Site Name: **FASTWAY MARKET**

Violation Date: 03-16-2018

23 CCR 16 2641(a) - California Code of Regulations, Title 23, Chapter Citation:

16, Section(s) 2641(a)

Violation Description: Failure to maintain secondarily contained piping to allow liquid to

flow into the sump in the event of a leak (i.e., failure to remove

Violation Notes: Returned to compliance on 03/21/2018. 91 test boot not pulled back.

Tester will pulled back and submit correction.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 29802

FASTWAY MARKET Site Name:

Violation Date: 05-01-2017

Citation: 23 CCR 16 2641(h) - California Code of Regulations, Title 23, Chapter

16, Section(s) 2641(h)

Violation Description: Failure to have an approved UST Monitoring Plan.

Violation Notes: Returned to compliance on 05/01/2017. Madera County Environmental Health Violation Division:

Violation Program: UST Violation Source: **CERS**

Site ID: 29802

Site Name: **FASTWAY MARKET**

Violation Date: 03-16-2018

Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code,

Chapter 6.75, Section(s) 25299.30-25299.34

Violation Description: Failure to submit and maintain complete and current Certification of

Financial Responsibility or other mechanism of financial assurance.

Violation Notes: Update CFO letter to CERS.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Site ID: 29802 **EDR ID Number**

EPA ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FASTWAY MARKET (Continued)

S101621191

Site Name: **FASTWAY MARKET**

Violation Date: 03-20-2017

23 CCR 6.7 25284, 25286 - California Code of Regulations, Title 23, Citation:

Chapter 6.7, Section(s) 25284, 25286

Violation Description: Failure to submit a complete and accurate application for a permit to

operate a UST, or for renewal of the permit.

Returned to compliance on 05/01/2017. Change the 87 primary Violation Notes:

containment tank construction to steel.

Violation Division: Madera County Environmental Health

Violation Program: UST Violation Source: **CERS**

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-13-2015

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-07-2014

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-13-2015

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Not reported

Madera County Environmental Health **Eval Division:**

Eval Program: **HMRRP CERS Eval Source:**

Eval General Type: Compliance Evaluation Inspection

Eval Date: 03-18-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **CERS** Eval Source:

Eval General Type: Other/Unknown Eval Date: 10-03-2016 Violations Found: Yes

Other, not routine, done by local agency Eval Type:

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FASTWAY MARKET (Continued)

S101621191

Eval General Type: Compliance Evaluation Inspection

03-20-2017 Eval Date: Violations Found: Yes

Routine done by local agency Eval Type:

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

UST Eval Program: **CERS Eval Source:**

Eval General Type: Other/Unknown 05-01-2017 Eval Date: Yes

Violations Found:

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST Eval Source: **CERS**

Eval General Type: Compliance Evaluation Inspection

03-16-2018 Eval Date:

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: UST **Eval Source: CERS**

Enforcement Action:

Site ID: 29802

FASTWAY MARKET Site Name:

Site Address: 800 N D ST Site City: **MADERA** Site Zip: 93638 Enf Action Date: 03-16-2018

Notice of Violation (Unified Program) Enf Action Type:

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: **CERS**

Site ID: 29802

Site Name: **FASTWAY MARKET**

Site Address: 800 N D ST Site City: **MADERA** Site Zip: 93638 Enf Action Date: 03-18-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST **CERS** Enf Action Source:

Site ID: 29802

Site Name: **FASTWAY MARKET**

800 N D ST Site Address:

Direction Distance

Elevation Site Database(s) EPA ID Number

FASTWAY MARKET (Continued)

S101621191

EDR ID Number

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 03-20-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: CERS

Site ID: 29802

Site Name: FASTWAY MARKET

 Site Address:
 800 N D ST

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 05-01-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: CERS

Site ID: 29802

Site Name: FASTWAY MARKET

 Site Address:
 800 N D ST

 Site City:
 MADERA

 Site Zip:
 93638

 Enf Action Date:
 10-03-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: UST Enf Action Source: CERS

Coordinates:

Site ID: 29802

Facility Name: FASTWAY MARKET

Env Int Type Code: HMBP
Program ID: 10425457
Coord Name: Not reported

Ref Point Type Desc: Center of a facility or station.

Latitude: 36.970410 Longitude: -120.063550

Affiliation:

Affiliation Type Desc: Facility Mailing Address

Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 800 N D ST
Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported

Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: Not reported

Distance

Elevation Site Database(s) EPA ID Number

FASTWAY MARKET (Continued)

S101621191

EDR ID Number

Affiliation Type Desc: Parent Corporation
Entity Name: FASTWAY MARKET

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: Not reported

Affiliation Country: Not reported Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Environmental Contact Entity Name: GAYLEN THELANDER

Entity Title: Not reported
Affiliation Address: 800 North D Street

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93638
Affiliation Phone: (559) 706-3590

Affiliation Type Desc: Identification Signer

Entity Name: GAYLEN THELANDER 03/22/2010

Entity Title: GENERAL MANAGER

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation Country:

Affiliation Zip:

Affiliation Phone:

Not reported

Not reported

Not reported

Affiliation Type Desc: Operator

Entity Name: GAYLEN THELANDER

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (559) 706-3590

Affiliation Type Desc: UST Property Owner Name Entity Name: NISHIMOTO COMPANY

Entity Title: Not reported
Affiliation Address: 748 N D ST
Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States

Distance

Elevation Site Database(s) EPA ID Number

FASTWAY MARKET (Continued)

S101621191

EDR ID Number

Affiliation Zip: 93638

Affiliation Phone: (559) 674-2922

Affiliation Type Desc:

UST Tank Operator
Entity Name:
OPERATOR
Entity Title:
Not reported
Affiliation Address:
800 North D street

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 673-5896

Affiliation Type Desc: Document Preparer
Entity Name: GAYLEN THELANDER

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner

Entity Name: Dorothy Nishimoto DBA Fastway Market

Entity Title: Not reported
Affiliation Address: 800 North D Street

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93638

Affiliation Phone: (559) 673-5896

Affiliation Type Desc: **UST Permit Applicant** Entity Name: Gaylen Thelander Entity Title: Gen Manager Affiliation Address: Not reported Affiliation City: Not reported Not reported Affiliation State: Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 706-3590

Affiliation Type Desc: UST Tank Owner
Entity Name: NISHIMOTO COMPANY

Entity Title: Not reported
Affiliation Address: 748 N D ST
Affiliation City: MADERA

Affiliation State: CA

Affiliation State: CA
Affiliation Country: Unit

Affiliation Country: United States
Affiliation Zip: 93638
Affiliation Phone: (559) 674-2922

Direction Distance

Elevation Site Database(s) EPA ID Number

K82 FASTWAY MARKET HIST UST S103989843
North 800 NORTH D ST EMI N/A

1/8-1/4 MADERA, CA 93638

0.240 mi.

1269 ft. Site 4 of 4 in cluster K

Relative: HIST UST:
Higher File Number: 00028EA7

Actual: URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028EA7.pdf

273 ft. Region: Not reported Facility ID: Not reported

Facility Type: Not reported Other Type: Not reported Not reported Contact Name: Telephone: Not reported Owner Name: Not reported Owner Address: Not reported Owner City, St, Zip: Not reported Total Tanks: Not reported

Tank Num: Not reported Container Num: Not reported Year Installed: Not reported Tank Capacity: Not reported Not reported Tank Used for: Type of Fuel: Not reported Container Construction Thickness: Not reported Leak Detection: Not reported

Click here for Geo Tracker PDF:

EMI:

 Year:
 2006

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1741

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: .2964497467271948193 Reactive Organic Gases Tons/Yr: .29488171588134846

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2007

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1741

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: .3262675014280992250

EDR ID Number

Direction Distance Elevation

ance EDR ID Number vation Site Database(s) EPA ID Number

FASTWAY MARKET (Continued)

S103989843

Reactive Organic Gases Tons/Yr: .32454175360107452

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2008

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1741

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: .2997788765727751258 Reactive Organic Gases Tons/Yr: .29815113665771512

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2009

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1741

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 0.29977887657277502 Reactive Organic Gases Tons/Yr: 0.29815113665771498

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2010

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1741

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 0.29978392860870501

Reactive Organic Gases Tons/Yr: 0.29815617

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Direction Distance

Elevation Site Database(s) EPA ID Number

FASTWAY MARKET (Continued)

S103989843

EDR ID Number

 Year:
 2011

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1741

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.21340401934 Reactive Organic Gases Tons/Yr: 0.21224527779

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2012

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1741

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.19124506678
Reactive Organic Gases Tons/Yr: 0.19020664395

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 2013

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1741

 Air District Name:
 SJU

 SIC Code:
 5541

Air District Name: SAN JOAQUIN VALLEY UNIFIED APCD Community Health Air Pollution Info System: Not reported

Consolidated Emission Reporting Rule:

Total Organic Hydrocarbon Gases Tons/Yr:

Reactive Organic Gases Tons/Yr:

Carbon Monoxide Emissions Tons/Yr:

NOX - Oxides of Nitrogen Tons/Yr:

SOX - Oxides of Sulphur Tons/Yr:

Particulate Matter Tons/Yr:

Not reported
0.19432
0.19432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0.09432
0

 Year:
 2014

 County Code:
 20

 Air Basin:
 SJV

 Facility ID:
 1741

Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Air District Name: SJU SIC Code: 5541

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FASTWAY MARKET (Continued)

S103989843

Air District Name: SAN JOAQUIN VALLEY APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.19089324117 Reactive Organic Gases Tons/Yr: 0.19089324117

Carbon Monoxide Emissions Tons/Yr: NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2015 Year: County Code: 20 Air Basin: SJV Facility ID: 1741 Air District Name: SJU SIC Code: 5541

Air District Name: SAN JOAQUIN VALLEY APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.19093 Reactive Organic Gases Tons/Yr: 0.19093 Carbon Monoxide Emissions Tons/Yr: 0 NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0

Particulate Matter Tons/Yr: Λ Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 2016 County Code: 20 SJV Air Basin: Facility ID: 1741 Air District Name: SJU SIC Code: 5541

SAN JOAQUIN VALLEY APCD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported Total Organic Hydrocarbon Gases Tons/Yr: 0.20377 Reactive Organic Gases Tons/Yr: 0.20377 Carbon Monoxide Emissions Tons/Yr: Not reported NOX - Oxides of Nitrogen Tons/Yr: Not reported SOX - Oxides of Sulphur Tons/Yr: Not reported Particulate Matter Tons/Yr: Not reported Part. Matter 10 Micrometers and Smllr Tons/Yr:Not reported

S101298580 J83 **CHEVRON #90318** LUST

HIST CORTESE SSE 2 YOSEMITE W N/A 1/4-1/2 MADERA, CA 93637 **CERS**

0.267 mi.

1412 ft. Site 7 of 7 in cluster J

LUST: Relative:

Lower Lead Agency: MADERA COUNTY Case Type: LUST Cleanup Site Actual:

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900145 272 ft.

T0603900145 Global Id: Latitude: 36.9613308 Longitude: -120.0603589

Direction Distance

Elevation Site Database(s) EPA ID Number

CHEVRON #90318 (Continued)

S101298580

EDR ID Number

Status: Completed - Case Closed

Status Date: 09/28/1998
Case Worker: ADR
RB Case Number: 5T20000148
Local Agency: MADERA COUNTY
File Location: Not reported
Local Case Number: Not reported

Potential Media Affect: Aquifer used for drinking water supply

Potential Contaminants of Concern: Gasoline Site History: Not reported

LUST:

Global Id: T0603900145

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900145

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603900145

 Action Type:
 Other

 Date:
 03/05/1991

 Action:
 Leak Reported

 Global Id:
 T0603900145

 Action Type:
 Other

 Date:
 12/11/1989

 Action:
 Leak Discovery

LUST:

Global Id: T0603900145

Status: Completed - Case Closed

Status Date: 09/28/1998

Global Id: T0603900145

Status: Open - Case Begin Date

Status Date: 12/11/1989

Global Id: T0603900145

Status: Open - Site Assessment

Status Date: 12/11/1989

Global Id: T0603900145

Status: Open - Site Assessment

Status Date: 03/05/1991

Direction Distance

Elevation Site Database(s) EPA ID Number

CHEVRON #90318 (Continued)

S101298580

EDR ID Number

Lead Agency: MADERA COUNTY
Case Type: LUST Cleanup Site

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900005

Global Id: T0603900005
Latitude: 36.9613308
Longitude: -120.0603589

Status: Completed - Case Closed

Status Date: 11/03/1998
Case Worker: ADR
RB Case Number: 5T20000005
Local Agency: MADERA COUNTY
File Location: Not reported
Local Case Number: 0026630

Potential Media Affect: Aquifer used for drinking water supply

Potential Contaminants of Concern: Gasoline Site History: Not reported

LUST:

Global Id: T0603900005

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900005

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603900005

 Action Type:
 Other

 Date:
 06/18/1986

 Action:
 Leak Reported

 Global Id:
 T0603900005

 Action Type:
 ENFORCEMENT

 Date:
 05/10/1999

Action: Closure/No Further Action Letter

 Global Id:
 T0603900005

 Action Type:
 Other

 Date:
 06/12/1986

 Action:
 Leak Discovery

LUST:

Global Id: T0603900005

Status: Completed - Case Closed

Status Date: 11/03/1998

Direction Distance

Elevation Site Database(s) EPA ID Number

CHEVRON #90318 (Continued)

S101298580

EDR ID Number

Global Id: T0603900005

Status: Open - Case Begin Date

Status Date: 06/12/1986

Global Id: T0603900005

Status: Open - Site Assessment

Status Date: 09/30/1987

LUST REG 5:

Region: 5

Status: Case Closed Case Number: 5T20000005

Case Type: Drinking Water Aquifer affected

Substance: REGULR GASOLINE

Staff Initials: JWH
Lead Agency: Local
Program: LUST
MTBE Code: 1

Region: 5

Status: Case Closed Case Number: 5T20000148

Case Type: Drinking Water Aquifer affected

Substance: GASOLINE
Staff Initials: JWH
Lead Agency: Local
Program: LUST
MTBE Code: 1

HIST CORTESE:

Region: CORTESE
Facility County Code: 20
Reg By: LTNKA
Reg Id: 5T20000005

Region: CORTESE
Facility County Code: 20
Reg By: LTNKA
Reg Id: 5T20000148

CERS TANKS:

 Site ID:
 222854

 CERS ID:
 T0603900005

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CHEVRON #90318 (Continued)

S101298580

Affiliation Type Desc: Regional Board Caseworker

JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F) **Entity Name:**

Entity Title: Not reported Affiliation Address: 1685 È STREET **FRESNO** Affiliation City: Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Site ID: 222854 CERS ID: T0603900145

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Regional Board Caseworker Affiliation Type Desc:

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported 1685 É STREET Affiliation Address: Affiliation City: **FRESNO** Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Not reported Affiliation Phone:

MADERA REDEVELOPMENT AGENCY PROPERTY LUST S105174064 **CERS** N/A

ESE C STREET @ YOSEMITE 1/4-1/2 MADERA, CA 93638

0.277 mi.

L84

1461 ft. Site 1 of 2 in cluster L

LUST REG 5: Relative: Higher Region:

Status: Case Closed Actual: 5T20000217 Case Number: 274 ft.

Case Type: Soil only Substance: WASTE OIL Staff Initials: JWH Lead Agency: Local Program: LUST MTBE Code: N/A

CERS TANKS:

233690 Site ID: CERS ID: T0603991985

Leaking Underground Storage Tank Cleanup Site **CERS** Description:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA REDEVELOPMENT AGENCY PROPERTY (Continued)

S105174064

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported Affiliation Address: 1685 E STREET **FRESNO** Affiliation City: Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

MADERA REDEVELOPMENT AGENCY PROPERTY L85

LUST S110654554

http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603991985

N/A

ESE C STREET @ YOSEMITE 1/4-1/2 MADERA, CA 93638

0.277 mi.

274 ft.

1461 ft. Site 2 of 2 in cluster L

Geo Track:

LUST: Relative:

Higher Lead Agency: MADERA COUNTY Case Type: **LUST Cleanup Site** Actual:

> Global Id: T0603991985

36.9633 Latitude: -120.0574 Longitude:

Status: Completed - Case Closed

08/30/2001 Status Date: Case Worker: ADR RB Case Number: 5T20000217 Local Agency: MADERA COUNTY File Location: Not reported Local Case Number: Not reported

Potential Media Affect: Soil

Potential Contaminants of Concern: Waste Oil / Motor / Hydraulic / Lubricating

Site History: Not reported

LUST:

T0603991985 Global Id:

Local Agency Caseworker Contact Type:

Contact Name: ANN ROLAN Organization Name: MADERA COUNTY Address: 2037 WEST CLEVELAND

City: **MADERA**

Email: arolan@madera-county.com

Phone Number: Not reported

T0603991985 Global Id:

Contact Type: Regional Board Caseworker

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA REDEVELOPMENT AGENCY PROPERTY (Continued)

S110654554

EDR ID Number

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603991985

 Action Type:
 Other

 Date:
 08/30/2001

 Action:
 Leak Reported

 Global Id:
 T0603991985

 Action Type:
 Other

 Date:
 08/01/2001

 Action:
 Leak Discovery

LUST:

Global Id: T0603991985

Status: Completed - Case Closed

Status Date: 08/30/2001

Global Id: T0603991985

Status: Open - Case Begin Date

Status Date: 08/01/2001

MR GAS - MADERA LUST S105181369

ESE 401 YOSEMITE AVE E 1/4-1/2 MADERA, CA 93638

0.318 mi. 1681 ft.

86

Relative: LUST:

 Higher
 Lead Agency:
 MADERA COUNTY

 Actual:
 Case Type:
 LUST Cleanup Site

 275 ft.
 Geo Track:
 http://geotracker.wat

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603991892

 Global Id:
 T0603991892

 Latitude:
 36.964199

 Longitude:
 -120.056376

Status: Completed - Case Closed

Status Date: 03/17/2010
Case Worker: ADR
RB Case Number: 5T20000214
Local Agency: MADERA COUNTY
File Location: Local Agency
Local Case Number: 0005738

Potential Media Affect: Under Investigation

Potential Contaminants of Concern: Gasoline Site History: Not reported

LUST:

Global Id: T0603991892

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY

CERS

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MR GAS - MADERA (Continued)

S105181369

Address: 2037 WEST CLEVELAND

City: MADERA

arolan@madera-county.com Email:

Phone Number: Not reported

Global Id: T0603991892

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET **FRESNO** City:

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

Global Id: T0603991892 Action Type: Other Date: 09/27/2001 Action: Leak Reported

T0603991892 Global Id: Action Type: **ENFORCEMENT** Date: 07/03/2008

Action: Technical Correspondence / Assistance / Other

Global Id: T0603991892 **ENFORCEMENT** Action Type: Date: 08/23/2007

Action: Technical Correspondence / Assistance / Other

Global Id: T0603991892 Action Type: **ENFORCEMENT** Date: 02/24/2010

Closure/No Further Action Letter Action:

Global Id: T0603991892 Action Type: Other 02/28/2001 Date: Action: Leak Discovery

Global Id: T0603991892 Action Type: Other Date: 02/28/2001 Action: Leak Stopped

LUST:

T0603991892 Global Id:

Status: Completed - Case Closed

Status Date: 02/24/2010

Global Id: T0603991892

Completed - Case Closed Status:

Status Date: 03/17/2010

Global Id: T0603991892

Status: Open - Assessment & Interim Remedial Action

Direction Distance

Elevation Site Database(s) EPA ID Number

MR GAS - MADERA (Continued)

S105181369

EDR ID Number

Status Date: 09/27/2001

Global Id: T0603991892

Status: Open - Assessment & Interim Remedial Action

Status Date: 02/26/2009

Global Id: T0603991892

Status: Open - Case Begin Date

Status Date: 02/28/2001

LUST REG 5:

Region: 5

Status: No Action Case Number: 5T20000214 Undefined Case Type: Substance: **GASOLINE** Staff Initials: JWH Lead Agency: Local LUST Program: MTBE Code: N/A

CERS TANKS:

 Site ID:
 220424

 CERS ID:
 T0603991892

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported
Affiliation Address: 1685 E STREET
Affiliation City: FRESNO
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

M87 FORMER SIX STAR SHELL LUST S121475785
SSE 125 GATEWAY DRIVE SOUTH LUST S121475785

1/4-1/2 MADERA, CA 93637

0.319 mi.

1685 ft. Site 1 of 3 in cluster M

Relative: LUST:

Higher Lead Agency: CENTRAL VALLEY RWQCB (REGION 5F)

Actual: Case Type: LUST Cleanup Site

273 ft. Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T10000011236

Global Id: T10000011236 Latitude: 36.96069 Longitude: -120.05951

Status: Open - Site Assessment

Status Date: 01/16/2018
Case Worker: MLE
RB Case Number: 5T20000232
Local Agency: Not reported
File Location: Not reported
Local Case Number: Not reported

Potential Media Affect: Aquifer used for drinking water supply, Indoor Air, Soil, Soil Vapor

Potential Contaminants of Concern: Benzene, Diesel, Ethylbenzene, Gasoline, MTBE / TBA / Other Fuel Oxygenates, Naphthalene, Tolu

Site History: Not reported

LUST:

Global Id: T10000011236

Contact Type: Regional Board Caseworker
Contact Name: MICHEALE EASLEY

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E Street City: FRESNO

Email: micheale.easley@waterboards.ca.gov

Phone Number: 5594884391

LUST:

 Global Id:
 T10000011236

 Action Type:
 Other

 Date:
 12/01/2017

 Action:
 Leak Stopped

 Global Id:
 T10000011236

 Action Type:
 Other

 Date:
 01/11/2018

 Action:
 Leak Reported

 Global Id:
 T10000011236

 Action Type:
 RESPONSE

 Date:
 08/27/2018

Action: Other Report / Document

 Global Id:
 T10000011236

 Action Type:
 RESPONSE

 Date:
 03/20/2018

Action: Proposed Plan - Regulator Responded

 Global Id:
 T10000011236

 Action Type:
 ENFORCEMENT

 Date:
 01/11/2018

 Action:
 Other Report

EDR ID Number

CERS

Direction Distance

Elevation Site Database(s) EPA ID Number

FORMER SIX STAR SHELL (Continued)

S121475785

EDR ID Number

 Global Id:
 T10000011236

 Action Type:
 ENFORCEMENT

 Date:
 01/17/2018

 Action:
 Staff Letter

 Global Id:
 T10000011236

 Action Type:
 ENFORCEMENT

 Date:
 10/15/2018

 Action:
 Staff Letter

 Global Id:
 T10000011236

 Action Type:
 ENFORCEMENT

 Date:
 06/27/2018

 Action:
 Staff Letter

 Global Id:
 T10000011236

 Action Type:
 Other

 Date:
 12/01/2017

 Action:
 Leak Began

Global Id: T10000011236
Action Type: RESPONSE
Date: 12/17/2018

Action: Other Report / Document

 Global Id:
 T10000011236

 Action Type:
 Other

 Date:
 12/01/2017

 Action:
 Leak Discovery

LUST:

Global Id: T10000011236

Status: Open - Case Begin Date

Status Date: 12/01/2017

Global Id: T10000011236

Status: Open - Site Assessment

Status Date: 01/16/2018

HAZNET:

Facility Name: SIX STAR SHELL envid: S121475785

Year: 2017

GEPAID: CAC002938424
Contact: NADEEM AHMED
Telephone: 5597060786
Mailing Name: Not reported

Mailing Address: 1501 E. YOSEMITE AVE Mailing City,St,Zip: MADERA, CA 93638

Gen County: Madera
TSD EPA ID: CAD008364432
TSD County: Los Angeles

Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Fuel Blending Prior To Energy Recovery At Another Site

Tons: 2.25

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FORMER SIX STAR SHELL (Continued)

S121475785

Cat Decode: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.) Fuel Blending Prior To Energy Recovery At Another Site Method Decode:

Facility County: Madera

CERS TANKS:

Site ID: 432498 CERS ID: T10000011236

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

MICHEALE EASLEY - CENTRAL VALLEY RWQCB (REGION 5F) Entity Name:

Entity Title: Not reported Affiliation Address: 1685 E Street **FRESNO** Affiliation City: Affiliation State: CA Affiliation Country: Not reported

Affiliation Zip: Not reported Affiliation Phone: 5594884391

S105033423 **M88** HATFIELDS SERVICE LUST 125 GATEWAY S SSE **CERS** N/A

1/4-1/2 MADERA, CA 93637

0.324 mi.

1711 ft. Site 2 of 3 in cluster M

Relative: LUST:

Higher MADERA COUNTY Lead Agency: Case Type: LUST Cleanup Site Actual:

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900097 273 ft.

T0603900097 Global Id: Latitude: 36.960585 -120.059558 Longitude:

Status: Completed - Case Closed

Status Date: 05/18/1997 Case Worker: **ADR** 5T20000097 RB Case Number: MADERA COUNTY Local Agency: File Location: Not reported Local Case Number: Not reported Potential Media Affect: Soil Gasoline Potential Contaminants of Concern: Site History: Not reported

LUST:

Global Id: T0603900097

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN Organization Name: MADERA COUNTY Address: 2037 WEST CLEVELAND

City: **MADERA**

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900097

Contact Type: Regional Board Caseworker

JEFFREY HANNEL Contact Name:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HATFIELDS SERVICE (Continued)

S105033423

CENTRAL VALLEY RWQCB (REGION 5F) Organization Name:

1685 E STREET Address: City: **FRESNO**

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

Global Id: T0603900097 Action Type: Other 03/04/1991 Date: Action: Leak Reported

Global Id: T0603900097 **ENFORCEMENT** Action Type: Date: 07/21/2010

Closure/No Further Action Letter Action:

Global Id: T0603900097 Action Type: Other 03/13/1990 Date: Leak Discovery Action:

LUST:

T0603900097 Global Id:

Status: Completed - Case Closed

05/18/1997 Status Date:

T0603900097 Global Id:

Open - Case Begin Date Status:

Status Date: 03/13/1990

LUST REG 5:

Region:

Case Closed Status: 5T20000097 Case Number: Case Type: Soil only **GASOLINE** Substance: Staff Initials: JWH Lead Agency: Local Program: LUST MTBE Code: N/A

CERS TANKS:

Site ID: 233898 CERS ID: T0603900097

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F) Entity Name:

Entity Title: Not reported 1685 É STREET Affiliation Address: Affiliation City: **FRESNO** Affiliation State: CA

Not reported Affiliation Country:

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

HATFIELDS SERVICE (Continued)

S105033423

U001589206

N/A

SWEEPS UST

CUPA Listings HIST CORTESE

HIST UST

Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

M89 HATFIELDS MOBIL SERVICE SSE 125 SOUTH GATEWAY DRIVE 1/4-1/2 MADERA, CA 93637

1/4-1/2 MAI 0.324 mi.

1712 ft. Site 3 of 3 in cluster M

Relative: SWEEPS UST:

HigherStatus:ActiveActual:Comp Number:100192273 ft.Number:9

Board Of Equalization: Not reported Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88

Owner Tank Id: 1

SWRCB Tank ld: 20-000-100192-001224

Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: 3

Status: Active Comp Number: 100192 Number: 9

Board Of Equalization: Not reported Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88

Owner Tank Id: 2

SWRCB Tank ld: 20-000-100192-001225

Not reported

Tank Status: A
Capacity: 8000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER

Status: Active Comp Number: 100192 Number: 9

Number Of Tanks:

Direction Distance

Elevation Site Database(s) EPA ID Number

HATFIELDS MOBIL SERVICE (Continued)

U001589206

EDR ID Number

Board Of Equalization: Not reported Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88 Owner Tank Id: 3

SWRCB Tank Id: 20-000-100192-001226

Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: Not reported

Status: Not reported Comp Number: 100192 Number: Not reported Board Of Equalization: Not reported Referral Date: Not reported Not reported Action Date: Created Date: Not reported Not reported Owner Tank Id:

SWRCB Tank ld: 20-000-100192-002256

Tank Status: Not reported Capacity: 500
Active Date: Not reported

Tank Use: OIL
STG: WASTE
Content: Not reported

Number Of Tanks: 1

HIST UST:

File Number: 00028C09

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028C09.pdf

Region: STATE
Facility ID: 00000012638
Facility Type: Gas Station
Other Type: Not reported

Contact Name: GEORGE HATFIELD

Telephone: 2096744771

Owner Name: HATFIELDS MOBIL SERVICE
Owner Address: 125 SOUTH GATEWAY DRIVE

Owner City,St,Zip: MADERA, CA 93637

Total Tanks: 0004

 Tank Num:
 001

 Container Num:
 1

 Year Installed:
 1969

 Tank Capacity:
 00010000

 Tank Used for:
 PRODUCT

 Type of Fuel:
 UNLEADED

 Container Construction Thickness:
 Not reported

Leak Detection: Visual, Stock Inventor

Tank Num: 002
Container Num: 2
Year Installed: 1975

Direction Distance

Elevation Site Database(s) EPA ID Number

HATFIELDS MOBIL SERVICE (Continued)

U001589206

EDR ID Number

Tank Capacity: 00008000
Tank Used for: PRODUCT
Type of Fuel: REGULAR
Container Construction Thickness: Not reported

Leak Detection: Visual, Stock Inventor

Tank Num: 003

Container Num: 3

Year Installed: 1969

Tank Capacity: 00000000

Tank Used for: PRODUCT

Type of Fuel: UNLEADED

Container Construction Thickness: Not reported

Leak Detection: Visual, Stock Inventor

Tank Num: 004
Container Num: 1
Year Installed: 1971
Tank Capacity: 00000500
Tank Used for: WASTE
Type of Fuel: WASTE OIL
Container Construction Thickness: Not reported
Leak Detection: None

Click here for Geo Tracker PDF:

CUPA MADERA:

Contact Name: AHMAD, TANVER
Region: MADERA
Facility Id: FA0100192
Contact Phone: 5596737600

Detail:

Facility Id: FA0100192

Common Name: Super Unleaded Gasoline

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165
Decode for c status: Not reported

Facility Id: FA0100192
Common Name: Unleaded Gasoline

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165

Decode for c status: Not reported

Facility Id: FA0100192

Common Name: Unleaded Plus Gasoline

Current Status: 01

Program/Elements: Haz Mat Inventory - Exempt

PE1: 2165
Decode for c status: Not reported

HIST CORTESE:

Region: CORTESE

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

HATFIELDS MOBIL SERVICE (Continued)

U001589206

Facility County Code: 20
Reg By: LTNKA
Reg Id: 5T20000097

90 DON ROBERTS JEWELERS LUST \$104404480

South 317 YOSEMITE E HIST CORTESE N/A

1/4-1/2 MADERA, CA 93637 CERS

0.355 mi. 1877 ft.

Relative: LUST:

 Lower
 Lead Agency:
 MADERA COUNTY

 Actual:
 Case Type:
 LUST Cleanup Site

267 ft. Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900135

Global Id: T0603900135
Latitude: 36.963856
Longitude: -120.057239

Status: Completed - Case Closed

Status Date: 06/24/1994
Case Worker: ADR
RB Case Number: 5T20000138
Local Agency: MADERA COUNTY
File Location: Not reported
Local Case Number: Not reported
Potential Media Affect: Soil

Potential Contaminants of Concern: Stoddard solvent / Mineral Spriits / Distillates

Site History: Not reported

LUST:

Global Id: T0603900135

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900135

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603900135

 Action Type:
 Other

 Date:
 01/24/1994

 Action:
 Leak Reported

 Global Id:
 T0603900135

 Action Type:
 ENFORCEMENT

 Date:
 07/21/2010

Action: Closure/No Further Action Letter

Direction Distance

Elevation Site Database(s) EPA ID Number

DON ROBERTS JEWELERS (Continued)

S104404480

EDR ID Number

 Global Id:
 T0603900135

 Action Type:
 Other

 Date:
 11/18/1993

 Action:
 Leak Discovery

LUST:

Global Id: T0603900135

Status: Completed - Case Closed

Status Date: 06/24/1994

Global Id: T0603900135

Status: Open - Case Begin Date

Status Date: 11/18/1993

Global Id: T0603900135

Status: Open - Site Assessment

Status Date: 01/24/1994

LUST REG 5:

Region: 5

Status: Case Closed
Case Number: 5T20000138
Case Type: Soil only

Substance: MINERAL SPIRITS

Staff Initials: JWH
Lead Agency: Local
Program: LUST
MTBE Code: N/A

HIST CORTESE:

Region: CORTESE
Facility County Code: 20
Reg By: LTNKA
Reg Id: 5T20000138

CERS TANKS:

 Site ID:
 255928

 CERS ID:
 T0603900135

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title:

Affiliation Address:

Affiliation City:

Affiliation State:

Affiliation Country:

Affiliation

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Direction Distance

Elevation Site Database(s) EPA ID Number

DON ROBERTS JEWELERS (Continued)

S104404480

EDR ID Number

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported

Affiliation Zip: Not reported
Affiliation Phone: Not reported

N91 PEARTS AUTO SUPPLY RCRA-SQG 1000370321

SE 212 E 6TH ST LUST CAD981684301 1/4-1/2 MADERA, CA 93638 SWEEPS UST

0.370 mi. HIST UST 1951 ft. Site 1 of 3 in cluster N CA FID UST

Relative: FINDS ECHO
Higher HIST CORTESE

Actual: CERS CERS

RCRA-SQG:

Date form received by agency: 09/01/1996

Facility name: PEARTS AUTO SUPPLY

Facility address: 212 E 6TH ST

MADERA, CA 93638

EPA ID: CAD981684301
Contact: Not reported
Contact address: Not reported

Not reported

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 09

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous

waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of

hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: NOT REQUIRED Owner/operator address: NOT REQUIRED

NOT REQUIRED, ME 99999

Owner/operator country: Not reported Owner/operator telephone: 415-555-1212 Owner/operator email: Not reported Owner/operator fax: Not reported Owner/operator extension: Not reported Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

Owner/operator name: E E PEART
Owner/operator address: NOT REQUIRED

NOT REQUIRED, ME 99999

Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

PEARTS AUTO SUPPLY (Continued)

1000370321

EDR ID Number

Owner/operator fax:
Owner/operator extension:
Legal status:
Owner/Operator Type:
Owner/Op start date:
Owner/Op end date:
Not reported
Not reported
Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: Nο Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 10/20/1986

Site name: PEARTS AUTO SUPPLY
Classification: Large Quantity Generator

Violation Status: No violations found

LUST:

Lead Agency: MADERA COUNTY
Case Type: LUST Cleanup Site

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900132

Global Id: T0603900132
Latitude: 36.9617822
Longitude: -120.057371

Status: Completed - Case Closed

05/07/1996 Status Date: Case Worker: **ADR** RB Case Number: 5T20000135 Local Agency: MADERA COUNTY File Location: Not reported Local Case Number: Not reported Potential Media Affect: Soil Potential Contaminants of Concern: Gasoline Not reported Site History:

LUST:

Global Id: T0603900132

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Direction
Distance

Elevation Site Database(s) EPA ID Number

PEARTS AUTO SUPPLY (Continued)

1000370321

EDR ID Number

Phone Number: Not reported

Global Id: T0603900132

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET
City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603900132

 Action Type:
 Other

 Date:
 08/13/1993

 Action:
 Leak Reported

Global Id: T0603900132
Action Type: ENFORCEMENT
Date: 05/07/1996

Action: Closure/No Further Action Letter

 Global Id:
 T0603900132

 Action Type:
 Other

 Date:
 06/04/1993

 Action:
 Leak Discovery

 Global Id:
 T0603900132

 Action Type:
 Other

 Date:
 06/04/1993

 Action:
 Leak Stopped

LUST:

Global Id: T0603900132

Status: Completed - Case Closed

Status Date: 05/07/1996

Global Id: T0603900132

Status: Open - Case Begin Date

Status Date: 06/04/1993

LUST REG 5:

Region: 5

Status: Case Closed 5T20000135 Case Number: Soil only Case Type: **GASOLINE** Substance: JWH Staff Initials: Lead Agency: Local Program: LUST MTBE Code: N/A

SWEEPS UST:

Status: Active

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

PEARTS AUTO SUPPLY (Continued)

1000370321

Comp Number: 100145 Number: 9

Board Of Equalization: 44-013705 Referral Date: 06-30-92 Action Date: 07-22-92 02-29-88 Created Date:

Owner Tank Id:

SWRCB Tank Id: 20-000-100145-001128

Tank Status: Α Capacity: 240

Active Date: Not reported M.V. FUEL Tank Use:

STG: Content: **OTHER** Number Of Tanks:

HIST UST:

File Number: 00028F06

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028F06.pdf

Region: STATE Facility ID: 0000007074 Facility Type: Other

Other Type: **AUTO PARTS & GARAGES**

Contact Name: E. E. PEART Telephone: 2096746754

PEARTS AUTO SUPPLY INC. Owner Name:

212 EAST 6TH Owner Address: Owner City, St, Zip: MADERA, CA 93638

Total Tanks: 0001

Tank Num: 001 Container Num: 1 Year Installed: 1976 00000240 Tank Capacity: Tank Used for: **PRODUCT** UNLEADED Type of Fuel: Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Click here for Geo Tracker PDF:

CA FID UST:

20000269 Facility ID: Regulated By: UTNKA Regulated ID: 00000707 Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2096746754 Mail To: Not reported Mailing Address: 212 E 6TH ST Mailing Address 2: Not reported **MADERA 93638** Mailing City, St, Zip: Contact: Not reported Contact Phone: Not reported **DUNs Number:** Not reported NPDES Number: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

PEARTS AUTO SUPPLY (Continued)

1000370321

EPA ID: Not reported Comments: Not reported Status: Active

FINDS:

110002751594 Registry ID:

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

STATE MASTER

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000370321 Registry ID: 110002751594

DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110002751594

HIST CORTESE:

CORTESE Region: Facility County Code: 20 Reg By: **LTNKA** 5T20000135 Reg Id:

CERS TANKS:

Site ID: 249807 CERS ID: T0603900132

Leaking Underground Storage Tank Cleanup Site CERS Description:

Affiliation:

Regional Board Caseworker Affiliation Type Desc:

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported Affiliation Address: 1685 È STREET FRESNO Affiliation City: Affiliation State: CA

Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

ANN ROLAN - MADERA COUNTY Entity Name:

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: **MADERA** Affiliation State: CA

Affiliation Country: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

PEARTS AUTO SUPPLY (Continued) 1000370321

Affiliation Zip: Not reported Affiliation Phone: Not reported

SILVA'S AUTO BODY N92 **ENVIROSTOR** S101588403

201 S C ST **ESE SWEEPS UST** N/A

1/4-1/2 MADERA, CA 93738 **CA FID UST**

0.377 mi.

1990 ft. Site 2 of 3 in cluster N

Relative: **ENVIROSTOR:** Higher 20750005 Facility ID:

Status: Refer: Other Agency Actual: Status Date: 11/16/1994 274 ft. Site Code: Not reported

Site Type: Historical Site Type Detailed: * Historical Acres: Not reported NPL: NO

NONE SPECIFIED Regulatory Agencies: NONE SPECIFIED Lead Agency: Program Manager: Not reported

Referred - Not Assigned Supervisor: Division Branch: Cleanup Sacramento

Assembly: 05 Senate: 12

Special Program: * Rural County Survey Program

Restricted Use: NO

NONE SPECIFIED Site Mgmt Req: Funding: Not reported Latitude: 36.96451 Longitude: -120.0582 APN:

NONE SPECIFIED NONE SPECIFIED Past Use: Potential COC: NONE SPECIFIED NONE SPECIFIED Confirmed COC: Potential Description: NONE SPECIFIED 20750005 Alias Name:

Alias Type: **Envirostor ID Number**

Completed Info:

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported Completed Document Type: * Discovery Completed Date: 09/29/1988

Comments: FACILITY IDENTIFIED COMMUNITY GUIDE & BUSINESS DIRECTORY - MADERA

COUNTY 1987.

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported Completed Document Type: Site Screening Completed Date: 01/24/1989

Comments: SITE SCREENING DONE. RATIONALE FOR PRELIMINARY ASSESSMENT LOW

PRIORITY BASED ON BUSINESS TYPE; SEND QUESTIONNAIRE.

Future Area Name: Not reported Future Sub Area Name: Not reported Not reported Future Document Type:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SILVA'S AUTO BODY (Continued)

S101588403

Future Due Date: Not reported Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported

SWEEPS UST:

Status: Not reported Comp Number: 100086 Not reported Number: Board Of Equalization: Not reported Not reported Referral Date: Action Date: Not reported Created Date: Not reported Not reported Owner Tank Id:

SWRCB Tank Id: 20-000-100086-000966

Tank Status: Not reported

Capacity: 550

Active Date: Not reported **PETROLEUM** Tank Use: **PRODUCT** STG: Content: Not reported

Number Of Tanks:

CA FID UST:

Facility ID: 20000333 Regulated By: UTNKI Regulated ID: 00000986 Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2096748591 Mail To: Not reported 201 S C ST Mailing Address: Not reported Mailing Address 2: Mailing City,St,Zip: **MADERA 93738** Contact: Not reported Contact Phone: Not reported **DUNs Number:** Not reported NPDES Number: Not reported Not reported EPA ID: Comments: Not reported Inactive Status:

N93 FORDS WELDING WORKS

SE **237 SOUTH D** 1/4-1/2 MADERA, CA 93637

0.394 mi.

2078 ft. Site 3 of 3 in cluster N

Relative: **ENVIROSTOR:**

Higher Facility ID: 20760004

Status: Refer: Other Agency Actual: Status Date: 11/16/1994 274 ft.

Site Code: Not reported Site Type: Historical Site Type Detailed: * Historical

S101481129

N/A

ENVIROSTOR

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FORDS WELDING WORKS (Continued)

S101481129

Acres: Not reported

NPL: NO

NONE SPECIFIED Regulatory Agencies: NONE SPECIFIED Lead Agency: Program Manager: Not reported

Supervisor: Referred - Not Assigned Division Branch: Cleanup Sacramento

Assembly: 05 Senate: 12

Special Program: * Rural County Survey Program

Restricted Use: NO

NONE SPECIFIED Site Mgmt Req: Funding: Not reported Latitude: 36.96083 Longitude: -120.0566

NONE SPECIFIED APN: Past Use: NONE SPECIFIED NONE SPECIFIED Potential COC: Confirmed COC: NONE SPECIFIED Potential Description: NONE SPECIFIED Alias Name: 20760004

Alias Type: **Envirostor ID Number**

Completed Info:

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported Completed Document Type: * Discovery Completed Date: 08/15/1988

Comments: FACILITY IDENTIFIED POLK'S DIRECTORY 1946, 55, 62, 69. FACILITY

DRIVE-BY: AT SOUTH END OF PISTORESI CAR DEALERSHIP. GROUND PHOTOS: METAL BUILDING. SITE SCREENING DONE. RATIONALE FOR PRELIMINARY ASSESSMENT LOW PRIORITY: STATUS BASED ON BUSINESS TYPE. SEND

QUESTIONNAIRE.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported Completed Document Type: Site Screening 08/15/1988 Completed Date: Comments: Not reported

Future Area Name: Not reported Not reported Future Sub Area Name: Future Document Type: Not reported Future Due Date: Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Schedule Due Date: Not reported Not reported Schedule Revised Date:

Direction Distance

Elevation Site Database(s) EPA ID Number

94 PACIFIC BELL RCRA-SQG 1000251869
SE 221 SOUTH E STREET LUST CAT080029218

1/4-1/2 MADERA, CA 93637 0.420 mi.

SWEEPS UST
HIST UST
CA FID UST
FINDS
ECHO

CERS

EDR ID Number

2219 ft. Relative: Higher

Actual:

273 ft. RCRA-SQG:

Date form received by agency: 09/01/1996
Facility name: PACIFIC BELL
Facility address: 221 SOUTH E STREET

MADERA, CA 93637 CAT080029218

EPA ID: CAT080029218
Mailing address: 370 THIRD STREET RM 600G

SAN FRANCISCO, CA 94107

Contact: Not reported
Contact address: Not reported
Not reported

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 09

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous

waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of

hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: THE PACIFIC TELEPHONE AND TELEGRAPH CO

Owner/operator address: NOT REQUIRED

NOT REQUIRED, ME 99999

Owner/operator country: Not reported Owner/operator telephone: 415-555-1212 Owner/operator email: Not reported Not reported Owner/operator fax: Owner/operator extension: Not reported Private Legal status: Owner Owner/Operator Type: Owner/Op start date: Not reported Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED Owner/operator address: NOT REQUIRED

NOT REQUIRED, ME 99999

Owner/operator country: Not reported 415-555-1212 Owner/operator telephone: Owner/operator email: Not reported Owner/operator fax: Not reported Owner/operator extension: Not reported Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

PACIFIC BELL (Continued) 1000251869

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: Nο Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 04/09/1990
Site name: PACIFIC BELL

Classification: Large Quantity Generator

Date form received by agency: 07/16/1985
Site name: PACIFIC BELL

Classification: Large Quantity Generator

Violation Status: No violations found

LUST:

Lead Agency: MADERA COUNTY
Case Type: LUST Cleanup Site

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603900068

Global Id: T0603900068
Latitude: 36.9604133
Longitude: -120.0579094

Status: Completed - Case Closed

Status Date: 04/03/1989 Case Worker: **ADR** 5T20000068 RB Case Number: Local Agency: MADERA COUNTY File Location: Not reported Local Case Number: Not reported Potential Media Affect: Soil Potential Contaminants of Concern: Diesel Site History: Not reported

LUST:

Global Id: T0603900068

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603900068

EDR ID Number

Direction Distance

Elevation Site Database(s) EPA ID Number

PACIFIC BELL (Continued) 1000251869

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

LUST:

 Global Id:
 T0603900068

 Action Type:
 Other

 Date:
 04/03/1989

 Action:
 Leak Reported

Global Id: T0603900068
Action Type: ENFORCEMENT
Date: 07/21/2010

Action: Closure/No Further Action Letter

 Global Id:
 T0603900068

 Action Type:
 Other

 Date:
 05/04/1988

 Action:
 Leak Discovery

LUST:

Global Id: T0603900068

Status: Completed - Case Closed

Status Date: 04/03/1989

Global Id: T0603900068

Status: Open - Case Begin Date

Status Date: 05/04/1988

LUST REG 5:

Region:

Status: Case Closed 5T20000068 Case Number: Case Type: Soil only Substance: DIESEL Staff Initials: JWH Lead Agency: Local Program: LUST MTBE Code: N/A

SWEEPS UST:

Status: Active Comp Number: 100141 Number: 9

Board Of Equalization: Not reported Referral Date: 06-30-92 Action Date: 07-22-92 Created Date: 02-29-88 Owner Tank Id: D-87-1K

SWRCB Tank ld: 20-000-100141-001121

EDR ID Number

Direction Distance Elevation

ation Site Database(s) EPA ID Number

PACIFIC BELL (Continued)

1000251869

EDR ID Number

Tank Status: A
Capacity: 1000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: 1

Status: Not reported Comp Number: 100141 Not reported Number: Board Of Equalization: Not reported Not reported Referral Date: Action Date: Not reported Not reported Created Date: Not reported Owner Tank Id:

SWRCB Tank Id: 20-000-100141-001122

Tank Status: Not reported
Capacity: 1000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: 1

HIST UST:

File Number: Not reported URL: Not reported Region: STATE 00000057477 Facility ID: Facility Type: Other Other Type: SIC 4800 E.J. KOEHLER Contact Name: Telephone: 4155426758 Owner Name: PACIFIC BELL Owner Address: 370 THIRD STREET

Owner City, St, Zip: SAN FRANCISCO, CA 94107

Total Tanks: 0001

Tank Num: 001
Container Num: 1
Year Installed: 1970
Tank Capacity: 00001000
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: Not reported
Leak Detection: None

CA FID UST:

Facility ID: 20000567
Regulated By: UTNKA
Regulated ID: 00005747
Cortese Code: Not reported
SIC Code: Not reported
Facility Phone: 2094544411
Mail To: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

PACIFIC BELL (Continued)

1000251869

EDR ID Number

Mailing Address: 221 S E ST Mailing Address 2: Not reported Mailing City, St, Zip: **MADERA 93637** Contact: Not reported Contact Phone: Not reported Not reported DUNs Number: Not reported NPDES Number: Not reported EPA ID: Not reported Comments: Status: Active

FINDS:

Registry ID: 110055658998

Environmental Interest/Information System STATE MASTER

Registry ID: 110002955106

Environmental Interest/Information System

AIR EMISSIONS CLASSIFICATION UNKNOWN

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

<u>Click this hyperlink</u> while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000251869 Registry ID: 110002955106

DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110002955106

CERS TANKS:

Site ID: 241094 CERS ID: T0603900068

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA
Affiliation State: CA

Direction Distance

Distance Elevation Site EDR ID Number Database(s) EPA ID Number

PACIFIC BELL (Continued) 1000251869

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported
Affiliation Address: 1685 E STREET
Affiliation City: FRESNO
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

O95 MADERA REDEVELOPMENT AGENCY PROPERTY LUST \$105174063

SSE 201 GATEWAY DR S CERS N/A

1/4-1/2 MADERA, CA 93637

0.425 mi.

2243 ft. Site 1 of 2 in cluster O

Relative: LUST:

LowerLead Agency:MADERA COUNTYActual:Case Type:LUST Cleanup Site

272 ft. Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0603991984

Global Id: T0603991984
Latitude: 36.9593386
Longitude: -120.0586002

Status: Completed - Case Closed

Status Date: 08/23/2001
Case Worker: ADR
RB Case Number: 5T20000216
Local Agency: MADERA COUNTY
File Location: Not reported
Local Case Number: 0005732

Potential Media Affect: Soil

Potential Contaminants of Concern: Waste Oil / Motor / Hydraulic / Lubricating

Site History: Not reported

LUST:

Global Id: T0603991984

Contact Type: Local Agency Caseworker

Contact Name: ANN ROLAN
Organization Name: MADERA COUNTY
Address: 2037 WEST CLEVELAND

City: MADERA

Email: arolan@madera-county.com

Phone Number: Not reported

Global Id: T0603991984

Contact Type: Regional Board Caseworker

Contact Name: JEFFREY HANNEL

Organization Name: CENTRAL VALLEY RWQCB (REGION 5F)

Address: 1685 E STREET
City: FRESNO

Email: jhannel@waterboards.ca.gov

Phone Number: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MADERA REDEVELOPMENT AGENCY PROPERTY (Continued)

S105174063

LUST:

Global Id: T0603991984 Action Type: Other Date: 08/23/2001 Action: Leak Reported

Global Id: T0603991984 Other Action Type: Date: 07/26/2001 Action: Leak Discovery

Global Id: T0603991984 Action Type: Other 01/01/1970 Date: Action: Leak Stopped

LUST:

Global Id: T0603991984

Completed - Case Closed Status:

Status Date: 08/23/2001

Global Id: T0603991984

Status: Open - Case Begin Date

07/26/2001 Status Date:

LUST REG 5:

Region: 5

Case Closed Status: Case Number: 5T20000216 Case Type: Soil only WASTE OIL Substance: JWH Staff Initials: Lead Agency: Local LUST Program: MTBE Code: N/A

CERS TANKS:

198845 Site ID: CERS ID: T0603991984

CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Regional Board Caseworker Affiliation Type Desc:

Entity Name: JEFFREY HANNEL - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported 1685 E STREET Affiliation Address: Affiliation City: **FRESNO** Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: Local Agency Caseworker

Entity Name: ANN ROLAN - MADERA COUNTY

Entity Title: Not reported

Direction Distance

O96

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

MADERA REDEVELOPMENT AGENCY PROPERTY (Continued)

S105174063

Affiliation Address: 2037 WEST CLEVELAND

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

PG&E FORMER MADERA SERVICE CENTER CPS-SLIC U001589297

SSE 309 S GATEWAY DR SWEEPS UST N/A

SSE 309 S GATEWAY DR SWEEPS UST N 1/4-1/2 MADERA, CA 93637 HIST UST

0.438 mi. DEED

2311 ft. Site 2 of 2 in cluster O CERS

Relative: CPS-SLIC:
Lower Region: STATE

Actual: Facility Status: Completed - Case Closed

272 ft. Status Date: 07/20/2001 Global ld: SL186434606

Lead Agency: DEPARTMENT OF TOXIC SUBSTANCES CONTROL

Lead Agency Case Number:60000297Latitude:36.959182Longitude:-120.0583808Case Type:Cleanup Program Site

Case Worker: Not reported
Local Agency: Not reported
RB Case Number: SL186434606
File Location: Not reported

Potential Media Affected: Aquifer used for drinking water supply, Surface water

Potential Contaminants of Concern: ** PCB-1260, Other Petroleum

Site History: Not reported

Click here to access the California GeoTracker records for this facility:

SWEEPS UST:

Status: Not reported 100146 Comp Number: Not reported Number: 44-013706 Board Of Equalization: Referral Date: Not reported Action Date: Not reported Not reported Created Date: Not reported Owner Tank Id:

SWRCB Tank Id: 20-000-100146-001129

Tank Status: Not reported Capacity: 2000

Active Date: Not reported Tank Use: M.V. FUEL STG: PRODUCT Content: OTHER Number Of Tanks: 1

HIST UST:

File Number: 00028EE1

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028EE1.pdf

Region: STATE Facility ID: 00000028268

Direction Distance

Elevation Site Database(s) EPA ID Number

PG&E FORMER MADERA SERVICE CENTER (Continued)

U001589297

EDR ID Number

Facility Type: Other

Other Type: PUBLIC UTILITY
Contact Name: Not reported
Telephone: 2092680441

Owner Name: PACIFIC GAS AND ELECTRIC COMPA

Owner Address: 77 BEALE STREET

Owner City, St, Zip: SAN FRANCISCO, CA 94106

Total Tanks: 0001

Tank Num: 001 25KC01 Container Num: Year Installed: Not reported Tank Capacity: 00002000 Tank Used for: **PRODUCT** UNLEADED Type of Fuel: Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Click here for Geo Tracker PDF:

DEED:

Envirostor ID: SL186434606 Area: Not reported Sub Area: Not reported

Site Type: SLIC

Status: COMPLETED - CASE CLOSED

Agency: SWRCB
Covenant Uploaded: Y
Deed Date(s): 09/24/2003

File Name: Geotracker Land Use/Deed Restrictions

CERS TANKS:

Site ID: 233701
CERS ID: SL186434606
CERS Description: Cleanup Program Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

Entity Name: JONG HAN - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported
Affiliation Address: 1685 E. Street
Affiliation City: Fresno
Affiliation State: CA
Affiliation Country: Not reported

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Direction Distance

Distance Elevation Site EDR ID Number Database(s) EPA ID Number

P97 MADERA PCE GROUNDWATER PLUME RESPONSE S110977147
SE SOUTH C STREET AND 7TH STREET ENVIROSTOR N/A

1/4-1/2 MADERA, CA 93638

0.455 mi.

2405 ft. Site 1 of 2 in cluster P

Relative: RESPONSE:

HigherFacility ID:60001450Actual:Site Type:State Response274 ft.Site Type Detail:State Response or NPL

Acres: 100
National Priorities List: NO
Cleanup Oversight Agencies: SMBRP

Lead Agency Description: DTSC - Site Cleanup Program

Project Manager: Sergio Chavez Supervisor: Joseph Tapia

Division Branch: Engineering & Special Projects

Site Code: 102045

Site Mgmt. Req.: NONE SPECIFIED

Assembly: 29, 05 Senate: 12

Special Program Status: Not reported Status: Active Status Date: 10/19/2010

Restricted Use: NO

Funding: Orphan Funds Latitude: 36.9583 Longitude: -120.0556

APN: NONE SPECIFIED
Past Use: DRY CLEANING
Potential COC: Tetrachloroethylene (PCE

Confirmed COC: Tetrachloroethylene (PCE Potential Description: UE Alias Name: 102045

Alias Type: Project Code (Site Code)

Alias Name: 60001450

Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 07/19/2015

Comments: Continued communications between OLC, project manager and PRP

attorney.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Letter - Notice
Completed Date: 12/15/2016
Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: State/Federal Funded Site Work Order

Completed Date: 11/01/2017

Comments: Finalized start work order

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Cortese

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA PCE GROUNDWATER PLUME (Continued)

S110977147

EDR ID Number

Completed Document Type: State/Federal Funded Site Contract

Completed Date: 06/08/2017

Comments: Fully executed contract.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: State/Federal Funded Site Contract Fiscal Approval (CFA)

Completed Date: 05/17/2011

Comments: Time extension for URS contract.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan

Completed Date: 01/24/2012

Comments: DTSC review and approval of groundwater/soil gas investigation in the

City of Madera.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Report
Completed Date: 08/01/2012

Comments: Passive soil gas sampling report approved.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 11/21/2012
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Report
Completed Date: 08/27/2013

Comments: Completed review of soil gas investigation report. Additional

investigations are needed.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
11/03/2014
Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: State/Federal Funded Site Work Order

Completed Date: 10/19/2010

Comments: Start Work Order signed for URS to conduct a soil gas investigation

for PCE contamination from Madera area Dry Cleaners.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: State/Federal Funded Site Work Order

Completed Date: 12/30/2009

Comments: CFA signed to do contract work by URS.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA PCE GROUNDWATER PLUME (Continued)

S110977147

EDR ID Number

Completed Document Type: Correspondence
Completed Date: 04/20/2015
Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Imminent and/or Subst. Endangerment Determination

Completed Date: 06/05/2015 Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Triage Meeting
Completed Date: 09/21/2015
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 07/06/2015

Comments: OLC responded via phone discussion.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 08/10/2015

Comments: Continue communications between OLC, project manager and PRP attorney.

Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Report
Completed Date: 02/16/2016

Comments: DTSC had URS finalize the draft Investigation Report as is. Final

document submitted was already approved.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Remedial Investigation Report

Completed Date: 02/18/2016

Comments: Comment letter not needed until the next phase of the investigation

is completed.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fact Sheets
Completed Date: 06/19/2017

Comments: The Fact Sheets were hand delivered to business owners/operators by

DTSC cleanup staff and public participation staff on June 22, 2017.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 05/23/2017

Comments: Final approval not needed since the draft was already approved and no

major revisions were made.

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA PCE GROUNDWATER PLUME (Continued)

S110977147

EDR ID Number

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 08/04/2017

Comments: Reviewed and approved draft workplan.

Future Area Name: Not reported Future Sub Area Name: Not reported Not reported Future Document Type: Future Due Date: Not reported Schedule Area Name: Not reported Not reported Schedule Sub Area Name: Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported

ENVIROSTOR:

Facility ID: 60001450
Status: Active
Status Date: 10/19/2010
Site Code: 102045
Site Type: State Response
Site Type Detailed: State Response or NPL

Acres: 100
NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: SMBRP
Program Manager: Sergio Chavez
Supervisor: Joseph Tapia

Division Branch: Engineering & Special Projects

Assembly: 29, 05 Senate: 12

Special Program: Not reported

Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: Orphan Funds
Latitude: 36.9583
Longitude: -120.0556

APN: NONE SPECIFIED
Past Use: DRY CLEANING
Potential COC: Tetrachloroethylene

Potential COC: Tetrachloroethylene (PCE Confirmed COC: Tetrachloroethylene (PCE

Potential Description: UE

Alias Name: 102045

Alias Type: Project Code (Site Code)

Alias Name: 60001450

Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 07/19/2015

Comments: Continued communications between OLC, project manager and PRP

attorney.

Completed Area Name: PROJECT WIDE

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA PCE GROUNDWATER PLUME (Continued)

S110977147

EDR ID Number

Completed Sub Area Name: Not reported
Completed Document Type: Letter - Notice
Completed Date: 12/15/2016
Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: State/Federal Funded Site Work Order

Completed Date: 11/01/2017

Comments: Finalized start work order

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: State/Federal Funded Site Contract

Completed Date: 06/08/2017

Comments: Fully executed contract.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: State/Federal Funded Site Contract Fiscal Approval (CFA)

Completed Date: 05/17/2011

Comments: Time extension for URS contract.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 01/24/2012

Comments: DTSC review and approval of groundwater/soil gas investigation in the

City of Madera.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Report
Completed Date: 08/01/2012

Comments: Passive soil gas sampling report approved.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 11/21/2012

Completed Date: 11/21/2012 Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Report
Completed Date: 08/27/2013

Comments: Completed review of soil gas investigation report. Additional

investigations are needed.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 11/03/2014
Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA PCE GROUNDWATER PLUME (Continued)

S110977147

EDR ID Number

Completed Document Type: State/Federal Funded Site Work Order

Completed Date: 10/19/2010

Comments: Start Work Order signed for URS to conduct a soil gas investigation

for PCE contamination from Madera area Dry Cleaners.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: State/Federal Funded Site Work Order

Completed Date: 12/30/2009

Comments: CFA signed to do contract work by URS.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 04/20/2015
Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Imminent and/or Subst. Endangerment Determination

Completed Date: 06/05/2015 Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Triage Meeting
Completed Date: 09/21/2015
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 07/06/2015

Comments: OLC responded via phone discussion.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 08/10/2015

Comments: Continue communications between OLC, project manager and PRP attorney.

Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Report
Completed Date: 02/16/2016

Comments: DTSC had URS finalize the draft Investigation Report as is. Final

document submitted was already approved.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Remedial Investigation Report

Completed Date: 02/18/2016

Comments: Comment letter not needed until the next phase of the investigation

is completed.

Completed Area Name: PROJECT WIDE

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA PCE GROUNDWATER PLUME (Continued)

S110977147

EDR ID Number

Completed Sub Area Name: Not reported Completed Document Type: Fact Sheets Completed Date: 06/19/2017

Comments: The Fact Sheets were hand delivered to business owners/operators by

DTSC cleanup staff and public participation staff on June 22, 2017.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 05/23/2017

Comments: Final approval not needed since the draft was already approved and no

major revisions were made.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan

Completed Date: 08/04/2017

Comments: Reviewed and approved draft workplan.

Future Area Name: Not reported Future Sub Area Name: Not reported Future Document Type: Not reported Not reported Future Due Date: Schedule Area Name: Not reported Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported

CORTESE:

Region: CORTESE Envirostor Id: 60001450

Site/Facility Type: STATE RESPONSE

Cleanup Status: ACTIVE Status Date: 10/19/2010 Site Code: 102045 Latitude: 36.9583 Longitude: -120.0556 Owner: Not reported Enf Type: Not reported Swat R: Not reported Flag: envirostor Order No: Not reported Waste Discharge System No: Not reported Effective Date: Not reported Region 2: Not reported WID Id: Not reported Solid Waste Id No: Not reported Waste Management Uit Name: Not reported

File Name: Haz Waste & Substances Sites

Direction Distance

Elevation Site Database(s) EPA ID Number

P98 MADERA CLEANERS AND LAUNDRY CPS-SLIC S107473162
ESE 321 SOUTH C STREET CERS N/A

ESE 321 SOUTH C STREET 1/4-1/2 MADERA, CA 93637

0.468 mi.

2469 ft. Site 2 of 2 in cluster P

Relative: CPS-SLIC:
Higher Region: STATE

Actual: Facility Status: Open - Verification Monitoring

274 ft. Status Date: 10/15/2016 Global Id: SL0603921176

Lead Agency: CENTRAL VALLEY RWQCB (REGION 5F)

Lead Agency Case Number: Not reported Latitude: 36.961349 Longitude: -120.055353

Case Type: Cleanup Program Site

Case Worker: GJI

Local Agency: Not reported
RB Case Number: Not reported
File Location: Regional Board

Potential Media Affected: Aquifer used for drinking water supply, Soil, Soil Vapor

Potential Contaminants of Concern: Tetrachloroethylene (PCE)

Site History: Dry cleaning facility that formerly used PCE. PCE detected in

monitoring wells on downgradient sites during early 1990's. Petrix tube study by Regional Water Board indicated source at the site. Initial soil, groundwater, soil vapor assessments have been completed. A vapor extraction operated at the site until shut down due to lack of financial resources of the Discharger. PCE soil vapor was significantly reduced. Site monitoring wells and soil vapor wells

need to be sampled.

Click here to access the California GeoTracker records for this facility:

CERS TANKS:

Site ID: 242185
CERS ID: SL0603921176
CERS Description: Cleanup Program Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker

Entity Name: GREG ISSINGHOFF - CENTRAL VALLEY RWQCB (REGION 5F)

Entity Title: Not reported
Affiliation Address: 1685 E STREET
Affiliation City: FRESNO
Affiliation State: CA

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: 5594884390

EDR ID Number

Direction Distance

Elevation Site Database(s) **EPA ID Number**

Q99 PG AND E MANUFACTURED GAS PLANT SQ-YO-MAD **EDR MGP** 1008407712

BLOCK OF 9TH, CLINTON, E STREET AND ALLEY

MADERA, CA 93637 1/2-1

0.562 mi.

SE

2965 ft. Site 1 of 4 in cluster Q Relative: Manufactured Gas Plants:

Higher No additional information available

Actual: 273 ft.

Q100 **PG&E MANUFACTURED GAS PLANT SQ-YO-MAD HIST Cal-Sites** S101481103 N/A

BLOCK OF: 9TH, CLINTON, E STREET & ALLEY SE

1/2-1 MADERA, CA 93637

0.573 mi.

3023 ft. Site 2 of 4 in cluster Q

Relative: Calsite:

Higher Region: **SACRAMENTO** Facility ID: 20490001 Actual: 273 ft. Facility Type: RP

RESPONSIBLE PARTY Type:

Branch: CC

Branch Name: **CENTRAL CALIFORNIA**

Not reported File Name: State Senate District: 06081995

Status: BACKLOG, POTENTIAL ANNUAL WORKPLAN (AWP) SITE

BACKLOG - POTENTIAL AWP SITE Status Name:

N/A Lead Agency: NPL: Not Listed SIC Code: 49

SIC Name: ELECTRIC, GAS & SANITARY SERVICES

Access: Not reported Cortese: Not reported

Hazardous Ranking Score: Not reported Date Site Hazard Ranked: Not reported Groundwater Contamination: Not reported Staff Member Responsible for Site: Not reported Supervisor Responsible for Site: Not reported

Region Water Control Board: CV

Region Water Control Board Name: CENTRAL VALLEY Lat/Long Direction: Not reported Lat/Long (dms): 000/000 Lat/long Method: Not reported Lat/Long Description: Not reported

State Assembly District Code: 29 State Senate District Code: 12 20490001 Facility ID: Activity: DISC Activity Name: DISCOVERY AWP Code: Not reported

Proposed Budget:

AWP Completion Date: Not reported Revised Due Date: Not reported Comments Date: 02011987 0

Est Person-Yrs to complete:

Estimated Size: Not reported Request to Delete Activity: Not reported

Activity Status: BKLG

Definition of Status: **BACKLOG - POTENTIAL AWP SITE** **EDR ID Number**

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

PG&E MANUFACTURED GAS PLANT SQ-YO-MAD (Continued)

S101481103

Liquids Removed (Gals): 0 Liquids Treated (Gals): 0

Action Included Capping: Not reported Well Decommissioned: Not reported Action Included Fencing: Not reported Not reported Removal Action Certification: Not reported **Activity Comments:**

For Commercial Reuse: For Industrial Reuse: 0 For Residential Reuse: 0 Unknown Type: 0 20490001 Facility ID: Activity: SS

Activity Name: SITE SCREENING AWP Code: Not reported

Proposed Budget:

Not reported AWP Completion Date: Revised Due Date: Not reported Comments Date: 02021987

Est Person-Yrs to complete: 0

Estimated Size: Not reported Request to Delete Activity: Not reported

Activity Status: **BKLG**

Definition of Status: BACKLOG - POTENTIAL AWP SITE

Liquids Removed (Gals): Liquids Treated (Gals): 0

Action Included Capping: Not reported Well Decommissioned: Not reported Action Included Fencing: Not reported Removal Action Certification: Not reported **Activity Comments:** Not reported

For Commercial Reuse: 0 For Industrial Reuse: 0 For Residential Reuse: 0 0 Unknown Type: 20490001 Facility ID: Activity: PEA

PRELIMINARY ENDANGERMENT ASSESSMENT Activity Name:

AWP Code: Not reported

Proposed Budget: 0

AWP Completion Date: Not reported Revised Due Date: Not reported 02271992 Comments Date:

Est Person-Yrs to complete:

Estimated Size: Not reported Not reported Request to Delete Activity:

Activity Status: BKLG

BACKLOG - POTENTIAL AWP SITE Definition of Status:

Liquids Removed (Gals): 0 Liquids Treated (Gals): 0

Action Included Capping: Not reported Well Decommissioned: Not reported Not reported Action Included Fencing: Removal Action Certification: Not reported **Activity Comments:** Not reported

For Commercial Reuse: For Industrial Reuse: 0

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

PG&E MANUFACTURED GAS PLANT SQ-YO-MAD (Continued)

S101481103

For Residential Reuse: 0 Unknown Type: 0

Alternate Address: BLOCK OF: 9TH, CLINTON, E STREET & ALLEY

Alternate City, St, Zip: MADERA, CA 93637

Alternate Address: E STREET BETWEEN 9TH & CLINTON

Alternate City, St, Zip: MADERA, CA 93637 Background Info: Not reported Comments Date: 02011987

FACILITY IDENTIFIED BY PG&E Comments:

Comments Date: 02011987

INSPECTION(OTHER) RP-PA CONDUCTED, REPORT TO DHS Comments:

Comments Date: 02011987

RP SAMPLE: LEAD 120 PPM, ARSENIC 59 PPM Comments: SAMPLE RESULTS

Comments Date: 02021987

Comments: SITE SCREENING DONE NO CLEANUP DOCUMENTED

Comments Date: 03301992

Preliminary endangerment assessment completed. Small Comments:

Comments Date: 03301992

Comments: quantities of PNAs detected in upper 3 feet of soil.

Comments Date: 03301992

As, Pb, Ni, Se, Zn detected above background in some Comments:

Comments Date: 03301992

soil samples. Implementation of institutional Comments:

Comments Date: 03301992

Comments: controls recommended. ID Name: CALSTARS CODE

ID Value: 100287

Alternate Name: PG&E MANUFACTURED GAS PLANT SQ-YO-MAD Alternate Name: PACIFIC GAS & ELECTRIC MFG GAS PLANT

Alternate Name: Not reported Special Programs Code: Not reported Special Programs Name: Not reported

Q101 **VICINITY OF PG&E POLE YARD** Notify 65 S100562416

CORNER OF "D" ST & 9TH ST SE

1/2-1 MADERA, CA

0.576 mi.

Site 3 of 4 in cluster Q 3039 ft.

NOTIFY 65: Relative:

Higher Date Reported: 19930430 Staff Initials: RΒ Actual:

Board File Number: 05F930013 273 ft. Facility Type: **UNKNOWN** Discharge Date: Not reported Issue Date: Not reported

> Incident Description: Investigation of PG&E former gas plant revealed contamination in

> > ground water above State action levels.

N/A

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

Q102 PG&E MANUFACTURED GAS PLANT - MADERA ENVIROSTOR S108054452 SE CORNER OF 9TH AND SOUTH E STREETS VCP N/A

1/2-1 MADERA, CA 93637

0.579 mi.

3057 ft. Site 4 of 4 in cluster Q

Relative: ENVIROSTOR:

 Higher
 Facility ID:
 60000297

 Actual:
 Status:
 Certified

 273 ft.
 Status Date:
 11/19/2013

 Site Code:
 100287

Site Type: Voluntary Cleanup
Site Type Detailed: Voluntary Cleanup

Acres: 1 NPL: NO

Regulatory Agencies: SMBRP, RWQCB 5F - Central Valley, MADERA COUNTY

Lead Agency: SMBRP
Program Manager: Jeff Gymer
Supervisor: Kevin Shaddy
Division Branch: Cleanup San Joaquin

Assembly: 05 Senate: 12

Special Program: Voluntary Cleanup Program

Restricted Use: NO

Site Mgmt Req: NONE SPECIFIED Funding: Responsible Party Latitude: 36.9583

Latitude: 36.9583 Longitude: -120.0556

APN: NONE SPECIFIED

Past Use: MANUFACTURED GAS PLANT, UTILITY - NATURAL GAS

Potential COC: Arsenic Lead Tetrachloroethylene (PCE Trichloroethylene (TCE Cobalt

Cyanide (free Cyanide (hydrogen Nickel Polynuclear aromatic hydrocarbons (PAHs Acenaphthene Anthracene Benza[a]anthracene Benzo[b]fluoranthene Benzo[k]fluoranthene Benzo[a]pyrene Chrysene Dibenz[ah]anthracene Fluoranthene Fluorene Indeno[1,2,3-cd]pyrene

Naphthalene Pyrene Selenium Zinc

Confirmed COC: Polynuclear aromatic hydrocarbons (PAHs Acenaphthene Anthracene

Benz[a]anthracene Benzo[b]fluoranthene Benzo[k]fluoranthene Benzo[a]pyrene Chrysene Dibenz[ah]anthracene Fluoranthene Fluorene

Indeno[1,2,3-cd]pyrene Naphthalene Pyrene Selenium

Tetrachloroethylene (PCE Trichloroethylene (TCE Cobalt 30160-NO

30161-NO Nickel Arsenic Lead Zinc

Potential Description: OTH, SOIL

Alias Name: MADERA MANUFACTURED GAS PLANT, PACIFIC GAS AND ELECTRIC

Alias Type: Alternate Name

Alias Name: PACIFIC GAS & ELECTRIC MFG GAS PLANT

Alias Type: Alternate Name

Alias Name: PG&E MANUFACTURED GAS PLANT SQ-YO-MAD

Alias Type: Alternate Name
Alias Name: 110033611009
Alias Type: EPA (FRS #)
Alias Name: SL186434606
Alias Type: GeoTracker Global ID
Alias Name: SLT5FT494524
Alias Type: GeoTracker Global ID

Alias Name: 100287

Alias Type: Project Code (Site Code)

Alias Name: 20490001

Alias Type: Envirostor ID Number

Direction Distance

Elevation Site Database(s) EPA ID Number

PG&E MANUFACTURED GAS PLANT - MADERA (Continued)

S108054452

EDR ID Number

Alias Name: 60000297

Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: *Voluntary Cleanup Agreement Completion

Completed Date: 05/11/2006

Comments: The VCA was signed and requires the Pacific Gas and Electric Company

to implement and complete a Remedial Investigation/Feasibility Study (RI/FS) and Remedial Action Plan (RAP) or Removal Action Workplan (RAW) to ultimately remediate the site of manufactured gas plant

contaminants.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: No Further Action Letter

Completed Date: 02/25/2013
Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Remedial Investigation Workplan

Completed Date: 05/09/2007

Comments: DTSC approved the final RI workplan and informing PG&E to implement

site field investigation activities.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Remedial Investigation / Feasibility Study

Completed Date: 06/17/2009

Comments: Draft RI Report Approved as Final w/agreement to undertake additional

groundwater monitoring work to plan for land use controls to be

identified in the RAW.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Removal Action Design

Completed Date: 06/03/2011 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Removal Action Completion Report

Completed Date: 06/28/2012 Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported

Completed Document Type: Preliminary Endangerment Assessment Report

Completed Date: 04/02/1992

Comments: PEA report dated 4/2/1992 submitted for DTSC review. Site placed on

backlog on 6/8/1995.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 02/05/1987

MAP FINDINGS Map ID Direction

Distance

Elevation Site Database(s) **EPA ID Number**

PG&E MANUFACTURED GAS PLANT - MADERA (Continued)

S108054452

EDR ID Number

Comments: Discovery completed.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported Completed Document Type: Community Profile Completed Date: 11/13/2007 Comments: approved

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported

Completed Document Type: Removal Action Workplan

Completed Date: 05/02/2011

Comments: Final RAW Approved.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported Monitoring Plan Completed Document Type: Completed Date: 06/30/2009

Comments: Workplan received and accepted. No approval letter issued as Workplan

includes sampling as required and agreed to in eamil exchange dated

6/15, 2009.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported Completed Document Type: Community Profile Completed Date: 10/01/2010

Comments: Approved an updated CP.

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported Completed Document Type: Public Notice Completed Date: 01/26/2011

Comments: Public Notice approved.

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported Completed Document Type: **Fact Sheets** Completed Date: 01/26/2011

Comments: Completed and approved Fact Sheet.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported Completed Document Type: Work Notice Completed Date: 06/29/2011 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Well Completion Report

06/27/2011 Completed Date: Comments: Not reported

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported

Completed Document Type: Preliminary Assessment Report

Completed Date: 05/05/1987 Comments: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

PG&E MANUFACTURED GAS PLANT - MADERA (Continued)

S108054452

EDR ID Number

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Site Characterization Workplan

Completed Date: 02/03/2012 Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 04/15/1992
Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Removal Action Completion Report

Completed Date: 01/10/2013 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Soils Management Plan

Completed Date: 02/26/2013
Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Soils Management Plan

Completed Date: 10/08/2013 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: CEQA - Notice of Exemption

Completed Date: 05/02/2011 Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Certification
Completed Date: 11/19/2013
Comments: Not reported

Future Area Name: Not reported Not reported Future Sub Area Name: Not reported Future Document Type: Future Due Date: Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Not reported Schedule Due Date: Schedule Revised Date: Not reported

VCP:

Facility ID: 60000297

Site Type: Voluntary Cleanup
Site Type Detail: Voluntary Cleanup
Site Mgmt. Req.: NONE SPECIFIED

Direction Distance

Elevation Site Database(s) EPA ID Number

PG&E MANUFACTURED GAS PLANT - MADERA (Continued)

S108054452

EDR ID Number

Acres: 1
National Priorities List: NO

Cleanup Oversight Agencies: SMBRP, RWQCB 5F - Central Valley, MADERA COUNTY

Lead Agency: SMBRP

Lead Agency Description: DTSC - Site Cleanup Program

Project Manager: Jeff Gymer
Supervisor: Kevin Shaddy
Division Branch: Cleanup San Joaquin

 Site Code:
 100287

 Assembly:
 05

 Senate:
 12

Special Programs Code: Voluntary Cleanup Program

Status: Certified
Status Date: 11/19/2013
Restricted Use: NO

Funding: Responsible Party
Lat/Long: 36.9583 / -120.0556
APN: NONE SPECIFIED

Past Use: MANUFACTURED GAS PLANT, UTILITY - NATURAL GAS

Potential COC: 30001, 30013, 30022, 30027, 30154, 30160, 30161, 30407, 30472, 30473,

 $30474,\,30475,\,30476,\,30477,\,30478,\,30479,\,30480,\,30481,\,30482,\,30483,$

30484, 30485, 30515, 30594

Confirmed COC: 30472,30473,30474,30475,30476,30477,30478,30479,30480,30481,30482,

30483,30484,30485,30515,30022,30027,30154,30160-NO,30161-NO,30407,

30001,30013,30594

Potential Description: OTH, SOIL

Alias Name: MADERA MANUFACTURED GAS PLANT, PACIFIC GAS AND ELECTRIC

Alias Type: Alternate Name

Alias Name: PACIFIC GAS & ELECTRIC MFG GAS PLANT

Alias Type: Alternate Name

Alias Name: PG&E MANUFACTURED GAS PLANT SQ-YO-MAD

Alias Type: Alternate Name
Alias Name: 110033611009
Alias Type: EPA (FRS #)
Alias Name: SL186434606
Alias Type: GeoTracker Global ID
Alias Name: SLT5FT494524
Alias Type: GeoTracker Global ID

Alias Name: 100287

Alias Type: Project Code (Site Code)

Alias Name: 20490001

Alias Type: Envirostor ID Number

Alias Name: 60000297

Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: *Voluntary Cleanup Agreement Completion

Completed Date: 05/11/2006

Comments: The VCA was signed and requires the Pacific Gas and Electric Company

to implement and complete a Remedial Investigation/Feasibility Study (RI/FS) and Remedial Action Plan (RAP) or Removal Action Workplan (RAW) to ultimately remediate the site of manufactured gas plant

contaminants.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

PG&E MANUFACTURED GAS PLANT - MADERA (Continued)

S108054452

EDR ID Number

Completed Document Type: No Further Action Letter

Completed Date: 02/25/2013
Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Remedial Investigation Workplan

Completed Date: 05/09/2007

Comments: DTSC approved the final RI workplan and informing PG&E to implement

site field investigation activities.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Remedial Investigation / Feasibility Study

Completed Date: 06/17/2009

Comments: Draft RI Report Approved as Final w/agreement to undertake additional

groundwater monitoring work to plan for land use controls to be

identified in the RAW.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Removal Action Design

Completed Date: 06/03/2011 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Removal Action Completion Report

Completed Date: 06/28/2012 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Preliminary Endangerment Assessment Report

Completed Date: 04/02/1992

Comments: PEA report dated 4/2/1992 submitted for DTSC review. Site placed on

backlog on 6/8/1995.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 02/05/1987

Comments: Discovery completed.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Community Profile
11/13/2007
Comments: PROJECT WIDE
Not reported
11/13/2007
approved

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Removal Action Workplan

Completed Date: 05/02/2011

Comments: Final RAW Approved.

Completed Area Name: PROJECT WIDE

Distance

Elevation Site Database(s) EPA ID Number

PG&E MANUFACTURED GAS PLANT - MADERA (Continued)

S108054452

EDR ID Number

Completed Sub Area Name: Not reported Completed Document Type: Monitoring Plan Completed Date: 06/30/2009

Comments: Workplan received and accepted. No approval letter issued as Workplan

includes sampling as required and agreed to in eamil exchange dated

6/15, 2009.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Community Profile
Completed Date: 10/01/2010

Comments: Approved an updated CP.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Public Notice
Completed Date: 01/26/2011

Comments: Public Notice approved.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fact Sheets
Completed Date: 01/26/2011

Comments: Completed and approved Fact Sheet.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Work Notice
Completed Date: 06/29/2011
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported

Completed Document Type: Well Completion Report

Completed Date: 06/27/2011 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Preliminary Assessment Report

Completed Date: 05/05/1987 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Site Characterization Workplan

Completed Date: 02/03/2012 Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Date: 04/15/1992
Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

PG&E MANUFACTURED GAS PLANT - MADERA (Continued)

S108054452

Completed Document Type: Removal Action Completion Report

Completed Date: 01/10/2013 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Soils Management Plan

Completed Date: 02/26/2013 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Soils Management Plan

Completed Date: 10/08/2013 Comments: Not reported

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported

Completed Document Type: CEQA - Notice of Exemption

Completed Date: 05/02/2011 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported Completed Document Type: Certification Completed Date: 11/19/2013 Comments: Not reported

Future Area Name: Not reported Not reported Future Sub Area Name: Not reported Future Document Type: Future Due Date: Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Not reported Not reported Schedule Document Type: Schedule Due Date: Not reported Schedule Revised Date: Not reported

COUNTY OF MADERA, BROWNFIELDS CLEANUP RE

WNW 2037 W. CLEVELAND AVENUE

1/2-1 MADERA, CA 93637

0.989 mi. 5224 ft.

103

ENVIROSTOR: Relative:

Lower Facility ID: 20000002 No Further Action Status: Actual: 264 ft. Status Date: 05/16/2011 Site Code: 101710

> Voluntary Cleanup Site Type: Site Type Detailed: Voluntary Cleanup

Acres: 0.1 NPL: NO Regulatory Agencies: **SMBRP** Lead Agency: **SMBRP** Program Manager: Not reported Supervisor: Kevin Shaddy Division Branch: Cleanup San Joaquin S106568250

N/A

ENVIROSTOR

VCP

Direction Distance

Elevation Site Database(s) EPA ID Number

COUNTY OF MADERA, BROWNFIELDS CLEANUP RE (Continued)

S106568250

EDR ID Number

Assembly: 05 Senate: 12

Special Program: Voluntary Cleanup Program

Restricted Use: NO

Site Mgmt Req: NONE SPECIFIED Funding: Responsible Party

Latitude: 36.9744
Longitude: -120.0803
APN: NONE SPECIFIED

Past Use: NONE

Potential COC: NONE SPECIFIED No Contaminants found

Confirmed COC: No Contaminants found

Potential Description: NMA

Alias Name: MADERA COUNTY - BROWNFIELDS CLEANUP RFL

Alias Type: Alternate Name

Alias Name: MADERA COUNTY, BROWNFIELDS CLEANUP REVOL

 Alias Type:
 Alternate Name

 Alias Name:
 110033616424

 Alias Type:
 EPA (FRS #)

 Alias Name:
 101710

Alias Type: Project Code (Site Code)

Alias Name: 20000002

Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 12/16/2009

Comments: Oversight cost estimate letter is dated 12/16/2009.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Voluntary Cleanup Agreement

Completed Date: 10/04/2004

Comments: ORDER/VCA -- A copy of the executed Voluntary Cleanup Agreement (VCA)

for the Brownfields Cleanup Revolving Loan Fund (BCRLF) was transmitted. The VCA includes provisions for providing technical consultative services associated with the BCRLF administration.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 03/31/2010

Comments: US EPA Brownfields Grant Expired on 3/30/2010 and request for final

bill sent.

Future Area Name: Not reported Future Sub Area Name: Not reported Not reported Future Document Type: Future Due Date: Not reported Not reported Schedule Area Name: Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Not reported Schedule Due Date: Schedule Revised Date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

COUNTY OF MADERA, BROWNFIELDS CLEANUP RE (Continued)

S106568250

EDR ID Number

VCP:

Facility ID: 20000002
Site Type: Voluntary Cleanup
Site Type Detail: Voluntary Cleanup
Site Mgmt. Req.: NONE SPECIFIED

Acres: 0.1
National Priorities List: NO
Cleanup Oversight Agencies: SMBRP
Lead Agency: SMBRP

Lead Agency Description: DTSC - Site Cleanup Program

Project Manager: Not reported
Supervisor: Kevin Shaddy
Division Branch: Cleanup San Joaquin

 Site Code:
 101710

 Assembly:
 05

 Senate:
 12

Special Programs Code: Voluntary Cleanup Program

Status: No Further Action
Status Date: 05/16/2011
Restricted Use: NO

Funding: Responsible Party
Lat/Long: 36.9744 / -120.0803
APN: NONE SPECIFIED

Past Use: NONE

Potential COC: NONE SPECIFIED,31000

Confirmed COC: 31000
Potential Description: NMA

Alias Name: MADERA COUNTY - BROWNFIELDS CLEANUP RFL

Alias Type: Alternate Name

Alias Name: MADERA COUNTY, BROWNFIELDS CLEANUP REVOL

 Alias Type:
 Alternate Name

 Alias Name:
 110033616424

 Alias Type:
 EPA (FRS #)

 Alias Name:
 101710

Alias Type: Project Code (Site Code)

Alias Name: 20000002

Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 12/16/2009

Comments: Oversight cost estimate letter is dated 12/16/2009.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Voluntary Cleanup Agreement

Completed Date: 10/04/2004

Comments: ORDER/VCA -- A copy of the executed Voluntary Cleanup Agreement (VCA)

for the Brownfields Cleanup Revolving Loan Fund (BCRLF) was transmitted. The VCA includes provisions for providing technical consultative services associated with the BCRLF administration.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COUNTY OF MADERA, BROWNFIELDS CLEANUP RE (Continued)

S106568250

S101481127

N/A

ENVIROSTOR

CUPA Listings

CERS

CERS HAZ WASTE

Completed Date: 03/31/2010

US EPA Brownfields Grant Expired on 3/30/2010 and request for final Comments:

bill sent.

Future Area Name: Not reported Not reported Future Sub Area Name: Not reported Future Document Type: Future Due Date: Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported

104 MADERA AUTOMATIC TRANSMISSION 905 SOUTH GATEWAY DRIVE SE

1/2-1 MADERA, CA 93637

0.995 mi.

5255 ft. Relative: **ENVIROSTOR:**

271 ft.

Lower Facility ID: Status: Actual:

01/21/1994 Status Date: Site Code: Not reported Site Type: Historical Site Type Detailed: * Historical Acres: Not reported

NPL: NO

NONE SPECIFIED Regulatory Agencies: Lead Agency: NONE SPECIFIED Program Manager: Not reported

Referred - Not Assigned Supervisor: Division Branch: Cleanup Sacramento

Assembly: 05 Senate: 12

Special Program: * Rural County Survey Program

20750006

Refer: RCRA

Restricted Use: NO

Site Mgmt Req: NONE SPECIFIED Funding: Not reported Latitude: 36.95313 Longitude: -120.0516

NONE SPECIFIED APN: Past Use: NONE SPECIFIED Potential COC: NONE SPECIFIED Confirmed COC: NONE SPECIFIED Potential Description: NONE SPECIFIED Alias Name: 20750006

Alias Type: **Envirostor ID Number**

Completed Info:

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported Completed Document Type: * Discovery Completed Date: 10/06/1988

Comments: FACILITY IDENTIFIED DEPARTMENT OF HEALTH SERVICES (DHS) DRIVEBY.

FACILITY DRIVE-BY STAINED GROUND. PART OF SITE APPEARS TO BE FORMER BULK OIL FACILITY TO SOUTHEAST. BUSINESS APPEARS TO BE USING PROPERTY

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA AUTOMATIC TRANSMISSION (Continued)

S101481127

EDR ID Number

FOR STORAGE OF DRUMS ON SITE. GROUND PHOTOS.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 12/16/1988

Comments: SITE SCREENING DONE. RATIONALE FOR REFERRAL TO DHS ENFORCEMENT:

STAINED GROUND, STORAGE OF DRUMS. PENDING STATUS UNTIL INSPECTION.

Future Area Name: Not reported Future Sub Area Name: Not reported Future Document Type: Not reported Future Due Date: Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Not reported Not reported Schedule Document Type: Not reported Schedule Due Date: Schedule Revised Date: Not reported

CERS HAZ WASTE:

Site ID: 132272 CERS ID: 10425859

CERS Description: Hazardous Waste Generator

Violations:

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Violation Date: 07-08-2016

Citation: 40 CFR 1 262.34(d)(5)(ii) - U.S. Code of Federal Regulations, Title

40, Chapter 1, Section(s) 262.34(d)(5)(ii)

Violation Description: Failure to post the following information next to the telephone: (A)

The name and telephone number of the emergency coordinator; (B) Location of fire extinguishers and spill control material, and, if present, fire alarm; and (C) The telephone number of the fire

department, unless the facility has a direct alarm.

Violation Notes: Returned to compliance on 07/08/2016.
Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Violation Date: 09-21-2017

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95,

Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the

business plan is complete and accurate on or before the annual due

date

Violation Notes: Returned to compliance on 09/27/2017.
Violation Division: Madera County Environmental Health

Violation Program: HMRRP
Violation Source: CERS

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Violation Date: 07-08-2016

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA AUTOMATIC TRANSMISSION (Continued)

S101481127

EDR ID Number

12, Section(s) 66262.12

Violation Description: Failure to obtain an Identification Number prior to treating, storing,

disposing of, transporting or offering for transportation any

hazardous waste.

Violation Notes: Returned to compliance on 07/19/2016. HW01: Facility personnel needs

to update EPA ID number

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Violation Date: 07-08-2016

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to establish and electronically submit an adequate training

program in safety procedures in the event of a release or threatened

release of a hazardous material.

Violation Notes: Returned to compliance on 08/30/2016. HM21: Did not observe training

records for 2014-2015. Not all topics are being covered. Will send PPT's that facility can use and sign off on once personnel go over it. uploaded all items on CERS on-site. Minor Violation Escalated to Class

II Violation on 08/29/16.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 07-08-2016

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 07-08-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW Eval Source: CERS

Eval General Type: Other/Unknown Eval Date: 09-21-2017

Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Enforcement Action:

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA AUTOMATIC TRANSMISSION (Continued)

S101481127

EDR ID Number

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Site Address: 905 S GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 07-08-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Site Address: 905 S GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 08-29-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HMRRP Enf Action Source: CERS

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Site Address: 905 S GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 09-21-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HMRRP Enf Action Source: CERS

Coordinates:

Site ID: 132272

Facility Name: MADERA AUTOMATIC TRANSMISSION

Env Int Type Code: HWG
Program ID: 10425859
Coord Name: Not reported
Ref Point Type Desc: Unknown
Latitude: 36.953140
Longitude: -120.051651

Affiliation:

Affiliation Type Desc:
Entity Name:
Entity Title:
Affiliation Address:
Legal Owner
ALLEN, STEVE
Not reported
905 S GATEWAY DR

Affiliation City: MADERA

Affiliation State: CA

MAP FINDINGS Map ID

Direction Distance

Elevation Site Database(s) **EPA ID Number**

MADERA AUTOMATIC TRANSMISSION (Continued)

S101481127

EDR ID Number

Affiliation Country: **United States** Affiliation Zip: 93637 Affiliation Phone: (559) 673-5126

Affiliation Type Desc: Operator Entity Name: Steve Allen Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: (559) 871-2698

Affiliation Type Desc: **Property Owner Entity Name:** Steven J. Allen Entity Title: Not reported Affiliation Address: 905 So. Gateway Dr.

Affiliation City: Madera Affiliation State: CA

United States Affiliation Country: Affiliation Zip: 93637

Affiliation Phone: (559) 871-2698

Affiliation Type Desc: **Environmental Contact**

Entity Name: Steve Allen Entity Title: Not reported

Affiliation Address: 905 SOUTH GATEWAY DRIVE

MADERA Affiliation City: Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

Affiliation Phone: (559) 673-5126

Affiliation Type Desc: Facility Mailing Address Entity Name: Mailing Address Entity Title: Not reported

Affiliation Address: 905 S GATEWAY DR

Affiliation City: MADERA Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637 Affiliation Phone: Not reported

Parent Corporation Affiliation Type Desc:

Entity Name: MADERA AUTOMATIC TRANSMISSION

Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Not reported Affiliation Country: Affiliation Zip: Not reported Affiliation Phone: Not reported

Affiliation Type Desc: **CUPA District**

Entity Name: Madera County Env Health

Entity Title: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA AUTOMATIC TRANSMISSION (Continued)

S101481127

EDR ID Number

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Identification Signer
Entity Name: Steven J. Allen
Entity Title: Owner

Affiliation Address:
Affiliation City:
Affiliation State:
Affiliation Country:
Affiliation Zip:
Affiliation Phone:

Not reported
Not reported
Not reported
Not reported
Not reported
Not reported

Document Preparer Affiliation Type Desc: Entity Name: STEVE ALLEN Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Not reported Affiliation Zip: Affiliation Phone: Not reported

CUPA MADERA:

Contact Name: ALLEN, STEVE
Region: MADERA
Facility Id: FA0101027
Contact Phone: 5596735126

Detail:

Facility Id: FA0101027
Common Name: Acetylene
Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111

Decode for c status: Not reported

Facility Id: FA0101027
Common Name: Argon-37
Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111

Decode for c status: Not reported

Facility Id: FA0101027
Common Name: C25
Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111
Decode for c status: Not reported

Facility Id: FA0101027

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA AUTOMATIC TRANSMISSION (Continued)

S101481127

EDR ID Number

Common Name: dexron atf

Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111
Decode for c status: Not reported

Facility Id: FA0101027
Common Name: Kerosene
Current Status: 01

Program/Elements: Haz Mat Inventory

PE1: 2164

Decode for c status: Not reported

Facility Id: FA0101027
Common Name: Oxygen
Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111

Decode for c status: Not reported

Facility Id: FA0101027 Common Name: Used oils

Current Status: 01

Program/Elements: Hazardous Material Handler - Range 1

PE1: 2111

Decode for c status: Not reported

Facility Id: FA0101027 Common Name: USED DRAIN OIL

Current Status: 01

Program/Elements: Haz Mat Inventory

PE1: 2164

Decode for c status: Not reported

CERS TANKS:

Site ID: 132272 CERS ID: 10425859

CERS Description: Chemical Storage Facilities

Violations:

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Violation Date: 07-08-2016

Citation: 40 CFR 1 262.34(d)(5)(ii) - U.S. Code of Federal Regulations, Title

40, Chapter 1, Section(s) 262.34(d)(5)(ii)

Violation Description: Failure to post the following information next to the telephone: (A)

The name and telephone number of the emergency coordinator; (B) Location of fire extinguishers and spill control material, and, if present, fire alarm; and (C) The telephone number of the fire

department, unless the facility has a direct alarm.

Violation Notes: Returned to compliance on 07/08/2016.
Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 132272

Map ID MAP FINDINGS
Direction

Direction

Elevation Site Database(s) EPA ID Number

MADERA AUTOMATIC TRANSMISSION (Continued)

S101481127

EDR ID Number

Site Name: MADERA AUTOMATIC TRANSMISSION

Violation Date: 09-21-2017

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95,

Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the

business plan is complete and accurate on or before the annual due

date.

Violation Notes: Returned to compliance on 09/27/2017. Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Violation Date: 07-08-2016

Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter

12, Section(s) 66262.12

Violation Description: Failure to obtain an Identification Number prior to treating, storing,

disposing of, transporting or offering for transportation any

hazardous waste.

Violation Notes: Returned to compliance on 07/19/2016. HW01: Facility personnel needs

to update EPA ID number

Violation Division: Madera County Environmental Health

Violation Program: HW
Violation Source: CERS

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Violation Date: 07-08-2016

Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter

6.95, Section(s) 25508(a)(1)

Violation Description: Failure to establish and electronically submit an adequate training

program in safety procedures in the event of a release or threatened

release of a hazardous material.

Violation Notes: Returned to compliance on 08/30/2016. HM21: Did not observe training

records for 2014-2015. Not all topics are being covered. Will send PPT's that facility can use and sign off on once personnel go over it. uploaded all items on CERS on-site. Minor Violation Escalated to Class

II Violation on 08/29/16.

Violation Division: Madera County Environmental Health

Violation Program: HMRRP Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 07-08-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 07-08-2016 Violations Found: Yes

Eval Type: Routine done by local agency

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA AUTOMATIC TRANSMISSION (Continued)

S101481127

EDR ID Number

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HW
Eval Source: CERS

Eval General Type: Other/Unknown
Eval Date: 09-21-2017
Violations Found: Yes

Eval Type: Other, not routine, done by local agency

Eval Notes: Not reported

Eval Division: Madera County Environmental Health

Eval Program: HMRRP Eval Source: CERS

Enforcement Action:

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Site Address: 905 S GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 07-08-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HW
Enf Action Source: CERS

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Site Address: 905 S GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 08-29-2016

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HMRRP
Enf Action Source: CERS

Site ID: 132272

Site Name: MADERA AUTOMATIC TRANSMISSION

Site Address: 905 S GATEWAY DR

 Site City:
 MADERA

 Site Zip:
 93637

 Enf Action Date:
 09-21-2017

Enf Action Type: Notice of Violation (Unified Program)

Enf Action Description: Notice of Violation Issued by the Inspector at the Time of Inspection

Enf Action Notes: Not reported

Enf Action Division: Madera County Environmental Health

Enf Action Program: HMRRP Enf Action Source: CERS

Coordinates:

Site ID: 132272

Direction Distance

Elevation Site Database(s) EPA ID Number

MADERA AUTOMATIC TRANSMISSION (Continued)

S101481127

EDR ID Number

Facility Name: MADERA AUTOMATIC TRANSMISSION

Env Int Type Code: HWG
Program ID: 10425859
Coord Name: Not reported
Ref Point Type Desc: Unknown
Latitude: 36.953140
Longitude: -120.051651

Affiliation:

Affiliation Type Desc: Legal Owner
Entity Name: ALLEN, STEVE
Entity Title: Not reported

Affiliation Address: 905 S GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: United States
Affiliation Zip: 93637

Affiliation Phone: (559) 673-5126

Affiliation Type Desc: Operator Entity Name: Steve Allen Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Affiliation Country: Not reported Affiliation Zip: Not reported Affiliation Phone: (559) 871-2698

Affiliation Type Desc: Property Owner
Entity Name: Steven J. Allen
Entity Title: Not reported

Affiliation Address: Property Owner

Affiliation Address: 905 So. Gateway Dr.

Affiliation City: Madera
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 93637
Affiliation Phone: (559) 871-2698

Affiliation Type Desc: Environmental Contact

Entity Name: Steve Allen
Entity Title: Not reported

Affiliation Address: 905 SOUTH GATEWAY DRIVE

Affiliation City: MADERA
Affiliation State: CA
Affiliation Country: Not report

Affiliation Country: Not reported
Affiliation Zip: 93637
Affiliation Phone: (559) 673-5126

Affiliation Type Desc: Facility Mailing Address

Entity Name: Mailing Address
Entity Title: Not reported

Affiliation Address: 905 S GATEWAY DR

Affiliation City: MADERA
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

Distance

Elevation Site Database(s) EPA ID Number

MADERA AUTOMATIC TRANSMISSION (Continued)

S101481127

EDR ID Number

Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation

Entity Name: MADERA AUTOMATIC TRANSMISSION

Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District

Entity Name: Madera County Env Health

Entity Title: Not reported

Affiliation Address: 200 W. 4th StreetSuite 3100

Affiliation City: Madera
Affiliation State: CA

Affiliation Country: Not reported Affiliation Zip: 93637

Affiliation Phone: (559) 675-7823

Affiliation Type Desc: Identification Signer Entity Name: Steven J. Allen

Entity Title: Owner
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: **Document Preparer** Entity Name: STEVE ALLEN Entity Title: Not reported Affiliation Address: Not reported Affiliation City: Not reported Affiliation State: Not reported Not reported Affiliation Country: Affiliation Zip: Not reported Affiliation Phone: Not reported

Count: 3 records. ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
MADERA	S101481107	LEON'S PLACE AND FIX IT	EAST OF NORTH GATEWAY DR/HIGHW	93637	ENVIROSTOR
MADERA	S100185578	LOT SOUTH OF VALLEY WHOLESALE BLDG	SOUTH OF EAST CENTRAL BETWEEN	93637	ENVIROSTOR
MADERA	S100181547	LANDFILL #1	RAYMOND ROAD OFF OF CLEVELAND	93637	ENVIROSTOR

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 03/11/2019 Source: EPA
Date Data Arrived at EDR: 03/14/2019 Telephone: N/A

Number of Days to Update: 18 Next Scheduled EDR Contact: 07/15/2019
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources

EPA's Environmental Photographic Interpretation Center (EPIC)

Telephone: 202-564-7333

EPA Region 1 EPA Region 6

Telephone 617-918-1143 Telephone: 214-655-6659

EPA Region 3 EPA Region 7

Telephone 215-814-5418 Telephone: 913-551-7247

EPA Region 4 EPA Region 8

Telephone 404-562-8033 Telephone: 303-312-6774

EPA Region 5 EPA Region 9

Telephone 312-886-6686 Telephone: 415-947-4246

EPA Region 10

Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 03/11/2019 Date Data Arrived at EDR: 03/14/2019

Date Made Active in Reports: 04/01/2019

Number of Days to Update: 18

Source: EPA Telephone: N/A

Last EDR Contact: 04/05/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991 Date Data Arrived at EDR: 02/02/1994 Date Made Active in Reports: 03/30/1994

Number of Days to Update: 56

Source: EPA

Telephone: 202-564-4267 Last EDR Contact: 08/15/2011

Next Scheduled EDR Contact: 11/28/2011 Data Release Frequency: No Update Planned

Federal Delisted NPL site list

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 03/11/2019 Date Data Arrived at EDR: 03/14/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 18

Source: EPA Telephone: N/A

Last EDR Contact: 04/05/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Quarterly

Federal CERCLIS list

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 11/07/2016 Date Data Arrived at EDR: 01/05/2017 Date Made Active in Reports: 04/07/2017

Number of Days to Update: 92

Source: Environmental Protection Agency Telephone: 703-603-8704

Last EDR Contact: 04/05/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly know as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 02/06/2019 Date Data Arrived at EDR: 02/15/2019 Date Made Active in Reports: 03/15/2019

Number of Days to Update: 28

Source: EPA Telephone: 800-424-9346 Last EDR Contact: 03/14/2019

Next Scheduled EDR Contact: 04/29/2019 Data Release Frequency: Quarterly

Federal CERCLIS NFRAP site list

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 02/06/2019 Date Data Arrived at EDR: 02/15/2019 Date Made Active in Reports: 03/15/2019

Number of Days to Update: 28

Source: EPA

Telephone: 800-424-9346 Last EDR Contact: 03/14/2019

Next Scheduled EDR Contact: 04/29/2019 Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 03/01/2018 Date Data Arrived at EDR: 03/28/2018 Date Made Active in Reports: 06/22/2018

Number of Days to Update: 86

Source: EPA

Telephone: 800-424-9346 Last EDR Contact: 03/27/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 03/01/2018 Date Data Arrived at EDR: 03/28/2018 Date Made Active in Reports: 06/22/2018

Number of Days to Update: 86

Source: Environmental Protection Agency

Telephone: (415) 495-8895 Last EDR Contact: 03/27/2019

Next Scheduled EDR Contact: 07/08/2019
Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/01/2018 Date Data Arrived at EDR: 03/28/2018 Date Made Active in Reports: 06/22/2018

Number of Days to Update: 86

Source: Environmental Protection Agency

Telephone: (415) 495-8895 Last EDR Contact: 03/27/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 03/01/2018 Date Data Arrived at EDR: 03/28/2018 Date Made Active in Reports: 06/22/2018

Number of Days to Update: 86

Source: Environmental Protection Agency

Telephone: (415) 495-8895 Last EDR Contact: 03/27/2019

Next Scheduled EDR Contact: 07/08/2019
Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/01/2018 Date Data Arrived at EDR: 03/28/2018 Date Made Active in Reports: 06/22/2018

Number of Days to Update: 86

Source: Environmental Protection Agency

Telephone: (415) 495-8895 Last EDR Contact: 03/27/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Quarterly

Federal institutional controls / engineering controls registries

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 10/17/2018 Date Data Arrived at EDR: 10/25/2018 Date Made Active in Reports: 12/07/2018

Number of Days to Update: 43

Source: Department of the Navy Telephone: 843-820-7326 Last EDR Contact: 02/07/2019

Next Scheduled EDR Contact: 05/27/2019 Data Release Frequency: Varies

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 01/31/2019 Date Data Arrived at EDR: 02/04/2019 Date Made Active in Reports: 03/08/2019

Number of Days to Update: 32

Source: Environmental Protection Agency

Telephone: 703-603-0695 Last EDR Contact: 02/04/2019

Next Scheduled EDR Contact: 06/10/2019 Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 01/31/2019 Date Data Arrived at EDR: 02/04/2019 Date Made Active in Reports: 03/08/2019

Number of Days to Update: 32

Source: Environmental Protection Agency

Telephone: 703-603-0695 Last EDR Contact: 02/04/2019

Next Scheduled EDR Contact: 06/10/2019

Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous

substances.

Date of Government Version: 02/04/2019 Date Data Arrived at EDR: 02/08/2019 Date Made Active in Reports: 03/08/2019

Number of Days to Update: 28

Source: National Response Center, United States Coast Guard

Telephone: 202-267-2180 Last EDR Contact: 03/26/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Quarterly

State- and tribal - equivalent NPL

RESPONSE: State Response Sites

Identifies confirmed release sites where DTSC is involved in remediation, either in a lead or oversight capacity.

These confirmed release sites are generally high-priority and high potential risk.

Date of Government Version: 01/28/2019
Date Data Arrived at EDR: 01/29/2019
Date Made Active in Reports: 03/05/2019

Number of Days to Update: 35

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 01/29/2019

Next Scheduled EDR Contact: 05/11/2019 Data Release Frequency: Quarterly

State- and tribal - equivalent CERCLIS

ENVIROSTOR: EnviroStor Database

The Department of Toxic Substances Control's (DTSC's) Site Mitigation and Brownfields Reuse Program's (SMBRP's) EnviroStor database identifes sites that have known contamination or sites for which there may be reasons to investigate further. The database includes the following site types: Federal Superfund sites (National Priorities List (NPL)); State Response, including Military Facilities and State Superfund; Voluntary Cleanup; and School sites. EnviroStor provides similar information to the information that was available in CalSites, and provides additional site information, including, but not limited to, identification of formerly-contaminated properties that have been released for reuse, properties where environmental deed restrictions have been recorded to prevent inappropriate land uses, and risk characterization information that is used to assess potential impacts to public health and the environment at contaminated sites.

Date of Government Version: 01/28/2019 Date Data Arrived at EDR: 01/29/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 35

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 01/29/2019

Next Scheduled EDR Contact: 05/11/2019 Data Release Frequency: Quarterly

State and tribal landfill and/or solid waste disposal site lists

SWF/LF (SWIS): Solid Waste Information System

Active, Closed and Inactive Landfills. SWF/LF records typically contain an inventory of solid waste disposal facilities or landfills. These may be active or inactive facilities or open dumps that failed to meet RCRA Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 02/11/2019 Date Data Arrived at EDR: 02/12/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 21

Source: Department of Resources Recycling and Recovery

Telephone: 916-341-6320 Last EDR Contact: 02/12/2019

Next Scheduled EDR Contact: 05/27/2019 Data Release Frequency: Quarterly

State and tribal leaking storage tank lists

LUST REG 1: Active Toxic Site Investigation

Del Norte, Humboldt, Lake, Mendocino, Modoc, Siskiyou, Sonoma, Trinity counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 02/01/2001 Date Data Arrived at EDR: 02/28/2001 Date Made Active in Reports: 03/29/2001

Number of Days to Update: 29

Source: California Regional Water Quality Control Board North Coast (1)

Telephone: 707-570-3769 Last EDR Contact: 08/01/2011

Next Scheduled EDR Contact: 11/14/2011 Data Release Frequency: No Update Planned

LUST REG 7: Leaking Underground Storage Tank Case Listing

Leaking Underground Storage Tank locations. Imperial, Riverside, San Diego, Santa Barbara counties.

Date of Government Version: 02/26/2004 Date Data Arrived at EDR: 02/26/2004 Date Made Active in Reports: 03/24/2004

Number of Days to Update: 27

Source: California Regional Water Quality Control Board Colorado River Basin Region (7)

Telephone: 760-776-8943 Last EDR Contact: 08/01/2011

Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: No Update Planned

LUST REG 8: Leaking Underground Storage Tanks

California Regional Water Quality Control Board Santa Ana Region (8). For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 02/14/2005 Date Data Arrived at EDR: 02/15/2005 Date Made Active in Reports: 03/28/2005

Number of Days to Update: 41

Source: California Regional Water Quality Control Board Santa Ana Region (8)

Telephone: 909-782-4496 Last EDR Contact: 08/15/2011

Next Scheduled EDR Contact: 11/28/2011

Data Release Frequency: Varies

LUST REG 6V: Leaking Underground Storage Tank Case Listing

Leaking Underground Storage Tank locations. Inyo, Kern, Los Angeles, Mono, San Bernardino counties.

Date of Government Version: 06/07/2005 Date Data Arrived at EDR: 06/07/2005 Date Made Active in Reports: 06/29/2005

Number of Days to Update: 22

Source: California Regional Water Quality Control Board Victorville Branch Office (6)

Telephone: 760-241-7365 Last EDR Contact: 09/12/2011

Next Scheduled EDR Contact: 12/26/2011 Data Release Frequency: No Update Planned

LUST REG 6L: Leaking Underground Storage Tank Case Listing

For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 09/09/2003 Date Data Arrived at EDR: 09/10/2003 Date Made Active in Reports: 10/07/2003

Number of Days to Update: 27

Source: California Regional Water Quality Control Board Lahontan Region (6)

Telephone: 530-542-5572 Last EDR Contact: 09/12/2011

Next Scheduled EDR Contact: 12/26/2011 Data Release Frequency: No Update Planned

LUST REG 5: Leaking Underground Storage Tank Database

Leaking Underground Storage Tank locations. Alameda, Alpine, Amador, Butte, Colusa, Contra Costa, Calveras, El Dorado, Fresno, Glenn, Kern, Kings, Lake, Lassen, Madera, Mariposa, Merced, Modoc, Napa, Nevada, Placer, Plumas, Sacramento, San Joaquin, Shasta, Solano, Stanislaus, Sutter, Tehama, Tulare, Tuolumne, Yolo, Yuba counties.

Date of Government Version: 07/01/2008 Date Data Arrived at EDR: 07/22/2008 Date Made Active in Reports: 07/31/2008

Number of Days to Update: 9

Source: California Regional Water Quality Control Board Central Valley Region (5)

Telephone: 916-464-4834 Last EDR Contact: 07/01/2011

Next Scheduled EDR Contact: 10/17/2011 Data Release Frequency: No Update Planned

LUST: Leaking Underground Fuel Tank Report (GEOTRACKER)

Leaking Underground Storage Tank (LUST) Sites included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: see region list Last EDR Contact: 12/11/2018

Next Scheduled EDR Contact: 03/25/2019 Data Release Frequency: Quarterly

LUST REG 2: Fuel Leak List

Leaking Underground Storage Tank locations. Alameda, Contra Costa, Marin, Napa, San Francisco, San Mateo, Santa

Clara, Solano, Sonoma counties.

Date of Government Version: 09/30/2004 Date Data Arrived at EDR: 10/20/2004 Date Made Active in Reports: 11/19/2004

Number of Days to Update: 30

Source: California Regional Water Quality Control Board San Francisco Bay Region (2)

Telephone: 510-622-2433 Last EDR Contact: 09/19/2011

Next Scheduled EDR Contact: 01/02/2012 Data Release Frequency: Quarterly

LUST REG 3: Leaking Underground Storage Tank Database

Leaking Underground Storage Tank locations. Monterey, San Benito, San Luis Obispo, Santa Barbara, Santa Cruz counties.

Date of Government Version: 05/19/2003 Date Data Arrived at EDR: 05/19/2003 Date Made Active in Reports: 06/02/2003

Number of Days to Update: 14

Source: California Regional Water Quality Control Board Central Coast Region (3)

Telephone: 805-542-4786 Last EDR Contact: 07/18/2011

Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: No Update Planned

LUST REG 4: Underground Storage Tank Leak List

Los Angeles, Ventura counties. For more current information, please refer to the State Water Resources Control

Board's LUST database.

Date of Government Version: 09/07/2004 Date Data Arrived at EDR: 09/07/2004 Date Made Active in Reports: 10/12/2004

Number of Days to Update: 35

Source: California Regional Water Quality Control Board Los Angeles Region (4)

Telephone: 213-576-6710 Last EDR Contact: 09/06/2011

Next Scheduled EDR Contact: 12/19/2011
Data Release Frequency: No Update Planned

LUST REG 9: Leaking Underground Storage Tank Report

Orange, Riverside, San Diego counties. For more current information, please refer to the State Water Resources

Control Board's LUST database.

Date of Government Version: 03/01/2001 Date Data Arrived at EDR: 04/23/2001 Date Made Active in Reports: 05/21/2001

Number of Days to Update: 28

Source: California Regional Water Quality Control Board San Diego Region (9)

Telephone: 858-637-5595 Last EDR Contact: 09/26/2011

Next Scheduled EDR Contact: 01/09/2012 Data Release Frequency: No Update Planned

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 04/12/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 10 Telephone: 206-553-2857 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 04/10/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: Environmental Protection Agency

Telephone: 415-972-3372 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 04/25/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 8 Telephone: 303-312-6271 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 04/24/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 7 Telephone: 913-551-7003 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 04/01/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 6 Telephone: 214-665-6597 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 05/08/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 4 Telephone: 404-562-8677 Last EDR Contact: 03/05/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/13/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 1 Telephone: 617-918-1313 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land

Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 04/12/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA, Region 5 Telephone: 312-886-7439 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

CPS-SLIC: Statewide SLIC Cases (GEOTRACKER)

Cleanup Program Sites (CPS; also known as Site Cleanups [SC] and formerly known as Spills, Leaks, Investigations, and Cleanups [SLIC] sites) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resources Control Board Telephone: 866-480-1028

Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019

Data Release Frequency: Varies

SLIC REG 1: Active Toxic Site Investigations

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 04/03/2003 Date Data Arrived at EDR: 04/07/2003 Date Made Active in Reports: 04/25/2003

Number of Days to Update: 18

Source: California Regional Water Quality Control Board, North Coast Region (1)

Telephone: 707-576-2220 Last EDR Contact: 08/01/2011

Next Scheduled EDR Contact: 11/14/2011 Data Release Frequency: No Update Planned

SLIC REG 2: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 09/30/2004 Date Data Arrived at EDR: 10/20/2004 Date Made Active in Reports: 11/19/2004

Number of Days to Update: 30

Source: Regional Water Quality Control Board San Francisco Bay Region (2)

Telephone: 510-286-0457 Last EDR Contact: 09/19/2011

Next Scheduled EDR Contact: 01/02/2012 Data Release Frequency: Quarterly

SLIC REG 3: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 05/18/2006 Date Data Arrived at EDR: 05/18/2006 Date Made Active in Reports: 06/15/2006

Number of Days to Update: 28

Source: California Regional Water Quality Control Board Central Coast Region (3)

Telephone: 805-549-3147 Last EDR Contact: 07/18/2011

Next Scheduled EDR Contact: 10/31/2011 Data Release Frequency: Semi-Annually

SLIC REG 4: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 11/17/2004 Date Data Arrived at EDR: 11/18/2004 Date Made Active in Reports: 01/04/2005

Number of Days to Update: 47

Source: Region Water Quality Control Board Los Angeles Region (4)

Telephone: 213-576-6600 Last EDR Contact: 07/01/2011

Next Scheduled EDR Contact: 10/17/2011

Data Release Frequency: Varies

SLIC REG 5: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 04/01/2005 Date Data Arrived at EDR: 04/05/2005 Date Made Active in Reports: 04/21/2005

Number of Days to Update: 16

Source: Regional Water Quality Control Board Central Valley Region (5)

Telephone: 916-464-3291 Last EDR Contact: 09/12/2011

Next Scheduled EDR Contact: 12/26/2011 Data Release Frequency: Semi-Annually

SLIC REG 6V: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 05/24/2005 Date Data Arrived at EDR: 05/25/2005 Date Made Active in Reports: 06/16/2005

Number of Days to Update: 22

Source: Regional Water Quality Control Board, Victorville Branch

Telephone: 619-241-6583 Last EDR Contact: 08/15/2011

Next Scheduled EDR Contact: 11/28/2011 Data Release Frequency: Semi-Annually

SLIC REG 6L: SLIC Sites

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 09/07/2004 Date Data Arrived at EDR: 09/07/2004 Date Made Active in Reports: 10/12/2004

Number of Days to Update: 35

Source: California Regional Water Quality Control Board, Lahontan Region

Telephone: 530-542-5574 Last EDR Contact: 08/15/2011

Next Scheduled EDR Contact: 11/28/2011 Data Release Frequency: No Update Planned

SLIC REG 7: SLIC List

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 11/24/2004 Date Data Arrived at EDR: 11/29/2004 Date Made Active in Reports: 01/04/2005

Number of Days to Update: 36

Source: California Regional Quality Control Board, Colorado River Basin Region

Telephone: 760-346-7491 Last EDR Contact: 08/01/2011

Next Scheduled EDR Contact: 11/14/2011 Data Release Frequency: No Update Planned

SLIC REG 8: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 04/03/2008 Date Data Arrived at EDR: 04/03/2008 Date Made Active in Reports: 04/14/2008

Number of Days to Update: 11

Source: California Region Water Quality Control Board Santa Ana Region (8)

Telephone: 951-782-3298 Last EDR Contact: 09/12/2011

Next Scheduled EDR Contact: 12/26/2011 Data Release Frequency: Semi-Annually

SLIC REG 9: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 09/10/2007 Date Data Arrived at EDR: 09/11/2007 Date Made Active in Reports: 09/28/2007

Number of Days to Update: 17

Source: California Regional Water Quality Control Board San Diego Region (9)

Telephone: 858-467-2980 Last EDR Contact: 08/08/2011

Next Scheduled EDR Contact: 11/21/2011 Data Release Frequency: Annually

State and tribal registered storage tank lists

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 05/15/2017 Date Data Arrived at EDR: 05/30/2017 Date Made Active in Reports: 10/13/2017

Number of Days to Update: 136

Source: FEMA

Telephone: 202-646-5797 Last EDR Contact: 04/12/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Varies

UST CLOSURE: Proposed Closure of Underground Storage Tank (UST) Cases

UST cases that are being considered for closure by either the State Water Resources Control Board or the Executive Director have been posted for a 60-day public comment period. UST Case Closures being proposed for consideration by the State Water Resources Control Board. These are primarily UST cases that meet closure criteria under the decisional framework in State Water Board Resolution No. 92-49 and other Board orders. UST Case Closures proposed for consideration by the Executive Director pursuant to State Water Board Resolution No. 2012-0061. These are cases that meet the criteria of the Low-Threat UST Case Closure Policy. UST Case Closure Review Denials and Approved Orders.

Date of Government Version: 03/11/2019 Date Data Arrived at EDR: 03/13/2019 Date Made Active in Reports: 04/03/2019

Number of Days to Update: 21

Source: State Water Resources Control Board

Telephone: 916-327-7844 Last EDR Contact: 03/13/2019

Next Scheduled EDR Contact: 06/24/2019 Data Release Frequency: Varies

MILITARY UST SITES: Military UST Sites (GEOTRACKER)

Military ust sites

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: 866-480-1028 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019 Data Release Frequency: Varies

UST: Active UST Facilities

Active UST facilities gathered from the local regulatory agencies

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: SWRCB Telephone: 916-341-5851 Last EDR Contact: 12/11/2018

Next Scheduled EDR Contact: 03/25/2019 Data Release Frequency: Semi-Annually

AST: Aboveground Petroleum Storage Tank Facilities

A listing of aboveground storage tank petroleum storage tank locations.

Date of Government Version: 07/06/2016 Date Data Arrived at EDR: 07/12/2016 Date Made Active in Reports: 09/19/2016

Number of Days to Update: 69

Source: California Environmental Protection Agency

Telephone: 916-327-5092 Last EDR Contact: 03/18/2019

Next Scheduled EDR Contact: 07/01/2019 Data Release Frequency: Quarterly

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 04/12/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 10 Telephone: 206-553-2857 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 04/10/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 9 Telephone: 415-972-3368 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 04/25/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 8 Telephone: 303-312-6137 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 04/24/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 7 Telephone: 913-551-7003 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 04/01/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 6 Telephone: 214-665-7591 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 04/13/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA, Region 1 Telephone: 617-918-1313 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 05/08/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 4 Telephone: 404-562-9424 Last EDR Contact: 03/05/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 04/12/2018 Date Data Arrived at EDR: 05/18/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 63

Source: EPA Region 5 Telephone: 312-886-6136 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

State and tribal voluntary cleanup sites

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015 Date Data Arrived at EDR: 09/29/2015 Date Made Active in Reports: 02/18/2016

Number of Days to Update: 142

Source: EPA, Region 1 Telephone: 617-918-1102 Last EDR Contact: 03/25/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Varies

VCP: Voluntary Cleanup Program Properties

Contains low threat level properties with either confirmed or unconfirmed releases and the project proponents have request that DTSC oversee investigation and/or cleanup activities and have agreed to provide coverage for DTSC's costs.

Date of Government Version: 01/28/2019 Date Data Arrived at EDR: 01/29/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 35

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 01/29/2019

Next Scheduled EDR Contact: 05/11/2019 Data Release Frequency: Quarterly

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008 Date Data Arrived at EDR: 04/22/2008 Date Made Active in Reports: 05/19/2008

Number of Days to Update: 27

Source: EPA, Region 7 Telephone: 913-551-7365 Last EDR Contact: 04/20/2009

Next Scheduled EDR Contact: 07/20/2009 Data Release Frequency: Varies

State and tribal Brownfields sites

BROWNFIELDS: Considered Brownfieds Sites Listing

A listing of sites the SWRCB considers to be Brownfields since these are sites have come to them through the MOA Process

Date of Government Version: 12/20/2018 Date Data Arrived at EDR: 12/21/2018 Date Made Active in Reports: 02/28/2019

Number of Days to Update: 69

Source: State Water Resources Control Board

Telephone: 916-323-7905 Last EDR Contact: 03/26/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Quarterly

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 12/17/2018 Date Data Arrived at EDR: 12/18/2018 Date Made Active in Reports: 01/11/2019

Number of Days to Update: 24

Source: Environmental Protection Agency

Telephone: 202-566-2777 Last EDR Contact: 03/19/2019

Next Scheduled EDR Contact: 07/01/2019 Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

WMUDS/SWAT: Waste Management Unit Database

Waste Management Unit Database System. WMUDS is used by the State Water Resources Control Board staff and the Regional Water Quality Control Boards for program tracking and inventory of waste management units. WMUDS is composed of the following databases: Facility Information, Scheduled Inspections Information, Waste Management Unit Information, SWAT Program Information, SWAT Report Summary Information, SWAT Report Summary Data, Chapter 15 (formerly Subchapter 15) Information, Chapter 15 Monitoring Parameters, TPCA Program Information, RCRA Program Information, Closure Information, and Interested Parties Information.

Date of Government Version: 04/01/2000 Date Data Arrived at EDR: 04/10/2000 Date Made Active in Reports: 05/10/2000

Number of Days to Update: 30

Source: State Water Resources Control Board

Telephone: 916-227-4448 Last EDR Contact: 01/28/2019

Next Scheduled EDR Contact: 05/11/2019
Data Release Frequency: No Update Planned

SWRCY: Recycler Database

A listing of recycling facilities in California.

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/12/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 34

Source: Department of Conservation

Telephone: 916-323-3836 Last EDR Contact: 03/13/2019

Next Scheduled EDR Contact: 06/24/2019 Data Release Frequency: Quarterly

HAULERS: Registered Waste Tire Haulers Listing A listing of registered waste tire haulers.

Date of Government Version: 02/09/2019
Date Data Arrived at EDR: 02/12/2019
Date Made Active in Reports: 03/27/2019

Number of Days to Update: 43

Source: Integrated Waste Management Board

Telephone: 916-341-6422 Last EDR Contact: 03/26/2019

Next Scheduled EDR Contact: 05/27/2019 Data Release Frequency: Varies

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998 Date Data Arrived at EDR: 12/03/2007 Date Made Active in Reports: 01/24/2008

Number of Days to Update: 52

Source: Environmental Protection Agency

Telephone: 703-308-8245 Last EDR Contact: 01/29/2019

Next Scheduled EDR Contact: 05/13/2019 Data Release Frequency: Varies

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258

Subtitle D Criteria.

Date of Government Version: 06/30/1985 Date Data Arrived at EDR: 08/09/2004 Date Made Active in Reports: 09/17/2004

Number of Days to Update: 39

Source: Environmental Protection Agency

Telephone: 800-424-9346 Last EDR Contact: 06/09/2004 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009 Date Data Arrived at EDR: 05/07/2009 Date Made Active in Reports: 09/21/2009

Number of Days to Update: 137

Source: EPA, Region 9 Telephone: 415-947-4219 Last EDR Contact: 01/17/2019

Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: No Update Planned

IHS OPEN DUMPS: Open Dumps on Indian Land

A listing of all open dumps located on Indian Land in the United States.

Date of Government Version: 04/01/2014 Date Data Arrived at EDR: 08/06/2014 Date Made Active in Reports: 01/29/2015

Number of Days to Update: 176

Source: Department of Health & Human Serivces, Indian Health Service

Telephone: 301-443-1452 Last EDR Contact: 02/01/2019

Next Scheduled EDR Contact: 05/13/2019 Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 09/21/2018 Date Data Arrived at EDR: 09/21/2018 Date Made Active in Reports: 11/09/2018

Number of Days to Update: 49

Source: Drug Enforcement Administration

Telephone: 202-307-1000 Last EDR Contact: 02/21/2019

Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: No Update Planned

HIST CAL-SITES: Calsites Database

The Calsites database contains potential or confirmed hazardous substance release properties. In 1996, California EPA reevaluated and significantly reduced the number of sites in the Calsites database. No longer updated by the state agency. It has been replaced by ENVIROSTOR.

Date of Government Version: 08/08/2005 Date Data Arrived at EDR: 08/03/2006 Date Made Active in Reports: 08/24/2006

Number of Days to Update: 21

Source: Department of Toxic Substance Control

Telephone: 916-323-3400 Last EDR Contact: 02/23/2009

Next Scheduled EDR Contact: 05/25/2009 Data Release Frequency: No Update Planned

SCH: School Property Evaluation Program

This category contains proposed and existing school sites that are being evaluated by DTSC for possible hazardous materials contamination. In some cases, these properties may be listed in the CalSites category depending on the level of threat to public health and safety or the environment they pose.

Date of Government Version: 01/28/2019 Date Data Arrived at EDR: 01/29/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 35

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 01/29/2019

Next Scheduled EDR Contact: 05/11/2019 Data Release Frequency: Quarterly

CDL: Clandestine Drug Labs

A listing of drug lab locations. Listing of a location in this database does not indicate that any illegal drug lab materials were or were not present there, and does not constitute a determination that the location either requires or does not require additional cleanup work.

Date of Government Version: 12/31/2017 Date Data Arrived at EDR: 06/12/2018 Date Made Active in Reports: 08/06/2018

Number of Days to Update: 55

Source: Department of Toxic Substances Control

Telephone: 916-255-6504 Last EDR Contact: 04/08/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Varies

CERS HAZ WASTE: CERS HAZ WASTE

List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the Hazardous Chemical Management, Hazardous Waste Onsite Treatment, Household Hazardous Waste Collection, Hazardous Waste Generator, and RCRA LQ HW Generator programs.

Date of Government Version: 10/22/2018 Date Data Arrived at EDR: 10/23/2018 Date Made Active in Reports: 11/30/2018

Number of Days to Update: 38

Source: CalEPA Telephone: 916-323-2514 Last EDR Contact: 04/11/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Quarterly

TOXIC PITS: Toxic Pits Cleanup Act Sites

Toxic PITS Cleanup Act Sites. TOXIC PITS identifies sites suspected of containing hazardous substances where cleanup has not yet been completed.

Date of Government Version: 07/01/1995 Date Data Arrived at EDR: 08/30/1995 Date Made Active in Reports: 09/26/1995

Number of Days to Update: 27

Source: State Water Resources Control Board

Telephone: 916-227-4364 Last EDR Contact: 01/26/2009

Next Scheduled EDR Contact: 04/27/2009 Data Release Frequency: No Update Planned

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 09/21/2018 Date Data Arrived at EDR: 09/21/2018 Date Made Active in Reports: 11/09/2018

Number of Days to Update: 49

Source: Drug Enforcement Administration Telephone: 202-307-1000

Last EDR Contact: 02/21/2019

Next Scheduled EDR Contact: 06/10/2019 Data Release Frequency: Quarterly

Local Lists of Registered Storage Tanks

SWEEPS UST: SWEEPS UST Listing

Statewide Environmental Evaluation and Planning System. This underground storage tank listing was updated and maintained by a company contacted by the SWRCB in the early 1990's. The listing is no longer updated or maintained. The local agency is the contact for more information on a site on the SWEEPS list.

Date of Government Version: 06/01/1994 Date Data Arrived at EDR: 07/07/2005 Date Made Active in Reports: 08/11/2005

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: N/A

Last EDR Contact: 06/03/2005 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

UST MENDOCINO: Mendocino County UST Database

A listing of underground storage tank locations in Mendocino County.

Date of Government Version: 12/04/2018 Date Data Arrived at EDR: 12/06/2018 Date Made Active in Reports: 12/14/2018

Number of Days to Update: 8

Source: Department of Public Health Telephone: 707-463-4466 Last EDR Contact: 02/21/2019

Next Scheduled EDR Contact: 06/10/2019 Data Release Frequency: Annually

HIST UST: Hazardous Substance Storage Container Database

The Hazardous Substance Storage Container Database is a historical listing of UST sites. Refer to local/county source for current data.

Date of Government Version: 10/15/1990 Date Data Arrived at EDR: 01/25/1991 Date Made Active in Reports: 02/12/1991

Number of Days to Update: 18

Source: State Water Resources Control Board

Telephone: 916-341-5851 Last EDR Contact: 07/26/2001 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

SAN FRANCISCO AST: Aboveground Storage Tank Site Listing

Aboveground storage tank sites

Date of Government Version: 09/11/2018 Date Data Arrived at EDR: 09/12/2018 Date Made Active in Reports: 10/11/2018

Number of Days to Update: 29

Source: San Francisco County Department of Public Health

Telephone: 415-252-3896 Last EDR Contact: 01/31/2019

Next Scheduled EDR Contact: 05/20/2019

Data Release Frequency: Varies

CA FID UST: Facility Inventory Database

The Facility Inventory Database (FID) contains a historical listing of active and inactive underground storage tank locations from the State Water Resource Control Board. Refer to local/county source for current data.

Date of Government Version: 10/31/1994 Date Data Arrived at EDR: 09/05/1995 Date Made Active in Reports: 09/29/1995

Number of Days to Update: 24

Source: California Environmental Protection Agency

Telephone: 916-341-5851 Last EDR Contact: 12/28/1998 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

CERS TANKS: California Environmental Reporting System (CERS) Tanks

List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the Aboveground Petroleum Storage and Underground Storage Tank regulatory programs.

Date of Government Version: 10/22/2018 Date Data Arrived at EDR: 10/23/2018 Date Made Active in Reports: 11/30/2018

Number of Days to Update: 38

Source: California Environmental Protection Agency

Telephone: 916-323-2514 Last EDR Contact: 04/11/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Quarterly

Local Land Records

LIENS: Environmental Liens Listing

A listing of property locations with environmental liens for California where DTSC is a lien holder.

Date of Government Version: 02/28/2019 Date Data Arrived at EDR: 03/01/2019 Date Made Active in Reports: 04/02/2019

Number of Days to Update: 32

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 06/17/2019

Data Release Frequency: Varies

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 03/11/2019 Date Data Arrived at EDR: 03/14/2019 Date Made Active in Reports: 03/21/2019

Number of Days to Update: 7

Source: Environmental Protection Agency

Telephone: 202-564-6023 Last EDR Contact: 03/14/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Semi-Annually

DEED: Deed Restriction Listing

Site Mitigation and Brownfields Reuse Program Facility Sites with Deed Restrictions & Hazardous Waste Management Program Facility Sites with Deed / Land Use Restriction. The DTSC Site Mitigation and Brownfields Reuse Program (SMBRP) list includes sites cleaned up under the program's oversight and generally does not include current or former hazardous waste facilities that required a hazardous waste facility permit. The list represents deed restrictions that are active. Some sites have multiple deed restrictions. The DTSC Hazardous Waste Management Program (HWMP) has developed a list of current or former hazardous waste facilities that have a recorded land use restriction at the local county recorder's office. The land use restrictions on this list were required by the DTSC HWMP as a result of the presence of hazardous substances that remain on site after the facility (or part of the facility) has been closed or cleaned up. The types of land use restriction include deed notice, deed restriction, or a land use restriction that binds current and future owners.

Date of Government Version: 03/04/2019 Date Data Arrived at EDR: 03/05/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 27

Source: DTSC and SWRCB Telephone: 916-323-3400 Last EDR Contact: 03/05/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Semi-Annually

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 02/08/2019 Date Data Arrived at EDR: 02/08/2019 Date Made Active in Reports: 03/21/2019

Number of Days to Update: 41

Source: U.S. Department of Transportation

Telephone: 202-366-4555 Last EDR Contact: 03/26/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Quarterly

CHMIRS: California Hazardous Material Incident Report System

California Hazardous Material Incident Reporting System. CHMIRS contains information on reported hazardous material

incidents (accidental releases or spills).

Date of Government Version: 10/24/2018 Date Data Arrived at EDR: 01/24/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 40

Source: Office of Emergency Services

Telephone: 916-845-8400 Last EDR Contact: 01/24/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Semi-Annually

LDS: Land Disposal Sites Listing (GEOTRACKER)

Land Disposal sites (Landfills) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Quality Control Board

Telephone: 866-480-1028 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019 Data Release Frequency: Quarterly

MCS: Military Cleanup Sites Listing (GEOTRACKER)

Military sites (consisting of: Military UST sites; Military Privatized sites; and Military Cleanup sites [formerly known as DoD non UST]) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: 866-480-1028 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019 Data Release Frequency: Quarterly

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 06/06/2012 Date Data Arrived at EDR: 01/03/2013 Date Made Active in Reports: 02/22/2013 Number of Days to Update: 50 Source: FirstSearch Telephone: N/A

Last EDR Contact: 01/03/2013 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 03/01/2018 Date Data Arrived at EDR: 03/28/2018 Date Made Active in Reports: 06/22/2018

Number of Days to Update: 86

Source: Environmental Protection Agency

Telephone: (415) 495-8895 Last EDR Contact: 03/27/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Quarterly

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 01/31/2015 Date Data Arrived at EDR: 07/08/2015 Date Made Active in Reports: 10/13/2015

Number of Days to Update: 97

Source: U.S. Army Corps of Engineers Telephone: 202-528-4285

Last EDR Contact: 04/03/2019

Next Scheduled EDR Contact: 06/03/2019

Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 11/10/2006 Date Made Active in Reports: 01/11/2007

Number of Days to Update: 62

Source: USGS

Telephone: 888-275-8747 Last EDR Contact: 04/12/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Semi-Annually

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 02/06/2006 Date Made Active in Reports: 01/11/2007

Number of Days to Update: 339

Source: U.S. Geological Survey Telephone: 888-275-8747 Last EDR Contact: 04/12/2019

Next Scheduled EDR Contact: 07/22/2019

Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 01/01/2017 Date Data Arrived at EDR: 02/03/2017 Date Made Active in Reports: 04/07/2017

Number of Days to Update: 63

Source: Environmental Protection Agency

Telephone: 615-532-8599 Last EDR Contact: 02/15/2019

Next Scheduled EDR Contact: 05/27/2019 Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 01/31/2019 Date Data Arrived at EDR: 02/04/2019 Date Made Active in Reports: 03/08/2019

Number of Days to Update: 32

Source: Environmental Protection Agency

Telephone: 202-566-1917 Last EDR Contact: 03/26/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Quarterly

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013 Date Data Arrived at EDR: 03/21/2014 Date Made Active in Reports: 06/17/2014

Number of Days to Update: 88

Source: Environmental Protection Agency

Telephone: 617-520-3000 Last EDR Contact: 02/08/2019

Next Scheduled EDR Contact: 05/20/2019 Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 09/30/2017 Date Data Arrived at EDR: 05/08/2018 Date Made Active in Reports: 07/20/2018

Number of Days to Update: 73

Source: Environmental Protection Agency

Telephone: 703-308-4044 Last EDR Contact: 02/08/2019

Next Scheduled EDR Contact: 05/20/2019

Data Release Frequency: Varies

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2016 Date Data Arrived at EDR: 06/21/2017 Date Made Active in Reports: 01/05/2018

Number of Days to Update: 198

Source: EPA

Telephone: 202-260-5521 Last EDR Contact: 03/22/2019

Next Scheduled EDR Contact: 07/01/2019 Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2016 Date Data Arrived at EDR: 01/10/2018 Date Made Active in Reports: 01/12/2018

Number of Days to Update: 2

Source: EPA

Telephone: 202-566-0250 Last EDR Contact: 02/20/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Annually

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009 Date Data Arrived at EDR: 12/10/2010 Date Made Active in Reports: 02/25/2011

Number of Days to Update: 77

Source: EPA

Telephone: 202-564-4203 Last EDR Contact: 03/25/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Annually

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 03/11/2019 Date Data Arrived at EDR: 03/14/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 18

Source: EPA

Telephone: 703-416-0223 Last EDR Contact: 03/14/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Annually

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 02/01/2019
Date Data Arrived at EDR: 02/14/2019
Date Made Active in Reports: 03/21/2019

Number of Days to Update: 35

Source: Environmental Protection Agency

Telephone: 202-564-8600 Last EDR Contact: 01/22/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995 Date Data Arrived at EDR: 07/03/1995 Date Made Active in Reports: 08/07/1995

Number of Days to Update: 35

Source: EPA

Telephone: 202-564-4104 Last EDR Contact: 06/02/2008

Next Scheduled EDR Contact: 09/01/2008 Data Release Frequency: No Update Planned

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 08/13/2018 Date Data Arrived at EDR: 10/04/2018 Date Made Active in Reports: 11/09/2018

Number of Days to Update: 36

Source: EPA

Telephone: 202-564-6023 Last EDR Contact: 03/14/2019

Next Scheduled EDR Contact: 05/20/2019 Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 09/14/2018 Date Data Arrived at EDR: 10/11/2018 Date Made Active in Reports: 12/07/2018

Number of Days to Update: 57

Source: EPA

Telephone: 202-566-0500 Last EDR Contact: 04/10/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016 Date Data Arrived at EDR: 11/23/2016 Date Made Active in Reports: 02/10/2017

Number of Days to Update: 79

Source: Environmental Protection Agency

Telephone: 202-564-2501 Last EDR Contact: 04/08/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Quarterly

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009 Date Data Arrived at EDR: 04/16/2009 Date Made Active in Reports: 05/11/2009

Number of Days to Update: 25

Source: EPA/Office of Prevention, Pesticides and Toxic Substances

Telephone: 202-566-1667 Last EDR Contact: 08/18/2017

Next Scheduled EDR Contact: 12/04/2017 Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act) A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009 Date Data Arrived at EDR: 04/16/2009 Date Made Active in Reports: 05/11/2009

Number of Days to Update: 25

Source: EPA

Telephone: 202-566-1667 Last EDR Contact: 08/18/2017

Next Scheduled EDR Contact: 12/04/2017 Data Release Frequency: Quarterly

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 08/30/2016 Date Data Arrived at EDR: 09/08/2016 Date Made Active in Reports: 10/21/2016

Number of Days to Update: 43

Source: Nuclear Regulatory Commission

Telephone: 301-415-7169 Last EDR Contact: 01/22/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Quarterly

COAL ASH DOE: Steam-Electric Plant Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 08/07/2009 Date Made Active in Reports: 10/22/2009

Number of Days to Update: 76

Source: Department of Energy Telephone: 202-586-8719 Last EDR Contact: 03/07/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 07/01/2014 Date Data Arrived at EDR: 09/10/2014 Date Made Active in Reports: 10/20/2014

Number of Days to Update: 40

Source: Environmental Protection Agency

Telephone: N/A

Last EDR Contact: 03/05/2019

Next Scheduled EDR Contact: 06/17/2019

Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 05/24/2017 Date Data Arrived at EDR: 11/30/2017 Date Made Active in Reports: 12/15/2017

Number of Days to Update: 15

Source: Environmental Protection Agency

Telephone: 202-566-0517 Last EDR Contact: 01/25/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S.

Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 01/02/2019 Date Data Arrived at EDR: 01/03/2019 Date Made Active in Reports: 03/15/2019

Number of Days to Update: 71

Source: Environmental Protection Agency

Telephone: 202-343-9775 Last EDR Contact: 04/02/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006 Date Data Arrived at EDR: 03/01/2007 Date Made Active in Reports: 04/10/2007

Number of Days to Update: 40

Source: Environmental Protection Agency

Telephone: 202-564-2501 Last EDR Contact: 12/17/2007

Next Scheduled EDR Contact: 03/17/2008 Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006 Date Data Arrived at EDR: 03/01/2007 Date Made Active in Reports: 04/10/2007

Number of Days to Update: 40

Source: Environmental Protection Agency

Telephone: 202-564-2501 Last EDR Contact: 12/17/2008

Next Scheduled EDR Contact: 03/17/2008 Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data

Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 12/03/2018 Date Data Arrived at EDR: 01/29/2019 Date Made Active in Reports: 03/21/2019

Number of Days to Update: 51

Source: Department of Transporation, Office of Pipeline Safety

Telephone: 202-366-4595 Last EDR Contact: 01/29/2019

Next Scheduled EDR Contact: 05/11/2019 Data Release Frequency: Quarterly

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 12/31/2018 Date Data Arrived at EDR: 02/11/2019 Date Made Active in Reports: 03/21/2019

Number of Days to Update: 38

Source: Department of Justice, Consent Decree Library

Telephone: Varies

Last EDR Contact: 04/05/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2015 Date Data Arrived at EDR: 02/22/2017 Date Made Active in Reports: 09/28/2017

Number of Days to Update: 218

Source: EPA/NTIS Telephone: 800-424-9346 Last EDR Contact: 02/13/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Biennially

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 07/14/2015
Date Made Active in Reports: 01/10/2017

Number of Days to Update: 546

Source: USGS Telephone: 202-208-3710 Last EDR Contact: 04/11/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 08/08/2017 Date Data Arrived at EDR: 09/11/2018 Date Made Active in Reports: 09/14/2018

Number of Days to Update: 3

Source: Department of Energy Telephone: 202-586-3559 Last EDR Contact: 01/31/2019

Next Scheduled EDR Contact: 05/20/2019 Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 06/23/2017 Date Data Arrived at EDR: 10/11/2017 Date Made Active in Reports: 11/03/2017

Number of Days to Update: 23

Source: Department of Energy Telephone: 505-845-0011 Last EDR Contact: 02/22/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 03/11/2019 Date Data Arrived at EDR: 03/14/2019 Date Made Active in Reports: 03/21/2019

Number of Days to Update: 7

Source: Environmental Protection Agency

Telephone: 703-603-8787 Last EDR Contact: 04/05/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust

Date of Government Version: 04/05/2001 Date Data Arrived at EDR: 10/27/2010 Date Made Active in Reports: 12/02/2010

Number of Days to Update: 36

Source: American Journal of Public Health

Telephone: 703-305-6451 Last EDR Contact: 12/02/2009 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/12/2016 Date Data Arrived at EDR: 10/26/2016 Date Made Active in Reports: 02/03/2017

Number of Days to Update: 100

Source: EPA

Telephone: 202-564-2496 Last EDR Contact: 09/26/2017

Next Scheduled EDR Contact: 01/08/2018 Data Release Frequency: Annually

US AIRS MINOR: Air Facility System Data A listing of minor source facilities.

Date of Government Version: 10/12/2016 Date Data Arrived at EDR: 10/26/2016 Date Made Active in Reports: 02/03/2017

Number of Days to Update: 100

Source: EPA

Telephone: 202-564-2496 Last EDR Contact: 09/26/2017

Next Scheduled EDR Contact: 01/08/2018 Data Release Frequency: Annually

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 11/27/2018 Date Data Arrived at EDR: 02/27/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 33

Source: Department of Labor, Mine Safety and Health Administration

Telephone: 303-231-5959 Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 06/10/2019 Data Release Frequency: Semi-Annually

US MINES 2: Ferrous and Nonferrous Metal Mines Database Listing

This map layer includes ferrous (ferrous metal mines are facilities that extract ferrous metals, such as iron ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

Date of Government Version: 12/05/2005 Date Data Arrived at EDR: 02/29/2008 Date Made Active in Reports: 04/18/2008

Number of Days to Update: 49

Source: USGS

Telephone: 703-648-7709 Last EDR Contact: 03/01/2019

Next Scheduled EDR Contact: 06/10/2019 Data Release Frequency: Varies

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011 Date Data Arrived at EDR: 06/08/2011 Date Made Active in Reports: 09/13/2011

Number of Days to Update: 97

Source: USGS

Telephone: 703-648-7709 Last EDR Contact: 03/01/2019

Next Scheduled EDR Contact: 06/10/2019 Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

Date of Government Version: 09/10/2018 Date Data Arrived at EDR: 09/11/2018 Date Made Active in Reports: 09/14/2018

Number of Days to Update: 3

Source: Department of Interior Telephone: 202-208-2609 Last EDR Contact: 03/21/2019

Next Scheduled EDR Contact: 06/24/2019 Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 02/15/2019 Date Data Arrived at EDR: 03/05/2019 Date Made Active in Reports: 03/15/2019

Number of Days to Update: 10

Source: EPA

Telephone: (415) 947-8000 Last EDR Contact: 03/05/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Quarterly

UXO: Unexploded Ordnance Sites

A listing of unexploded ordnance site locations

Date of Government Version: 12/31/2017 Date Data Arrived at EDR: 01/17/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 74

Source: Department of Defense Telephone: 703-704-1564 Last EDR Contact: 01/14/2019

Next Scheduled EDR Contact: 04/29/2019 Data Release Frequency: Varies

DOCKET HWC: Hazardous Waste Compliance Docket Listing

A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

Date of Government Version: 05/31/2018 Date Data Arrived at EDR: 07/26/2018 Date Made Active in Reports: 10/05/2018

Number of Days to Update: 71

Source: Environmental Protection Agency

Telephone: 202-564-0527 Last EDR Contact: 03/01/2019

Next Scheduled EDR Contact: 06/10/2019 Data Release Frequency: Varies

ECHO: Enforcement & Compliance History Information

ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 03/03/2019 Date Data Arrived at EDR: 03/05/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 27

Source: Environmental Protection Agency

Telephone: 202-564-2280 Last EDR Contact: 04/09/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Quarterly

FUELS PROGRAM: EPA Fuels Program Registered Listing

This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 02/19/2019 Date Data Arrived at EDR: 02/21/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 39

Source: EPA

Telephone: 800-385-6164 Last EDR Contact: 02/21/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Quarterly

CA BOND EXP. PLAN: Bond Expenditure Plan

Department of Health Services developed a site-specific expenditure plan as the basis for an appropriation of

Hazardous Substance Cleanup Bond Act funds. It is not updated.

Date of Government Version: 01/01/1989 Date Data Arrived at EDR: 07/27/1994 Date Made Active in Reports: 08/02/1994

Number of Days to Update: 6

Source: Department of Health Services

Telephone: 916-255-2118 Last EDR Contact: 05/31/1994 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

CORTESE: "Cortese" Hazardous Waste & Substances Sites List

The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste

Board (SWF/LS), and the Department of Toxic Substances Control (Cal-Sites).

Date of Government Version: 12/20/2018 Date Data Arrived at EDR: 12/21/2018 Date Made Active in Reports: 02/28/2019

Number of Days to Update: 69

Source: CAL EPA/Office of Emergency Information

Telephone: 916-323-3400 Last EDR Contact: 03/26/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Quarterly

CUPA LIVERMORE-PLEASANTON: CUPA Facility Listing

list of facilities associated with the various CUPA programs in Livermore-Pleasanton

Date of Government Version: 01/23/2019 Date Data Arrived at EDR: 02/26/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 34

Source: Livermore-Pleasanton Fire Department

Telephone: 925-454-2361 Last EDR Contact: 02/26/2019

Next Scheduled EDR Contact: 05/27/2019 Data Release Frequency: Varies

CUPA SAN FRANCISCO CO: CUPA Facility Listing

Cupa facilities

Date of Government Version: 09/11/2018 Date Data Arrived at EDR: 09/12/2018 Date Made Active in Reports: 09/19/2018

Number of Days to Update: 7

Source: San Francisco County Department of Environmental Health

Telephone: 415-252-3896 Last EDR Contact: 01/31/2019

Next Scheduled EDR Contact: 05/20/2019 Data Release Frequency: Varies

DRYCLEAN AVAQMD: Antelope Valley Air Quality Management District Drycleaner Listing

A listing of dry cleaners in the Antelope Valley Air Quality Management District.

Date of Government Version: 02/27/2019 Date Data Arrived at EDR: 02/28/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 32

Source: Antelope Valley Air Quality Management District

Telephone: 661-723-8070 Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 06/17/2019

Data Release Frequency: Varies

DRYCLEANERS: Cleaner Facilities

A list of drycleaner related facilities that have EPA ID numbers. These are facilities with certain SIC codes: power laundries, family and commercial; garment pressing and cleaner's agents; linen supply; coin-operated laundries and cleaning; drycleaning plants, except rugs; carpet and upholster cleaning; industrial launderers; laundry and garment services.

Date of Government Version: 12/13/2018 Date Data Arrived at EDR: 01/17/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 47

Source: Department of Toxic Substance Control

Telephone: 916-327-4498 Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Annually

DRYCLEAN SOUTH COAST: South Coast Air Quality Management District Drycleaner Listing

A listing of dry cleaners in the South Coast Air Quality Management District

Date of Government Version: 03/19/2019 Date Data Arrived at EDR: 03/22/2019 Date Made Active in Reports: 04/09/2019

Number of Days to Update: 18

Source: South Coast Air Quality Management District

Telephone: 909-396-3211 Last EDR Contact: 03/22/2019

Next Scheduled EDR Contact: 06/10/2019 Data Release Frequency: Varies

EMI: Emissions Inventory Data

Toxics and criteria pollutant emissions data collected by the ARB and local air pollution agencies.

Date of Government Version: 12/31/2017 Date Data Arrived at EDR: 06/20/2018 Date Made Active in Reports: 08/06/2018

Number of Days to Update: 47

Source: California Air Resources Board

Telephone: 916-322-2990 Last EDR Contact: 03/22/2019

Next Scheduled EDR Contact: 07/01/2019 Data Release Frequency: Varies

ENF: Enforcement Action Listing

A listing of Water Board Enforcement Actions. Formal is everything except Oral/Verbal Communication, Notice of Violation, Expedited Payment Letter, and Staff Enforcement Letter.

Date of Government Version: 11/01/2018 Date Data Arrived at EDR: 11/02/2018 Date Made Active in Reports: 12/13/2018

Number of Days to Update: 41

Source: State Water Resoruces Control Board

Telephone: 916-445-9379 Last EDR Contact: 03/18/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

Financial Assurance 1: Financial Assurance Information Listing

Financial Assurance information

Date of Government Version: 01/10/2019 Date Data Arrived at EDR: 01/23/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 41

Source: Department of Toxic Substances Control

Telephone: 916-255-3628 Last EDR Contact: 01/17/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

Financial Assurance 2: Financial Assurance Information Listing

A listing of financial assurance information for solid waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 02/15/2019 Date Data Arrived at EDR: 02/19/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 14

Source: California Integrated Waste Management Board

Telephone: 916-341-6066 Last EDR Contact: 02/11/2019

Next Scheduled EDR Contact: 05/27/2019 Data Release Frequency: Varies

HAZNET: Facility and Manifest Data

Facility and Manifest Data. The data is extracted from the copies of hazardous waste manifests received each year by the DTSC. The annual volume of manifests is typically 700,000 - 1,000,000 annually, representing approximately 350,000 - 500,000 shipments. Data are from the manifests submitted without correction, and therefore many contain some invalid values for data elements such as generator ID, TSD ID, waste category, and disposal method. This database begins with calendar year 1993.

Date of Government Version: 12/31/2017 Date Data Arrived at EDR: 10/10/2018 Date Made Active in Reports: 11/16/2018

Number of Days to Update: 37

Source: California Environmental Protection Agency

Telephone: 916-255-1136 Last EDR Contact: 04/09/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Annually

ICE: ICE

Contains data pertaining to the Permitted Facilities with Inspections / Enforcements sites tracked in Envirostor.

Date of Government Version: 02/19/2019 Date Data Arrived at EDR: 02/20/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 13

Source: Department of Toxic Subsances Control

Telephone: 877-786-9427 Last EDR Contact: 02/20/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Quarterly

HIST CORTESE: Hazardous Waste & Substance Site List

The sites for the list are designated by the State Water Resource Control Board [LUST], the Integrated Waste Board [SWF/LS], and the Department of Toxic Substances Control [CALSITES]. This listing is no longer updated by the

state agency.

Date of Government Version: 04/01/2001 Date Data Arrived at EDR: 01/22/2009 Date Made Active in Reports: 04/08/2009

Number of Days to Update: 76

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 01/22/2009 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

HWP: EnviroStor Permitted Facilities Listing

Detailed information on permitted hazardous waste facilities and corrective action ("cleanups") tracked in EnviroStor.

Date of Government Version: 02/19/2019 Date Data Arrived at EDR: 02/20/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 13

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 02/20/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Quarterly

HWT: Registered Hazardous Waste Transporter Database

A listing of hazardous waste transporters. In California, unless specifically exempted, it is unlawful for any person to transport hazardous wastes unless the person holds a valid registration issued by DTSC. A hazardous waste transporter registration is valid for one year and is assigned a unique registration number.

Date of Government Version: 01/07/2019 Date Data Arrived at EDR: 01/08/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 56

Source: Department of Toxic Substances Control

Telephone: 916-440-7145 Last EDR Contact: 04/09/2019

Next Scheduled EDR Contact: 07/22/2019
Data Release Frequency: Quarterly

MINES: Mines Site Location Listing

A listing of mine site locations from the Office of Mine Reclamation.

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/12/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 34

Source: Department of Conservation

Telephone: 916-322-1080 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019 Data Release Frequency: Quarterly

MWMP: Medical Waste Management Program Listing

The Medical Waste Management Program (MWMP) ensures the proper handling and disposal of medical waste by permitting and inspecting medical waste Offsite Treatment Facilities (PDF) and Transfer Stations (PDF) throughout the state. MWMP also oversees all Medical Waste Transporters.

Date of Government Version: 02/20/2019 Date Data Arrived at EDR: 03/05/2019 Date Made Active in Reports: 04/02/2019

Number of Days to Update: 28

Source: Department of Public Health Telephone: 916-558-1784 Last EDR Contact: 03/05/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Varies

NPDES: NPDES Permits Listing

A listing of NPDES permits, including stormwater.

Date of Government Version: 02/11/2019 Date Data Arrived at EDR: 02/12/2019 Date Made Active in Reports: 03/07/2019

Number of Days to Update: 23

Source: State Water Resources Control Board

Telephone: 916-445-9379 Last EDR Contact: 02/12/2019

Next Scheduled EDR Contact: 05/27/2019 Data Release Frequency: Quarterly

PEST LIC: Pesticide Regulation Licenses Listing

A listing of licenses and certificates issued by the Department of Pesticide Regulation. The DPR issues licenses and/or certificates to: Persons and businesses that apply or sell pesticides; Pest control dealers and brokers; Persons who advise on agricultural pesticide applications.

Date of Government Version: 03/04/2019 Date Data Arrived at EDR: 03/05/2019 Date Made Active in Reports: 04/05/2019

Number of Days to Update: 31

Source: Department of Pesticide Regulation

Telephone: 916-445-4038 Last EDR Contact: 03/05/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Quarterly

PROC: Certified Processors Database A listing of certified processors.

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/12/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 34

Source: Department of Conservation

Telephone: 916-323-3836 Last EDR Contact: 03/13/2019

Next Scheduled EDR Contact: 06/24/2019 Data Release Frequency: Quarterly

NOTIFY 65: Proposition 65 Records

Listings of all Proposition 65 incidents reported to counties by the State Water Resources Control Board and the Regional Water Quality Control Board. This database is no longer updated by the reporting agency.

Date of Government Version: 09/19/2018 Date Data Arrived at EDR: 09/20/2018 Date Made Active in Reports: 10/19/2018

Number of Days to Update: 29

Source: State Water Resources Control Board

Telephone: 916-445-3846 Last EDR Contact: 03/18/2019

Next Scheduled EDR Contact: 07/01/2019
Data Release Frequency: No Update Planned

UIC: UIC Listing

A listing of wells identified as underground injection wells, in the California Oil and Gas Wells database.

Date of Government Version: 04/27/2018 Date Data Arrived at EDR: 06/13/2018 Date Made Active in Reports: 07/17/2018

Number of Days to Update: 34

Source: Deaprtment of Conservation Telephone: 916-445-2408

Last EDR Contact: 03/13/2019

Next Scheduled EDR Contact: 06/24/2019 Data Release Frequency: Varies

UIC GEO: Underground Injection Control Sites (GEOTRACKER)

Underground control injection sites

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resource Control Board

Telephone: 866-480-1028 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019 Data Release Frequency: Varies

WASTEWATER PITS: Oil Wastewater Pits Listing

Water officials discovered that oil producers have been dumping chemical-laden wastewater into hundreds of unlined pits that are operating without proper permits. Inspections completed by the Central Valley Regional Water Quality Control Board revealed the existence of previously unidentified waste sites. The water boards review found that more than one-third of the region's active disposal pits are operating without permission.

Date of Government Version: 05/08/2018 Date Data Arrived at EDR: 07/11/2018 Date Made Active in Reports: 09/13/2018

Number of Days to Update: 64

Source: RWQCB, Central Valley Region

Telephone: 559-445-5577 Last EDR Contact: 04/12/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Varies

WDS: Waste Discharge System

Sites which have been issued waste discharge requirements.

Date of Government Version: 06/19/2007 Date Data Arrived at EDR: 06/20/2007 Date Made Active in Reports: 06/29/2007

Number of Days to Update: 9

Source: State Water Resources Control Board

Telephone: 916-341-5227 Last EDR Contact: 02/13/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Quarterly

MILITARY PRIV SITES: Military Privatized Sites (GEOTRACKER)

Military privatized sites

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: 866-480-1028 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019

Data Release Frequency: Varies

PROJECT: Project Sites (GEOTRACKER)

Projects sites

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: 866-480-1028 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019 Data Release Frequency: Varies

WDR: Waste Discharge Requirements Listing

In general, the Waste Discharge Requirements (WDRs) Program (sometimes also referred to as the "Non Chapter 15 (Non 15) Program") regulates point discharges that are exempt pursuant to Subsection 20090 of Title 27 and not subject to the Federal Water Pollution Control Act. Exemptions from Title 27 may be granted for nine categories of discharges (e.g., sewage, wastewater, etc.) that meet, and continue to meet, the preconditions listed for each specific exemption. The scope of the WDRs Program also includes the discharge of wastes classified as inert, pursuant to section 20230 of Title 27.

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/12/2018 Date Made Active in Reports: 01/18/2019

Number of Days to Update: 37

Source: State Water Resources Control Board

Telephone: 916-341-5810 Last EDR Contact: 03/13/2019

Next Scheduled EDR Contact: 06/24/2019 Data Release Frequency: Quarterly

CIWQS: California Integrated Water Quality System

The California Integrated Water Quality System (CIWQS) is a computer system used by the State and Regional Water Quality Control Boards to track information about places of environmental interest, manage permits and other orders, track inspections, and manage violations and enforcement activities.

Date of Government Version: 03/05/2019 Date Data Arrived at EDR: 03/05/2019 Date Made Active in Reports: 04/02/2019

Number of Days to Update: 28

Source: State Water Resources Control Board

Telephone: 866-794-4977 Last EDR Contact: 03/05/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Varies

CERS: CalEPA Regulated Site Portal Data

The CalEPA Regulated Site Portal database combines data about environmentally regulated sites and facilities in California into a single database. It combines data from a variety of state and federal databases, and provides an overview of regulated activities across the spectrum of environmental programs for any given location in California. These activities include hazardous materials and waste, state and federal cleanups, impacted ground and surface waters, and toxic materials

Date of Government Version: 10/22/2018 Date Data Arrived at EDR: 10/23/2018 Date Made Active in Reports: 11/30/2018

Number of Days to Update: 38

Source: California Environmental Protection Agency

Telephone: 916-323-2514 Last EDR Contact: 04/11/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

NON-CASE INFO: Non-Case Information Sites (GEOTRACKER)

Non-Case Information sites

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: 866-480-1028 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019 Data Release Frequency: Varies

WIP: Well Investigation Program Case List

Well Investigation Program case in the San Gabriel and San Fernando Valley area.

Date of Government Version: 07/03/2009 Date Data Arrived at EDR: 07/21/2009 Date Made Active in Reports: 08/03/2009

Number of Days to Update: 13

Source: Los Angeles Water Quality Control Board

Telephone: 213-576-6726 Last EDR Contact: 03/25/2019

Next Scheduled EDR Contact: 07/08/2019

Data Release Frequency: Varies

OTHER OIL GAS: Other Oil & Gas Projects Sites (GEOTRACKER)

Other Oil & Gas Projects sites

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: 866-480-1028 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019

Data Release Frequency: Varies

PROD WATER PONDS: Produced Water Ponds Sites (GEOTRACKER)

Produced water ponds sites

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: 866-480-1028 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019 Data Release Frequency: Varies

SAMPLING POINT: Sampling Point? Public Sites (GEOTRACKER)

Sampling point - public sites

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: 866-480-1028 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019 Data Release Frequency: Varies

WELL STIM PROJ: Well Stimulation Project (GEOTRACKER)

Includes areas of groundwater monitoring plans, a depiction of the monitoring network, and the facilities, boundaries, and subsurface characteristics of the oilfield and the features (oil and gas wells, produced water ponds, UIC wells, water supply wells, etc?) being monitored

Date of Government Version: 12/10/2018 Date Data Arrived at EDR: 12/11/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: 866-480-1028 Last EDR Contact: 12/12/2018

Next Scheduled EDR Contact: 03/25/2019

Data Release Frequency: Varies

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A Date Data Arrived at EDR: N/A Date Made Active in Reports: N/A

Number of Days to Update: N/A

Source: EDR, Inc. Telephone: N/A Last EDR Contact: N/A

Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historical Auto Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A Date Data Arrived at EDR: N/A Date Made Active in Reports: N/A

Number of Days to Update: N/A

Source: EDR, Inc. Telephone: N/A Last EDR Contact: N/A

Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A Date Data Arrived at EDR: N/A Date Made Active in Reports: N/A

Number of Days to Update: N/A

Source: EDR, Inc. Telephone: N/A Last EDR Contact: N/A

Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Resources Recycling and Recovery in California.

Date of Government Version: N/A Date Data Arrived at EDR: 07/01/2013 Date Made Active in Reports: 01/13/2014 Number of Days to Update: 196

Source: Department of Resources Recycling and Recovery Telephone: N/A

Last EDR Contact: 06/01/2012 Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

RGA LUST: Recovered Government Archive Leaking Underground Storage Tank

The EDR Recovered Government Archive Leaking Underground Storage Tank database provides a list of LUST incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the State Water Resources Control Board in California.

Date of Government Version: N/A Date Data Arrived at EDR: 07/01/2013 Date Made Active in Reports: 12/30/2013 Number of Days to Update: 182

Source: State Water Resources Control Board Telephone: N/A

Last EDR Contact: 06/01/2012 Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

COUNTY RECORDS

ALAMEDA COUNTY:

CS ALAMEDA: Contaminated Sites

A listing of contaminated sites overseen by the Toxic Release Program (oil and groundwater contamination from chemical releases and spills) and the Leaking Underground Storage Tank Program (soil and ground water contamination from leaking petroleum USTs).

Date of Government Version: 01/09/2019 Date Data Arrived at EDR: 01/11/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 53

Source: Alameda County Environmental Health Services

Telephone: 510-567-6700 Last EDR Contact: 04/08/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Semi-Annually

UST ALAMEDA: Underground Tanks

Underground storage tank sites located in Alameda county.

Date of Government Version: 01/07/2019 Date Data Arrived at EDR: 01/08/2019 Date Made Active in Reports: 03/08/2019

Number of Days to Update: 59

Source: Alameda County Environmental Health Services

Telephone: 510-567-6700 Last EDR Contact: 04/08/2019

Next Scheduled EDR Contact: 04/24/2047 Data Release Frequency: Semi-Annually

AMADOR COUNTY:

CUPA AMADOR: CUPA Facility List

Cupa Facility List

Date of Government Version: 01/07/2019 Date Data Arrived at EDR: 01/08/2019 Date Made Active in Reports: 03/07/2019

Number of Days to Update: 58

Source: Amador County Environmental Health

Telephone: 209-223-6439 Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 06/17/2019

Data Release Frequency: Varies

BUTTE COUNTY:

CUPA BUTTE: CUPA Facility Listing

Cupa facility list.

Date of Government Version: 04/21/2017 Date Data Arrived at EDR: 04/25/2017 Date Made Active in Reports: 08/09/2017

Number of Days to Update: 106

Source: Public Health Department Telephone: 530-538-7149 Last EDR Contact: 04/08/2019

Next Scheduled EDR Contact: 07/22/2019
Data Release Frequency: No Update Planned

CALVERAS COUNTY:

CUPA CALVERAS: CUPA Facility Listing

Cupa Facility Listing

Date of Government Version: 01/24/2019 Date Data Arrived at EDR: 01/25/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 39

Source: Calveras County Environmental Health

Telephone: 209-754-6399 Last EDR Contact: 03/25/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Quarterly

COLUSA COUNTY:

CUPA COLUSA: CUPA Facility List

Cupa facility list.

Date of Government Version: 02/27/2019 Date Data Arrived at EDR: 02/28/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 32

Source: Health & Human Services Telephone: 530-458-0396 Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 05/20/2019 Data Release Frequency: Semi-Annually

CONTRA COSTA COUNTY:

SL CONTRA COSTA: Site List

List includes sites from the underground tank, hazardous waste generator and business plan/2185 programs.

Date of Government Version: 02/14/2019 Date Data Arrived at EDR: 02/19/2019 Date Made Active in Reports: 03/08/2019

Number of Days to Update: 17

Source: Contra Costa Health Services Department

Telephone: 925-646-2286 Last EDR Contact: 01/28/2019

Next Scheduled EDR Contact: 05/11/2019 Data Release Frequency: Semi-Annually

DEL NORTE COUNTY:

CUPA DEL NORTE: CUPA Facility List

Cupa Facility list

Date of Government Version: 01/16/2019 Date Data Arrived at EDR: 02/05/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 28

Source: Del Norte County Environmental Health Division

Telephone: 707-465-0426 Last EDR Contact: 01/28/2019

Next Scheduled EDR Contact: 05/11/2019

Data Release Frequency: Varies

EL DORADO COUNTY:

CUPA EL DORADO: CUPA Facility List

CUPA facility list.

Date of Government Version: 02/27/2019 Date Data Arrived at EDR: 02/28/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 32

Source: El Dorado County Environmental Management Department

Telephone: 530-621-6623 Last EDR Contact: 01/28/2019

Next Scheduled EDR Contact: 05/11/2019 Data Release Frequency: Varies

FRESNO COUNTY:

CUPA FRESNO: CUPA Resources List

Certified Unified Program Agency. CUPA's are responsible for implementing a unified hazardous materials and hazardous waste management regulatory program. The agency provides oversight of businesses that deal with hazardous materials, operate underground storage tanks or aboveground storage tanks.

Date of Government Version: 10/16/2018 Date Data Arrived at EDR: 10/18/2018 Date Made Active in Reports: 11/14/2018

Number of Days to Update: 27

Source: Dept. of Community Health Telephone: 559-445-3271 Last EDR Contact: 03/29/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Semi-Annually

GLENN COUNTY:

CUPA GLENN: CUPA Facility List

Cupa facility list

Date of Government Version: 01/22/2018 Date Data Arrived at EDR: 01/24/2018 Date Made Active in Reports: 03/14/2018

Number of Days to Update: 49

Source: Glenn County Air Pollution Control District

Telephone: 830-934-6500 Last EDR Contact: 01/17/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

HUMBOLDT COUNTY:

CUPA HUMBOLDT: CUPA Facility List

CUPA facility list.

Date of Government Version: 12/11/2018 Date Data Arrived at EDR: 12/13/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 33

Source: Humboldt County Environmental Health

Telephone: N/A

Last EDR Contact: 11/19/2018

Next Scheduled EDR Contact: 03/04/2019 Data Release Frequency: Semi-Annually

IMPERIAL COUNTY:

CUPA IMPERIAL: CUPA Facility List

Cupa facility list.

Date of Government Version: 01/18/2019 Date Data Arrived at EDR: 01/23/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 41

Source: San Diego Border Field Office

Telephone: 760-339-2777 Last EDR Contact: 01/17/2019

Next Scheduled EDR Contact: 05/06/2019

Data Release Frequency: Varies

INYO COUNTY:

CUPA INYO: CUPA Facility List

Cupa facility list.

Date of Government Version: 04/02/2018 Date Data Arrived at EDR: 04/03/2018 Date Made Active in Reports: 06/14/2018

Number of Days to Update: 72

Source: Inyo County Environmental Health Services

Telephone: 760-878-0238 Last EDR Contact: 02/13/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Varies

KERN COUNTY:

UST KERN: Underground Storage Tank Sites & Tank Listing

Kern County Sites and Tanks Listing.

Date of Government Version: 01/28/2019 Date Data Arrived at EDR: 02/07/2019 Date Made Active in Reports: 03/08/2019

Number of Days to Update: 29

Source: Kern County Environment Health Services Department

Telephone: 661-862-8700 Last EDR Contact: 01/31/2019

Next Scheduled EDR Contact: 05/20/2019 Data Release Frequency: Quarterly

KINGS COUNTY:

CUPA KINGS: CUPA Facility List

A listing of sites included in the county's Certified Unified Program Agency database. California's Secretary for Environmental Protection established the unified hazardous materials and hazardous waste regulatory program as required by chapter 6.11 of the California Health and Safety Code. The Unified Program consolidates the administration, permits, inspections, and enforcement activities.

Date of Government Version: 02/14/2019 Date Data Arrived at EDR: 02/19/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 14

Source: Kings County Department of Public Health

Telephone: 559-584-1411 Last EDR Contact: 02/13/2019

Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Varies

LAKE COUNTY:

CUPA LAKE: CUPA Facility List

Cupa facility list

Date of Government Version: 02/08/2019 Date Data Arrived at EDR: 02/12/2019 Date Made Active in Reports: 03/12/2019

Number of Days to Update: 28

Source: Lake County Environmental Health

Telephone: 707-263-1164 Last EDR Contact: 01/14/2019

Next Scheduled EDR Contact: 04/29/2019 Data Release Frequency: Varies

LASSEN COUNTY:

CUPA LASSEN: CUPA Facility List

Cupa facility list

Date of Government Version: 01/17/2019 Date Data Arrived at EDR: 01/18/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 46

Source: Lassen County Environmental Health

Telephone: 530-251-8528 Last EDR Contact: 01/17/2019

Next Scheduled EDR Contact: 05/06/2019

Data Release Frequency: Varies

LOS ANGELES COUNTY:

AOCONCERN: Key Areas of Concerns in Los Angeles County

San Gabriel Valley areas where VOC contamination is at or above the MCL as designated by region 9 EPA office. Date of Government Version: 3/30/2009 Exide Site area is a cleanup plan of lead-impacted soil surrounding the former

Exide Facility as designated by the DTSC. Date of Government Version: 7/17/2017

Date of Government Version: 03/30/2009 Date Data Arrived at EDR: 03/31/2009 Date Made Active in Reports: 10/23/2009

Number of Days to Update: 206

Source: N/A Telephone: N/A

Last EDR Contact: 03/18/2019

Next Scheduled EDR Contact: 07/01/2019
Data Release Frequency: No Update Planned

HMS LOS ANGELES: HMS: Street Number List

Industrial Waste and Underground Storage Tank Sites.

Date of Government Version: 12/19/2018 Date Data Arrived at EDR: 01/10/2019 Date Made Active in Reports: 03/07/2019

Number of Days to Update: 56

Source: Department of Public Works

Telephone: 626-458-3517 Last EDR Contact: 04/08/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Semi-Annually

LF LOS ANGELES: List of Solid Waste Facilities Solid Waste Facilities in Los Angeles County.

> Date of Government Version: 01/14/2019 Date Data Arrived at EDR: 01/15/2019 Date Made Active in Reports: 03/07/2019

Number of Days to Update: 51

Source: La County Department of Public Works

Telephone: 818-458-5185 Last EDR Contact: 01/15/2019

Next Scheduled EDR Contact: 04/29/2019

Data Release Frequency: Varies

LF LOS ANGELES CITY: City of Los Angeles Landfills

Landfills owned and maintained by the City of Los Angeles.

Date of Government Version: 01/01/2019 Date Data Arrived at EDR: 01/15/2019 Date Made Active in Reports: 03/07/2019

Number of Days to Update: 51

Source: Engineering & Construction Division

Telephone: 213-473-7869 Last EDR Contact: 01/15/2019

Next Scheduled EDR Contact: 04/29/2019 Data Release Frequency: Varies

SITE MIT LOS ANGELES: Site Mitigation List

Industrial sites that have had some sort of spill or complaint.

Date of Government Version: 01/30/2019 Date Data Arrived at EDR: 02/01/2019 Date Made Active in Reports: 03/07/2019

Number of Days to Update: 34

Source: Community Health Services

Telephone: 323-890-7806 Last EDR Contact: 02/01/2019

Next Scheduled EDR Contact: 04/29/2019 Data Release Frequency: Annually

UST EL SEGUNDO: City of El Segundo Underground Storage Tank Underground storage tank sites located in El Segundo city.

Date of Government Version: 01/21/2017 Date Data Arrived at EDR: 04/19/2017 Date Made Active in Reports: 05/10/2017

Number of Days to Update: 21

Source: City of El Segundo Fire Department

Telephone: 310-524-2236 Last EDR Contact: 01/14/2019

Next Scheduled EDR Contact: 04/29/2019 Data Release Frequency: Semi-Annually

UST LONG BEACH: City of Long Beach Underground Storage Tank
Underground storage tank sites located in the city of Long Beach.

Date of Government Version: 03/09/2017 Date Data Arrived at EDR: 03/10/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 54

Source: City of Long Beach Fire Department

Telephone: 562-570-2563 Last EDR Contact: 01/17/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Annually

UST TORRANCE: City of Torrance Underground Storage Tank
Underground storage tank sites located in the city of Torrance.

Date of Government Version: 10/02/2018 Date Data Arrived at EDR: 10/05/2018 Date Made Active in Reports: 11/02/2018

Number of Days to Update: 28

Source: City of Torrance Fire Department

Telephone: 310-618-2973 Last EDR Contact: 01/17/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Semi-Annually

MADERA COUNTY:

CUPA MADERA: CUPA Facility List

A listing of sites included in the county's Certified Unified Program Agency database. California's Secretary for Environmental Protection established the unified hazardous materials and hazardous waste regulatory program as required by chapter 6.11 of the California Health and Safety Code. The Unified Program consolidates the administration, permits, inspections, and enforcement activities.

Date of Government Version: 02/20/2019 Date Data Arrived at EDR: 02/22/2019 Date Made Active in Reports: 03/07/2019

Number of Days to Update: 13

Source: Madera County Environmental Health

Telephone: 559-675-7823 Last EDR Contact: 02/15/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Varies

MARIN COUNTY:

UST MARIN: Underground Storage Tank Sites Currently permitted USTs in Marin County.

> Date of Government Version: 09/26/2018 Date Data Arrived at EDR: 10/04/2018 Date Made Active in Reports: 11/02/2018

Number of Days to Update: 29

Source: Public Works Department Waste Management

Telephone: 415-473-6647 Last EDR Contact: 03/29/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Semi-Annually

MERCED COUNTY:

CUPA MERCED: CUPA Facility List CUPA facility list.

Date of Government Version: 08/29/2018 Date Data Arrived at EDR: 08/31/2018 Date Made Active in Reports: 09/19/2018

Number of Days to Update: 19

Source: Merced County Environmental Health

Telephone: 209-381-1094 Last EDR Contact: 03/18/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Varies

MONO COUNTY:

CUPA MONO: CUPA Facility List CUPA Facility List

> Date of Government Version: 02/21/2019 Date Data Arrived at EDR: 02/26/2019 Date Made Active in Reports: 04/01/2019

Number of Days to Update: 34

Source: Mono County Health Department

Telephone: 760-932-5580 Last EDR Contact: 02/21/2019

Next Scheduled EDR Contact: 06/10/2019 Data Release Frequency: Varies

MONTEREY COUNTY:

CUPA MONTEREY: CUPA Facility Listing

CUPA Program listing from the Environmental Health Division.

Date of Government Version: 02/05/2019 Date Data Arrived at EDR: 02/07/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 26

Source: Monterey County Health Department

Telephone: 831-796-1297 Last EDR Contact: 04/01/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Varies

NAPA COUNTY:

LUST NAPA: Sites With Reported Contamination

A listing of leaking underground storage tank sites located in Napa county.

Date of Government Version: 01/09/2017 Date Data Arrived at EDR: 01/11/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 50

Source: Napa County Department of Environmental Management

Telephone: 707-253-4269 Last EDR Contact: 02/21/2019

Next Scheduled EDR Contact: 06/10/2019 Data Release Frequency: No Update Planned

UST NAPA: Closed and Operating Underground Storage Tank Sites Underground storage tank sites located in Napa county.

Date of Government Version: 02/21/2019 Date Data Arrived at EDR: 02/22/2019 Date Made Active in Reports: 03/08/2019

Number of Days to Update: 14

Source: Napa County Department of Environmental Management

Telephone: 707-253-4269 Last EDR Contact: 02/21/2019

Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: No Update Planned

NEVADA COUNTY:

CUPA NEVADA: CUPA Facility List CUPA facility list.

Date of Government Version: 01/25/2019 Date Data Arrived at EDR: 01/29/2019

Date Made Active in Reports: 03/05/2019 Number of Days to Update: 35 Source: Community Development Agency

Telephone: 530-265-1467 Last EDR Contact: 01/28/2019

Next Scheduled EDR Contact: 05/11/2019 Data Release Frequency: Varies

ORANGE COUNTY:

IND_SITE ORANGE: List of Industrial Site Cleanups

Petroleum and non-petroleum spills.

Date of Government Version: 01/02/2019 Date Data Arrived at EDR: 02/07/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 26

Source: Health Care Agency Telephone: 714-834-3446 Last EDR Contact: 02/04/2019

Next Scheduled EDR Contact: 05/20/2019 Data Release Frequency: Annually

LUST ORANGE: List of Underground Storage Tank Cleanups Orange County Underground Storage Tank Cleanups (LUST).

Date of Government Version: 01/02/2019 Date Data Arrived at EDR: 02/08/2019 Date Made Active in Reports: 03/06/2019

Number of Days to Update: 26

Source: Health Care Agency Telephone: 714-834-3446 Last EDR Contact: 02/04/2019

Next Scheduled EDR Contact: 05/20/2019 Data Release Frequency: Quarterly

UST ORANGE: List of Underground Storage Tank Facilities
Orange County Underground Storage Tank Facilities (UST).

Date of Government Version: 01/02/2019 Date Data Arrived at EDR: 02/05/2019 Date Made Active in Reports: 03/08/2019

Number of Days to Update: 31

Source: Health Care Agency Telephone: 714-834-3446 Last EDR Contact: 02/05/2019

Next Scheduled EDR Contact: 05/20/2019 Data Release Frequency: Quarterly

PLACER COUNTY:

MS PLACER: Master List of Facilities

List includes aboveground tanks, underground tanks and cleanup sites.

Date of Government Version: 02/28/2019 Date Data Arrived at EDR: 03/01/2019 Date Made Active in Reports: 04/12/2019

Number of Days to Update: 42

Source: Placer County Health and Human Services

Telephone: 530-745-2363 Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Semi-Annually

PLUMAS COUNTY:

CUPA PLUMAS: CUPA Facility List

Plumas County CUPA Program facilities.

Date of Government Version: 01/14/2019 Date Data Arrived at EDR: 01/18/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 46

Source: Plumas County Environmental Health

Telephone: 530-283-6355 Last EDR Contact: 01/17/2019

Next Scheduled EDR Contact: 05/06/2019

Data Release Frequency: Varies

RIVERSIDE COUNTY:

LUST RIVERSIDE: Listing of Underground Tank Cleanup Sites

Riverside County Underground Storage Tank Cleanup Sites (LUST).

Date of Government Version: 01/29/2019 Date Data Arrived at EDR: 01/31/2019 Date Made Active in Reports: 03/06/2019

Number of Days to Update: 34

Source: Department of Environmental Health

Telephone: 951-358-5055 Last EDR Contact: 03/18/2019

Next Scheduled EDR Contact: 07/01/2019 Data Release Frequency: Quarterly

UST RIVERSIDE: Underground Storage Tank Tank List

Underground storage tank sites located in Riverside county.

Date of Government Version: 01/29/2019 Date Data Arrived at EDR: 01/31/2019 Date Made Active in Reports: 03/08/2019

Number of Days to Update: 36

Source: Department of Environmental Health

Telephone: 951-358-5055 Last EDR Contact: 03/18/2019

Next Scheduled EDR Contact: 07/01/2019 Data Release Frequency: Quarterly

SACRAMENTO COUNTY:

CS SACRAMENTO: Toxic Site Clean-Up List

List of sites where unauthorized releases of potentially hazardous materials have occurred.

Date of Government Version: 11/07/2018 Date Data Arrived at EDR: 01/04/2019 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 60

Source: Sacramento County Environmental Management

Telephone: 916-875-8406 Last EDR Contact: 04/02/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Quarterly

ML SACRAMENTO: Master Hazardous Materials Facility List

Any business that has hazardous materials on site - hazardous material storage sites, underground storage tanks, waste generators.

Date of Government Version: 11/07/2018 Date Data Arrived at EDR: 12/28/2018 Date Made Active in Reports: 03/05/2019

Number of Days to Update: 67

Source: Sacramento County Environmental Management

Telephone: 916-875-8406 Last EDR Contact: 04/02/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Quarterly

SAN BENITO COUNTY:

CUPA SAN BENITO: CUPA Facility List

Cupa facility list

Date of Government Version: 11/15/2018 Date Data Arrived at EDR: 11/16/2018 Date Made Active in Reports: 12/13/2018

Number of Days to Update: 27

Source: San Benito County Environmental Health

Telephone: N/A

Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 05/20/2019

Data Release Frequency: Varies

SAN BERNARDINO COUNTY:

PERMITS SAN BERNARDINO: Hazardous Material Permits

This listing includes underground storage tanks, medical waste handlers/generators, hazardous materials handlers, hazardous waste generators, and waste oil generators/handlers.

Date of Government Version: 02/27/2019 Date Data Arrived at EDR: 02/28/2019 Date Made Active in Reports: 04/02/2019

Number of Days to Update: 33

Source: San Bernardino County Fire Department Hazardous Materials Division

Telephone: 909-387-3041 Last EDR Contact: 02/19/2019

Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Quarterly

SAN DIEGO COUNTY:

HMMD SAN DIEGO: Hazardous Materials Management Division Database

The database includes: HE58 - This report contains the business name, site address, business phone number, establishment 'H' permit number, type of permit, and the business status. HE17 - In addition to providing the same information provided in the HE58 listing, HE17 provides inspection dates, violations received by the establishment, hazardous waste generated, the quantity, method of storage, treatment/disposal of waste and the hauler, and information on underground storage tanks. Unauthorized Release List - Includes a summary of environmental contamination cases in San Diego County (underground tank cases, non-tank cases, groundwater contamination, and soil contamination are included.)

Date of Government Version: 03/04/2019 Date Data Arrived at EDR: 03/05/2019 Date Made Active in Reports: 04/02/2019

Number of Days to Update: 28

Source: Hazardous Materials Management Division

Telephone: 619-338-2268 Last EDR Contact: 03/05/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Quarterly

LF SAN DIEGO: Solid Waste Facilities

San Diego County Solid Waste Facilities.

Date of Government Version: 04/18/2018 Date Data Arrived at EDR: 04/24/2018 Date Made Active in Reports: 06/19/2018

Number of Days to Update: 56

Source: Department of Health Services

Telephone: 619-338-2209 Last EDR Contact: 01/17/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

SAN DIEGO CO LOP: Local Oversight Program Listing

A listing of all LOP release sites that are or were under the County of San Diego's jurisdiction. Included are closed or transferred cases, open cases, and cases that did not have a case type indicated. The cases without a case type are mostly complaints; however, some of them could be LOP cases.

Date of Government Version: 10/22/2018 Date Data Arrived at EDR: 10/23/2018 Date Made Active in Reports: 11/30/2018

Number of Days to Update: 38

Source: Department of Environmental Health

Telephone: 858-505-6874 Last EDR Contact: 03/06/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Varies

SAN DIEGO CO. SAM: Environmental Case Listing

The listing contains all underground tank release cases and projects pertaining to properties contaminated with hazardous substances that are actively under review by the Site Assessment and Mitigation Program.

Date of Government Version: 03/23/2010 Date Data Arrived at EDR: 06/15/2010 Date Made Active in Reports: 07/09/2010

Number of Days to Update: 24

Source: San Diego County Department of Environmental Health

Telephone: 619-338-2371 Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: No Update Planned

SAN FRANCISCO COUNTY:

LUST SAN FRANCISCO: Local Oversite Facilities

A listing of leaking underground storage tank sites located in San Francisco county.

Date of Government Version: 09/19/2008 Date Data Arrived at EDR: 09/19/2008 Date Made Active in Reports: 09/29/2008

Number of Days to Update: 10

Source: Department Of Public Health San Francisco County

Telephone: 415-252-3920 Last EDR Contact: 01/31/2019

Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Quarterly

UST SAN FRANCISCO: Underground Storage Tank Information

Underground storage tank sites located in San Francisco county.

Date of Government Version: 11/05/2018 Date Data Arrived at EDR: 11/06/2018 Date Made Active in Reports: 12/14/2018

Number of Days to Update: 38

Source: Department of Public Health

Telephone: 415-252-3920 Last EDR Contact: 01/31/2019

Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Quarterly

SAN JOAQUIN COUNTY:

UST SAN JOAQUIN: San Joaquin Co. UST

A listing of underground storage tank locations in San Joaquin county.

Date of Government Version: 06/22/2018 Date Data Arrived at EDR: 06/26/2018 Date Made Active in Reports: 07/11/2018

Number of Days to Update: 15

Source: Environmental Health Department

Telephone: N/A

Last EDR Contact: 03/18/2019

Next Scheduled EDR Contact: 07/01/2019 Data Release Frequency: Semi-Annually

SAN LUIS OBISPO COUNTY:

CUPA SAN LUIS OBISPO: CUPA Facility List

Cupa Facility List.

Date of Government Version: 02/13/2019 Date Data Arrived at EDR: 02/15/2019 Date Made Active in Reports: 03/14/2019

Number of Days to Update: 27

Source: San Luis Obispo County Public Health Department

Telephone: 805-781-5596 Last EDR Contact: 02/13/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Varies

SAN MATEO COUNTY:

BI SAN MATEO: Business Inventory

List includes Hazardous Materials Business Plan, hazardous waste generators, and underground storage tanks.

Date of Government Version: 12/03/2018 Date Data Arrived at EDR: 12/12/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 34

Telephone: 650-363-1921 Last EDR Contact: 03/13/2019

Next Scheduled EDR Contact: 06/24/2019 Data Release Frequency: Annually

LUST SAN MATEO: Fuel Leak List

A listing of leaking underground storage tank sites located in San Mateo county.

Date of Government Version: 12/13/2018 Date Data Arrived at EDR: 12/18/2018 Date Made Active in Reports: 01/23/2019

Number of Days to Update: 36

Source: San Mateo County Environmental Health Services Division

Source: San Mateo County Environmental Health Services Division

Telephone: 650-363-1921 Last EDR Contact: 03/25/2019

Next Scheduled EDR Contact: 06/24/2019 Data Release Frequency: Semi-Annually

SANTA BARBARA COUNTY:

CUPA SANTA BARBARA: CUPA Facility Listing

CUPA Program Listing from the Environmental Health Services division.

Date of Government Version: 09/08/2011 Date Data Arrived at EDR: 09/09/2011 Date Made Active in Reports: 10/07/2011

Number of Days to Update: 28

Source: Santa Barbara County Public Health Department

Telephone: 805-686-8167 Last EDR Contact: 02/13/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Varies

SANTA CLARA COUNTY:

CUPA SANTA CLARA: Cupa Facility List

Cupa facility list

Date of Government Version: 02/13/2019 Date Data Arrived at EDR: 02/19/2019 Date Made Active in Reports: 03/06/2019

Number of Days to Update: 15

Source: Department of Environmental Health

Telephone: 408-918-1973 Last EDR Contact: 02/13/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Varies

HIST LUST SANTA CLARA: HIST LUST - Fuel Leak Site Activity Report

A listing of open and closed leaking underground storage tanks. This listing is no longer updated by the county.

Leaking underground storage tanks are now handled by the Department of Environmental Health.

Date of Government Version: 03/29/2005 Date Data Arrived at EDR: 03/30/2005 Date Made Active in Reports: 04/21/2005

Number of Days to Update: 22

Source: Santa Clara Valley Water District

Telephone: 408-265-2600 Last EDR Contact: 03/23/2009

Next Scheduled EDR Contact: 06/22/2009 Data Release Frequency: No Update Planned

LUST SANTA CLARA: LOP Listing

A listing of leaking underground storage tanks located in Santa Clara county.

Date of Government Version: 03/03/2014 Date Data Arrived at EDR: 03/05/2014 Date Made Active in Reports: 03/18/2014

Number of Days to Update: 13

Source: Department of Environmental Health

Telephone: 408-918-3417 Last EDR Contact: 02/21/2019

Next Scheduled EDR Contact: 06/10/2019 Data Release Frequency: Annually

SAN JOSE HAZMAT: Hazardous Material Facilities

Hazardous material facilities, including underground storage tank sites.

Date of Government Version: 01/30/2019 Date Data Arrived at EDR: 02/01/2019 Date Made Active in Reports: 03/07/2019

Number of Days to Update: 34

Source: City of San Jose Fire Department

Telephone: 408-535-7694 Last EDR Contact: 01/31/2019

Next Scheduled EDR Contact: 05/20/2019 Data Release Frequency: Annually

SANTA CRUZ COUNTY:

CUPA SANTA CRUZ: CUPA Facility List

CUPA facility listing.

Date of Government Version: 01/21/2017 Date Data Arrived at EDR: 02/22/2017 Date Made Active in Reports: 05/23/2017

Number of Days to Update: 90

Source: Santa Cruz County Environmental Health

Telephone: 831-464-2761 Last EDR Contact: 02/13/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Varies

SHASTA COUNTY:

CUPA SHASTA: CUPA Facility List

Cupa Facility List.

Date of Government Version: 06/15/2017 Date Data Arrived at EDR: 06/19/2017 Date Made Active in Reports: 08/09/2017

Number of Days to Update: 51

Source: Shasta County Department of Resource Management

Telephone: 530-225-5789 Last EDR Contact: 02/13/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Varies

SOLANO COUNTY:

LUST SOLANO: Leaking Underground Storage Tanks

A listing of leaking underground storage tank sites located in Solano county.

Date of Government Version: 11/29/2018 Date Data Arrived at EDR: 12/04/2018 Date Made Active in Reports: 01/11/2019

Number of Days to Update: 38

Source: Solano County Department of Environmental Management

Telephone: 707-784-6770 Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Quarterly

UST SOLANO: Underground Storage Tanks

Underground storage tank sites located in Solano county.

Date of Government Version: 03/05/2019 Date Data Arrived at EDR: 03/07/2019 Date Made Active in Reports: 04/03/2019

Number of Days to Update: 27

Source: Solano County Department of Environmental Management

Telephone: 707-784-6770 Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Quarterly

SONOMA COUNTY:

CUPA SONOMA: Cupa Facility List

Cupa Facility list

Date of Government Version: 12/21/2018 Date Data Arrived at EDR: 12/27/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 19

Source: County of Sonoma Fire & Emergency Services Department

Telephone: 707-565-1174 Last EDR Contact: 03/25/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Varies

LUST SONOMA: Leaking Underground Storage Tank Sites

A listing of leaking underground storage tank sites located in Sonoma county.

Date of Government Version: 01/08/2019 Date Data Arrived at EDR: 01/10/2019 Date Made Active in Reports: 03/06/2019

Number of Days to Update: 55

Source: Department of Health Services

Telephone: 707-565-6565 Last EDR Contact: 04/08/2019

Next Scheduled EDR Contact: 07/08/2019 Data Release Frequency: Quarterly

STANISLAUS COUNTY:

CUPA STANISLAUS: CUPA Facility List

Cupa facility list

Date of Government Version: 12/11/2018 Date Data Arrived at EDR: 12/13/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 33

Source: Stanislaus County Department of Ennvironmental Protection

Telephone: 209-525-6751 Last EDR Contact: 12/13/2018

Next Scheduled EDR Contact: 04/29/2019 Data Release Frequency: Varies

SUTTER COUNTY:

UST SUTTER: Underground Storage Tanks

Underground storage tank sites located in Sutter county.

Date of Government Version: 02/28/2019 Date Data Arrived at EDR: 03/01/2019 Date Made Active in Reports: 04/03/2019

Number of Days to Update: 33

Source: Sutter County Environmental Health Services

Telephone: 530-822-7500 Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 06/17/2019 Data Release Frequency: Semi-Annually

TEHAMA COUNTY:

CUPA TEHAMA: CUPA Facility List

Cupa facilities

Date of Government Version: 12/13/2018 Date Data Arrived at EDR: 12/18/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 28

Source: Tehama County Department of Environmental Health

Telephone: 530-527-8020 Last EDR Contact: 01/31/2019

Next Scheduled EDR Contact: 05/20/2019 Data Release Frequency: Varies

TRINITY COUNTY:

CUPA TRINITY: CUPA Facility List

Cupa facility list

Date of Government Version: 01/18/2019 Date Data Arrived at EDR: 01/23/2019 Date Made Active in Reports: 03/06/2019

Number of Days to Update: 42

Source: Department of Toxic Substances Control

Telephone: 760-352-0381 Last EDR Contact: 01/17/2019

Next Scheduled EDR Contact: 05/06/2019

Data Release Frequency: Varies

TULARE COUNTY:

CUPA TULARE: CUPA Facility List Cupa program facilities

Date of Government Version: 12/26/2018 Date Data Arrived at EDR: 12/27/2018 Date Made Active in Reports: 01/15/2019

Number of Days to Update: 19

Source: Tulare County Environmental Health Services Division

Telephone: 559-624-7400

Last EDR Contact: 01/31/2019

Next Scheduled EDR Contact: 05/20/2019

Data Release Frequency: Varies

TUOLUMNE COUNTY:

CUPA TUOLUMNE: CUPA Facility List

Cupa facility list

Date of Government Version: 04/23/2018 Date Data Arrived at EDR: 04/25/2018 Date Made Active in Reports: 06/25/2018

Number of Days to Update: 61

Source: Divison of Environmental Health

Telephone: 209-533-5633 Last EDR Contact: 03/18/2019

Next Scheduled EDR Contact: 05/06/2019

Data Release Frequency: Varies

VENTURA COUNTY:

BWT VENTURA: Business Plan, Hazardous Waste Producers, and Operating Underground Tanks

The BWT list indicates by site address whether the Environmental Health Division has Business Plan (B), Waste

Producer (W), and/or Underground Tank (T) information.

Date of Government Version: 12/26/2018 Date Data Arrived at EDR: 01/24/2019 Date Made Active in Reports: 02/28/2019

Number of Days to Update: 35

Source: Ventura County Environmental Health Division

Telephone: 805-654-2813 Last EDR Contact: 01/22/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Quarterly

LF VENTURA: Inventory of Illegal Abandoned and Inactive Sites

Ventura County Inventory of Closed, Illegal Abandoned, and Inactive Sites.

Date of Government Version: 12/01/2011
Date Data Arrived at EDR: 12/01/2011
Date Made Active in Reports: 01/19/2012

Number of Days to Update: 49

Source: Environmental Health Division

Telephone: 805-654-2813 Last EDR Contact: 03/29/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Annually

LUST VENTURA: Listing of Underground Tank Cleanup Sites

Ventura County Underground Storage Tank Cleanup Sites (LUST).

Date of Government Version: 05/29/2008 Date Data Arrived at EDR: 06/24/2008 Date Made Active in Reports: 07/31/2008

Number of Days to Update: 37

Source: Environmental Health Division

Telephone: 805-654-2813 Last EDR Contact: 02/07/2019

Next Scheduled EDR Contact: 05/27/2019 Data Release Frequency: Quarterly

MED WASTE VENTURA: Medical Waste Program List

To protect public health and safety and the environment from potential exposure to disease causing agents, the Environmental Health Division Medical Waste Program regulates the generation, handling, storage, treatment and disposal of medical waste throughout the County.

Date of Government Version: 12/26/2018 Date Data Arrived at EDR: 01/24/2019 Date Made Active in Reports: 03/07/2019

Number of Days to Update: 42

Source: Ventura County Resource Management Agency

Telephone: 805-654-2813 Last EDR Contact: 01/22/2019

Next Scheduled EDR Contact: 05/06/2019 Data Release Frequency: Quarterly

UST VENTURA: Underground Tank Closed Sites List

Ventura County Operating Underground Storage Tank Sites (UST)/Underground Tank Closed Sites List.

Date of Government Version: 02/26/2019 Date Data Arrived at EDR: 03/13/2019 Date Made Active in Reports: 04/03/2019

Number of Days to Update: 21

Source: Environmental Health Division

Telephone: 805-654-2813 Last EDR Contact: 03/13/2019

Next Scheduled EDR Contact: 06/24/2019 Data Release Frequency: Quarterly

YOLO COUNTY:

UST YOLO: Underground Storage Tank Comprehensive Facility Report Underground storage tank sites located in Yolo county.

Date of Government Version: 12/26/2018
Date Data Arrived at EDR: 01/03/2019
Date Made Active in Reports: 01/16/2019

Number of Days to Update: 13

Source: Yolo County Department of Health

Telephone: 530-666-8646 Last EDR Contact: 03/29/2019

Next Scheduled EDR Contact: 07/15/2019 Data Release Frequency: Annually

YUBA COUNTY:

CUPA YUBA: CUPA Facility List

CUPA facility listing for Yuba County.

Date of Government Version: 02/08/2019 Date Data Arrived at EDR: 02/12/2019 Date Made Active in Reports: 03/06/2019

Number of Days to Update: 22

Source: Yuba County Environmental Health Department

Telephone: 530-749-7523 Last EDR Contact: 01/28/2019

Next Scheduled EDR Contact: 05/11/2019

Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 02/11/2019 Date Data Arrived at EDR: 02/12/2019 Date Made Active in Reports: 03/04/2019

Number of Days to Update: 20

Source: Department of Energy & Environmental Protection

Telephone: 860-424-3375 Last EDR Contact: 02/12/2019

Next Scheduled EDR Contact: 05/27/2019
Data Release Frequency: No Update Planned

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2017 Date Data Arrived at EDR: 07/13/2018 Date Made Active in Reports: 08/01/2018

Number of Days to Update: 19

Source: Department of Environmental Protection

Telephone: N/A

Last EDR Contact: 04/10/2019

Next Scheduled EDR Contact: 07/22/2019 Data Release Frequency: Annually

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD

facility.

Date of Government Version: 01/01/2019 Date Data Arrived at EDR: 01/30/2019 Date Made Active in Reports: 02/14/2019

Number of Days to Update: 15

Source: Department of Environmental Conservation

Telephone: 518-402-8651 Last EDR Contact: 01/30/2019

Next Scheduled EDR Contact: 05/11/2019 Data Release Frequency: Quarterly

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2017 Date Data Arrived at EDR: 10/23/2018 Date Made Active in Reports: 11/27/2018

Number of Days to Update: 35

Source: Department of Environmental Protection

Telephone: 717-783-8990 Last EDR Contact: 01/11/2019

Next Scheduled EDR Contact: 04/29/2019 Data Release Frequency: Annually

RI MANIFEST: Manifest information Hazardous waste manifest information

> Date of Government Version: 12/31/2017 Date Data Arrived at EDR: 02/23/2018 Date Made Active in Reports: 04/09/2018

Number of Days to Update: 45

Source: Department of Environmental Management

Telephone: 401-222-2797 Last EDR Contact: 02/19/2019

Next Scheduled EDR Contact: 06/03/2019 Data Release Frequency: Annually

WI MANIFEST: Manifest Information Hazardous waste manifest information.

> Date of Government Version: 12/31/2017 Date Data Arrived at EDR: 06/15/2018 Date Made Active in Reports: 07/09/2018

Number of Days to Update: 24

Source: Department of Natural Resources

Telephone: N/A

Last EDR Contact: 03/11/2019

Next Scheduled EDR Contact: 06/24/2019 Data Release Frequency: Annually

Oil/Gas Pipelines

Source: PennWell Corporation

Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Electric Power Transmission Line Data

Source: PennWell Corporation

This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services,

a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary

and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Licensed Facilities Source: Department of Social Services

Telephone: 916-657-4041

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory

Source: Department of Fish and Wildlife

Telephone: 916-445-0411

Current USGS 7.5 Minute Topographic Map Source: U.S. Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK®-PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

MADERA INDUSTRIAL WAREHOUSE BUILDINGS 401-425 & 610 NORTH E STREET MADERA, CA 93638

TARGET PROPERTY COORDINATES

Latitude (North): 36.965317 - 36° 57' 55.14" Longitude (West): 120.062753 - 120° 3' 45.91"

Universal Tranverse Mercator: Zone 10 UTM X (Meters): 761501.7 UTM Y (Meters): 4094854.5

Elevation: 273 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map: 5602514 MADERA, CA

Version Date: 2012

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

- 1. Groundwater flow direction, and
- 2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General SSW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

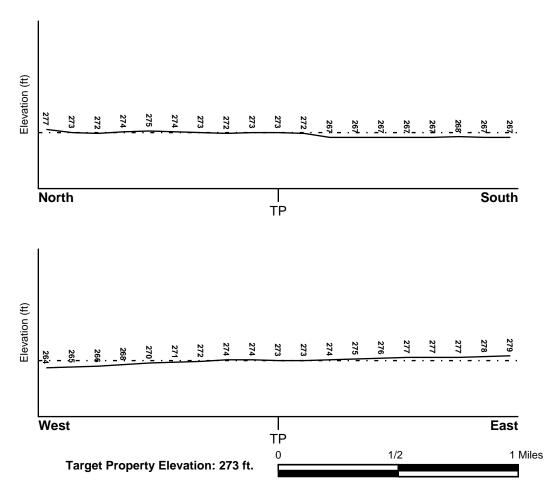

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Flood Plain Panel at Target Property FEMA Source Type

06039C1155E FEMA FIRM Flood data

Additional Panels in search area: FEMA Source Type

06039C1160E FEMA FIRM Flood data

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property Data Coverage

MADERA YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius: 1.25 miles Status: Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

LOCATION GENERAL DIRECTION
MAP ID FROM TP GROUNDWATER FLOW
Not Reported

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

GEOLOGIC AGE IDENTIFICATION


Era: Cenozoic Category: Stratifed Sequence

System: Quaternary Series: Quaternary

Code: Q (decoded above as Era, System & Series)

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 5620993.2s

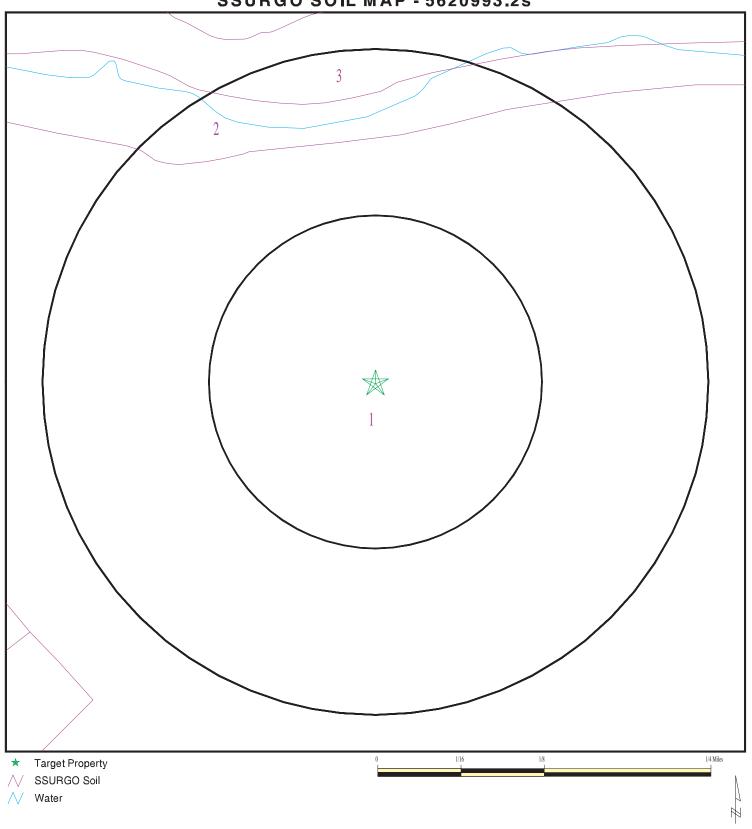

SITE NAME: Madera Industrial Warehouse Buildings ADDRESS: 401-425 & 610 North E Street MADERA CA 93638 LAT/LONG: 36.965317 / 120.062753

CLIENT: Partner Engineering and Science, Inc. CONTACT: Colleen Tubridy INQUIRY #: 5620993.2s

DATE: April 15, 2019 12:08 pm

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: Towns (not surveyed)

Soil Surface Texture:

Hydrologic Group: Not reported

Soil Drainage Class: Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

No Layer Information available.

Soil Map ID: 2

Soil Component Name: Riverwash

Soil Surface Texture: sand

Hydrologic Group: Class D - Very slow infiltration rates. Soils are clayey, have a high

water table, or are shallow to an impervious layer.

Soil Drainage Class: Excessively drained

Hydric Status: All hydric

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
	Boundary			Classification		Saturated hydraulic	
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity micro m/sec	
1	0 inches	5 inches	sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: Min:
2	5 inches	59 inches	stratified coarse sand to sandy loam	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: Min:

Soil Map ID: 3

Soil Component Name: Greenfield

Soil Surface Texture: fine sandy loam

Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse Hydrologic Group:

textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
	Boundary			Classification		Saturated hydraulic	
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity micro m/sec	Soil Reaction (pH)
1	0 inches	22 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 42 Min: 14	Max: 7.8 Min: 6.6
2	22 inches	51 inches	sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 42 Min: 14	Max: 7.8 Min: 6.6
3	51 inches	72 inches	stratified loamy sand to sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 42 Min: 14	Max: 7.8 Min: 6.6

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

DATABASE SEARCH DISTANCE (miles)

Federal USGS 1.000

Federal FRDS PWS Nearest PWS within 1 mile

State Database 1.000

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
A1	USGS40000179957	1/8 - 1/4 Mile SSW
A2	USGS40000179955	1/8 - 1/4 Mile SSW
3	USGS40000179961	1/8 - 1/4 Mile ESE
5	USGS40000180038	1/4 - 1/2 Mile North
11	USGS40000179933	1/4 - 1/2 Mile SE

FEDERAL USGS WELL INFORMATION

WELL ID	LOCATION FROM TP
USGS40000180015	1/4 - 1/2 Mile ENE
USGS40000179906	1/2 - 1 Mile SW
USGS40000180091	1/2 - 1 Mile North
USGS40000179889	1/2 - 1 Mile SE
USGS40000179850	1/2 - 1 Mile South
USGS40000180065	1/2 - 1 Mile ENE
USGS40000179925	1/2 - 1 Mile WSW
USGS40000179973	1/2 - 1 Mile East
	USGS40000180015 USGS40000179906 USGS40000180091 USGS40000179889 USGS40000179850 USGS40000180065 USGS40000179925

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION


MAP ID	WELL ID	LOCATION FROM TP
10	CA3100024	1/4 - 1/2 Mile SSE

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
	10660	1/8 - 1/4 Mile SSW
B6	10661	1/4 - 1/2 Mile WNW
B7	10652	1/4 - 1/2 Mile WNW
B8	10658	1/4 - 1/2 Mile WNW
B9	10659	1/4 - 1/2 Mile WNW
C13	CADW60000025054	1/2 - 1 Mile West
C14	CADW60000025055	1/2 - 1 Mile West
D16	10678	1/2 - 1 Mile East
D17	10676	1/2 - 1 Mile East
D18	10680	1/2 - 1 Mile East
D19	10679	1/2 - 1 Mile East
E21	10677	1/2 - 1 Mile ENE
25	10655	1/2 - 1 Mile NW
27	CADW60000008566	1/2 - 1 Mile SSE

PHYSICAL SETTING SOURCE MAP - 5620993.2s

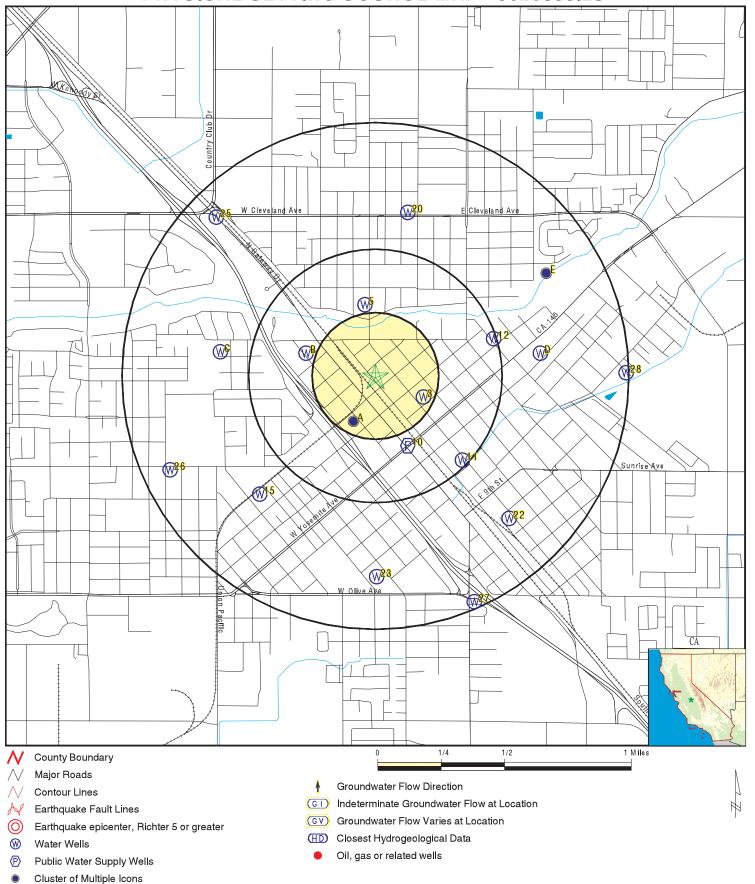

No contour lines were detected within this map area.

SITE NAME: Madera Industrial Warehouse Buildings
ADDRESS: 401-425 & 610 North E Street

CLIENT: Partner Engineering and Science, Inc.
CONTACT: Colleen Tubridy

Copyright © 2019 EDR, Inc. © 2015 TomTom Rel. 2015.

GEOCHECK®-PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID Direction Distance

Elevation Database EDR ID Number

A1 SSW 1/8 - 1/4 Mile

FED USGS USGS40000179957

USGS40000179955

USGS40000179961

1/8 - 1/4 Mile Higher

Organization ID: USGS-CA

Organization Name: USGS California Water Science Center

011S017E24G003M Monitor Location: Well Type: 18040001 Description: Not Reported HUC: Drainage Area: Not Reported Drainage Area Units: Not Reported Contrib Drainage Area: Not Reported Contrib Drainage Area Unts: Not Reported

Aquifer: Central Valley aquifer system

Formation Type: Not Reported Aquifer Type: Not Reported

Construction Date: 19810402 Well Depth: 540 Well Depth Units: ft Well Hole Depth: 635

Well Hole Depth Units: ft

Ground water levels, Number of Measurements: 1 Level reading date: 1981-04-02 Feet below surface: 105 Feet to sea level: Not Reported

Note: Not Reported

40

SSW 1/8 - 1/4 Mile Lower

- 1/4 Mille Wer

Organization ID: USGS-CA

Organization Name: USGS California Water Science Center Monitor Location: 011S017E24G001M Well Type: Description: Not Reported 18040001 HUC: Drainage Area: Not Reported Drainage Area Units: Not Reported Contrib Drainage Area: Not Reported Contrib Drainage Area Unts: Not Reported

Aquifer: Central Valley aquifer system

Formation Type: Not Reported Aquifer Type: Not Reported

Construction Date: 19610101 Well Depth: 376

Well Depth Units: ft Well Hole Depth: Not Reported

Well Hole Depth Units: Not Reported

ESE 1/8 - 1/4 Mile Higher

Organization ID: USGS-CA

Organization Name: USGS California Water Science Center

Monitor Location: 011S017E24A001M Well Type: Description: Not Reported HUC: 18040001 Drainage Area: Not Reported Drainage Area Units: Not Reported Contrib Drainage Area: Not Reported Contrib Drainage Area Unts: Not Reported

Aquifer: Central Valley aquifer system

Formation Type: Not Reported Aquifer Type: Not Reported

Construction Date: 19270101 Well Depth: 132

Well Depth Units: ft Well Hole Depth: Not Reported

Well Hole Depth Units: Not Reported

FED USGS

FED USGS

GEOCHECK®-PHYSICAL SETTING SOURCE MAP FINDINGS

1965-11-01 Ground water levels, Number of Measurements: Level reading date: 1 Feet below surface: 64.00 Feet to sea level: Not Reported

Note: Not Reported

A4 SSW **CA WELLS** 10660

1/8 - 1/4 Mile Lower

> Seq: 10660 Prim sta c: 11S/17E-24G03 M

Frds no: 2010002018 County: 20 District: 11 User id: **AGE** System no: 2010002 Water type: G

WELL/AMBNT/MUN/INTAKE WELL 22 Source nam: Station ty:

365745.0 Latitude: Longitude: 1200348.0 Precision: Status: ΑU

Not Reported Comment 2: Not Reported Comment 1: Not Reported Not Reported Comment 3: Comment 4: Comment 5: Not Reported Comment 6: Not Reported

Comment 7: Not Reported

CITY OF MADERA System no: 2010002 System nam: 205 W. 4TH STREET Hqname: Not Reported Address:

City: **MADERA** State: Not Reported Zip: 93637 Zip ext: Not Reported Pop serv: 31740 Connection: 7810

MADERA AND SURROUNDING AREA Area serve:

16-NOV-17 Sample date: Finding: 2.8

Chemical: **TETRACHLOROETHYLENE** Report units: UG/L

Dlr: 0.5

25-MAY-17 Sample date: 4.5 Finding: Chemical: **SULFATE** Report units: MG/L

DIr: 0.5

25-MAY-17 Sample date: Finding: 0.11

LANGELIER INDEX @ 60 C Chemical: Report units: Not Reported

DIr: 0.

25-MAY-17 Sample date: Finding: 12.

AGGRSSIVE INDEX (CORROSIVITY) Chemical: Report units: Not Reported

DIr:

Sample date: 25-MAY-17 Finding:

Chemical: NITRATE + NITRITE (AS N) Report units: MG/L

DIr:

Sample date: 25-MAY-17 Finding: 2.

ODOR THRESHOLD @ 60 C TON Chemical: Report units:

DIr:

Sample date: 25-MAY-17 Finding: 230.

Chemical: SPECIFIC CONDUCTANCE Report units: US DIr: 0.

Sample date: 25-MAY-17 94. Finding:

Chemical: **BICARBONATE ALKALINITY** Report units: MG/L

DIr:

Sample date: 25-MAY-17 Finding: 1.1

Chemical: NITRATE (AS N) Report units: MG/L DIr: 0.4 Finding: 61.

Chemical: HARDNESS (TOTAL) AS CACO3 Report units: MG/L

Dlr: 0.

Sample date: 25-MAY-17 Finding: 16.
Chemical: CALCIUM Report units: MG/L

Dlr: 0.

Sample date: 25-MAY-17 Finding: 5.2 Chemical: MAGNESIUM Report units: MG/L

DIr: 0

Sample date: 25-MAY-17 Finding: 21.
Chemical: SODIUM Report units: MG/L

DIr: 0.

Sample date: 25-MAY-17 Finding: 3. Chemical: POTASSIUM Report units: MG/L

Dlr: 0.

Sample date: 25-MAY-17 Finding: 18.
Chemical: CHLORIDE Report units: MG/L

DIr: 0

Sample date: 25-MAY-17 Finding: 200.

Chemical: TOTAL DISSOLVED SOLIDS Report units: MG/L

DIr: 0

Sample date: 25-MAY-17 Finding: 2.1 Chemical: TETRACHLOROETHYLENE Report units: UG/L

DIr: 0.5

Sample date: 25-MAY-17 Finding: 77.

Chemical: ALKALINITY (TOTAL) AS CACO3 Report units: MG/L DIr: 0.

DIF: 0.

Sample date: 25-MAY-17 Finding: 7.9

Chemical: PH, LABORATORY Report units: Not Reported

Dlr: 0.

Sample date: 10-NOV-16 Finding: 2.3 Chemical: TETRACHLOROETHYLENE Report units: UG/L

DIr: 0.5

Sample date: 31-MAY-16 Finding: 1.3

Chemical: NITRATE (AS N) Report units: MG/L

Dlr: 0.4

Sample date: 19-NOV-15 Finding: 2.1
Chemical: TETRACHLOROETHYLENE Report units: UG/L

Chemical: TETRACHLOROETHYLENE Report units: DIr: 0.5

Sample date: 21-MAY-15 Finding: 5.2

Chemical: NITRATE (AS NO3) Report units: MG/L DIr: 2.

Sample date: 19-FEB-15 Finding: 1.1

Chemical: CHROMIUM, HEXAVALENT Report units: UG/L

Dlr: 1.

20-NOV-14 Sample date: Finding: 2.6 Chemical: **TETRACHLOROETHYLENE** Report units: UG/L DIr: 0.5 Sample date: 29-MAY-14 Finding: 12. AGGRSSIVE INDEX (CORROSIVITY) Chemical: Report units: Not Reported DIr: Finding: Sample date: 29-MAY-14 5.1 Chemical: NITRATE (AS NO3) Report units: MG/L DIr: Sample date: 29-MAY-14 Finding: 180. TOTAL DISSOLVED SOLIDS Chemical: Report units: MG/L DIr: Sample date: 29-MAY-14 Finding: 2.3 TETRACHLOROETHYLENE Report units: UG/L Chemical: DIr: 0.5 Sample date: 29-MAY-14 4.5 Finding: Chemical: SULFATE Report units: MG/L DIr: 0.5 Finding: Sample date: 29-MAY-14 2.9 Chemical: **POTASSIUM** Report units: MG/L DIr: Sample date: 29-MAY-14 Finding: 21. Chemical: SODIUM Report units: MG/L DIr: 29-MAY-14 Sample date: Finding: 4.9 MAGNESIUM Report units: Chemical: MG/L DIr: Sample date: 29-MAY-14 Finding: 16. CALCIUM Report units: Chemical: MG/L DIr: 0. Sample date: 29-MAY-14 Finding: 60. HARDNESS (TOTAL) AS CACO3 Chemical: Report units: MG/L DIr: 0. Sample date: 29-MAY-14 Finding: 100. Chemical: **BICARBONATE ALKALINITY** Report units: MG/L DIr: Sample date: 29-MAY-14 85. Finding: Chemical: ALKALINITY (TOTAL) AS CACO3 Report units: MG/L DIr: 29-MAY-14 Sample date: Finding: 8.1 Chemical: PH, LABORATORY Report units: Not Reported 230. Sample date: 29-MAY-14 Finding: SPECIFIC CONDUCTANCE Chemical: Report units: US Sample date: 29-MAY-14 Finding: 17. Chemical: **CHLORIDE** Report units: MG/L

DIr: 0.

Sample date: 21-NOV-13 Finding: 2.5 Chemical: TETRACHLOROETHYLENE Report units: UG/L

Dlr: 0.5

Sample date: 20-JUN-13 Finding: 3.9 Chemical: NITRATE (AS NO3) Report units: MG/L

Dlr: 2.

Sample date: 22-FEB-13 Finding: 1.9 Chemical: TETRACHLOROETHYLENE Report units: UG/L

Dlr: 0.5

Sample date: 22-FEB-13 Finding: 0.12

Chemical: FLUORIDE (F) (NATURAL-SOURCE) Report units: MG/L DIr: 0.1

Sample date: 22-FEB-13 Finding: 4. Chemical: SULFATE Report units: MG/L

Dir: 0.5

Sample date: 22-FEB-13 Finding: 16.
Chemical: CHLORIDE Report units: MG/L

Dlr: 0.

Sample date: 22-FEB-13 Finding: 2.7 Chemical: POTASSIUM Report units: MG/L

Dir: 0.

Sample date: 22-FEB-13 Finding: 21.

Chemical: SODIUM Report units: MG/L

Dir: 0.

Sample date: 22-FEB-13 Finding: 4.9

Chemical: MAGNESIUM Report units: MG/L DIr: 0.

Sample date: 22-FEB-13 Finding: 16.
Chemical: CALCIUM Report units: MG/L

Chemical: CALCIUM Report units: DIr: 0.

Sample date: 22-FEB-13 Finding: 60.

Chemical: HARDNESS (TOTAL) AS CACO3 Report units: MG/L DIr: 0.

Sample date: 22-FEB-13 Finding: 97.

Chemical: BICARBONATE ALKALINITY Report units: MG/L DIr: 0.

Sample date: 22-FEB-13 Finding: 79.

Chemical: ALKALINITY (TOTAL) AS CACO3 Report units: MG/L DIr: 0.

Sample date: 22-FEB-13 Finding: 7.8

Chemical: PH, LABORATORY Report units: Not Reported

Dir: 0.

Sample date: 22-FEB-13 Finding: 220.

Chemical: SPECIFIC CONDUCTANCE Report units: US

Dlr: 0.

Sample date: 22-FEB-13

Finding: Chemical: TOTAL DISSOLVED SOLIDS Report units: MG/L

DIr:

Sample date: 22-FEB-13 Finding: 3.9 Chemical: NITRATE (AS NO3) Report units: MG/L

DIr:

Sample date: 22-FEB-13 Finding: 11.

Chemical: AGGRSSIVE INDEX (CORROSIVITY) Report units: Not Reported

DIr:

Sample date: 10-DEC-12 Finding: 2.4

Chemical: **TETRACHLOROETHYLENE** Report units: UG/L

DIr: 0.5

Sample date: 29-MAY-12 Finding: 4.1 NITRATE (AS NO3) Chemical: Report units: MG/L

DIr:

Sample date: 06-MAR-12 0.77 Finding:

Chemical: **GROSS ALPHA MDA95** Report units: PCI/L

DIr:

Sample date: 06-MAR-12 8.e-002 Finding:

Chemical: **GROSS ALPHA COUNTING ERROR** Report units: PCI/L

DIr:

North **FED USGS** USGS40000180038

1/4 - 1/2 Mile Higher

> Organization ID: **USGS-CA**

Organization Name: USGS California Water Science Center

Monitor Location: 011S017E13Q001M Well 18040001 Description: Not Reported HUC: Drainage Area: Not Reported Drainage Area Units: Not Reported Contrib Drainage Area: Not Reported Contrib Drainage Area Unts: Not Reported

Aquifer: Central Valley aquifer system

Formation Type: Not Reported Aquifer Type: Not Reported

19380101 Construction Date: Well Depth: 245

Well Depth Units: Well Hole Depth: Not Reported

Well Hole Depth Units: Not Reported

WNW **CA WELLS** 10661

1/4 - 1/2 Mile Higher

> 10661 Prim sta c: 11S/17E-24Q02 M Seq:

Frds no: 2010002005 County: 20 District: 11 User id: AGE System no: 2010002 Water type: G

WELL/AMBNT/MUN/INTAKE/SUPPLY Source nam: WELL 07 - DESTROYED Station ty:

Latitude: 365800.0 Longitude: 1200400.0 Precision: 8 Status: DS

Not Reported Comment 2: Not Reported Comment 1: Comment 3: Not Reported Comment 4: Not Reported

170.

Comment 5: Not Reported Comment 6: Not Reported

Comment 7: Not Reported

System no: 2010002 System nam: CITY OF MADERA Hqname: Not Reported Address: 205 W. 4TH STREET City: MADERA State: Not Reported Zip: 93637 Zip ext: Not Reported

 Zip:
 93637
 Zip ext:
 Not Reported

 Pop serv:
 31740
 Connection:
 7810

Area serve: MADERA AND SURROUNDING AREA

B7
WNW CA WELLS 10652
1/4 - 1/2 Mile

Higher

Seq: 10652 Prim sta c: 11S/17E-13Q02 M

 Frds no:
 2010002003
 County:
 20

 District:
 11
 User id:
 AGE

 System no:
 2010002
 Water type:
 G

Source nam: WELL 05 - DESTROYED Station ty: WELL/AMBNT/MUN/INTAKE/SUPPLY

 Latitude:
 365800.0
 Longitude:
 1200400.0

 Precision:
 8
 Status:
 DS

Comment 1: Not Reported Comment 2: Not Reported Comment 3: Not Reported Comment 4: Not Reported Comment 5: Not Reported Comment 6: Not Reported

Comment 7: Not Reported

System no: 2010002 System nam: CITY OF MADERA Hqname: Not Reported Address: 205 W. 4TH STREET City: MADERA State: Not Reported

City:MADERAState:Not ReportedZip:93637Zip ext:Not ReportedPop serv:31740Connection:7810

Area serve: MADERA AND SURROUNDING AREA

B8 WNW 1/4 - 1/2 Mile Higher

Seq: 10658 Prim sta c: 11S/17E-24B01 M

 Frds no:
 2010002014
 County:
 20

 District:
 11
 User id:
 AGE

 System no:
 2010002
 Water type:
 G

Source nam: WELL 18 Station ty: WELL/AMBNT/MUN/INTAKE/SUPPLY

 Latitude:
 365800.0
 Longitude:
 1200400.0

 Precision:
 8
 Status:
 AU

Comment 1: Not Reported Comment 2: Not Reported Comment 3: Not Reported Comment 4: Not Reported Comment 5: Not Reported Comment 6: Not Reported

Comment 7: Not Reported

System no: 2010002 System nam: CITY OF MADERA Hqname: Not Reported Address: 205 W. 4TH STREET City: **MADERA** State: Not Reported Zip: 93637 Zip ext: Not Reported

Pop serv: 31740 Connection: 7810

Area serve: MADERA AND SURROUNDING AREA

Sample date: 15-MAR-18 Finding: 180. Chemical: TOTAL DISSOLVED SOLIDS Report units: MG/L

CA WELLS

10658

Dlr: 0.

Sample date: 15-MAR-18 Finding: 0.13 FLUORIDE (F) (NATURAL-SOURCE) Chemical: Report units: MG/L

DIr: 0.1

Sample date: 15-MAR-18 Finding: 5.4 Chemical: SULFATE Report units: MG/L

DIr: 0.5

15-MAR-18 Sample date: Finding: 18. Chemical: **CHLORIDE** Report units: MG/L

DIr:

Sample date: 15-MAR-18 7.8 Finding:

PH, LABORATORY Chemical: Report units: Not Reported

DIr:

15-MAR-18 Sample date: Finding: 2.8 Chemical: **POTASSIUM** Report units: MG/L

DIr: 0.

15-MAR-18 Sample date: Finding: 98.

BICARBONATE ALKALINITY Chemical: Report units: MG/L

DIr:

15-MAR-18 1.2 Sample date: Finding: Chemical: NITRATE (AS N) Report units: MG/L

DIr: 0.4

Sample date: 15-MAR-18 Finding: 17.

Chemical: **CALCIUM** Report units: MG/L

DIr: 0.

Sample date: 15-MAR-18 Finding: 5.4 Chemical: **MAGNESIUM** Report units: MG/L

DIr: 0.

15-MAR-18 Finding: Sample date: 23. MG/L

Chemical: **SODIUM** Report units:

DIr: 0.

Sample date: 15-MAR-18 81. Finding:

ALKALINITY (TOTAL) AS CACO3 Report units: MG/L Chemical: DIr:

Sample date: 25-MAY-17 Finding: 1.4

Chemical: NITRATE + NITRITE (AS N) Report units: MG/L

DIr: 0.4

Sample date: 25-MAY-17 Finding: 11.

Chemical: AGGRSSIVE INDEX (CORROSIVITY) Report units: Not Reported

DIr: 0.

Sample date: 25-MAY-17 Finding: 0.11

FLUORIDE (F) (NATURAL-SOURCE) Chemical: Report units: MG/L DIr: 0.1

Sample date: 25-MAY-17 Finding: 190.

TOTAL DISSOLVED SOLIDS Chemical: Report units: MG/L

DIr: 0.

Sample date: Chemical: Dlr:	25-MAY-17 SULFATE 0.5	Finding: Report units:	6.3 MG/L
Sample date: Chemical: Dlr:	25-MAY-17 CHLORIDE 0.	Finding: Report units:	18. MG/L
Sample date: Chemical: Dlr:	25-MAY-17 POTASSIUM 0.	Finding: Report units:	2.9 MG/L
Sample date: Chemical: Dlr:	25-MAY-17 SODIUM 0.	Finding: Report units:	22. MG/L
Sample date: Chemical: Dlr:	25-MAY-17 MAGNESIUM 0.	Finding: Report units:	5.6 MG/L
Sample date: Chemical: Dlr:	25-MAY-17 CALCIUM 0.	Finding: Report units:	18. MG/L
Sample date: Chemical: Dlr:	25-MAY-17 HARDNESS (TOTAL) AS CACO3 0.	Finding: Report units:	68. MG/L
Sample date: Chemical: Dlr:	25-MAY-17 NITRATE (AS N) 0.4	Finding: Report units:	1.4 MG/L
Sample date: Chemical: Dlr:	25-MAY-17 BICARBONATE ALKALINITY 0.	Finding: Report units:	100. MG/L
Sample date: Chemical: Dlr:	25-MAY-17 ALKALINITY (TOTAL) AS CACO3 0.	Finding: Report units:	82. MG/L
Sample date: Chemical: Dlr:	25-MAY-17 PH, LABORATORY 0.	Finding: Report units:	7.6 Not Reported
Sample date: Chemical: Dlr:	25-MAY-17 SPECIFIC CONDUCTANCE 0.	Finding: Report units:	240. US
Sample date: Chemical: Dlr:	25-AUG-16 POTASSIUM 0.	Finding: Report units:	3.2 MG/L
Sample date: Chemical: Dlr:	25-AUG-16 CHLORIDE 0.	Finding: Report units:	17. MG/L
Sample date: Chemical: Dlr:	25-AUG-16 SPECIFIC CONDUCTANCE 0.	Finding: Report units:	240. US
Sample date: Chemical:	25-AUG-16 PH, LABORATORY	Finding: Report units:	7.8 Not Reported

Dlr: 0.

Sample date: 25-AUG-16 Finding: 83. ALKALINITY (TOTAL) AS CACO3 Chemical: Report units: MG/L

DIr: 0.

Sample date: 25-AUG-16 Finding: 100. Chemical: **BICARBONATE ALKALINITY** Report units: MG/L

DIr:

25-AUG-16 Sample date: Finding: 5.6 Chemical: **SULFATE** Report units: MG/L

DIr: 0.5

Sample date: 25-AUG-16 0.11 Finding:

FLUORIDE (F) (NATURAL-SOURCE) Chemical: Report units: MG/L DIr: 0.1

25-AUG-16 Sample date: Finding: 190.

TOTAL DISSOLVED SOLIDS Chemical: Report units: MG/L DIr:

25-AUG-16 Sample date: Finding: 0.36

TURBIDITY, LABORATORY Chemical: Report units: NTU DIr: 0.1

25-AUG-16 Sample date: Finding: AGGRSSIVE INDEX (CORROSIVITY) Chemical:

Report units: Not Reported DIr:

Sample date: 25-AUG-16 Finding: 20.

Chemical: SODIUM Report units: MG/L DIr: 0.

Sample date: 25-AUG-16 Finding: 5.8

Chemical: **MAGNESIUM** Report units: MG/L DIr: 0.

25-AUG-16 Finding: Sample date: 19. Chemical: **CALCIUM** Report units: MG/L

DIr: 0.

Sample date: 25-AUG-16 72. Finding: HARDNESS (TOTAL) AS CACO3 Report units: MG/L Chemical:

DIr:

Sample date: 25-AUG-16 Finding: 1.3 NITRATE (AS N) Chemical: Report units: MG/L

DIr: 0.4

Sample date: 21-MAY-15 Finding: 7.4 Chemical: NITRATE (AS NO3) Report units: MG/L

DIr:

Sample date: 20-JUN-13 Finding: 6.9 Chemical: NITRATE (AS NO3) Report units: MG/L

DIr:

Sample date: 29-MAY-12 Finding: 6. Chemical: NITRATE (AS NO3) Report units: MG/L

DIr: 2.

Sample date: 06-MAR-12 Finding: 0.774 Chemical: GROSS ALPHA MDA95 Report units: PCI/L

Dlr: 0.

Sample date: 06-MAR-12 Finding: 9.5e-002 Chemical: GROSS ALPHA COUNTING ERROR Report units: PCI/L

DIr: 0.

B9 WNW CA WELLS 10659 1/4 - 1/2 Mile

Higher

Seq: 10659 Prim sta c: 11S/17E-24G02 M

 Frds no:
 2010002010
 County:
 20

 District:
 11
 User id:
 AGE

 System no:
 2010002
 Water type:
 G

Source nam: WELL 13 - DESTROYED Station ty: WELL/AMBNT/MUN/INTAKE/SUPPLY

 Latitude:
 365800.0
 Longitude:
 1200400.0

 Precision:
 8
 Status:
 DS

Comment 1: Not Reported Comment 2: Not Reported Comment 3: Not Reported Comment 4: Not Reported Comment 5: Not Reported Comment 6: Not Reported

Comment 7: Not Reported

System no: 2010002 System nam: CITY OF MADERA
Hqname: Not Reported Address: 205 W. 4TH STREET
City: MADERA State: Not Reported

 Zip:
 93637
 Zip ext:
 Not Reported

 Pop serv:
 31740
 Connection:
 7810

Area serve: MADERA AND SURROUNDING AREA

10 SSE FRDS PWS CA3100024

1/4 - 1/2 Mile Higher

PWS ID: CA3100024 PWS name: EDEN VALLEY IRRIGATION ASSOC

Address: Not Reported Care of: Not Reported

City: WEIMAR State: CA

Zip: 95736 Owner: EDEN VALLEY IRRIGATION ASSOC

Source code: Surface water Population: 105

PWS ID: CA3100024 PWS type: System Owner/Responsible Party

PWS name: EDEN VALLEY IRRIGATION ASSOC

PWS address:Not ReportedPWS city:WEIMARPWS state:CAPWS zip:93637PWS ID:CA3100024Activity status:Active

Date system activated: 7706 Date system deactivated: Not Reported

Retail population: System name: EDEN VALLEY IRRIGATION ASSOC

System address: EDEN VALLEY IRRIGATION ASSOC

System address: EDEN VALLEY System city: COLFAX System state: CA System zip: 94234

Population served: 101 - 500 Persons Treatment: Mixed (treated and untreated)

Latitude: 365741 Longitude: 1200334

PWS currently has or had major violation(s) or enforcement:Yes

Violation source ID:

Contaminant:

Not Reported

COLIFORM (TCR)

Violation ID: 9400001 PWS telephone: Not Reported

Violation type: Monitoring, Routine Major (TCR)

Violation start date: 100193 Violation end date: 103193 Violation period (months): 001 Violation awareness date: 113093 Major violator: Maximum contaminant level: Not Reported Yes Number of required samples: Not Reported Number of samples taken: Not Reported Analysis method: Not Reported Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

9400002 Violation source ID: Not Reported Violation ID: PWS telephone: Not Reported Contaminant: **Turbidity** Violation type: Monitoring, Regular Violation start date: 100193 Violation end date: 103193 Violation period (months): 001 Violation awareness date: 113093 Major violator: Yes

Maximum contaminant level: Not Reported Number of required samples: Not Reported Number of samples taken: Not Reported Analysis method: Not Reported

Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

Violation ID: 9400003 Violation source ID: Not Reported

PWS telephone: Not Reported Contaminant: COLIFORM (TCR)

PWS telephone: Not Reported Contaminant: COLIFORM (TCR)
Violation type: Monitoring, Routine Major (TCR)

Violation start date: 110193 Violation end date: 113093 Violation period (months): 001 Violation awareness date: 123093 Not Reported Major violator: Yes Maximum contaminant level: Number of required samples: Not Reported Number of samples taken: Not Reported Analysis method: Not Reported Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

9400004 Violation source ID: Not Reported Violation ID: PWS telephone: Not Reported Contaminant: **Turbidity** Violation type: Monitoring, Regular Violation start date: 110193 Violation end date: 113093 Violation period (months): 001 Violation awareness date: 123093 Major violator: Yes

Maximum contaminant level: Not Reported Number of required samples: Not Reported Number of samples taken: Not Reported Analysis method: Not Reported

Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

Violation ID: 9400005 Violation source ID: Not Reported PWS telephone: Not Reported Contaminant: Turbidity Violation type: Monitoring, Regular Violation start date: 070193 Violation end date: 073193 Violation period (months): 001

Violation end date: 073193 Violation period (months): 001
Violation awareness date: 083093 Major violator: Yes
Maximum contaminant level: Not Reported Number of required samples: Not Rep

Maximum contaminant level: Not Reported Number of required samples: Not Reported Number of samples taken: Not Reported Analysis method: Not Reported

Number of samples taken: 000 Analysis method: Not Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

 Violation ID:
 9400006
 Violation source ID:
 Not Reported

 PWS telephone:
 Not Reported
 Contaminant:
 COLIFORM (TCR)

Violation type: Monitoring, Routine Major (TCR)

Violation start date:070193Violation end date:073193Violation period (months):001Violation awareness date:083093Major violator:YesMaximum contaminant level:Not Reported

Number of required samples: Not Reported Number of samples taken: Not Reported

Analysis method: Not Reported Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

Not Reported Violation ID: 9400007 Violation source ID: PWS telephone: Not Reported Contaminant: **Turbidity** Violation type: Monitoring, Regular Violation start date: 080193 Violation end date: 083193 Violation period (months): 001 Violation awareness date: 093093 Major violator: Yes

Maximum contaminant level: Not Reported Number of required samples: Not Reported Number of samples taken: Not Reported Analysis method: Not Reported

Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

Violation ID:9400008Violation source ID:Not ReportedPWS telephone:Not ReportedContaminant:COLIFORM (TCR)

Violation type: Max Contaminant Level, Monthly (TCR)

Violation start date: 080193 Violation end date: 083193 Violation period (months): 001 Violation awareness date: 093093 Not Reported Major violator: Not Reported Maximum contaminant level: Number of required samples: Not Reported Number of samples taken: Not Reported Analysis method: Not Reported Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

Violation ID: 9400009 Violation source ID: Not Reported PWS telephone: Not Reported Contaminant: **Turbidity** Violation type: Monitoring, Regular Violation start date: 090193 Violation end date: 093093 Violation period (months): 001 103093 Violation awareness date: Major violator: Yes

Maximum contaminant level: Not Reported Number of required samples: Not Reported Number of samples taken: Not Reported Analysis method: Not Reported

Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

 Violation ID:
 9400010
 Violation source ID:
 Not Reported

 PWS telephone:
 Not Reported
 Contaminant:
 COLIFORM (TCR)

Violation type: Monitoring, Routine Major (TCR)

Violation start date: 120193 Violation end date: 123193 013094 Violation period (months): 001 Violation awareness date: Not Reported Major violator: Maximum contaminant level: Yes Number of required samples: Not Reported Number of samples taken: Not Reported Not Reported Analysis result: Not Reported Analysis method:

PWS currently has or had major violation(s) or enforcement:Yes

Violation ID:9400012Violation source ID:Not ReportedPWS telephone:Not ReportedContaminant:COLIFORM (TCR)

Violation type: Monitoring, Routine Major (TCR)

Violation start date: 020194 Violation end date: 022894 Violation period (months): 001 Violation awareness date: 033094 Major violator: Yes Maximum contaminant level: Not Reported Number of required samples: Not Reported Number of samples taken: Not Reported Analysis method: Not Reported Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

Violation ID:9400013Violation source ID:Not ReportedPWS telephone:Not ReportedContaminant:TurbidityViolation type:Monitoring, RegularViolation start date:020194

Violation end date: 022894 001 Violation period (months): Violation awareness date: 033094 Major violator: Yes

Maximum contaminant level: Not Reported Number of required samples: Not Reported Number of samples taken: 000 Analysis method: Not Reported

Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

9400014 Violation source ID: Violation ID: Not Reported PWS telephone: Not Reported COLIFORM (TCR) Contaminant:

Violation type: Monitoring, Routine Major (TCR)

Violation end date: 013194 Violation start date: Violation period (months): 001 Violation awareness date: 030294 Major violator: Maximum contaminant level: Not Reported Yes Number of required samples: Not Reported Number of samples taken: Not Reported Analysis method: Not Reported Analysis result: Not Reported

PWS currently has or had major violation(s) or enforcement:Yes

Violation ID: 9400015 Violation source ID: Not Reported PWS telephone: Not Reported Contaminant: **Turbidity** Violation type: Monitoring, Regular Violation start date: 010194 Violation end date: 013194 Violation period (months): 001 Violation awareness date: 030294 Major violator: Yes

Not Reported Maximum contaminant level: Number of required samples: Not Reported Not Reported

Number of samples taken: Analysis method:

Analysis result: Not Reported

System Name: **EDEN VALLEY IRRIGATION ASS**

Violation Type: Contaminant: 3100 Compliance Begin: 1994-02-01 Compliance End: 1994-02-28 Violation ID: 9400012 Enforcement Date: 1994-04-09

Enforcement Action: SFH

System Name: **EDEN VALLEY IRRIGATION ASS**

Violation Type: Contaminant: 0100 Compliance Begin: 1994-02-01 Compliance End: 1994-02-28 Violation ID: 9400013 Enforcement Date: 1994-04-09

Enforcement Action: SFH

System Name: **EDEN VALLEY IRRIGATION ASS**

Violation Type: Contaminant: 3100 23 Compliance Begin: 1994-01-01 Compliance End: 1994-01-31 Violation ID: 9400014 **Enforcement Date:** 1994-03-12

Enforcement Action: SFH

System Name: **EDEN VALLEY IRRIGATION ASS**

0100 Violation Type: Contaminant: Compliance Begin: 1994-01-01 Compliance End: 1994-01-31 Violation ID: 9400015 **Enforcement Date:** 1994-03-12

Enforcement Action: SFH

System Name: **EDEN VALLEY IRRIGATION ASS**

0200 Violation Type: Contaminant: Compliance Begin: 1992-01-01 Compliance End: 2015-12-31 Violation ID: 97099999 Enforcement Date: 1993-12-01

Enforcement Action: SFL

System Name: **EDEN VALLEY IRRIGATION ASS**

Violation Type: Contaminant: 0200 Compliance Begin: 1992-01-01 Compliance End: 2015-12-31 Violation ID: 97099999 Enforcement Date: Not Reported

Enforcement Action: Not Reported

System Name: **EDEN VALLEY IRRIGATION ASS**

Violation Type: Contaminant: 0200 Compliance End: Compliance Begin: 1992-01-01 2015-12-31 Violation ID: 9799999 **Enforcement Date:** 1993-12-01

Enforcement Action: SFL

EDEN VALLEY IRRIGATION ASS System Name:

0200 Violation Type: Contaminant: 1992-01-01 2015-12-31 Compliance Begin: Compliance End: Violation ID: 9799999 **Enforcement Date:** 1993-12-01

Enforcement Action: SFL

EDEN VALLEY IRRIGATION ASS System Name:

0200 Violation Type: Contaminant: 1992-01-01 Compliance Begin: Compliance End: 2015-12-31 9799999 **Enforcement Date:** 1993-12-01 Violation ID:

SFL Enforcement Action:

FED USGS USGS40000179933

1/4 - 1/2 Mile Higher

> **USGS-CA** Organization ID:

USGS California Water Science Center Organization Name: Monitor Location: 011S017E24H001M Type: Well 18040001 Description: Not Reported HUC: Drainage Area: Not Reported Drainage Area Units: Not Reported Contrib Drainage Area: Not Reported Contrib Drainage Area Unts: Not Reported

Aquifer:

Formation Type: Not Reported Aquifer Type: Not Reported

Construction Date: 19330101 Well Depth: 433

Central Valley aquifer system

Well Depth Units: Well Hole Depth: Not Reported

Well Hole Depth Units: Not Reported

FED USGS USGS40000180015 **ENE**

1/4 - 1/2 Mile Higher

> Organization ID: **USGS-CA**

Organization Name: USGS California Water Science Center Monitor Location: 011S018E18N001M Well Type: 18040001 Description: Not Reported HUC: Drainage Area: Not Reported **Drainage Area Units:** Not Reported Contrib Drainage Area: Contrib Drainage Area Unts: Not Reported Not Reported

Aquifer:

Central Valley aquifer system Formation Type: Not Reported Aquifer Type: Not Reported

Construction Date: Not Reported Well Depth: 215

Well Depth Units: Well Hole Depth: Not Reported

Well Hole Depth Units: Not Reported

Map ID Direction Distance

EDR ID Number Elevation Database

C13 West

CA WELLS CADW60000025054

CADW60000025055

CA WELLS

36.9666

1/2 - 1 Mile Lower

> Objectid: 25054 Latitude: 36.9668

Longitude: -120.0735 369668N1200735W001 Site code:

State well numbe: 11S17E24D001M Local well name:

Well use id: 6 Well use descrip: Unknown County id: 20 County name: Madera Basin code: '5-22.06' Basin desc: Madera

Dwr region id: 80237 Dwr region: South Central Region Office

CADW60000025054 Site id:

C14 West 1/2 - 1 Mile Lower

Objectid: 25055 Latitude: 369666N1200741W001 Longitude: -120.0741 Site code:

State well numbe: 11S17E24D002M Local well name:

Well use id: 6 Well use descrip: Unknown County id: 20 County name: Madera '5-22.06' Basin desc: Basin code: Madera

Dwr region id: 80237 Dwr region: South Central Region Office

CADW60000025055 Site id:

15 SW 1/2 - 1 Mile Lower

FED USGS USGS40000179906

Organization ID: **USGS-CA**

Organization Name: USGS California Water Science Center Monitor Location: 011S017E24M001M Type: Well Description: Not Reported HUC: 18040001 Drainage Area: Not Reported Drainage Area Units: Not Reported Contrib Drainage Area: Not Reported Contrib Drainage Area Unts: Not Reported

Aquifer: Central Valley aquifer system

Formation Type: Not Reported Aquifer Type: Not Reported Construction Date: Not Reported Well Depth: Not Reported Well Depth Units: Not Reported Well Hole Depth: Not Reported

Well Hole Depth Units: Not Reported

D16 **CA WELLS** 10678

East 1/2 - 1 Mile Higher

11S/18E-19B02 M Seq: 10678 Prim sta c:

County: Frds no: 2010002007 20 District: 11 User id: **AGE** System no: 2010002 Water type:

WELL 10 - DESTROYED Station ty: WELL/AMBNT/MUN/INTAKE/SUPPLY Source nam:

Latitude: 365800.0 Longitude: 1200300.0

Precision: 8 Status: DS

Comment 1: Not Reported Comment 2: Not Reported Comment 3: Not Reported Comment 4: Not Reported Comment 5: Not Reported Comment 6: Not Reported

Comment 7: Not Reported

System no: 2010002 System nam: CITY OF MADERA Hqname: Not Reported Address: 205 W. 4TH STREET

 City:
 MADERA
 State:
 Not Reported

 Zip:
 93637
 Zip ext:
 Not Reported

 Pop serv:
 31740
 Connection:
 7810

Area serve: MADERA AND SURROUNDING AREA

1/2 - 1 Mile Higher

Seq: 10676 Prim sta c: 11S/18E-18L02 M

 Frds no:
 2010002009
 County:
 20

 District:
 11
 User id:
 AGE

 System no:
 2010002
 Water type:
 G

Source nam: WELL 12 - DESTROYED Station ty: WELL/AMBNT/MUN/INTAKE/SUPPLY

 Latitude:
 365800.0
 Longitude:
 1200300.0

 Precision:
 8
 Status:
 DS

Comment 1: Not Reported Comment 2: Not Reported Comment 3: Not Reported Comment 4: Not Reported Comment 5: Not Reported Comment 6: Not Reported

Comment 7: Not Reported

System no: 2010002 System nam: CITY OF MADERA Hqname: Not Reported Address: 205 W. 4TH STREET

City: MADERA State: Not Reported
Zip: 93637 Zip ext: Not Reported
Pop serv: 31740 Connection: 7810

Area serve: MADERA AND SURROUNDING AREA

D18
East CA WELLS
1/2 - 1 Mile
Higher

Seq: 10680 Prim sta c: 11S/18E-19M03 M

 Frds no:
 2010002002
 County:
 20

 District:
 11
 User id:
 AGE

 System no:
 2010002
 Water type:
 G

Source nam: WELL 04 - DESTROYED Station ty: WELL/AMBNT/MUN/INTAKE/SUPPLY

 Latitude:
 365800.0
 Longitude:
 1200300.0

 Precision:
 8
 Status:
 DS

Comment 1: Not Reported Comment 2: Not Reported Comment 3: Not Reported Comment 4: Not Reported Comment 5: Not Reported Comment 6: Not Reported

Comment 7: Not Reported

CITY OF MADERA System no: 2010002 System nam: Haname: Not Reported Address: 205 W. 4TH STREET City: **MADERA** State: Not Reported Zip: 93637 Zip ext: Not Reported

Pop serv: 31740 Connection: 7810

Area serve: MADERA AND SURROUNDING AREA

10680

Map ID Direction Distance

Database EDR ID Number Elevation

D19 **CA WELLS** 10679

1/2 - 1 Mile Higher

> Seq: 10679 Prim sta c: 11S/18E-19M02 M

Frds no: 2010002004 County: 20 District: User id: **AGE** 11 2010002 System no: Water type:

Source nam: WELL 06 - DESTROYED Station ty: WELL/AMBNT/MUN/INTAKE/SUPPLY

Latitude: 365800.0 Longitude: 1200300.0 Precision: 8 Status: DS Not Reported Not Reported Comment 1: Comment 2: Comment 3: Not Reported Comment 4: Not Reported Comment 5: Not Reported Comment 6: Not Reported

Not Reported Comment 7:

CITY OF MADERA System no: 2010002 System nam: Hqname: Not Reported Address: 205 W. 4TH STREET City: **MADERA** State: Not Reported

Zip: 93637 Zip ext: Not Reported Pop serv: 31740 Connection: 7810

Area serve: MADERA AND SURROUNDING AREA

20 North 1/2 - 1 Mile **FED USGS** USGS40000180091

Higher

USGS-CA Organization ID:

Organization Name: USGS California Water Science Center

Monitor Location: 011S017E13H001M Type: Well Description: Not Reported HUC: 18040001 Drainage Area: Not Reported Drainage Area Units: Not Reported Contrib Drainage Area: Contrib Drainage Area Unts: Not Reported Not Reported

Central Valley aquifer system Aquifer:

Formation Type: Not Reported Aquifer Type: Not Reported Construction Date: 19460101 Well Depth: 145 Well Hole Depth: Well Depth Units: ft Not Reported

Well Hole Depth Units: Not Reported

E21 10677 **ENE CA WELLS** 1/2 - 1 Mile

Higher

Seq: 10677 Prim sta c: 11S/18E-18L03 M

Frds no: 2010002020 County: 20 User id: AGE District: 11 System no: 2010002 Water type:

WELL/AMBNT/MUN/INTAKE Source nam: WELL 24 Station ty:

365815.0 1200300.0 Latitude: Longitude: Precision: Status: 2

ΑU

Comment 1: Not Reported Comment 2: Not Reported Comment 3: Not Reported Comment 4: Not Reported Not Reported Not Reported Comment 5: Comment 6:

Comment 7: Not Reported

System no: 2010002 CITY OF MADERA System nam: Hqname: Not Reported Address: 205 W. 4TH STREET City: MADERA State: Not Reported 93637 Not Reported Zip: Zip ext: Pop serv: 31740 Connection: 7810

MADERA AND SURROUNDING AREA Area serve:

Sample date: 25-MAY-17 Finding: 1.6 Chemical: NITRATE + NITRITE (AS N) Report units: MG/L

DIr: 0.4

Sample date: 25-MAY-17 Finding: 11.

Chemical: AGGRSSIVE INDEX (CORROSIVITY) Report units: Not Reported

DIr:

25-MAY-17 Sample date: Finding: 220.

Chemical: SPECIFIC CONDUCTANCE Report units: US

DIr: 0.

Sample date: 25-MAY-17 Finding: 7.5

Chemical: PH, LABORATORY Report units: Not Reported

DIr: 0.

Sample date: 25-MAY-17 Finding: 78. Chemical: ALKALINITY (TOTAL) AS CACO3 Report units: MG/L

DIr:

Sample date: 25-MAY-17 95. Finding:

Chemical: BICARBONATE ALKALINITY Report units: MG/L

DIr:

Sample date: 25-MAY-17 Finding: 1.6

Chemical: NITRATE (AS N) Report units: MG/L

Dlr: 0.4

Sample date: 25-MAY-17 Finding: 60. HARDNESS (TOTAL) AS CACO3 MG/L

Chemical: Report units:

DIr:

Sample date: 25-MAY-17 Finding: 16. Chemical: CALCIUM Report units: MG/L

DIr: 0.

25-MAY-17 Sample date: Finding: 5. Chemical: **MAGNESIUM** Report units: MG/L

DIr:

Finding: Sample date: 25-MAY-17 20. SODIUM Chemical: Report units: MG/L

DIr:

Sample date: 25-MAY-17 Finding: 3. Chemical: **POTASSIUM** Report units: MG/L

DIr:

25-MAY-17 Sample date: Finding: 13. Chemical: CHLORIDE Report units: MG/L

DIr: 0.

Sample date: 25-MAY-17 Finding: 6. Report units: Chemical: SULFATE MG/L

DIr: 0.5

25-MAY-17 180. Sample date: Finding: Chemical: TOTAL DISSOLVED SOLIDS Report units: MG/L DIr: Sample date: 31-MAY-16 Finding: 1.4 Chemical: NITRATE (AS N) Report units: MG/L DIr: 0.4 Finding: Sample date: 21-MAY-15 6.5 Chemical: NITRATE (AS NO3) Report units: MG/L DIr: Sample date: 29-MAY-14 Finding: 12. Chemical: AGGRSSIVE INDEX (CORROSIVITY) Report units: Not Reported DIr: Sample date: 29-MAY-14 Finding: 60. HARDNESS (TOTAL) AS CACO3 Chemical: Report units: MG/L DIr: Sample date: 29-MAY-14 180. Finding: Chemical: TOTAL DISSOLVED SOLIDS Report units: MG/L Dlr: Sample date: 29-MAY-14 Finding: 5.6 Chemical: SULFATE Report units: MG/L DIr: 0.5 Sample date: 29-MAY-14 Finding: 220. Chemical: SPECIFIC CONDUCTANCE Report units: US DIr: 29-MAY-14 Sample date: Finding: 8.1 PH, LABORATORY Report units: Chemical: Not Reported DIr: Sample date: 29-MAY-14 Finding: 89. ALKALINITY (TOTAL) AS CACO3 Chemical: Report units: MG/L DIr: 0. Sample date: 29-MAY-14 Finding: 110. **BICARBONATE ALKALINITY** Chemical: Report units: MG/L DIr: 0. Sample date: 29-MAY-14 Finding: 5.8 Chemical: NITRATE (AS NO3) Report units: MG/L DIr: 29-MAY-14 Sample date: 16. Finding: Chemical: **CALCIUM** Report units: MG/L DIr: 0. 29-MAY-14 Sample date: Finding: 4.8 Chemical: **MAGNESIUM** Report units: MG/L 29-MAY-14 Sample date: Finding: 22. Chemical: SODIUM Report units: MG/L Sample date: 29-MAY-14 Finding: 2.7 Chemical: **POTASSIUM** Report units: MG/L

Dir: 0.

Sample date: 29-MAY-14 Finding: 14. Chemical: CHLORIDE Report units: MG/L

Dlr: 0.

Sample date: 20-JUN-13 Finding: 5.9 Chemical: NITRATE (AS NO3) Report units: MG/L

Dlr: 2.

Sample date: 29-MAY-12 Finding: 5.2 Chemical: NITRATE (AS NO3) Report units: MG/L

Dlr: 2.

Sample date: 06-MAR-12 Finding: 0.77 Chemical: GROSS ALPHA MDA95 Report units: PCI/L

Dlr: C

Sample date: 06-MAR-12 Finding: 8.e-002 Chemical: GROSS ALPHA COUNTING ERROR Report units: PCI/L

DIr: 0

22 SE FED USGS USGS40000179889

1/2 - 1 Mile Higher

Organization ID: USGS-CA

Organization Name: USGS California Water Science Center

Monitor Location: 011S018E19M001M Well Type: Description: Not Reported HUC: 18040001 Not Reported Drainage Area: Not Reported Drainage Area Units: Contrib Drainage Area: Not Reported Contrib Drainage Area Unts: Not Reported

Aquifer: Central Valley aquifer system

Formation Type: Not Reported Aquifer Type: Not Reported

Construction Date: 19290101 Well Depth: 157

Well Depth Units: ft Well Hole Depth: Not Reported

Well Hole Depth Units: Not Reported

23
South FED USGS USGS40000179850
1/2 - 1 Mile

Lower

Organization ID: USGS-CA

USGS California Water Science Center Organization Name: Monitor Location: 011S017E24Q001M Type: Well Description: 18040001 Not Reported HUC: Drainage Area: Not Reported Not Reported Drainage Area Units: Contrib Drainage Area: Not Reported Contrib Drainage Area Unts: Not Reported

Aquifer: Central Valley aquifer system

Formation Type: Not Reported Aquifer Type: Not Reported

Construction Date: Not Reported Well Depth: 405

Well Depth Units: ft Well Hole Depth: Not Reported

Well Hole Depth Units: Not Reported

Map ID Direction Distance

Database EDR ID Number Elevation

ENE 1/2 - 1 Mile **FED USGS** USGS40000180065

10655

Higher

Organization ID: **USGS-CA**

Organization Name: USGS California Water Science Center Monitor Location: 011S018E18L001M Well Type: 18040001 Description: Not Reported HUC: Drainage Area: Not Reported Drainage Area Units: Not Reported Contrib Drainage Area: Not Reported Contrib Drainage Area Unts: Not Reported

Aquifer: Central Valley aquifer system

Formation Type: Not Reported Aquifer Type: Not Reported

19590101 Well Depth: Construction Date: 364

Well Depth Units: Well Hole Depth: Not Reported

Well Hole Depth Units: Not Reported

NW **CA WELLS**

1/2 - 1 Mile Lower

11S/17E-14J01 M Seq: 10655 Prim sta c:

Frds no: 2010002016 County: 20 District: 11 User id: AGE System no: 2010002 Water type: G

WELL 20 Station ty: WELL/AMBNT/MUN/INTAKE Source nam:

Latitude: 365828.0 Longitude: 1200423.0 Precision: 5 Status: ΑU

Comment 1: Not Reported Comment 2: Not Reported Comment 3: Not Reported Comment 4: Not Reported Comment 5: Not Reported Comment 6: Not Reported

Comment 7: Not Reported

System no: CITY OF MADERA 2010002 System nam: Hqname: Not Reported Address: 205 W. 4TH STREET City: **MADERA** State: Not Reported 93637 Not Reported Zip: Zip ext:

31740 Pop serv: Connection: 7810

MADERA AND SURROUNDING AREA Area serve:

Sample date: 21-MAY-15 Finding: 8.1 Chemical: NITRATE (AS NO3) Report units: MG/L

DIr:

Sample date: 29-MAY-14 Finding: 24. **CALCIUM** Chemical: Report units: MG/L

DIr: 0.

Sample date: 29-MAY-14 Finding: 12.

Chemical: AGGRSSIVE INDEX (CORROSIVITY) Report units: Not Reported

DIr:

Sample date: 29-MAY-14 8.6 Finding: Chemical: NITRATE (AS NO3) Report units: MG/L

DIr:

Sample date: 29-MAY-14 Finding: 210.

Chemical: TOTAL DISSOLVED SOLIDS Report units: MG/L

Dlr: 0

Sample date: 29-MAY-14 Finding: 280. Chemical: SPECIFIC CONDUCTANCE Report units: US

DIr: 0.

Sample date: 29-MAY-14 Finding: 8.

Chemical: PH, LABORATORY Report units: Not Reported

Dlr: 0

Sample date: 29-MAY-14 Finding: 110.

Chemical: ALKALINITY (TOTAL) AS CACO3 Report units: MG/L

Dlr: 0.

Sample date: 29-MAY-14 Finding: 130. Chemical: BICARBONATE ALKALINITY Report units: MG/L

Dir: 0.

Sample date: 29-MAY-14 Finding: 89.

Chemical: HARDNESS (TOTAL) AS CACO3 Report units: MG/L

Dlr: 0.

Sample date: 29-MAY-14 Finding: 7.
Chemical: MAGNESIUM Report units: MG/L

Chemical: MAGNESIUM Report DIr: 0.

Sample date: 29-MAY-14 Finding: 23. Chemical: SODIUM Report units: MG/L

Dir: 0.

Sample date: 29-MAY-14 Finding: 3.5

Chemical: POTASSIUM Report units: MG/L DIr: 0.

Sample date: 29-MAY-14 Finding: 19.

Chemical: CHLORIDE Report units: MG/L

Dir: 0.

Sample date: 29-MAY-14 Finding: 7.7 Chemical: SULFATE Report units: MG/L

Chemical: SULFATE Report units: MG/L DIr: 0.5

Sample date: 29-MAY-14 Finding: 0.11

Chemical: FLUORIDE (F) (NATURAL-SOURCE) Report units: MG/L DIr: 0.1

Sample date: 20-JUN-13 Finding: 8.3

Chemical: NITRATE (AS NO3) Report units: MG/L DIr: 2.

Sample date: 29-MAY-12 Finding: 7.6

Chemical: NITRATE (AS NO3) Report units: MG/L DIr: 2.

Sample date: 06-MAR-12 Finding: 0.15

Chemical: GROSS ALPHA COUNTING ERROR Report units: PCI/L DIr: 0.

Sample date: 06-MAR-12 Finding: 0.77

Chemical: GROSS ALPHA MDA95 Report units: PCI/L

DIr: 0.

Map ID Direction Distance

Elevation Database EDR ID Number

26 WSW 1/2 - 1 Mile

Lower

FED USGS USGS40000179925

Organization ID: USGS-CA

Organization Name: USGS California Water Science Center

Monitor Location: 011S017E23J001M Well Type: 18040001 Description: Not Reported HUC: Drainage Area: Not Reported Drainage Area Units: Not Reported Contrib Drainage Area: Not Reported Contrib Drainage Area Unts: Not Reported

Aquifer: Central Valley aquifer system

Formation Type: Not Reported Aquifer Type: Not Reported

Construction Date: 19480101 Well Depth: 440

Well Depth Units: ft Well Hole Depth: Not Reported

Well Hole Depth Units: Not Reported

27
SSE CA WELLS CADW6000008566

1/2 - 1 Mile Lower

Objectid: 8566 Latitude: 36.9524

Longitude: -120.0557 Site code: 369524N1200557W001

State well numbe: 11S18E30D001M Local well name: "

Well use id:6Well use descrip:UnknownCounty id:20County name:MaderaBasin code:'5-22.06'Basin desc:Madera

Dwr region id: 80237 Dwr region: South Central Region Office

Site id: CADW6000008566

28 East FED USGS USGS40000179973

Contrib Drainage Area Unts:

1/2 - 1 Mile Higher

Contrib Drainage Area:

Organization ID: USGS-CA

 Organization Name:
 USGS California Water Science Center

 Monitor Location:
 011S018E19B001M
 Type:
 Well

 Description:
 Not Reported
 HUC:
 18040001

 Drainage Area:
 Not Reported
 Drainage Area Units:
 Not Reported

Aquifer: Central Valley aquifer system

Not Reported

Formation Type: Not Reported Aquifer Type: Not Reported

Construction Date: 19500101 Well Depth: 404

Well Depth Units: ft Well Hole Depth: Not Reported

Well Hole Depth Units: Not Reported

Not Reported

AREA RADON INFORMATION

State Database: CA Radon

Radon Test Results

Zipcode	Num Tests	> 4 pCi/L
93638	22	2

Federal EPA Radon Zone for MADERA County: 2

Note: Zone 1 indoor average level > 4 pCi/L.

: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.

: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for Zip Code: 93638

Number of sites tested: 5

Area Average Activity % <4 pCi/L % 4-20 pCi/L % >20 pCi/L 0.900 pCi/L Living Area - 1st Floor 100% 0% 0% Living Area - 2nd Floor Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Basement Not Reported Not Reported

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map Source: U.S. Geological Survey

HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory Source: Department of Fish and Wildlife

Telephone: 916-445-0411

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

Water Well Database

Source: Department of Water Resources

Telephone: 916-651-9648

California Drinking Water Quality Database Source: Department of Public Health

Telephone: 916-324-2319

The database includes all drinking water compliance and special studies monitoring for the state of California since 1984. It consists of over 3,200,000 individual analyses along with well and water system information.

OTHER STATE DATABASE INFORMATION

California Oil and Gas Well Locations Source: Department of Conservation

Telephone: 916-323-1779

Oil and Gas well locations in the state.

California Earthquake Fault Lines

Source: California Division of Mines and Geology

The fault lines displayed on EDR's Topographic map are digitized quaternary fault lines prepared in 1975 by the United State Geological Survey. Additional information (also from 1975) regarding activity at specific fault lines comes from California's Preliminary Fault Activity Map prepared by the California Division of Mines and Geology.

RADON

State Database: CA Radon

Source: Department of Public Health

Telephone: 916-210-8558 Radon Database for California

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency

(USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at

private sources such as universities and research institutions.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

EPA Radon Zones Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor

radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

California Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary fault lines, prepared in 1975 by the United State Geological Survey. Additional information (also from 1975) regarding activity at specific fault lines comes from California's Preliminary Fault Activity Map prepared by the California Division of Mines and Geology.

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

APPENDIX D: QUALIFICATIONS





Education

Majored in English and Psychology, Point Loma Nazarene University, Point Loma, CA

Highlights

10 years in the property management and building construction field 9 years in the environmental engineering industry Phase I Environmental Site Assessments Environmental Desktop Reports Construction Progress Monitoring

Experience Summary

Ms. Amezcua has nearly ten years of experience in the environmental industry and is a project scientist at Partner Engineering and Science, Inc. (Partner). She has significant experience providing due diligence assessments for a variety of property types and exceeding the needs and requirements for a diverse number of reporting standards, including ASTM standards, EPA's All Appropriate Inquiry (AAI), and customized client formats for Phase I Environmental Site Assessments, Transaction Screen Assessments, Environmental Desktop Reports, Peer Reviews and Construction Progress Monitoring.

Ms. Amezcua has served as a project manager on jobs involving large development sites, dairies, gasoline stations, two local college districts, agricultural packing houses, trucking facilities, commercial, office, industrial, towing yards and agricultural properties of various kinds cataloging the presence of hazardous materials or petroleum products and has completed hundreds of complex historical industrial/commercial assessments throughout the Central Valley of California.

Ms. Amezcua has experience gathering historical research pertaining to each site, encompassing; review of historical aerial photographs, reverse street directories, building permits, planning records, topographical maps, Sanborn fire insurance maps, department of oil and gas maps, title information, geology and hydrology, soil type, groundwater depth, regulatory research, fire departments, state environmental agencies, federal environmental agencies, interviews and document review. Ms. Amezcua has led radon testing for apartment complexes, collected lead based paint and asbestos samples and made recommendations based on the findings. Ms. Amezcua also interviews tenants, owners, state/local regulators, and reviewed provided reports, as well as, formulating and crafting effective, persuasive arguments for conclusions reached utilizing multiple historical and current resources to document findings.

Project Experience

Proposed Hotel Property, Highway 99 South, Selma, California. The subject property at the time of the assessment was observed to be a vacant graded parcel of land that was being assessed for the construction of a prospective hotel site. Review of historical aerial photographs identified a 1950s use that appeared to be a former travel trailer and camping site. Consultations with State and local regulatory agency records and interviews with persons knowledgeable of the site did not identify any known past uses of the property. Based on the inherent potential for onsite fueling due to the convenient location near to Highway 99, a Phase II recommendation was made for a geophysical survey that ultimately discovered previously unknown underground storage tanks (USTs) onsite. Analytical soil sampling and the removal of the USTs was conducted with the results returning non-detect for constituents of concern. The culmination of the two assessments conducted on the property indicated no further assessment was necessary.

800-419-4923 www.PARTNEResi.com

P Street Property, Downtown Fresno, California. A review of a regulatory agency data indicated a potential environmental concern. The subject property at the time of the assessment consisted of a vacant warehouse and a parking lot totaling 2.66 acres. Review of the City of Fresno Fire Department (CFFD) historical records identified the presence of a former 1,000-gallon fuel underground storage tank (UST) that was permitted on January 17, 1949. Subsequent documents indicate the removal and or abandonment of the UST in 1967. An inspection report dated in 1967 indicated an assessment utilizing a metal detecting instrument that did not find the former UST. No additional records pertaining to the UST were identified on file with the State or local regulatory agencies consulted during the course of the assessment. Based on the reported absence of the UST on the subject property during the metal detection investigation in 1967 and subsequent redevelopment of the subject property it was determined that the UST had most likely been removed. However, based on the absence of soil sampling and analysis during the tank removal activities or subsequent subsurface investigations of the UST, the UST was considered a recognized environmental condition. A Phase II subsurface investigation was conducted that identified three areas of subsurface anomalies that appeared to be a compilation of metallic objects rather than one singular object. Soil samples were tested by a State certified analytical laboratory that returned non-detect for constituents of concern in the former UST location that was identified in the CFFD records. The culmination of the two assessments conducted on the property indicated no further assessment was necessary.

Musco Olive Company Property, California. The assessment was comprised of review of several State and local regulatory agency data that indicated a number of potential environmental concerns. The subject property was observed to be occupied by Musco Olive Products Co. (Musco), as a commercial olive production facility with a 332,256 square foot building on 309 acres. Onsite operations consist of the storage, curing, brining, rinsing and canning of olives. Other subject property features include evaporation and irrigation ponds, and saline extraction forage crops. The site is regulated by the California Regional Water Quality Control Board (RWQCB), for surface impoundments which receive concentrated process water and spent lye solutions and the less concentrated process water system which is aerated and utilized to irrigate approximately 200+ acres of forage crop. Several onsite monitoring wells are monitored by the RWQCB for alkalinity, TSD, sodium, chloride, manganese and bicarbonate. A review of the RWQCB records indicated substantial compliance with the regulatory agency requirements. The site formerly operated four USTs that were reported in local regulatory agency records absent any indications of the specific use. Upon review of the records and interviews with the site contact, the USTs were identified as exclusively for the storage of vinegar and were determined as not a concern or an REC. Partner identified a California Division of Oil, Gas, and Geothermal Resources (DOGGR) Maps plugged oil well associated with the subject property abandoned October of 1993. According to the site contact, the injection well was not intended to be a gas or oil exploration well, but that the deep well was to be utilized to dispose of process water to the subsurface but that the ground was too dense to receive large amounts of water so the project was abandoned. Based on the review of the records, site observations and interviews with the site contact no recognized environmental concerns were identified and no further assessment appeared to be necessary.

Large Dairy Operation, Bakersfield, California. The subject property at the time of the assessment was utilized as a 320+ acre dairy and an agriculturally cultivated property. Consultations with State and local regulatory agency records, regulatory database review and interviews with persons knowledgeable of the site did not identify any initial concerns associated with the property. No RECs were identified at the time of the assessment, however large capacity fueling, equipment repairing and the storage of hazardous substances with staining on unpaved ground surfaces were identified onsite constituting an environmental



concern. It was determined that the farming practices appeared to be in substantial compliance with the regulatory agencies and a recommendation for secondary containment and removal of the stained soils was made. The result of the assessment of the property indicated no further assessment was necessary.

Restaurant Site/Historical Gasoline Station, Lodi California. The subject property at the time of the assessment was occupied by a fast food restaurant on a single parcel of land of 0.88 acres located to the west of State Route 99. No environmental concerns were identified during the review of State regulatory agency or the database report. However, a review of historical aerial photographs and the City of Lodi Building Department (CLBD) records identified a gasoline service station operated on the subject property from 1965 to 1986 with four 6,000-gallon gasoline underground storage tanks (USTs). No additional records related to the former gasoline service station including UST removals and/or subsurface investigations were found on file with the State or local regulatory agencies consulted during the course of this assessment. Experience with historical gasoline service stations indicates that full services which include fueling and automotive service/repair were commonly conducted with little to no regulatory oversight. These operations commonly utilize petroleum products, solvents, and other hazardous materials are commonly stored and utilized. Based on the historical presence of a gasoline service station on the subject property for at least 20 years coupled with the absence of previous subsurface investigations and UST removal documentation, the historical gasoline service station operations on the subject property was considered an REC. A Phase II ESA confirmed the removal of the former subsurface features and six soil borings returned nondetect for constituents of concern. The culmination of the two assessments conducted on the property indicated no further assessment was necessary.

Contact

samezcua@partneresi.com





Education

B.A. Geography, California State University Fresno

Training

OSHA 24-Hour Health and Safety Training

Highlights

11 years of experience in environmental consulting Phase I Environmental Site Assessments (ESAs) Environmental Transaction Screens

Experience Summary

Mr. Redding serves as a Project Manager for Partner Engineering and Science, Inc. (Partner), overseeing and managing all aspects of multi-scope projects including Phase I ESAs in accordance with EPA's All Appropriate Inquiry (AAI), Property Condition Assessments (PCAs), Zoning Reports, and Seismic Assessments.

Mr. Redding has over eleven years of project experience in the environmental consulting industry. Mr. Redding is familiar with all aspects of Due Diligence Property Assessments and the needs and requirements of a varied number of reporting standards, including ASTM E1527-13, EPA's All Appropriate Inquiry (AAI), The U.S. Small Business Administration (SBA), and customized client formats and scopes. Mr. Redding has performed and supervised over 1,000 ESAs and customized environmental assessments of a variety of properties including multi-family residential, hospitality, commercial office buildings, shopping centers, multi-tenant commercial complexes, industrial warehouses, manufacturing facilities, dry cleaning plants, gasoline service stations, automotive repair and body shops, medical facilities, food processing facilities, and agricultural properties.

Project Experience

Junior College Campus and Historical Military and Medical Hospital, Modesto, CA. Mr. Redding prepared a Phase I ESA on a junior college campus in Modesto, the site of a historical World War II era military hospital and subsequent State-run hospital. Multiple recognized environmental conditions (RECs) were identified related to current and historical uses including vehicle and facilities maintenance, underground and aboveground fueling facilities, domestic wastewater treatment systems and septic systems, and asbestos and lead-based paint issues.

2,500-Acre Agricultural Property, Maricopa, CA. Mr. Redding prepared a Phase I ESA on a large agricultural property within an active oil and gas production area. Multiple RECs were identified related to oil and gas well development, oil and gas production, subsurface oil and gas pipelines, aboveground fuel storage, and agricultural chemical use, storage, and application.

Printed Circuit Board Manufacturing Facility, Redwood City, CA. Mr. Redding prepared a Phase I ESA on a printed circuit board manufacturing facility. Multiple RECs were identified related to electroplating, etching, silk screening, chemical storage, and hazardous waste generation, storage, and treatment operations.

800-419-4923 www.PARTNEResi.com

10-Site Residential Portfolio, Central CA. Managed a multi-million dollar acquisition project consisting of Phase ESAs of ten, large-acreage, rural agricultural properties throughout Central California for a residential developer. Duties included managing, performing, and reviewing Phase I ESAs.

25-Site Grocery Chain Portfolio, OR and CA. Managed a multi-million dollar rehabilitation financing project consisting of Phase I ESAs of 25 grocery store properties throughout the State of Oregon and Northern California. Duties included managing, performing, and reviewing Phase I ESAs.

16-Site Multi-Family Residential Portfolio, FL. Managed a multi-million dollar acquisition project consisting of 16, multi-story apartment buildings in Florida. Duties included managing and reviewing Phase I ESAs.

Contact

jredding@partneresi.com







Education

B.A., Environmental Analysis and Criminal Justice, University of California Irvine Hazardous Materials Management Certificate Courses, University of California Irvine

Registrations

OSHA 40-Hour Hazwoper
OSHA 8-Hour Hazwoper Refreshers
ASTM Technical and Professional Training

Highlights

20 years of experience in national environmental due diligence consulting Phase I Environmental Site Assessments Phase II Subsurface Soil/Soil Gas Investigations Property Condition Assessments

Experience Summary

Mr. Taylor is Principal and National Client Manager with significant environmental and due diligence engineering experience in all states with specialized geographical experience in the Pacific West/Northwest. His responsibilities include full-phase environmental consulting, national client management, multi-scope contract negotiation/execution, portfolio project management, and technical report quality control. Mr. Taylor's regional and national expertise compliments the wide variety of Partner projects and client types including national and local lending institutions, asset management/investment groups, developers, and commercial real estate professionals.

Mr. Taylor has 20 years of experience in national environmental due diligence consulting including Phase I Environmental Site Assessments, Phase II Subsurface Soil/Soil Gas Investigations, Property Condition Assessments, Seismic Evaluations, Asbestos, Lead-Paint, and Radon Surveys, ALTA Surveys, Geotechnical Investigations, MEP Special Inspections, Energy Evaluations, and Construction Monitoring.

Mr. Taylor has assessed/managed over 15,000 commercial real estate transactions throughout his professional career including several multi-million dollar asset portfolios consisting of a 29-site commercial office property acquisition, two 1,200-site cellular tower transactions, a 25-site regional grocery-store chain evaluation, a 10-site residential development acquisition, and a 16-site multi-family apartment building acquisition. These transactions have included some or all of Partner's core engineering due diligence services described above. Mr. Taylor routinely manages national asset/developer clients to evaluate the environmental and structural risks associated with commercial/industrial properties prior to acquisition. These risks may be associated with past hazardous materials use (i.e., gasoline stations, dry cleaners) which require historical research combined with subsurface evaluations to assess for contamination that could devaluate the property or create a human health concern to occupants or construction workers; evaluate for asbestos, lead-based paint, and radon to determine the need for abatement or venting systems; evaluate the structural integrity of the building and assess for seismic retrofit; evaluate the roof, mechanical, electrical, plumbing systems (i.e., elevators, HVAC systems, sewer); evaluate for American Disabilities Act (ADA) deficiencies (i.e., ramps, railings, access); survey the property boundaries (i.e., ALTA Surveys); evaluate the

800-419-4923 www.PARTNEResi.com

subsurface conditions for construction suitability (i.e., Geotechnical Investigations); and conduct energy studies of the site building to meet with current requirements and systems efficiencies.

Project Experience

Philadelphia Commercial Office Portfolio. A \$186 million dollar acquisition project consisting of 29, multistory commercial office buildings and included Phase I Environmental Site Assessments and Property Condition Assessments with special inspections of HVAC systems, elevators, and roofing systems. Multiple inspectors were coordinated and dispatched to each site within a two-week report completion timeline. Special inspection findings and related repair costs were cross-calculated with generalist inspection reporting and incorporated into the Property Condition Assessment spreadsheets for client/lender review. The acquisition was successful and exemplified Mr. Taylor's project management and negotiation skills, coordination of several in-house engineering professionals and subcontracted elevator consultants as well as Partner's responsiveness and expertise of client/lender's expedited timeline.

National Cellular Tower Portfolios. Two multi-million dollar acquisition projects consisting of over 2,400 cellular towers located throughout the United States which included Phase I Environmental Site Assessments. Multiple national inspectors were dispatched to each mountain-top tower within each state. The inspections incorporated the use of guides and four-wheel drive vehicles (primarily Jeeps) to visually inspect each tower. The acquisition project was successful and exemplified Mr. Taylor's project management skills, coordination of dozens of national inspectors, quality control reviews, and responsiveness to client's timeline.

Oregon Grocery Chain Portfolio. A multi-million dollar rehabilitation financing project consisting of 25 grocery store properties throughout the State of Oregon and included Phase I Environmental Site Assessments and ALTA Surveys. Multiple inspectors were dispatched to each site within a two-week turnaround. The financing project was successful and the project exemplified Mr. Taylor's negotiation/client management skills, coordination of inspections, quality control and completion of timely reports as well as the responsiveness and professional acumen of Partner's Engineering Team.

Central California Residential Portfolio. A multi-million dollar acquisition project consisting of 10, large-acreage, rural agricultural properties throughout Central California for a residential developer which included Phase I Environmental Site Assessments and Phase II Subsurface Investigations of former underground storage tanks, burn pits, and residual agricultural herbicides/pesticides from past orchard cultivation. The Phase II investigations included ground penetrating radar (GPR), subsurface soil sampling utilizing a hollow-stem auger drill rig, and surface soil sampling in accordance with the Cal EPA Department of Toxic Substances Control protocol. Results of the investigations revealed no evidence of underground storage tanks or former tanks pits, and no detectable concentrations of petroleum hydrocarbons or agricultural chemicals. The acquisition was successful and the project exemplified Mr. Taylor's negotiation/client management skills, coordination of inspections, quality control and completion of timely reports as well as the responsiveness and professional acumen of Partner's Engineering Team.

Florida Apartment Portfolio. A multi-million dollar acquisition project consisting of 16, multi-story apartment buildings in Florida which included Phase I Environmental Site Assessments and Property Condition Assessments. Multiple inspectors were dispatched to each site to complete the reports within a two-week timeline. The acquisition was successful and the project exemplified Mr. Taylor's



negotiation/client management skills, coordination of inspections, quality control and completion of timely reports as well as the responsiveness and professional acumen of Partner's Engineering Team.

Affiliations

ASTM Member No. 000216930 Environmental Bankers Association Risk Management Association, Director National Association of Development Companies Northwest Environmental Business Council Commercial Brokers Association

Speaking

"Regulations in Lending", Risk Management Association, Fresno, CA. Risk Tolerance and Environmental Regulation for Commercial Bankers

"Water in the Central Valley", Fresno, CA. Contaminated Sites and Environmental Remediation of Commercial Properties

Contact

CTaylor@partneresi.com

